



Expertise

Protocol number: 46449051
Order No. / Reference: 26693992
Inspection date: 9 Jul 2026

Manufacturer: Ford

Model: Galaxy 2.0 EcoBlue S&S Aut. TITANIUM

VIN: WF0KXXWPCKNS82660



Vehicle details	
Manufacturer / Type / Model / Equipment	
Ford Galaxy 2.0 EcoBlue S&S Aut. TITANIUM	
Vehicle Identification number	WF0KXXWPCKNS82660
Mileage (Read)	104,797 km
First registration	19 May 2022
Number of holders	1
Next periodical technical inspection	08/2027
(Report not on hand)	
Power / Engine displacement	140 kw / 1,995 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 8
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Blazer Blau
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Grey-Black
Re-import	no
readiness to drive	Roadworthy



Vehicle details			
Maintenance booklet / proof	digital proof / complete	Next maintenance in	
Last service on / at	02/2026 at 96,877 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GK798239
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
readiness to drive	Roadworthy		
Manufacturer key number/ type code number	8566 / BQR 00339		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,605 kg	Empty weight	

Tyres				
Mounted tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/55 R17 103Y	Summer tyres on Light alloy	Pirelli	6mm / 6mm
2)	235/55 R17 103V	Summer tyres on Light alloy	Continental	5mm / 5mm
Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.				



Equipment



Standard equipment

- Airbag: Passenger airbag deactivation
- Anti-lock braking system (ABS) (with Electronic Stability Program (ESP), Roll Stability Control (RSC) and Traction Control System (TCS))
- Attachment points for safety partition grilles (attachment points 1st row of seats)
- Tires: 7.5 J x 17 alloy wheels (4) with 235/55 R 17 tires (in 5x2-spoke design)
- Hill start assist
- Roof rails "aluminum look"
- Tachometer
- Lane Assist including Lane Keeping Assist and Driver Alert (warns the driver of an unintentional lane change via short steering wheel vibrations (without activation of the turn signal) - additionally, active steering support assists in returning to the lane)
- Ford Key Free System (keyless locking/unlocking)
- FordPass Connect including eCall, live traffic information and Wi-Fi hotspot (information about the current status or location of the vehicle as well as control of selected vehicle functions via smartphone with the FordPass app - eCall emergency call system to send an emergency call in the event of an accident or when manually activated - Real-time traffic information - Wi-Fi hotspot (up to 4G/LTE7, for up to 10 mobile devices))
- Intelligent Protection System (IPS) including: - Front airbags for driver and front passenger - Knee airbag for driver - Head and shoulder airbags in the front and for the 2nd and 3rd rows of seats - Side airbags for driver and front passenger - Side airbags on the outer seats of the 2nd row - Seat belt tensioners and belt force limiters in the front - 3-point seat belts in all seats, height-adjustable in the front)
- Steering wheel: Multifunction leather steering wheel
- Steering wheel: Paddle shifters on the steering wheel
- Front center console with padded armrest (storage compartment and 2 cup holders)
- Ford navigation system including Ford SYNC 3 with AppLink, touchscreen, DAB/DAB+ and FordPass Connect (communication and entertainment with voice control - Android Auto, Apple CarPlay - Bluetooth hands-free system and audio streaming - eCall emergency call system - live traffic - Wi-Fi hotspot - radio/CD player, 2 USB ports, 8 speakers, steering wheel controls - 20.3 cm screen - DAB/DAB+ - acoustic and visual route guidance, dynamic navigation, lane keeping assist, road map for Europe - extended voice control and voice output - Michelin travel guide for Europe - quick address search)
- Upholstery: Cloth
- Tire Pressure Monitoring System (TPMS)
- Headlight assistant with day/night sensor (high beam assistant - interior mirror, automatically dimming)
- Ambient lighting in the front with LED technology (including lighting of the front door handles, audio system console, cup holders and footwell)
- Exterior mirrors painted in body color, electrically adjustable and heated (with integrated turn signals and ambient lighting)
- Tires: Tire repair kit ((maximum speed of 80 km/h when used))
- third brake light
- Diesel particulate filter (DPF)
- Driver information system display 25.4 cm color (on-board computer with fuel consumption and mileage information as well as outside temperature display)
- Electric front and rear windows (with all-around closing function)
- Electronic parking brake
- Ford Power Start function (keyless start, including two passive keys with remote control)
- Cruise control system with intelligent speed limiter (interior mirror, automatically dimming - traffic sign recognition system)
- Transmission: 8-speed automatic transmission
- Back window, heater
- rear window wiper
- Interior lighting with delay circuit
- Isofix mounting (on all seats in the 2nd row)
- Electric child safety lock
- Air conditioning with automatic temperature control, CFC-free (separately adjustable for driver and front passenger side as well as rear (3-zone automatic climate control))
- Paint finish: Solid
- Steering wheel: Steering column, adjustable in height and reach
- Front and rear reading lights (with LED technology)
- MyKey key system (individually programmable second key) (setting options include: limiting the maximum speed and radio volume, speed warning (when the set speed limit is exceeded), safety assistance systems cannot be deactivated, extended warning system for unfastened seat belts)
- Fog lights with LED technology
- Emergency brake light (pulsating illumination of the brake lights during hard braking)
- Package: Winter (Heated windscreen - Heated leather steering wheel - Individually and variably heated front seats)
- Front and rear parking pilot system
- Rain sensor
- Headlight dipped beam with switch-off delay including "greeting function"
- Electro-mechanical power steering (EPAS - Electric Power Assisted Steering)
- Seats: Driver and front passenger seats, 4-way manually adjustable (including manually adjustable lumbar support)
- Seats: Comfort seats, front
- Start-stop system
- Power outlet: 230-volt connection (150 watts)



- Seats: 2nd row of seats with 3 individual seats (FoldFlat System) (adjustable longitudinally - seat backrests individually foldable - headrests retractable - easy entry to the 3rd row of seats (Easy Entry))
- Seats: Trays on the front seat backrests
- Power outlet: 12-volt connection in the luggage compartment and in the center console
- LED daytime running lights
- Velour carpet floor mats (for the 1st, 2nd and 3rd row of seats)
- thermal insulation glazing
- Cigarette lighter (and ashtray in the center console)

- Front bumper painted in body color (rear bumper top painted in body color, bottom painted black)
- Lashing eyes in the luggage compartment
- Electronic immobilizer
- Central locking with remote control (remote luggage compartment release - second folding vehicle key)

Extra equipment

- Detachable towbar (including ESP trailer stabilization)
- Package: Business III (Automatic) (Sony Navigation incl. Ford SYNC 3, AppLink, Touchscreen, Voice Control, Radio/CD Player, MP3-compatible, 2 USB ports, 390-watt premium sound system, 12 speakers, steering wheel remote control, Bluetooth hands-free system, FordPass Connect, eCall, DAB/DAB+, Adaptive LED headlights with glare-free high beam, ACC, Traffic Jam Assist, Pre-Collision Assist, Forward Collision Warning, Emergency Brake Assist, Front and Rear View Camera, Blind Spot Assist, Cross Traffic Alert, Dynamic Distance Control, Power Tailgate with Sensors, Ford Key Free System, Park Assist)
- Reversible luggage compartment mat, black, for Ford Galaxy
- Panoramic sunroof (can be opened - sun protection blinds integrated into the rear side doors - windshield and panoramic roof with "Solar-Reflect" heat protection)
- Side windows from the 2nd row of seats and rear window, dark tinted.
- Safety partition net behind the 2nd row of seats for the luggage compartment
- Seats: Ford ergonomic seat (driver and front passenger seat adjustable in 18 ways: - length, height and tilt of the seat - extendable thigh support - adjustable backrest - lumbar support electrically adjustable in 4 ways - fabric seat material Calder/Omni)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was roadworthy at the time of inspection.



Value reducing factors

No.	Component group	Description
1	Trim / covers	Trim / covers - Missing - Replace
2	Door - front right side	Door - dent(s) - Smooth repair work
3	Sill - left side	Sill - Scratch(es) - Smart repair
4	Sill - right side	Sill - Scratch(es) - Smart repair
5	Side panel - rear right side	Sill - Scratch(es) - Smart repair
6	Side panel - rear left side	Sill - Dent / paintcoat damage - Smart repair
7	Boot lid / rear door	Boot lid - Scratch(es) - Smart repair
8	Mudguard - left side	Mudguard - left side - Scratch(es) - Smart repair
9	Door - front right side	Door handle - outside - Scratch(es) - Paint
10	Side panel - rear right side	Side panel - dent(s) - Smart repair
11	Door - front left side	Door - Scratch(es) - Paint
12	Door - rear right side	Door - Scratch(es) - Paint
13	Bonnet	Bonnet - Scratch(es) - Paint
14	Side panel - rear left side	Side panel - Dent / paintcoat damage - Repair and paint
15	Rear bumper	Rear bumper - Dent / paintcoat damage - Repair and paint
16	Front bumper	Front bumper - Dent / paintcoat damage - Repair and paint

Wear and tear

No.	Component group	Description
1	Trim / covers	Boot lid - interior trim - Scratch(es) - No deduction
2	Trim / covers	Boot lining - Scratch(es) - No deduction
3	Door - front right side	Door - Scratch(es) - No deduction
4	Vehicle glazing	Windscreen - Stone chips - No deduction
5	Misc.	Inspection / maintenance (1. Wartung überzogen) - does not meet manufacturer specifications - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

Equipment - Tirefit complete

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

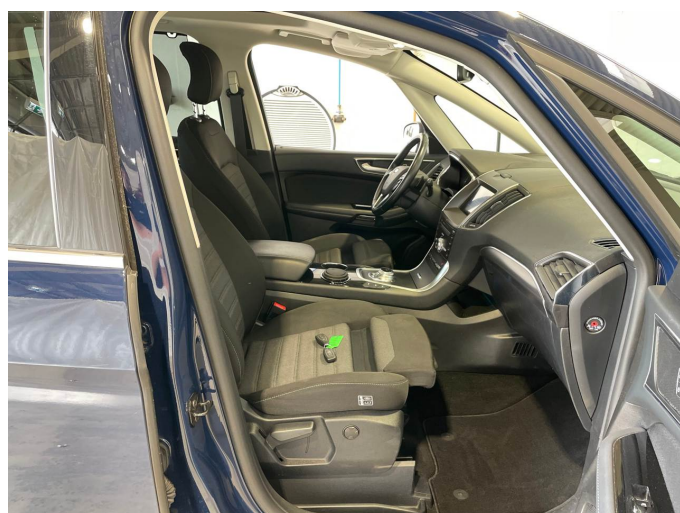


Figure 5: Interior - front

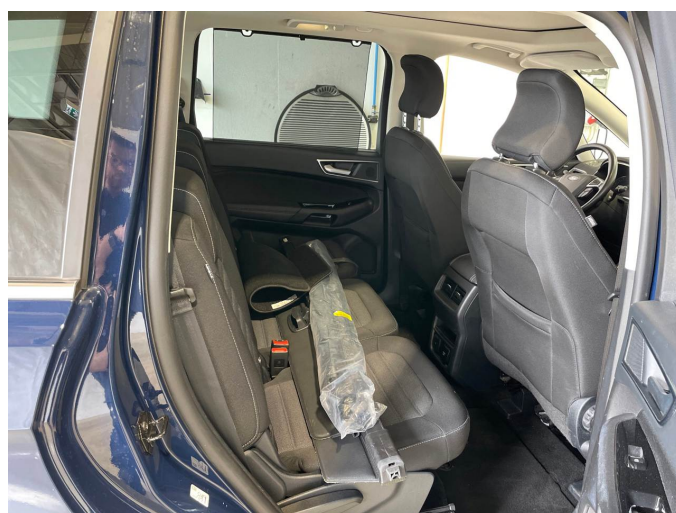


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres

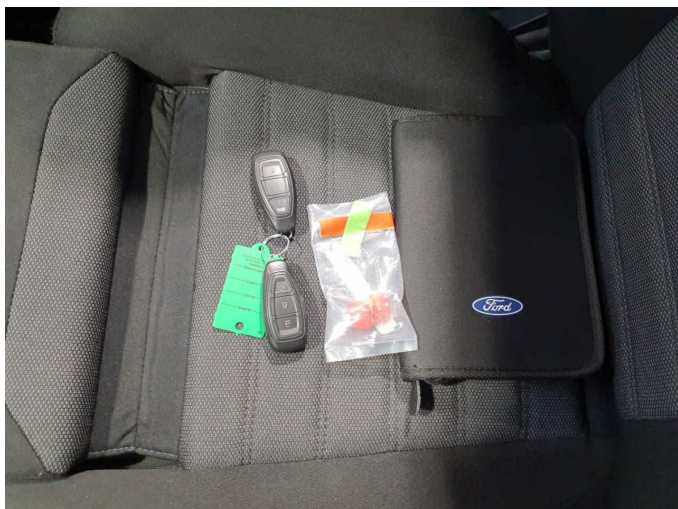


Figure 13: Documents



Figure 14: Navigation



Figure 15: Misc.



Figure 16: Misc.



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.

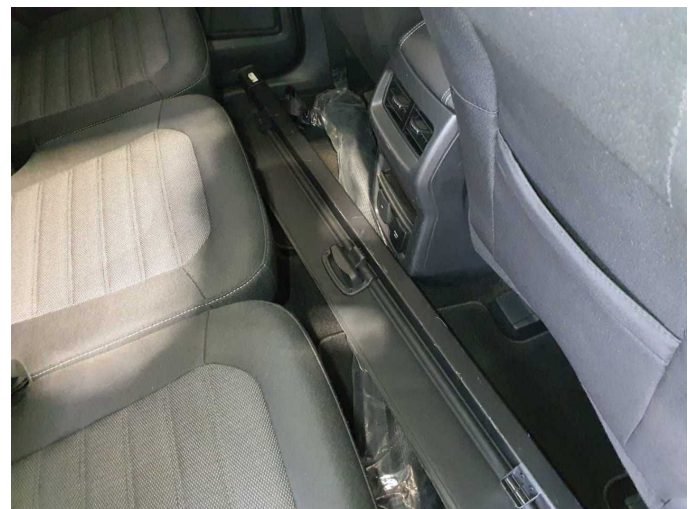


Figure 24: Misc.



Figure 25: Misc.

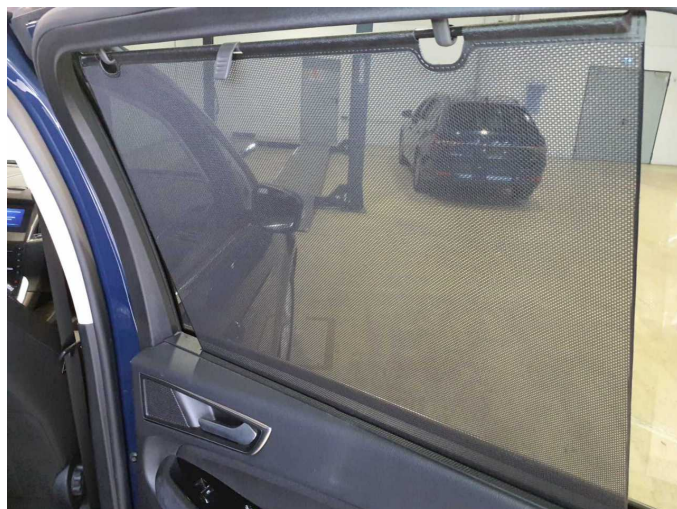


Figure 26: Misc.


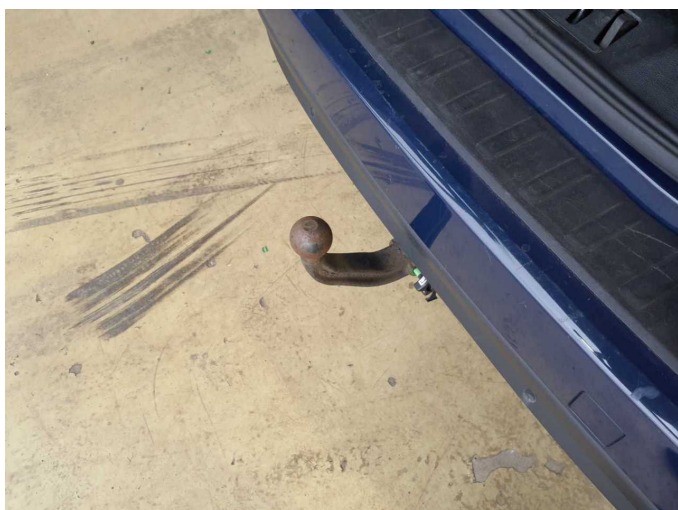



Figure 27: Misc.




Damage 1: Trim / covers: Trim / covers - Missing - Replace

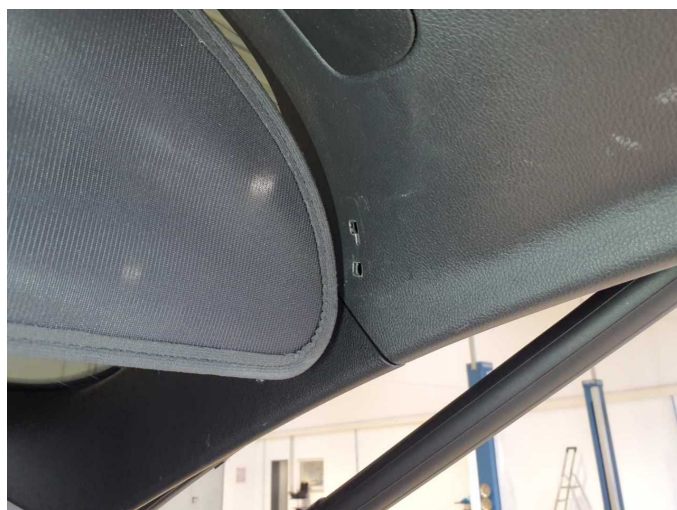


Damage 1: Trim / covers: Trim / covers - Missing - Replace

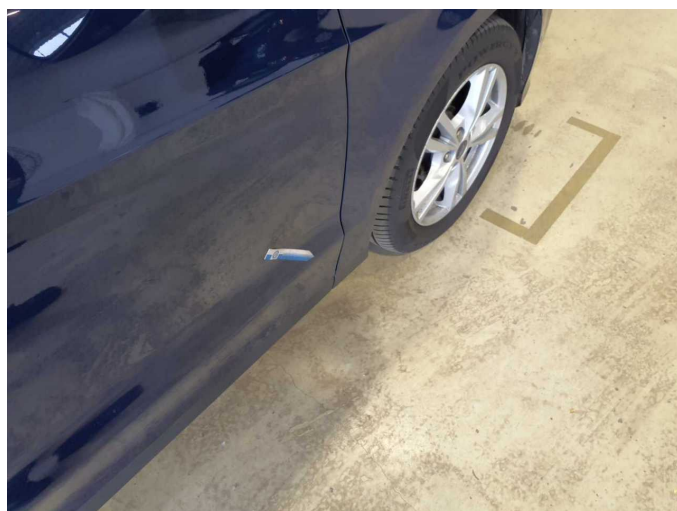

Damage 2: Door - front right side: Door - dent(s) - Smooth repair work

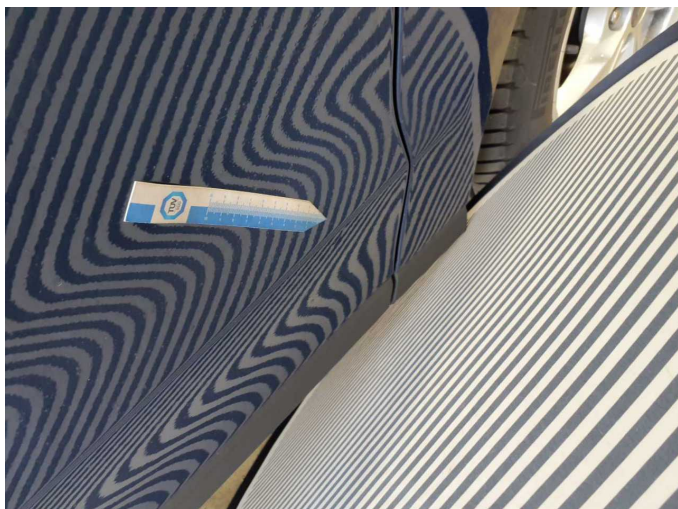

Damage 2: Door - front right side: Door - dent(s) - Smooth repair work

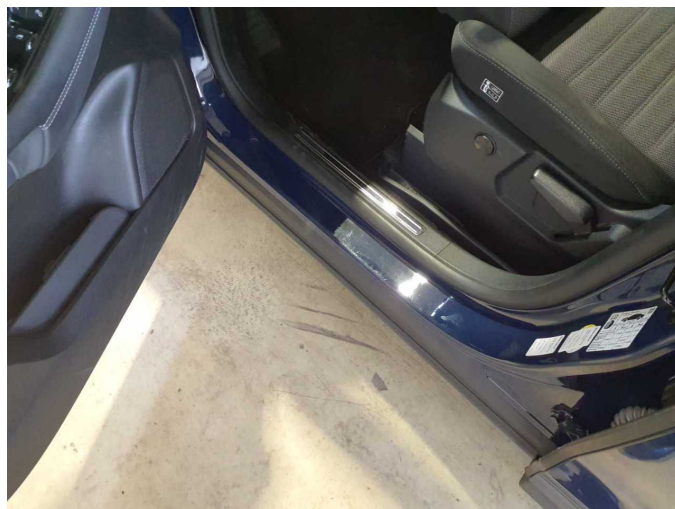

Damage 3: Sill - left side: Sill - Scratch(es) - Smart repair




Damage 3: Sill - left side: Sill - Scratch(es) - Smart repair




Damage 4: Sill - right side: Sill - Scratch(es) - Smart repair




Damage 4: Sill - right side: Sill - Scratch(es) - Smart repair

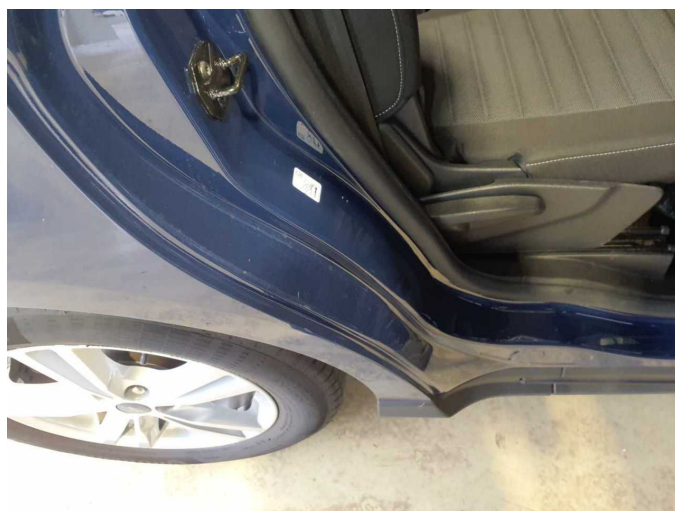

Damage 5: Side panel - rear right side: Sill - Scratch(es) - Smart repair

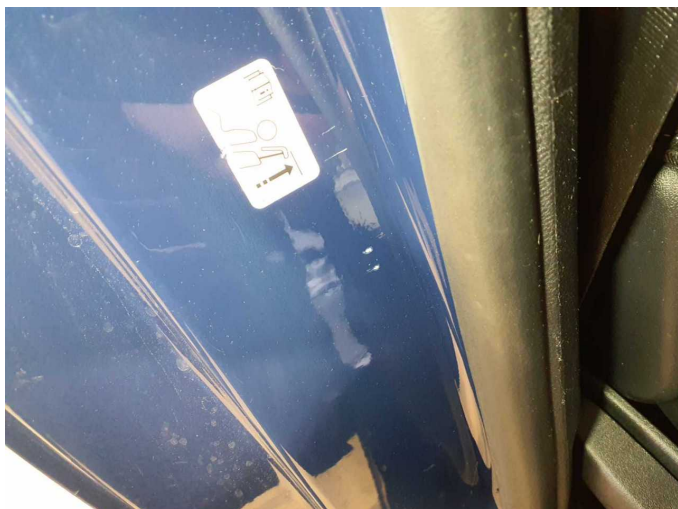


Damage 5: Side panel - rear right side: Sill - Scratch(es) - Smart repair

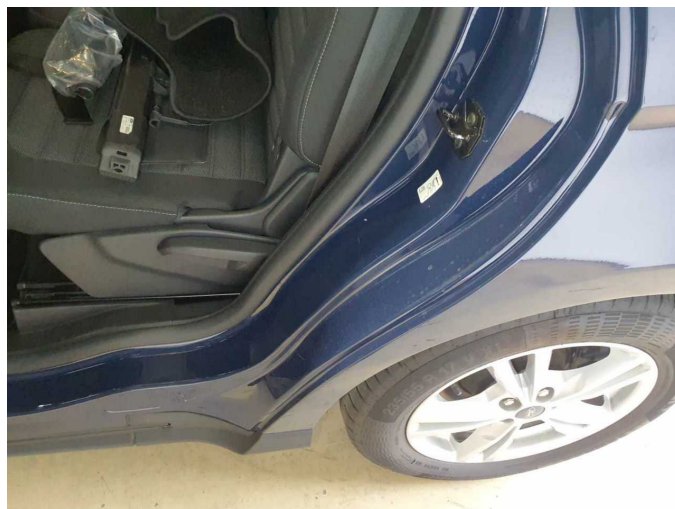

Damage 6: Side panel - rear left side: Sill - Dent / paintcoat damage - Smart repair




Damage 6: Side panel - rear left side: Sill - Dent / paintcoat damage - Smart repair

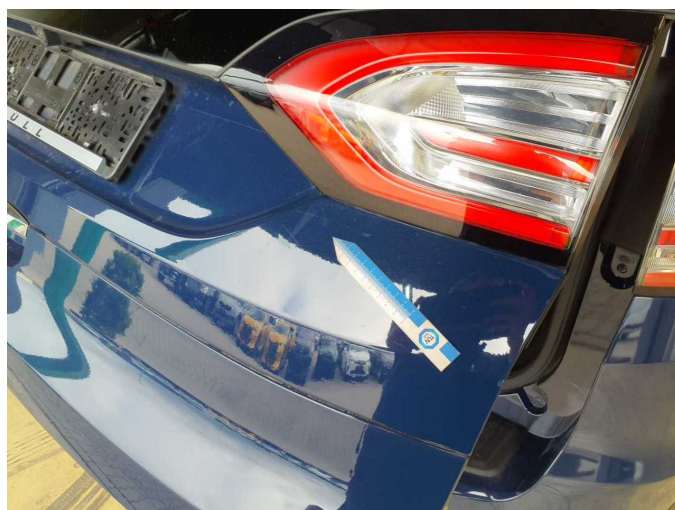

Damage 7: Boot lid / rear door: Boot lid - Scratch(es) - Smart repair



Damage 7: Boot lid / rear door: Boot lid - Scratch(es) - Smart repair

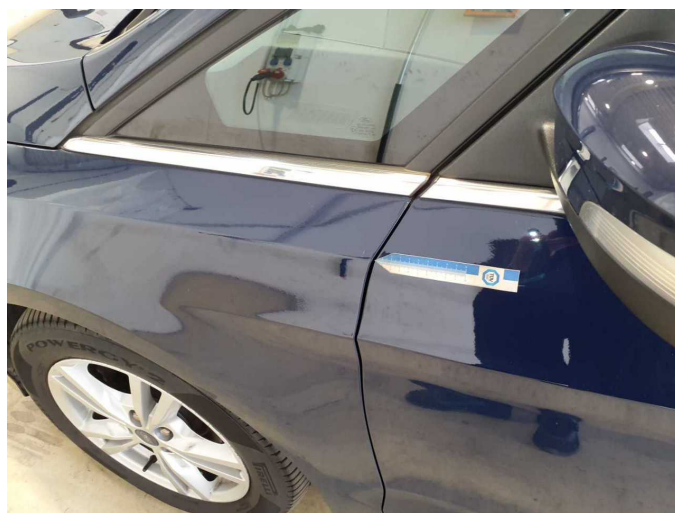

Damage 8: Mudguard - left side: Mudguard - left side - Scratch(es) - Smart repair




Damage 8: Mudguard - left side: Mudguard - left side - Scratch(es) - Smart repair




Damage 9: Door - front right side: Door handle - outside - Scratch(es) - Paint



Damage 9: Door - front right side: Door handle - outside - Scratch(es) - Paint

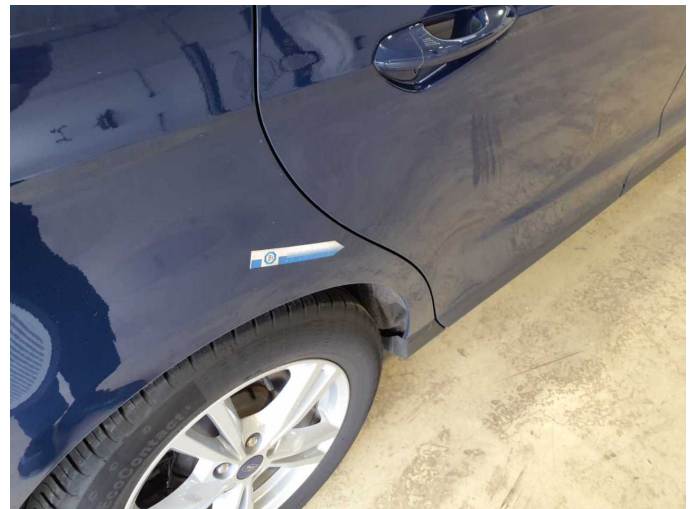


Damage 10: Side panel - rear right side: Side panel - dent(s) - Smart repair

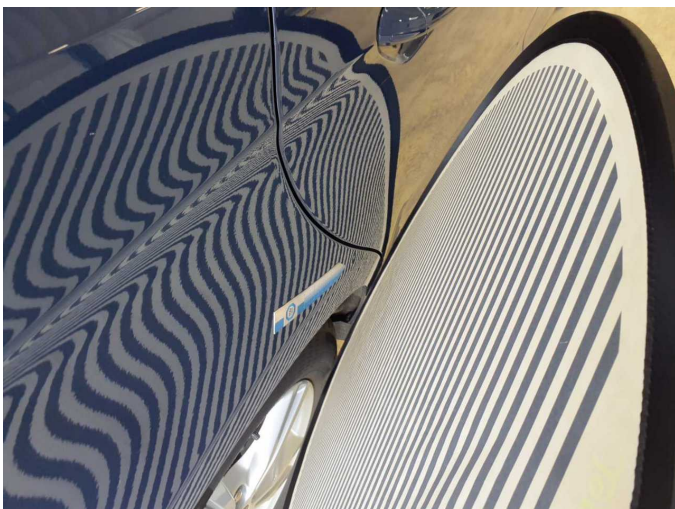

Damage 10: Side panel - rear right side: Side panel - dent(s) - Smart repair




Damage 10: Side panel - rear right side: Side panel - dent(s) - Smart repair

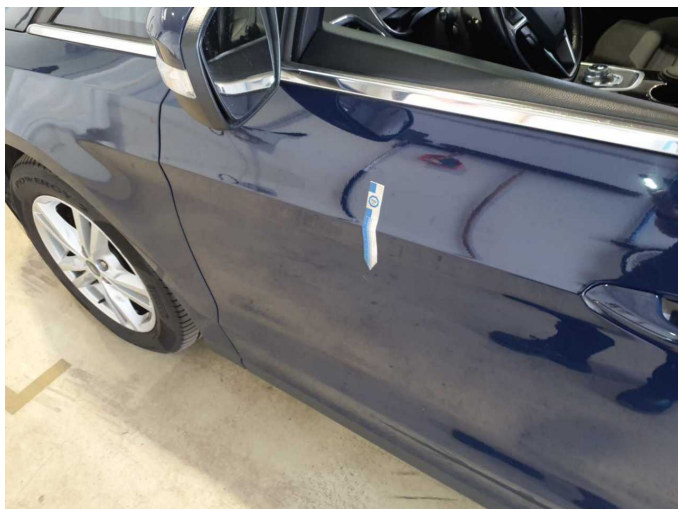

Damage 11: Door - front left side: Door - Scratch(es) - Paint




Damage 11: Door - front left side: Door - Scratch(es) - Paint

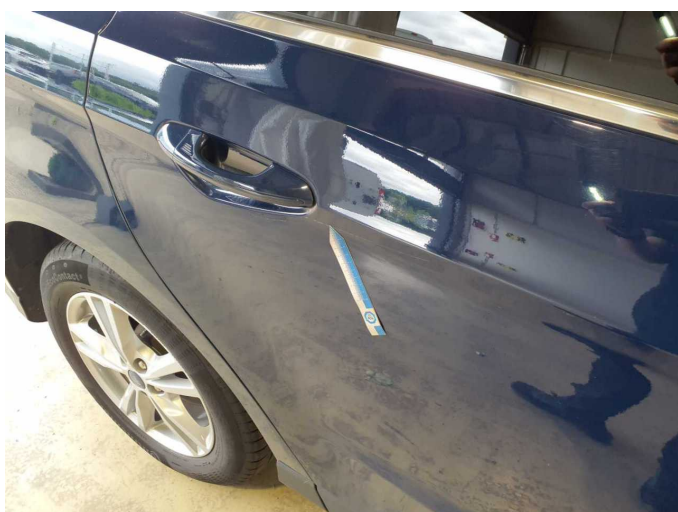


Damage 12: Door - rear right side: Door - Scratch(es) - Paint




Damage 12: Door - rear right side: Door - Scratch(es) - Paint

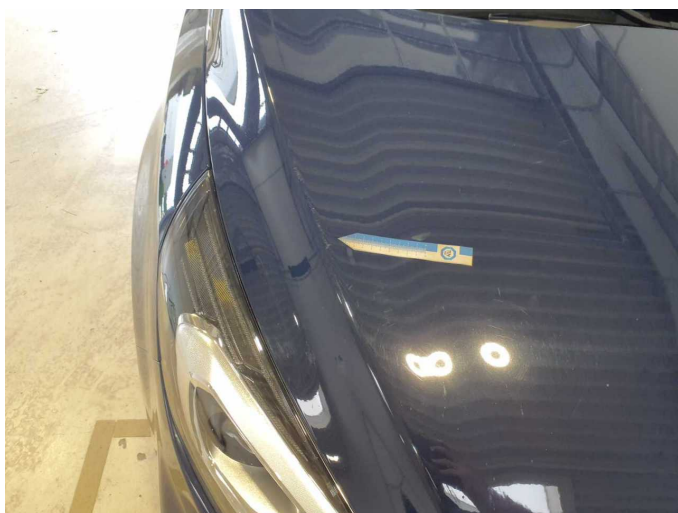


Damage 13: Bonnet: Bonnet - Scratch(es) - Paint

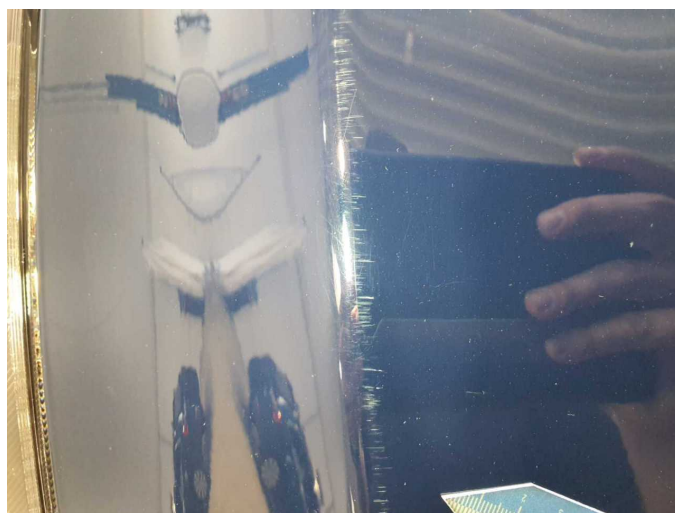


Damage 13: Bonnet: Bonnet - Scratch(es) - Paint

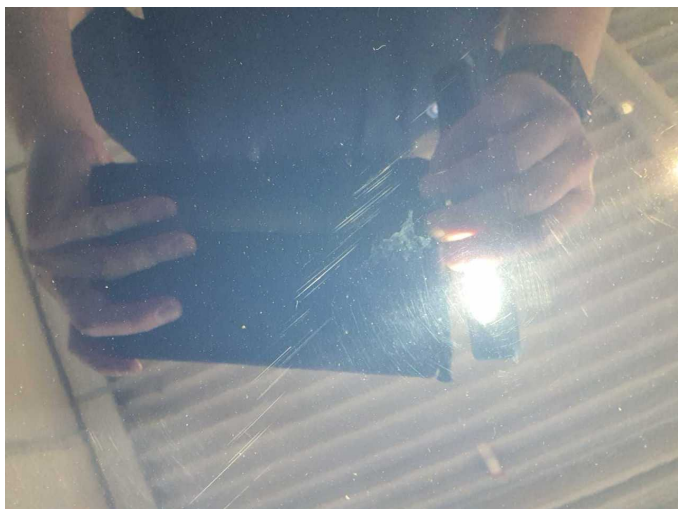


Damage 13: Bonnet: Bonnet - Scratch(es) - Paint

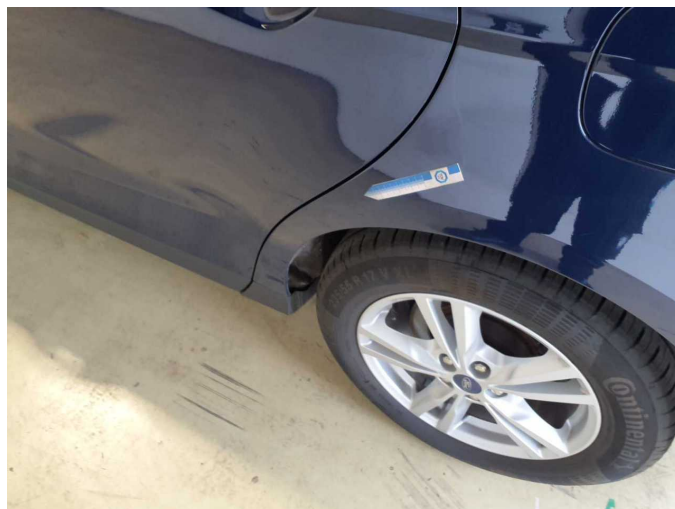

Damage 14: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint

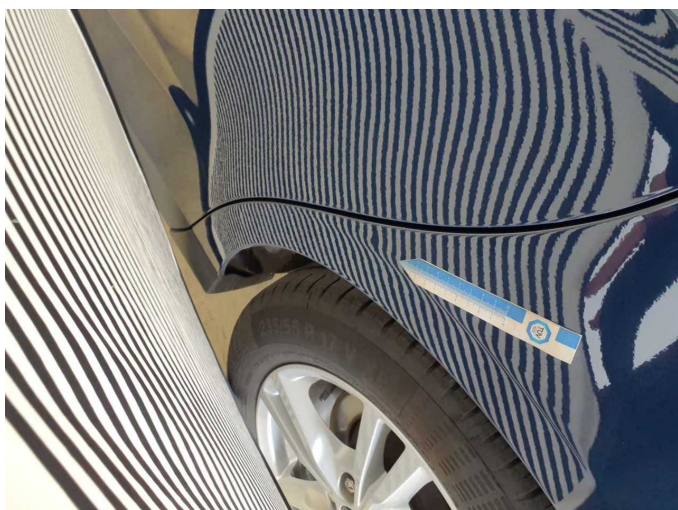

Damage 14: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint

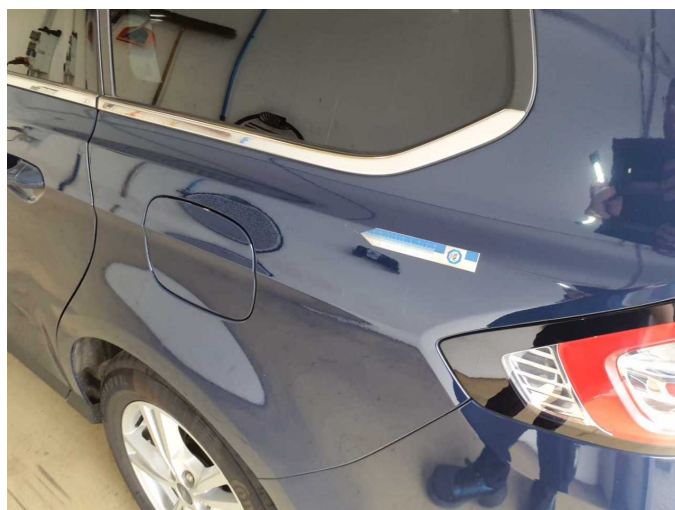


Damage 14: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint




Damage 14: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint



Damage 14: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint

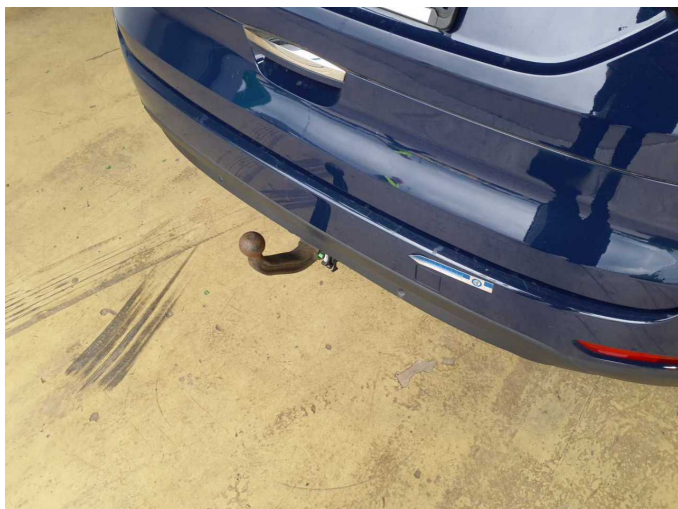

Damage 15: Rear bumper: Rear bumper - Dent / paintcoat damage - Repair and paint

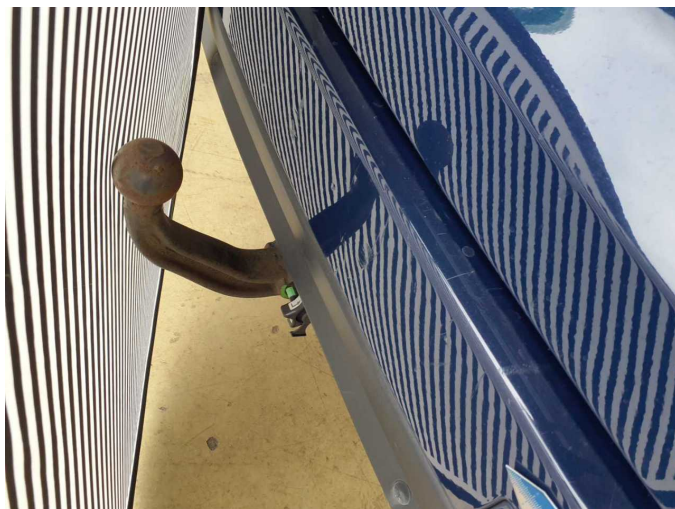


Damage 15: Rear bumper: Rear bumper - Dent / paintcoat damage - Repair and paint



Damage 15: Rear bumper: Rear bumper - Dent / paintcoat damage - Repair and paint



Damage 16: Front bumper: Front bumper - Dent / paintcoat damage - Repair and paint

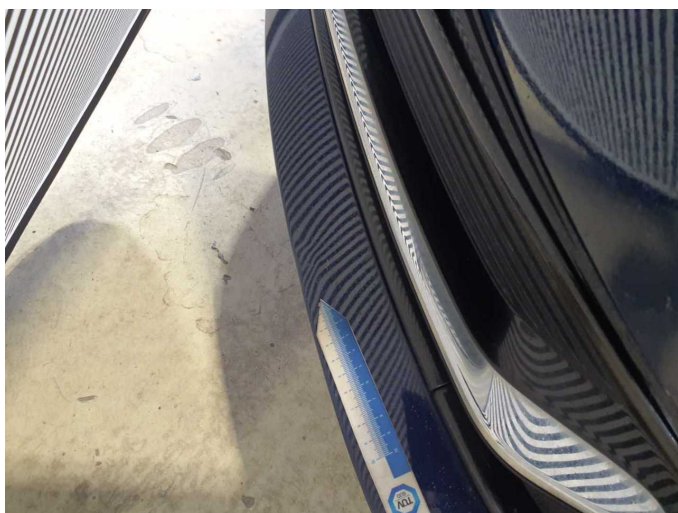

Damage 16: Front bumper: Front bumper - Dent / paintcoat damage - Repair and paint



Damage 16: Front bumper: Front bumper - Dent / paintcoat damage - Repair and paint