



Expertise

Protocol number: 46525356
Order No. / Reference: 26681245
Inspection date: 15 Jul 2026

Manufacturer: Ford

Model: Kuga 2.0 EcoBlue 4x4 Aut. ST-LINE X

VIN: WF0FXXWPMFLT26148



Vehicle details	
Manufacturer / Type / Model / Equipment	
Ford Kuga 2.0 EcoBlue 4x4 Aut. ST-LINE X	
Vehicle Identification number	WF0FXXWPMFLT26148
Mileage (Read)	100,935 km
First registration	26 Mar 2021
Number of holders	1
Next periodical technical inspection	06/2028
(Report on hand)	
Power / Engine displacement	140 kw / 1,995 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 8
Type of drive	All-wheel drive
Type of vehicle	Station wagon
Colour / colour code	Frozen White
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Anthracite



Vehicle details

Maintenance booklet / proof	Available / complete	Next maintenance in	14 %
Last service on / at	10/2025 at 90,090 km		
Key is / should be	1 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	FZ438292
Previous damage / Accident	Detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	8566 / BTH 00041		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,245 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/60 R18 104W	Summer tyres on Light alloy	Pirelli	5mm / 5mm
2)	225/60 R18 104W	Summer tyres on Light alloy	Pirelli	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/60 R18 104V	Winter tyres on Light alloy	Continental	8mm / 8mm
2)	225/60 R18 104V	Winter tyres on Light alloy	Continental	8mm / 8mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
N				4 mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- All-wheel drive
- Anti-lock braking system
- Passenger airbag deactivation
- Tires: Tire repair kit
- Body styling kit
- Fabric headliner
- Roof rails, black
- Diesel particulate filter
- Dual exhaust system
- Electronic Stability Program (ESP)
- Lane keeping assist including lane keeping assist
- Electric parking brake with auto hold function
- Ford EcoCoach
- FordPass Connect
- Luggage compartment lighting
- Transmission: 8-speed automatic
- Electric tailgate, sensor-controlled (opens and closes via foot movement)
- Inductive charging station for mobile devices
- Intelligent Protection System (IPS)
- Air conditioning with automatic temperature control
- Front and rear headrests (5) height adjustable
- LED taillights
- Steering wheel: ST-Line design, flattened at the bottom and with red decorative stitching, in Sensico synthetic leather
- MyKey key system
- Emergency brake light, pulsating illumination of the brake lights during hard braking
- Pedal assembly with aluminum surface
- Post-Collision Assist
- Pre-Collision Assist
- Radio accessories: B&O Sound System
- Rear view camera
- Headlights with delayed shut-off
- Side windows from the 2nd row of seats and rear window, dark tinted.
- Seats: Driver's seat electrically adjustable, 10-way including electrically adjustable lumbar support
- Seats: Rear bench seat, sliding, with split-folding backrest
- Seats: Front seats, individually and variably heated
- Start-stop system
- Power outlet: 12-volt connection in the luggage compartment
- Black trim around the side windows
- Central locking with remote control and remote luggage compartment release
- Ambient lighting
- Electrically adjustable, heated and folding exterior mirrors
- Tires: 7.5 J x 18 alloy wheels (4) in 5x2-spoke design in rock metallic
- third brake light
- Overhead console with glasses storage compartment
- Roof spoiler
- 12.3-inch digital instrument panel
- Tachometer
- Driving mode switch selective
- Electric windows front and rear
- Ford Easy Fuel
- Ford Power Start Function & Ford Key Free System
- Luggage compartment cover, roller blind, removable
- Cruise control
- Illuminated glove compartment
- Heated rear window
- rear window wiper
- Interior mirror, automatically dimming
- ISOFIX mounts including top tether attachment points on the outer seats of the 2nd row.
- Paint finish: Solid
- Steering wheel: Paddle shifters on the steering wheel
- Steering column, adjustable in height and reach
- Rear center armrest with cup holder
- Front center console with integrated armrest
- Navigation system: Ford navigation system including Ford SYNC 3
- Front and rear parking pilot system
- Upholstery: Sensico faux leather fabric in suede look with red decorative stitching (with seat center panels in suede look and seat bolsters in Sensico faux leather)
- Tire Pressure Monitoring System (TPMS)
- Windscreen wipers with rain sensor
- Headlight assistant with day/night sensor
- Power steering
- Seats: Passenger seat, 8-way manually adjustable
- Seats: Map pockets on the driver's and front passenger's seat backrests
- Seats: Front sports seats with integrated headrests
- Sun visor on driver and passenger side
- Static LED headlights
- Carpet floor mats front and rear
- Electric door child safety lock
- Immobiliser



Extra equipment

- Fixing points behind the 1st row of seats according to ISO 27955
- Reversible luggage compartment mat
- Package: Driver Assistance Package (Automatic Transmission)
(Intelligent Adaptive Cruise Control with Traffic Sign Recognition -
Traffic Jam Assist with Stop & Go Function and Lane Keeping Assist
- Wrong-Way Driver Warning - Evasive Steering Assist - Driver
Drowsiness Warning - Cross Traffic Alert - Blind Spot Assist - Active
Park Assist with semi-automatic steering - Front Camera with Split
View Technology - Door Edge Protection - Intelligent Speed Limiter
with Speed Limit Display)
- Tires: Spare wheel (T165/70 R17 tire - instead of tire repair kit -
permissible at max. 80 km/h when used)
- Paint finish: Solid color, special color
- Package: Technology (Adaptive LED headlights with glare-free high
beam assist and dynamic cornering lights, automatic headlight range
control and LED fog lights - Head-up display)
- Package: Winter (heated windscreen - heated leather steering
wheel)
- Package: Winter II
- Safety partition net (including attachment points behind the first and
second rows of seats)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Door - front right side	Door - dent(s) - Smart repair
2	Engine	Engine cowling - Broken / torn - Replace

Wear and tear

No.	Component group	Description
1	Vehicle glazing	Windscreen - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description
Equipment - Vehicle key

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Rear, Professionally repaired, from 9 Aug 2023	3.043,30 €



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

Professionally repaired previous damages were found at the vehicle.

Comments

- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

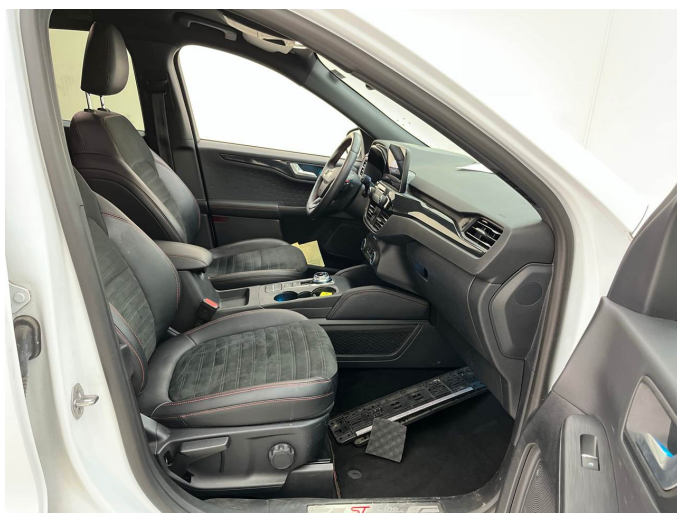


Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

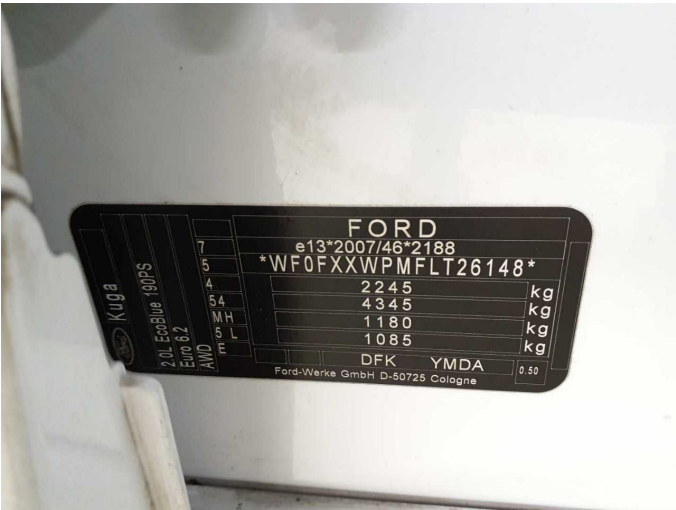


Figure 11: VIN



Figure 12: Mounted tyres

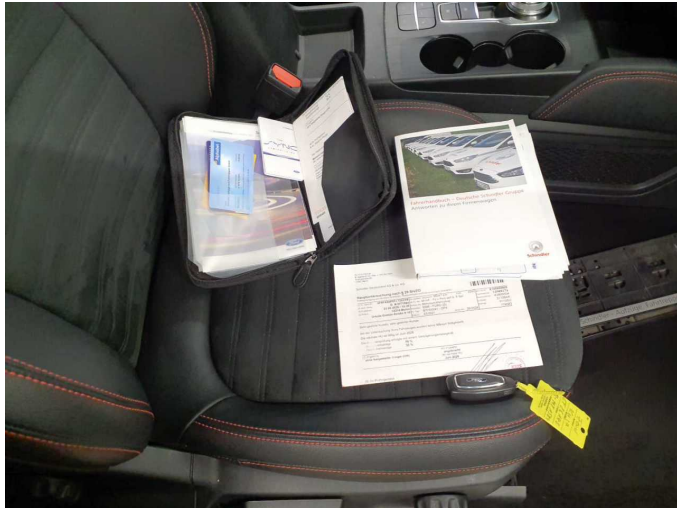


Figure 13: Documents



Figure 14: Additional tyres



Figure 15: Navigation



Figure 16: Navigation



Figure 17: Misc.

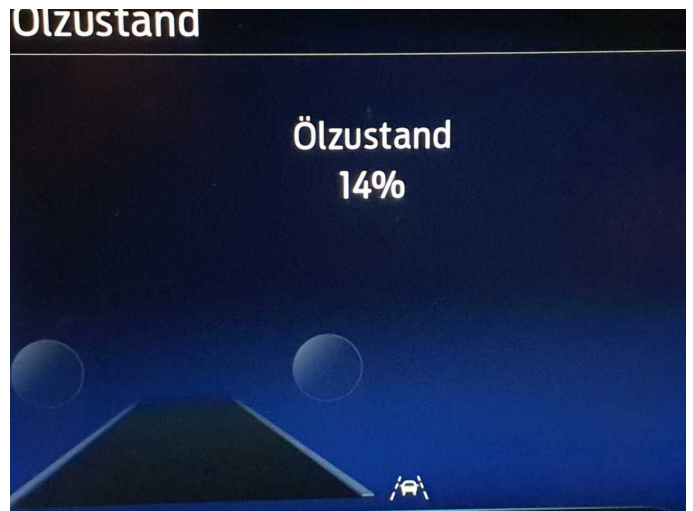


Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.




Damage 1: Door - front right side: Door - dent(s) - Smart repair




Damage 1: Door - front right side: Door - dent(s) - Smart repair



Damage 2: Engine: Engine cowling - Broken / torn - Replace

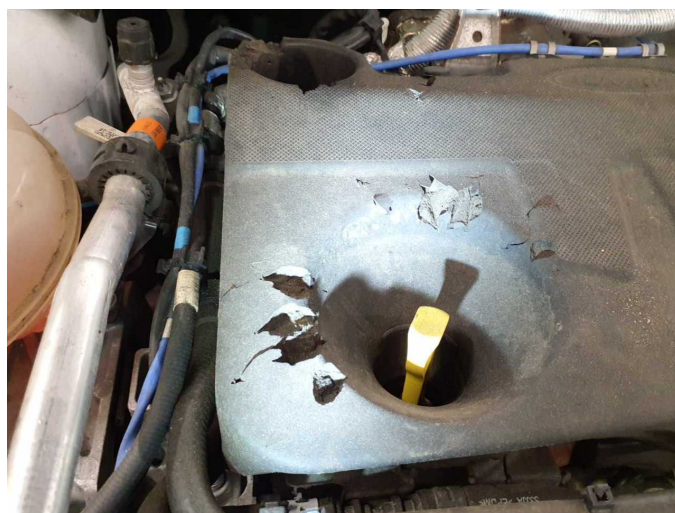

Damage 2: Engine: Engine cowling - Broken / torn - Replace

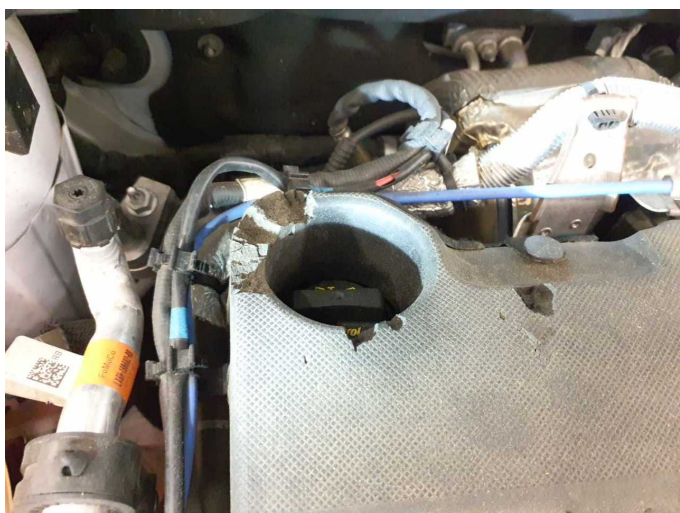

Damage 2: Engine: Engine cowling - Broken / torn - Replace



Wear and tear 1: Vehicle glazing: Windscreen - Stone chips - No deduction