



Expertise

Protocol number: 46729449
Order No. / Reference: 26716717
Inspection date: 28 Jul 2026

Manufacturer: Volkswagen

Model: Caddy 2.0 TDI BMT (5-Si.) DSG Style

VIN: WV2ZZZSKZNX030541



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volkswagen Caddy 2.0 TDI BMT (5-Si.) DSG Style	
Vehicle Identification number	WV2ZZZSKZNX030541
Mileage (Read)	120,941 km
First registration	3 Feb 2022
Number of holders	1
Fuel type	Diesel
Engine displacement / Cylinder	1,968 ccm / 4
Power	90 kW
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Costa Azul-Metallic (W5M)
Doors / Seats	5 / 5
Upholstery type	Cloth / leather combination
Colour of upholstery	Black
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	200 km
Last service on / at	04/2026 at 115,707 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GF478063
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	0603 / CLH 00517		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,250 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/55 R17 98W	Summer tyres on Light alloy	Pirelli	5mm / 5mm
2)	215/55 R17 98W	Summer tyres on Light alloy	Pirelli	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 96H	Winter tyres on Light alloy	Continental	6mm / 6mm
2)	205/60 R16 96H	Winter tyres on Light alloy	Continental	7mm / 7mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 11/2025		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- Waste container with removable lid
- Storage compartments: Storage tray on the headliner with 2 roof grab handles in the driver's cab
- Airbag: Side and head airbags for driver and front passenger
- Reinforced battery (70 Ah/ 420 A)
- Operating voltage 12 V
- Brake booster
- third brake light
- Three-phase generator 140 A
- Electrical interface for external use
- Electronic Stability Program with Brake Assist
- Windows: Heated rear window
- Window: Side window in the passenger/cargo compartment, rear right, permanently installed
- Window: Side window in the passenger/cargo compartment, front right, permanently installed
- Windows: Laminated glass front pane in heat-insulating glazing
- Transmission: DSG (dual-clutch transmission), 7-speed automatic
- Rear window wiper/washer system with intermittent function
- Child seat anchorage (I-Size) and top tether
- Headrests (2), height adjustable
- Paint protection/transport protection film
- LED taillights
- Steering column adjustable in height and tilt
- Headlight range control
- Multifunction display: Digital cockpit, multicolor, various information profiles selectable
- Fatigue detection
- Emergency braking assistant "Front Assist"
- Particulate filter: Soot particle filter for diesel engines
- Radio accessories: Digital radio reception DAB+
- Wheels/Tires: 215/55 R 17 98 H XL, optimized for low rolling resistance
- Wheels/Tires: Tire pressure monitoring system
- Gearshift lever DSG
- Keys for locking system: 2 remote control flip keys
- Side paneling for comfort in the passenger compartment
- Speed-sensitive power steering (Servotronic)
- Seat belts: in the passenger compartment
- Driver's cab seats: Height adjustment for both front seats, manual
- Seats in the driver's cab: Lumbar support manually adjustable, left and right
- Seats: Folding tables on the backrests of the seats in the 1st row.
- Lane keeping assistant "Lane Assist"
- Start-stop system
- Bumpers in body color
- First aid kit, warning triangle and high-visibility vest
- Warning tone and light for unfastened front seat belts
- Central locking with keyless start system "Keyless Start" without safe locking
- Storage and stowage boxes
- Towing eye front and rear, screw-in
- Airbag for driver and front passenger
- Exterior mirrors, electrically adjustable, heated and folding
- Exterior mirror housings in black, door handles in body color and sliding door track in black
- Floor coverings, carpeting in the driver's cab and passenger compartment
- Roof rails, painted silver
- Front door sill trims in silver
- Electronic parking brake including auto-hold function
- Automatic headlight control, with daytime running lights
- Window: Side window in the passenger/cargo compartment, rear left, permanently installed
- Window: Side window in the passenger/cargo compartment, front left, permanently installed
- Windows: Front side windows in heat-insulating glass
- electric window regulator
- Luggage compartment cover, extendable and removable
- Glove compartment with lid, illuminated
- Tailgate with window cutout
- Instrument usage (km/h)
- Electric child safety lock for sliding doors
- Air conditioning system "Air Care Climatronic" with 2-zone temperature control and air purification function
- LED headlights with LED daytime running lights
- Steering wheel: Multifunction steering wheel in leather (DSG)
- front center armrest
- Multifunctional camera
- Multi-collision brake
- Non-smoking version
- eCall emergency call system
- Upholstery: Microfleece/leather look
- Wheels, tires: Covers for alloy wheels
- Wheels/Tires: "Colombo" alloy wheels 6.5 J x 17, glossy black
- Wheels: Tire Mobility Set
- Windscreen wiper intermittent control with light and rain sensor
- Side indicator lights
- Seat belts: Three-point automatic seat belts
- Automatically dimming interior safety mirror
- Seats in the driver's cab: Backrest release for the right front seat
- Seats in the passenger compartment: 3-seater bench in the 2nd row (foldable, rollable and removable)
- Seats: Seat left and right, in the 1st row
- Sun visors with mirrors, airbag label on passenger sun visor
- Power outlets: 12-volt socket in the cargo area
- Telephone: Mobile phone interface
- Lashing points: 4 lashing points for securing cargo
- Electronic immobilizer
- Auxiliary heating: Electric auxiliary air heater



- Additional dust protection seal on the outside

Extra equipment

- Detachable/lockable towbar (including trailer stabilization)
- High beam assistant "Light Assist"
- Interior lighting: in the passenger compartment (LED reading lights - LED tailgate lighting)
- Paint finish: Metallic
- Navigation system "Discover Media" (Life, PanAmericana, Style) (25.4 cm (10 inch) touch color display - streaming & internet)
- Package: Winter package (Seat heating for seats in the driver's cab, left and right, separately adjustable - Washer fluid level indicator with enlarged washer fluid reservoir - Heated windshield washer nozzles at the front)
- Wheels/Tires: Tire pressure monitoring system (direct measuring)
- Sliding door, right side in passenger/cargo compartment with closing aid
- Deletion: Lettering on the rear (excluding lettering for type/model designation - excluding promotional lettering and decals)
- Comfort ventilation for the passenger compartment with roof vents in the sky
- Package: Driver Assistance Package "Travel Assist" (Style) (Emergency Evasive Steering Assist and Turn Assist - Driver Assistance Travel Assist, Lane Keeping Assist, Lane Assist, Emergency Assist - Park Assist, Front/Rear Parking Aid - Lane Change Assist, Side Assist incl. Blind Spot Detection, Rear Traffic Alert Assist - Emergency Brake Assist, Front Assist with Pedestrian and Cyclist Detection - ACC incl. Speed Limiter)
- Sliding door, left side in passenger/cargo compartment with closing aid
- Partition net: Luggage net in the cargo/passenger compartment

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Equipment	Tirefit filler - Expired - Replace
2	Roof	Roof - dent(s) - Smart repair
3	Wheel / tyres	Tyre - front left side - Leaking - Replace
4	Rear bumper	Bumper with Parktronic - Scratch(es) - Paint
5	Front bumper	Bumper with Parktronic - Scratched - Repair and paint

Wear and tear

No.	Component group	Description
1	Mudguard - right side	Mudguard - right side - Dent / paintcoat damage - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

- Winterradsatz ist kein Bestandteil des Auslieferumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

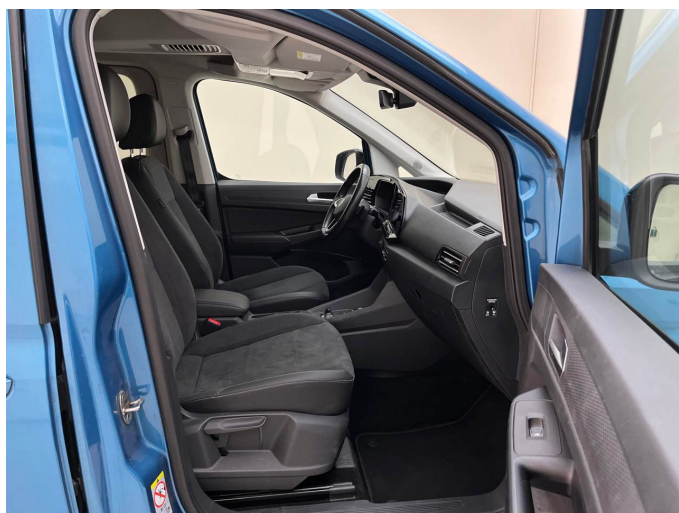


Figure 5: Interior - front

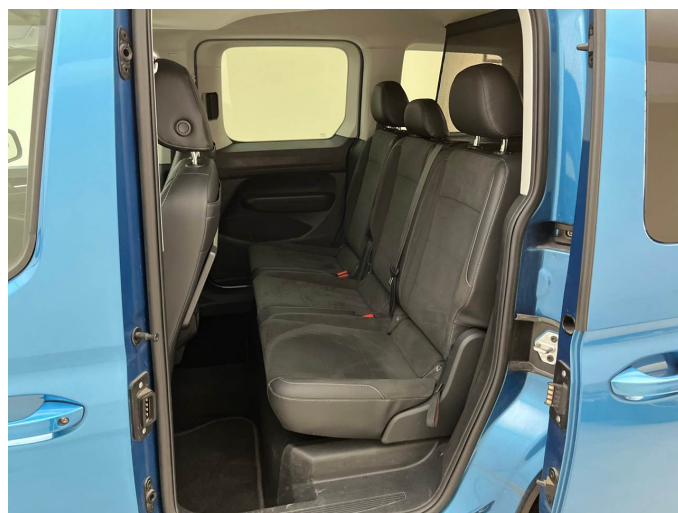


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

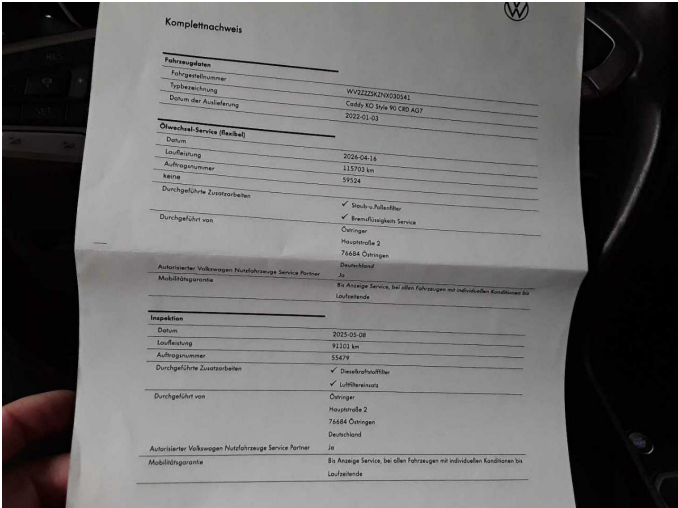


Figure 14: Documents

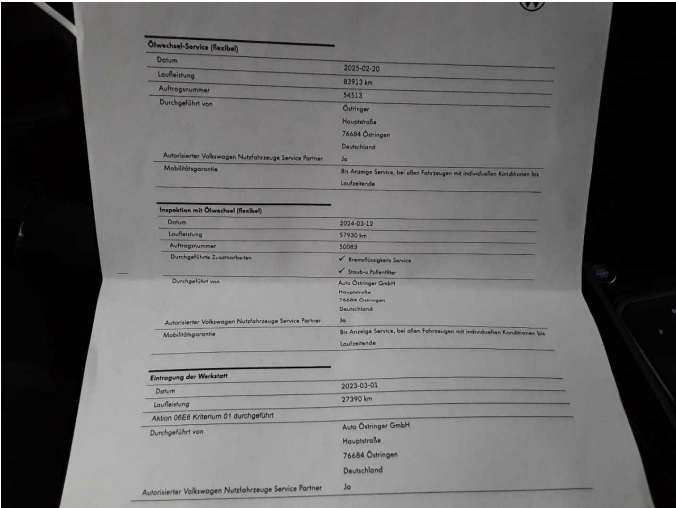


Figure 15: Documents



Figure 16: Documents

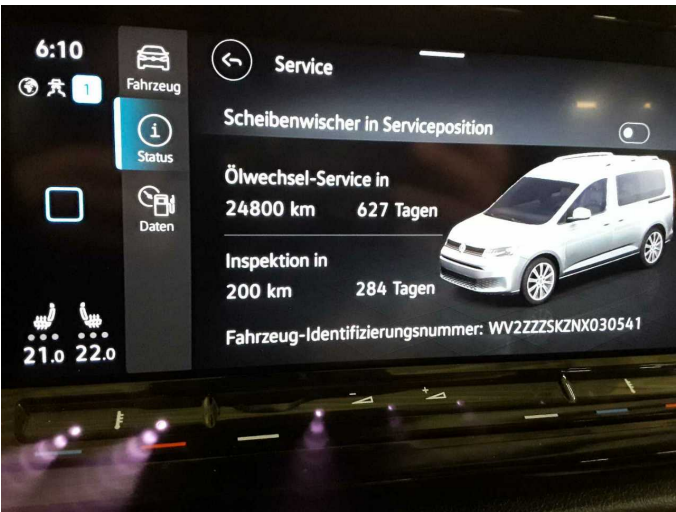


Figure 17: Documents



Figure 18: Additional tyres

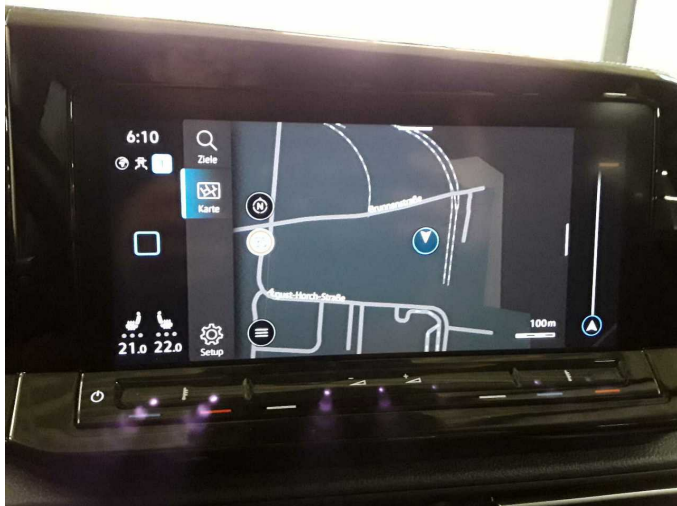


Figure 19: Navigation



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.

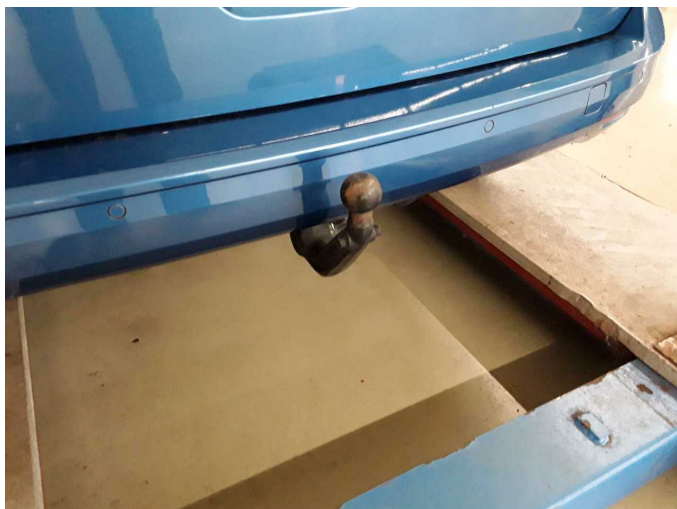


Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.

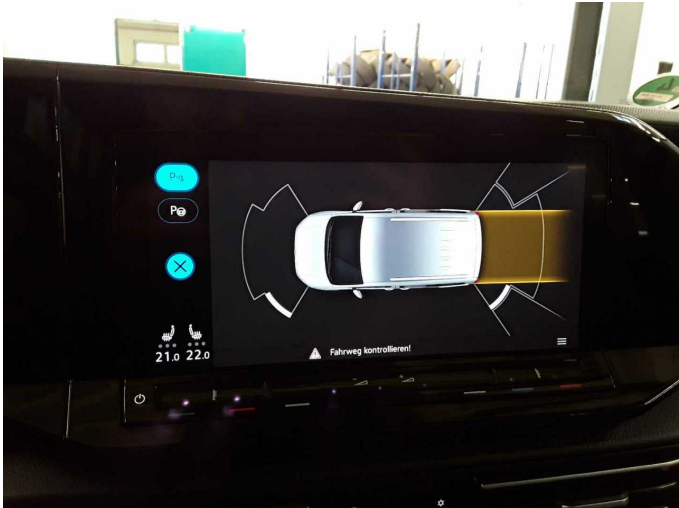


Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.

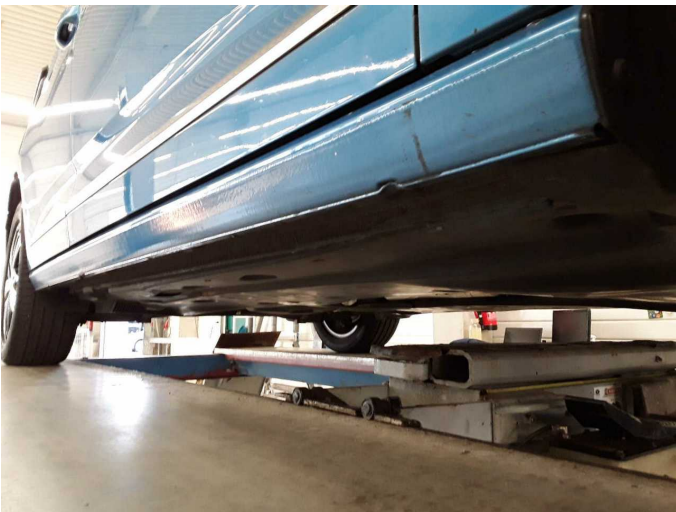


Figure 29: Misc.


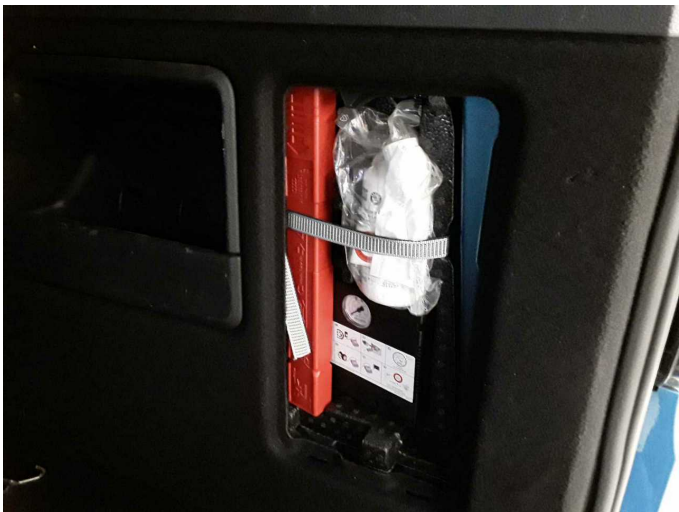


Figure 30: Misc.



Figure 31: Misc.

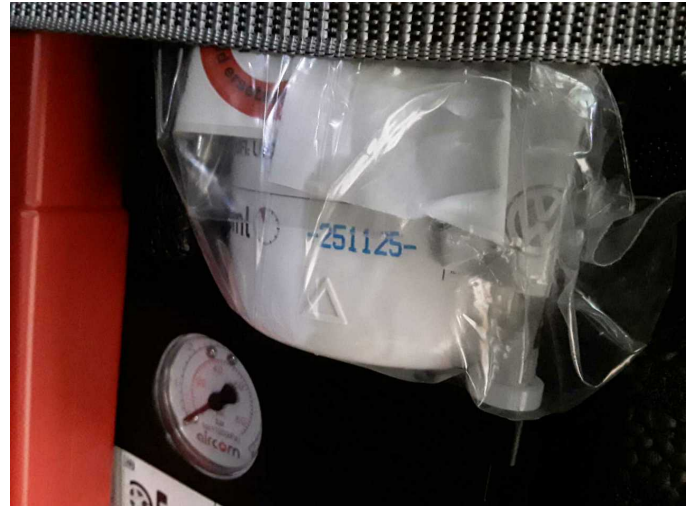

Damage 1: Equipment: Tirefit filler - Expired - Replace




Damage 2: Roof: Roof - dent(s) - Smart repair




Damage 2: Roof: Roof - dent(s) - Smart repair



Damage 3: Wheel / tyres: Tyre - front left side - Leaking - Replace

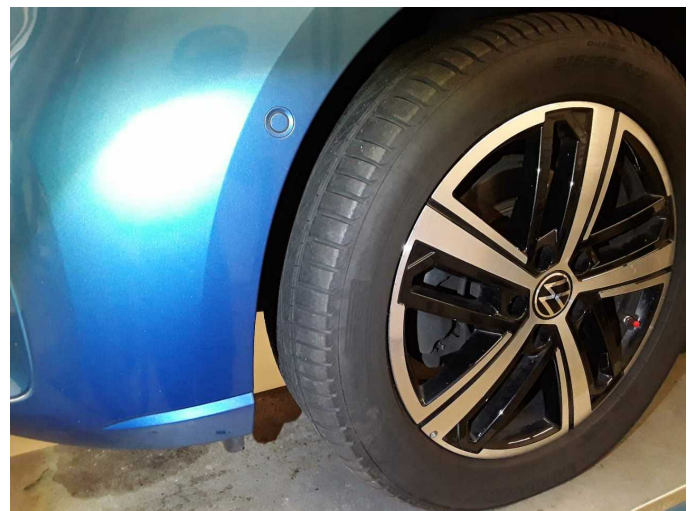

Damage 3: Wheel / tyres: Tyre - front left side - Leaking - Replace

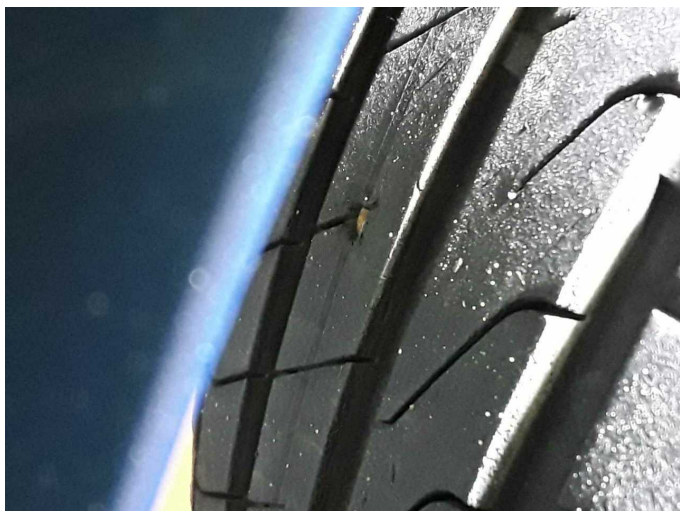


Damage 3: Wheel / tyres: Tyre - front left side - Leaking - Replace




Damage 4: Rear bumper: Bumper with Parktronic - Scratch(es) - Paint



Damage 4: Rear bumper: Bumper with Parktronic - Scratch(es) - Paint

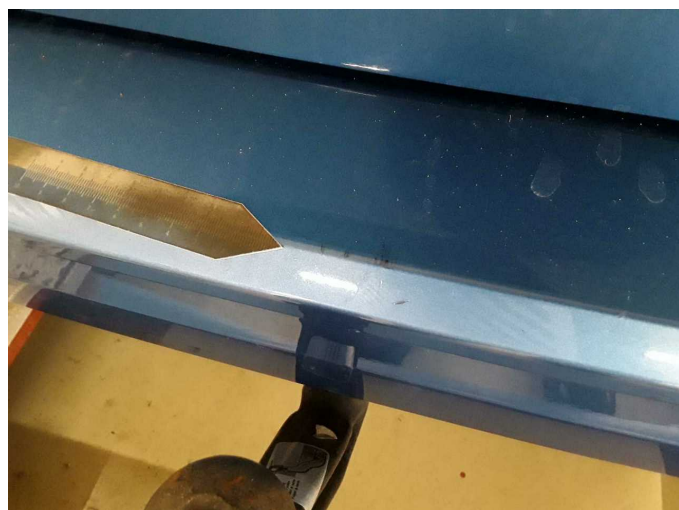

Damage 4: Rear bumper: Bumper with Parktronic - Scratch(es) - Paint

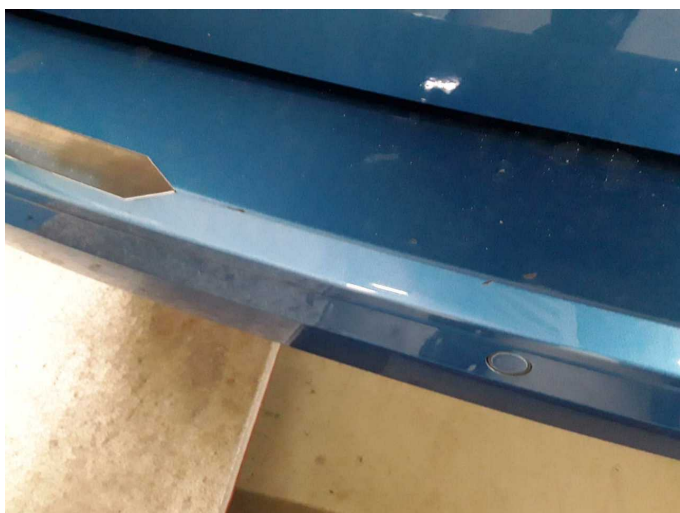

Damage 4: Rear bumper: Bumper with Parktronic - Scratch(es) - Paint



Damage 5: Front bumper: Bumper with Parktronic - Scratched - Repair and paint



Damage 5: Front bumper: Bumper with Parktronic - Scratched - Repair and paint



Damage 5: Front bumper: Bumper with Parktronic - Scratched - Repair and paint



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WV2ZZZSKZNX030541

Hersteller / Modell: VOLKSWAGEN VOLKSWAGEN Caddy 2.0 TDI BMT (5-Si.) DSG
Style

Datum	KM-Stand	Beschreibung
16.04.2026	115.707	Bremsflüssigkeit; Bremsflüssigkeit ern; Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
12.05.2025	91.105	Kraftstofffilter ern; Luftfiltereinsatz ern; Regelwartungsdienst; Systemtest/Eigendiagnose
20.02.2025	83.917	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
12.03.2024	57.939	Bremsflüssigkeit; Bremsflüssigkeit ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Systemtest/Eigendiagnose; Wartung Sonstiges
01.03.2023	27.397	Motoröl b. Wartung; Regelwartungsdienst