


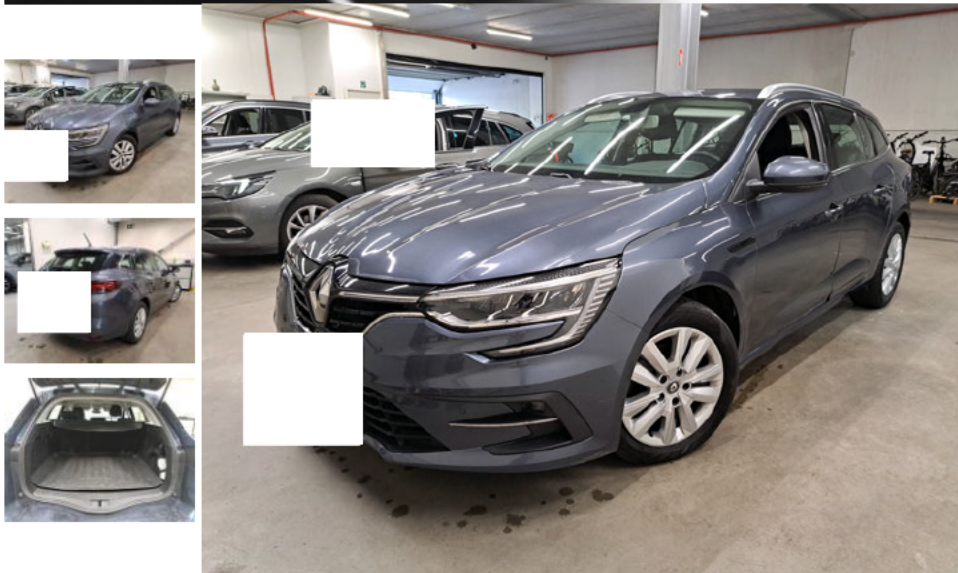

Renault Mégane:

Vinnumber:	VF1RFB00067287677	Versionname:	
First Registrationdate:	9/06/2021	Fiscalpower:	
Expertise Mileage:	128693	Power Kw:	85
Bodytype:		Body colour	Grey
Gearbox:	MAN 6 VIT	Type of rims (mounted)	Steel
Transmission:		Parking lot	3424
Fueltype:	Diesel		
Maintenance	OK		
Type of rims (mounted)	Steel		
Certificate of Conformity	Yes		
Category	Passenger Car		
Registration Certificate Car (BE)	Yes		
Registration Certificate Home (BE)	No		

Options

Number of keys total	1	Luggage cover	
Cruise Control		Front parking sensors	
Steering wheel multifunctional		Rear parking sensors	
Radio multimedia		Type of Tow bar	No Tow bar
Type of headlighting	Headlighting LED		
Type of GPS	GPS big screen color		
Type of Lining	Lining fabrics		
Type of climate control	Autom climate control		
Type of GPS storage	HD		

Limited Technical Inspection

Tyres

205/55/16/91 H				
Summer tyres:	Fr.L.	Uniroyal: 3 mm	Fr.R.	Uniroyal: 3 mm
	Re.L.	Continental: 5 mm	Re.R.	Continental: 5 mm
Tyre profile depth FL				3.0
Tyre profile depth FR				3.0
Tyre profile depth RL				5.0
Tyre profile depth RR				5.0
Tyre size FL				205/55 R 16 91 H
Tyre size FR				205/55 R 16 92 H
Tyre size RL				205/55 R 16 94 H
Tyre size RR				205/55 R 16 94 H
Tyre type FL				Summer
Tyre type FR				Summer
Tyre type RL				Summer
Tyre type RR				Summer
Tyre make FL				265
Tyre make FR				265
Tyre make RL				256
Tyre make RR				256

Assistance equipment

Emergency spare wheel	Yes	Jack	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		


Total cost ex VAT	5827,15
Ignition key, Missing, Replace	350,09



Seat cover FL, Hole, eplace	490,14
-----------------------------	--------



Floor covering FL, Burned, Smart repair	116,69
---	--------

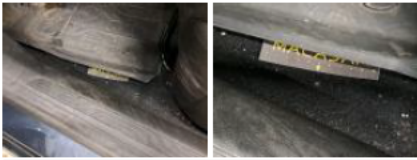

Seat cover R, Hole, Replace	642,66
-----------------------------	--------



Seat cover FR, Stain, Cleaning	29,16
--------------------------------	-------



Bonnet, Dent(s) and scratch(es), Repair and paint (complete)	465,70
--	--------



Bumper F, Dent(s) and scratch(es), Repair and paint (complete)	356,09
--	--------



Windscreen, Not original part, Replace	0,00
--	------



Wheel cover FL, Scratch(es), Replace

25,00



Tyre FL, Worn, Replace

180,98



Outside rear-view mirror housing L, Scratch(es), Acceptable

0,00



Door FL, Dent(s) and scratch(es), Repair and paint (complete)

505,30



Wing RL, Dent(s) and scratch(es), Repair and paint (complete)

491,09



Wheel cover RL, Scratch(es), Acceptable

0,00



Door RL, Scratch(es), Acceptable

0,00



Bumper R, Broken, Replace and paint	0,00
-------------------------------------	------



Wheel cover RR, Scratch(es), Replace	25,00
--------------------------------------	-------



Wing RR, Dent(s) and scratch(es), Repair and paint (complete)	491,09
---	--------



Door RR, Dent(s) and scratch(es), Repair and paint (complete)	505,30
---	--------



Door FR, Dent(s), Paintless dent repair	95,47
---	-------



Outside rear-view mirror housing R, Scratch(es), Repair and paint (complete)	161,81
--	--------



Step R, Dent(s), Repair and paint (complete)	221,32
--	--------



Roof, Chemical polution, Repair and paint (complete)	674,26
--	--------



