



Expertise

Protocol number: 46139472
Order No. / Reference: 26329210
Inspection date: 24 Jun 2026

Manufacturer: Skoda
VIN: TMBJW7NP8M7044309

Model: Superb Combi 1.4 TSI iV DSG L&K



Vehicle details	
Manufacturer / Type / Model / Equipment	
Skoda Superb Combi 1.4 TSI iV DSG L&K	
Vehicle Identification number	TMBJW7NP8M7044309
Mileage (Read)	92,609 km
First registration	26 Mar 2021
Number of holders	1
Next periodical technical inspection	04/2026
(Report on hand)	
Power / Engine displacement	115 kw / 1,395 ccm
Fuel type / Cylinder	Hybr.B/E ext.auf / 4
Gearbox / Number of gears	Automatic / 6
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Velvet rot metallic (F3P)
Doors / Seats	5 / 5
Upholstery type	Leather
Colour of upholstery	Black
Vehicle with smoke odor	no



Vehicle details			
Maintenance booklet / proof	digital evidence / incomplete	Next maintenance in	11,300 km
Last service on / at	01/2026 at 88,866 km		
Key is / should be	3 / 3	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GA507910
Previous damage / Accident	Detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	8004 / AUJ 00096		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,291 kg	Empty weight	

Tyres				
Mounted tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/55 R17 98V	Winter tyres on Light alloy	Goodyear	5mm / 5mm
2)	215/55 R17 98V	Winter tyres on Light alloy	Goodyear	6mm / 6mm
Additional tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/45 R18 94W	Summer tyres on Light alloy	Continental	5mm / 5mm
2)	235/45 R18 94W	Summer tyres on Light alloy	Continental	6mm / 6mm
Replacement				
Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 11/2024		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- Closed storage compartments behind the wheel arches in the trunk, including cargo elements
- Airbag, driver and switchable passenger airbag
- Airbag, driver's knee airbag
- Airbag, head airbags
- Airbag, front side airbags
- Anti-lock braking system (ABS)
- Traction control (ASR)
- Electrically adjustable and heated exterior mirrors
- Exterior mirrors and door handles in body color
- Electrically folding exterior mirrors (with boarding lights - interior and exterior mirrors with automatic dimming)
- Hydraulic brake assist (HBA)
- Roof rails, anodized
- Tachometer
- Dynamic Light Assistant (Masked Continuous High Beam)
- Electronic transverse differential lock (XDS+)
- Driving light assistant and rain sensor (tunnel light, coming and leaving home function)
- Chassis: Adaptive chassis DCC (10 mm lowering, adjustable damper setting) (including driving profile selection (Normal, Comfort, Eco, Sport, Individual))
- Front radar assist including city emergency braking function (The front radar assist warns of impending collisions and initiates braking to reduce the force of an unavoidable impact. The front radar assist continuously monitors the distance to the vehicle ahead using a radar sensor integrated into the radiator grille.)
- Heated rear window
- ISOFIX preparation on the outer rear seats, including top tether
- Front and rear headrests are height-adjustable.
- Metal loading sill protector
- Remote release of the rear seat backrests in the trunk
- Steering wheel: 2-spoke leather steering wheel with multifunction buttons (including gearshift and handbrake levers in leather)
- Steering wheel: height and reach adjustable
- Matrix LED headlights (AFS - dynamic high beam assist - automatic headlight range control - headlight cleaning system - LED taillights in crystal glass look - incl. dynamic turn signals)
- Color multifunction display in the instrument cluster
- Navigation: Amundsen 8" Dynamic Navigation System
- Otto particulate filter
- Upholstery: Executive leather interior (combined with high-quality materials)
- Radio accessories: 2 USB-C ports in the center console
- Radio accessories: SmartLink+ (Apple CarPlay - Android Auto - MirrorLink - SmartGate)
- Tire mobility kit (tire repair spray incl. compressor)
- Heated windshield washer nozzles
- Electromechanical power steering
- Seats: Heated front seats
- Storage compartments (ticket holder on the windshield, 4 roof grab handles, rear with coat hooks, coat hooks on the B-pillar, holder for the warning vests in the front doors, glasses compartment in the headliner, storage compartments in the door panels (front and rear) with 1.5l bottle holders, cup holder in the front center console with easy-open bottle opening, storage pockets on the front seat backrests, storage compartments behind the wheel arches in the trunk including cargo elements, illuminated trunk)
- Illuminated glove compartment
- Hill start assist
- Grey headliner
- Decorative inlay Piano Black
- Third brake light
- Electronic parking brake including auto-hold function
- Electronic Stability Control (ESC)
- Driving profile selection including customizable key (Normal, Eco, Sport, Individual) (incl. additional key)
- Chassis: Adaptive chassis DCC (including driving profile selection and customizable key, without lowering)
- Electric windows front and rear, including anti-pinch protection and child safety lock
- Front footwell lighting
- Cruise control system (cruise control) including speed limiter
- Transmission: 6-speed direct-shift gearbox (DSG)
- Tinted windows
- Rear window wiper including windshield washer system
- Kessy, keyless entry and start-stop system
- Boot cover, roll-up and removable, semi-automatic
- Charging cable, Mode 2, Schuko, 10A
- LED ambient lighting (decorative strips with selectable color climate, reading lamps, door handles and footwell as well as sun visors with LED lighting - projection of the SKODA lettering from the underside of the door onto the floor (front doors))
- Reading lights at the front and rear of the headliner
- Rear center armrest with cup holders and pass-through option
- Front center armrest with storage compartment
- Engine drag torque control (MSR)
- Multi-collision brake
- LED fog lights with integrated cornering lights
- Front and rear parking sensors
- Radio: CANTON sound system (11 speakers - 1 subwoofer - digital equalizer 610W)
- Radio accessories: Digital radio reception DAB+
- Radio accessories: Wireless SmartLink for Apple CarPlay
- Tire pressure monitoring
- Wheels: 18" Propus Aero alloy wheels (8J x 18" ET 44 with 235/45 R18 tires)
- Superb safety belts (Height-adjustable three-point front seat belts with belt tensioners - Three three-point rear seat belts - Belt fastening indicator for all seats)



- Seats: Adjustable lumbar support in the front seats
- Seats: Electrically adjustable front seats with memory function
- SKODA Care Connect (SOS emergency call function (Emergency Call incl. automatic activation in the event of an accident with airbag deployment), Mobility service (connection for rapid assistance in case of breakdown), Information service (connection to the hotline for all questions relating to vehicle functions), Free remote vehicle access for 1 year (Remote Access) with access to vehicle data and functions via smartphone, e.g. parking position, activating hazard warning lights, current fuel level)
- Chrome-plated elements (on air vents, light switches, music or navigation systems, air conditioning)
- Central locking with remote control

- Seats: Height-adjustable front seats
- Seats: Rear seat backrest split 60:40, foldable
- Sun visor on driver and passenger side with illuminated make-up mirror
- Start/stop system including brake energy recuperation
- 12V socket in the trunk
- 12V socket in the center console, front and rear
- Sunset (rear window and rear side windows tinted dark)
- Telephone: Convenient hands-free phone system with Bluetooth (without connection to an external antenna)
- Textile floor mats
- Lashing eyes in the trunk
- Immobiliser

Extra equipment

- 360° surround view camera (area view) including trailer maneuvering assistant (trailer assist) (parking assistant)
- Comfort opening for the electric tailgate (sensor-controlled opening)
- Digital instrument cluster (Virtual Cockpit) 10.2"
- Fatigue detection
- Heated windshield
- Lane Assist, Blind Spot Detection, Parking Assist, Emergency Assist and Traffic Jam Assist (Lane Assist with adaptive lane guidance)
- Luggage net partition
- Package: Storage (waste bin - net system in the trunk)
- Paint finish: Premium paint finish
- Seats: Heated outer rear seats
- Stainless steel rear protection strip
- Swiveling trailer hitch including trailer stabilization

- Adaptive Cruise Control (ACC) (control range up to 210 km/h) (replaces cruise control)
- Charging cable for AC charging stations (Mode 3 charging cable, Type 2, 16A)
- Climatronic air conditioning (3-zone) (fully automatic, separately adjustable for driver, front passenger and rear seats)
- Package: Business Columbus (Combi) (dynamic Columbus radio navigation system, capacitive 9.2" touchscreen, color Maxi-Dot display, Wi-Fi hotspot, voice control, phone box with inductive charging function (connection via external antenna), driver fatigue detection, 230V socket and USB ports, tablet holder in the rear, Sunset (dark tinted rear window and rear side windows), Infotainment Online (3-year subscription), heated rear seats and heated steering wheel, cargo net in the trunk, luggage net partition)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.



Value reducing factors

No.	Component group	Description
1	Trim / covers	Boot lid - interior trim - Scratch(es) - Loss in value
2	Trim / covers	Floor mats - Holes - Replace
3	Equipment	Tirefit filler - Expired - Replace
4	Side panel - rear left side	Side panel - Scratch(es) - Smart repair
5	Misc.	Main inspection - Due - Perform
6	2nd wheel set	1 alloy rim - Scratch(es) - Loss in value
7	Roof	Roof - Scratched - Smart repair
8	Trim / covers	Door trim - rear right side (Und links) - Deformed - Loss in value
9	Rear bumper	Rear bumper - Scratch(es) - Paint

Wear and tear

No.	Component group	Description
1	Body	Body - Scratch(es) - No deduction
2	Seat - front	Seat cover - left side - Abrasion - No deduction
3	Wheel / tyres	Alloy rim - rear right side - Scratch(es) - No deduction
4	Front bumper	Front bumper - Stone chips - No deduction
5	Body	Underbody panelling - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Replacement engines

No. Replacement engine

- 1 Replacement engine, Installation date 20 May 2026, at -Status 92,427

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Rear, Provided by user / customer, from 2 Apr 2023	1.093,19 €
2	Front, Provided by user / customer, from 3 Apr 2024	5.727,11 €

Paint coat thickness measurement

Boot lid / rear door	121 µm	Bonnet	80 µm
----------------------	--------	--------	-------

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

Winter - Radsatz ist kein Bestandteil des Lieferumfangs.

ALPHABET



Figure 1: Diagonal front (left)

ALPHABET



Figure 2: Diagonal front (right)

ALPHABET



Figure 3: Diagonal rear (left)

ALPHABET



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel

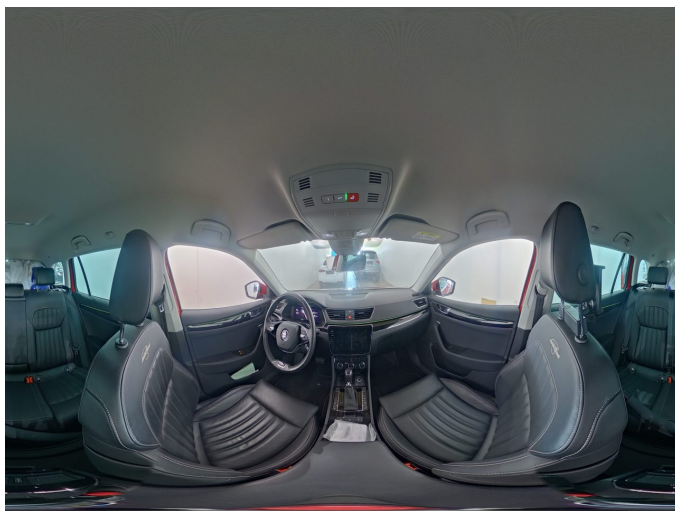


Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN

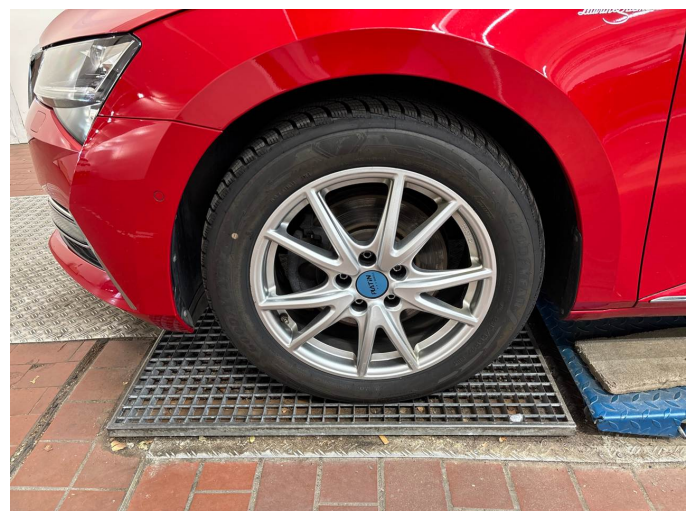


Figure 12: Mounted tyres

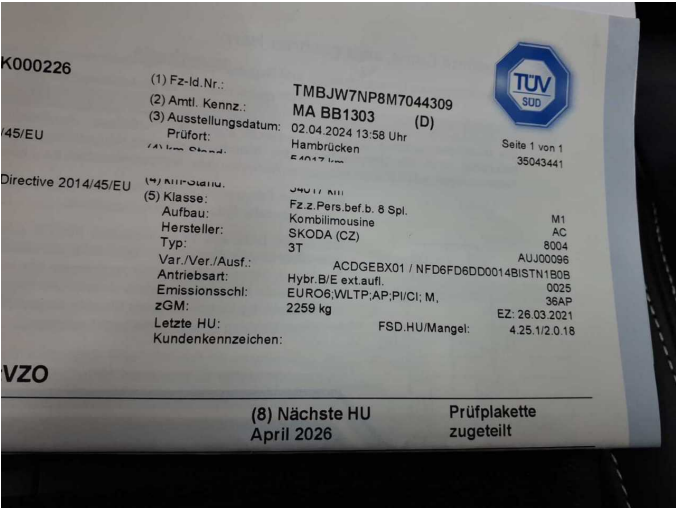


Figure 13: Documents

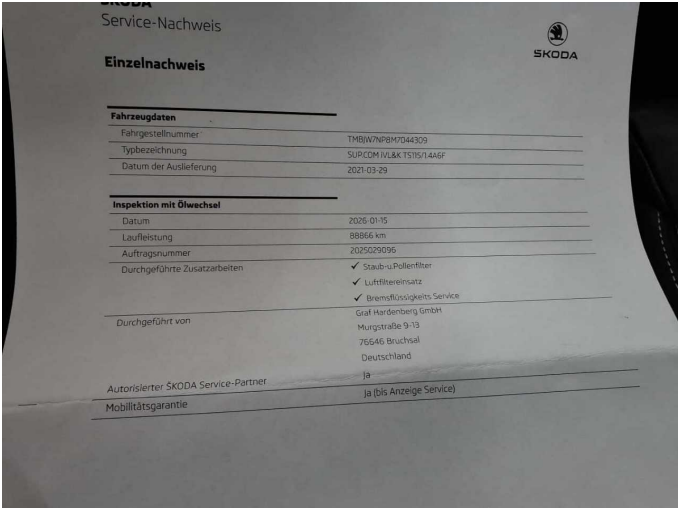


Figure 14: Documents



Figure 15: Documents



Figure 16: Documents



Figure 17: Additional tyres



Figure 18: Navigation



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.

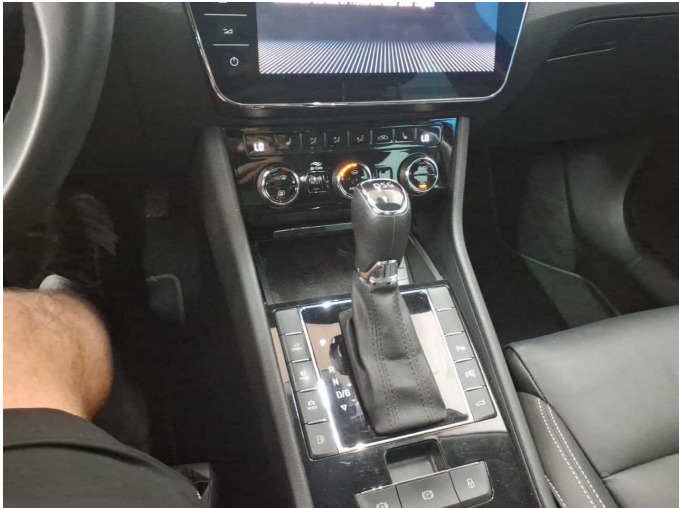


Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.

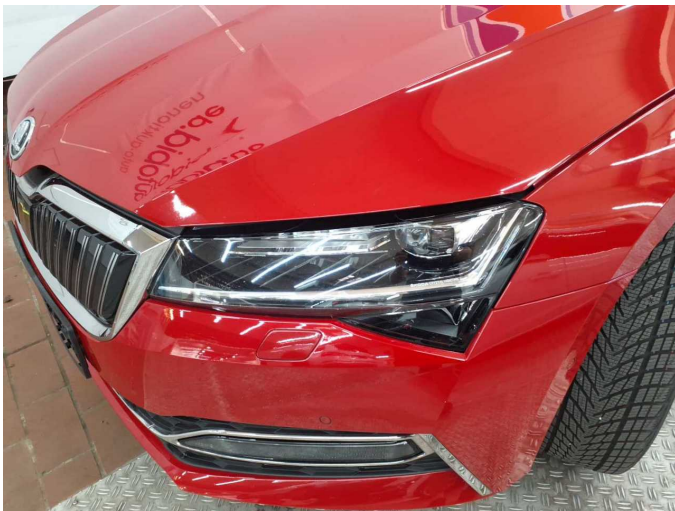


Figure 27: Misc.

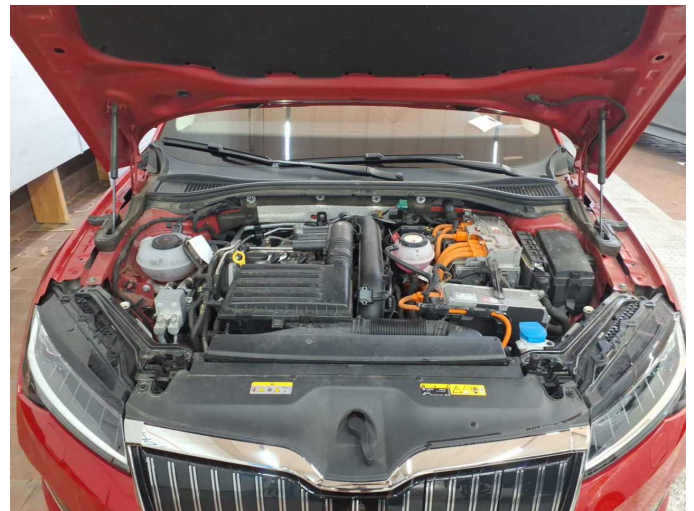


Figure 28: Misc.

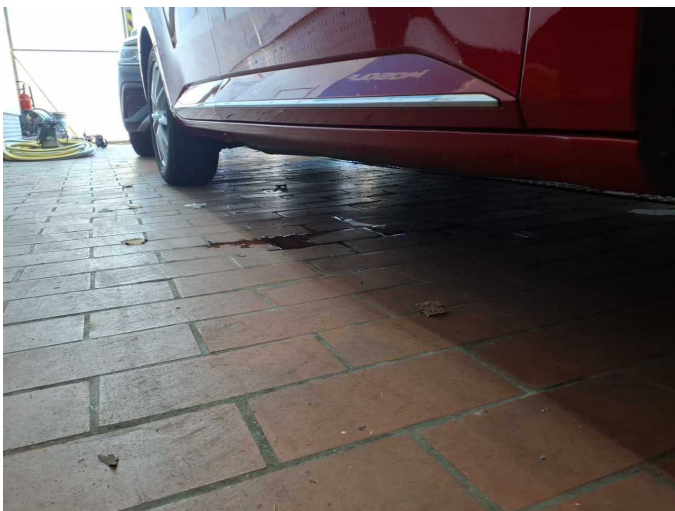


Figure 29: Misc.



Figure 30: Misc.

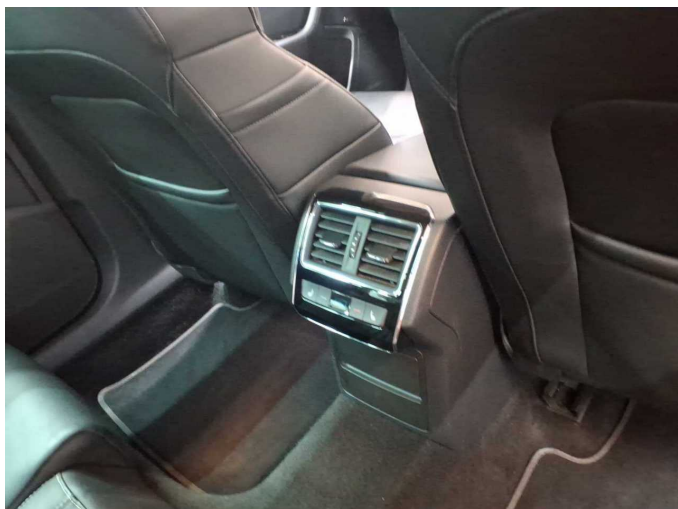


Figure 31: Misc.

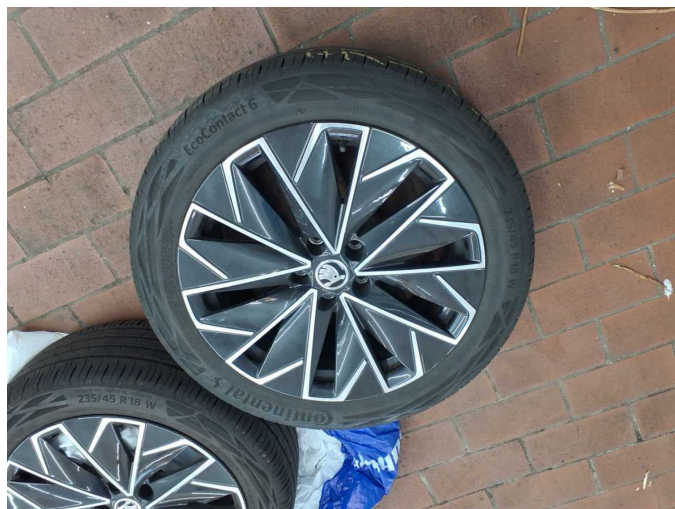


Figure 32: Misc.



Figure 33: Misc.

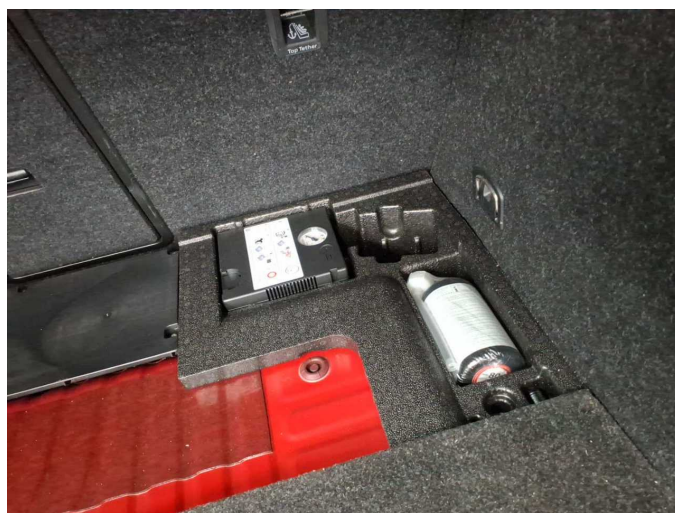


Figure 34: Misc.



Figure 35: Misc.

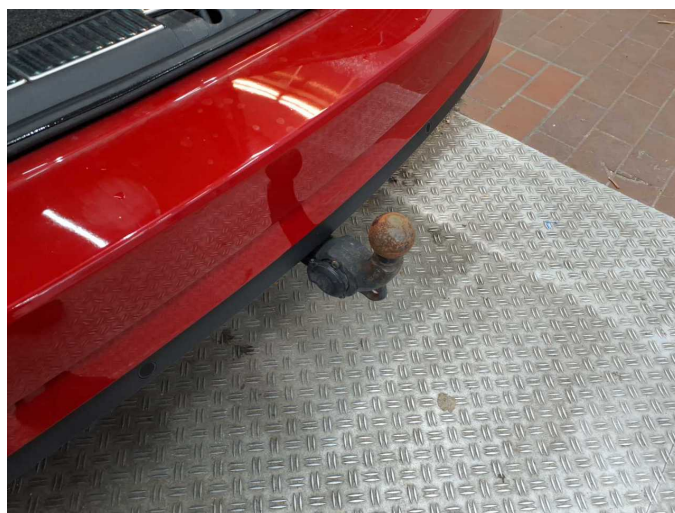


Figure 36: Misc.



Figure 37: Misc.




Figure 38: Misc.



Damage 1: Trim / covers: Boot lid - interior trim - Scratch(es) - Loss in value



Damage 1: Trim / covers: Boot lid - interior trim - Scratch(es) - Loss in value

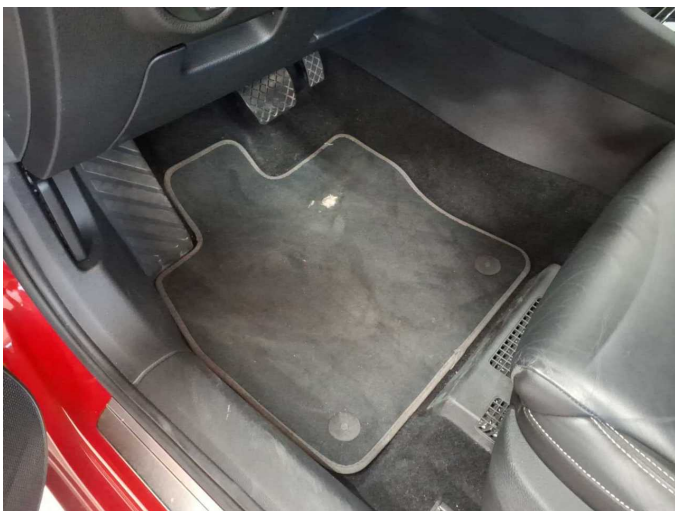

Damage 2: Trim / covers: Floor mats - Holes - Replace



Damage 2: Trim / covers: Floor mats - Holes - Replace




Damage 3: Equipment: Tirefit filler - Expired - Replace



Damage 4: Side panel - rear left side: Side panel - Scratch(es) - Smart repair



Damage 4: Side panel - rear left side: Side panel - Scratch(es) - Smart repair

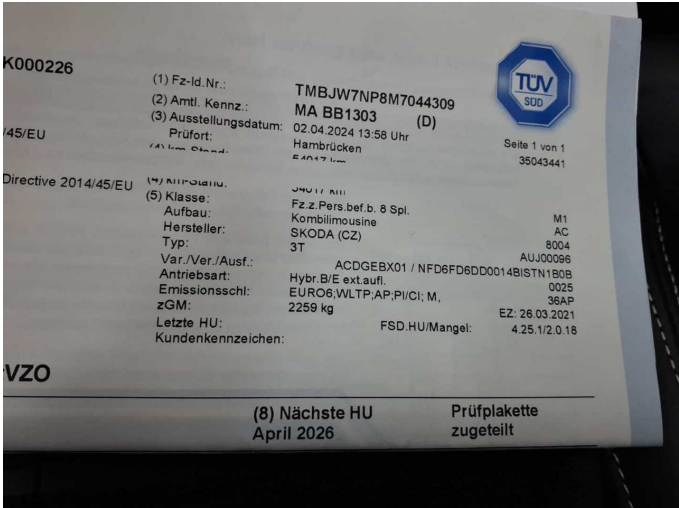

Damage 5: Misc.: Main inspection - Due - Perform




Damage 6: 2nd wheel set: 1 alloy rim - Scratch(es) - Loss in value



Damage 6: 2nd wheel set: 1 alloy rim - Scratch(es) - Loss in value



Damage 6: 2nd wheel set: 1 alloy rim - Scratch(es) - Loss in value

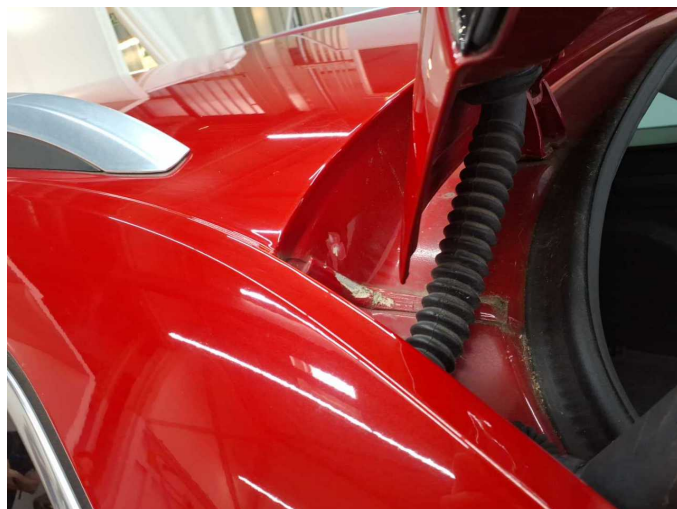


Damage 7: Roof: Roof - Scratched - Smart repair



Damage 7: Roof: Roof - Scratched - Smart repair




Damage 8: Trim / covers: Door trim - rear right side (Und links) - Deformed - Loss in value

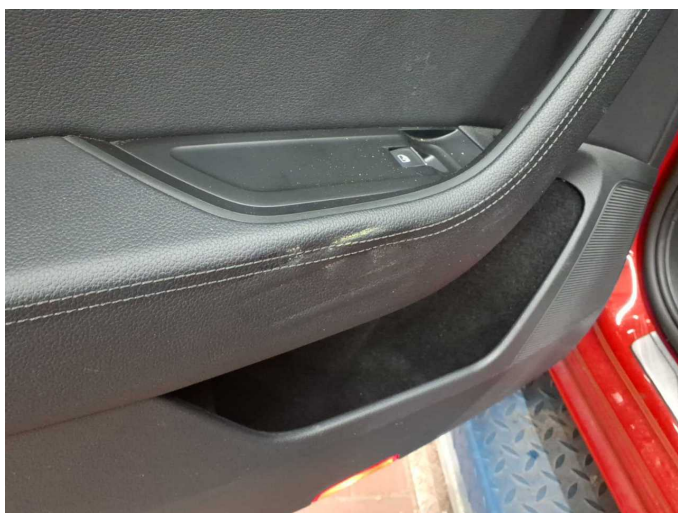


Damage 8: Trim / covers: Door trim - rear right side (Und links) - Deformed - Loss in value




Damage 8: Trim / covers: Door trim - rear right side (Und links) - Deformed - Loss in value

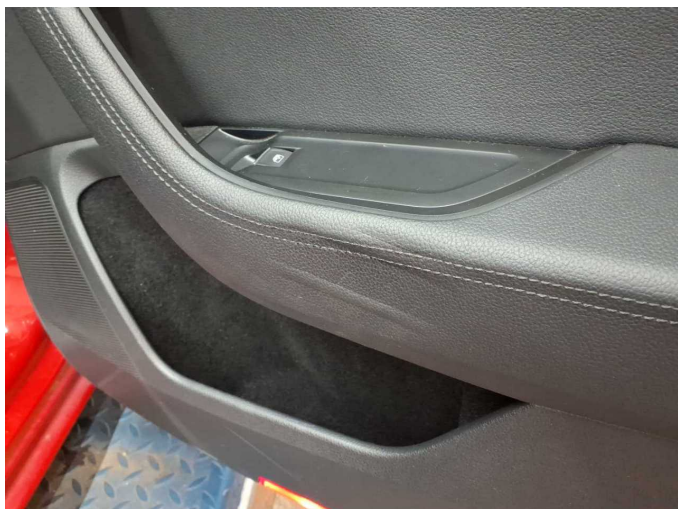

Damage 8: Trim / covers: Door trim - rear right side (Und links) - Deformed - Loss in value

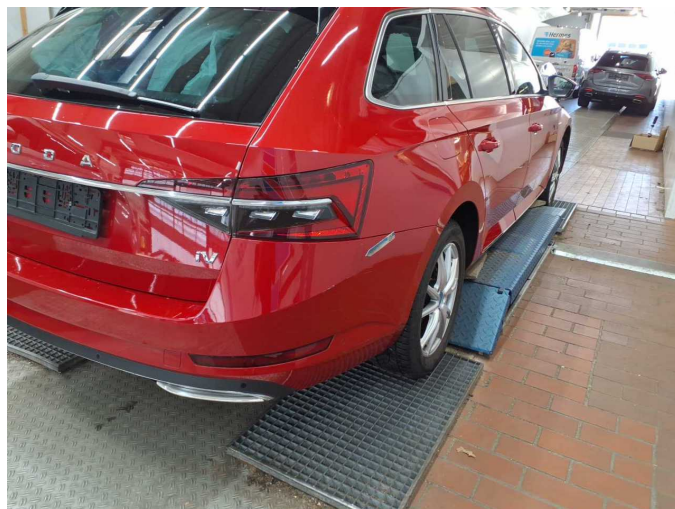


Damage 9: Rear bumper: Rear bumper - Scratch(es) - Paint

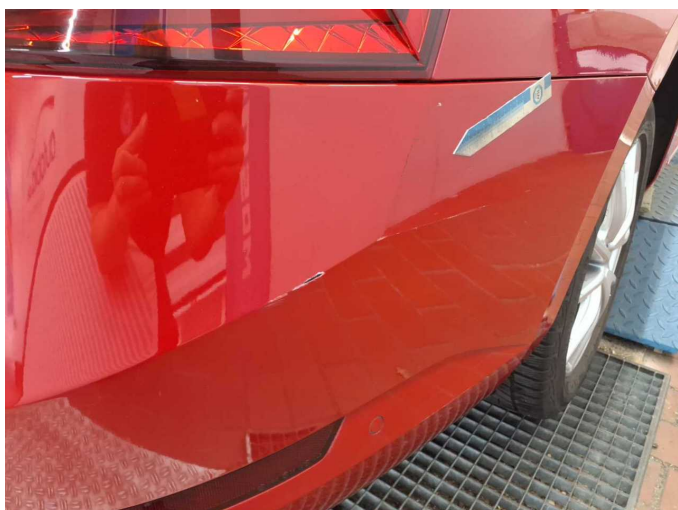

Damage 9: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 9: Rear bumper: Rear bumper - Scratch(es) - Paint

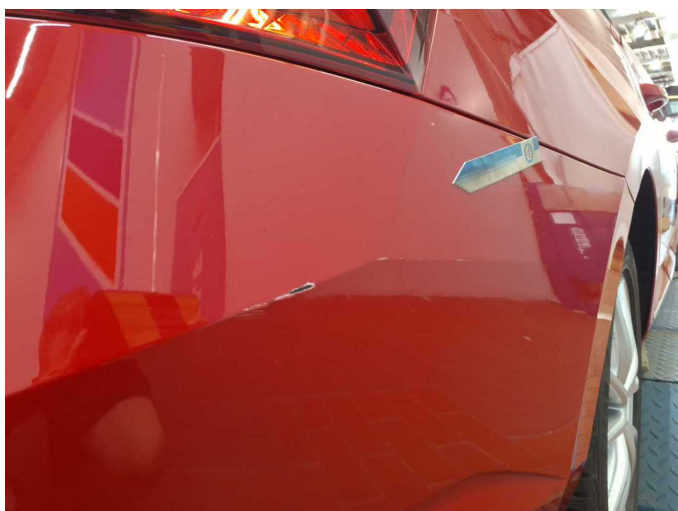


Damage 9: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 9: Rear bumper: Rear bumper - Scratch(es) - Paint



Previous damage 1: Rear

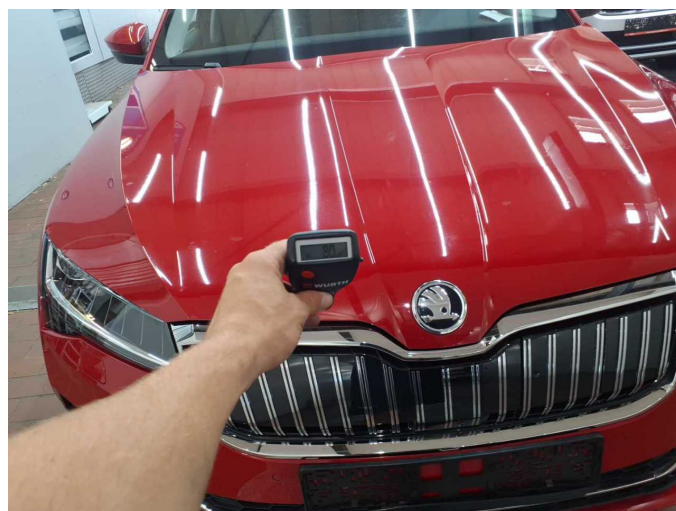

Previous damage 2: Front



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: TMBJW7NP8M7044309

Hersteller / Modell: SKODA SKODA Superb Combi 1.4 TSI iv DSG L&K

Datum	KM-Stand	Beschreibung
20.05.2026	92.427	Motor ern; Systemtest/Eigendiagnose
15.01.2026	88.866	Bremse Sonstiges; Bremsflüssigkeit; Bremsflüssigkeit ern; Bremsklötze hinten; Bremsscheiben hinten; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
25.09.2025	83.876	Reparatur Sonstiges
03.07.2024	60.712	Klimaanlage inst.; Systemtest/Eigendiagnose; Wartung Sonstiges
21.06.2024	60.184	Getriebeöl ern/prüfen; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges; Zündkerzen ern
25.04.2024	54.011	AU; Motoröl b. Wartung; Ölwechsel
12.01.2023	30.555	Bremsflüssigkeit; Bremsflüssigkeit ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
15.03.2022	14.443	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges