



Expertise

Protocol number: 46408656
Order No. / Reference: 26625640
Inspection date: 9 Jul 2026

Manufacturer: Ford

Model: Transit Connect 240 L2 LKW Trend

VIN: WF07XXWPG7NJ46047



Vehicle details

Manufacturer / Type / Model / Equipment

Ford Transit Connect 240 L2 LKW Trend

Vehicle Identification number	WF07XXWPG7NJ46047
Mileage (Read)	99,218 km
First registration	22 Aug 2022
Number of holders	1
Next periodical technical inspection	09/2026
(Report on hand)	

Power / Engine displacement	88 kw / 1,499 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Manual / 6
Type of drive	Front drive
Type of vehicle	Van

Colour / colour code	Frost-Weiß
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black-Anthracite



Vehicle details			
Maintenance booklet / proof	digital proof / complete	Next maintenance in	91 %
Last service on / at	05/2026 at 97,506 km		
Key is / should be	2 / 3	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GK841459
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	8566 / BMN 02598		
Emission standard	EURO6;WLTP;AR;PI/CI;N1 III, N2	fine dust sticker	
Permitted total weight	2,405 kg	Empty weight	

Tyres				
Mounted tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 96H	Summer tyres on Steel rim with wheel cover	Continental	3mm / 3mm
2)	205/60 R16 96H	Summer tyres on Steel rim with wheel cover	Continental	4mm / 4mm
Additional tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 96H	Winter tyres on Steel	Fulda	5mm / 5mm
2)	205/60 R16 96H	Winter tyres on Steel	unterschiedliche Hersteller	5mm / 5mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- ABS with EBD
- Exterior mirrors, narrow mirror format
- Battery, reinforced
- Rubberized flooring, front
- Diesel particulate filter (DPF) with SCR catalyst and AdBlue tank
- Third brake light
- Window, rear, left, fixed (at the height of the 2nd row of seats)
- Rear right window, fixed (at the height of the 2nd row of seats)
- Ford Easy Fuel - Comfort fuel cap and misfuelling protection
- Heated windscreen including electrically adjustable and heated exterior mirrors
- Warranty: 2-year Ford new car warranty including Ford Assistance mobility guarantee
- Rubberized luggage compartment floor mat
- Glove compartment with lid
- Front interior lighting with delay function
- Paint finish: Solid
- Steering column, adjustable in height and reach
- Center console, front - open with storage area, 2 cup holders
- Wheels: Tire repair kit
- Wheels: Steel wheels 6.5 J x 16 with 205/60 R 16 tires and wheel trims
- Electro-mechanical power steering (EPAS - Electric Power Assisted Steering)
- Automatic security door lock (45 sec.) - Automatic relocking if no door is opened within 45 seconds of unlocking via remote control.
- Front spoiler lip
- Start-stop system
- Dust and pollen filter
- Front bumper and rear bumper end caps painted in body color
- Child safety lock on sliding doors
- Door handles, black
- Warning system for unfastened seat belts. Warning system for unfastened seat belts in all other seats.
- Central locking with remote control - door lock only on driver's door - 2 keys, including 1 remote control key
- Driver's side airbag
- Exterior mirror housing black
- Hill start assist
- On-board computer including outside temperature display
- Double rear doors with window
- Tachometer
- Electronic Stability Program (ESP) with Traction Control System (TCS) including Torque Vectoring Control and Adaptive Load Control
- Front electric windows - with one-touch down function for driver's side
- FordPass Connect - Information about the current status or location of the vehicle and control of selected vehicle functions via smartphone with the FordPass app - including live traffic information in real time (in conjunction with Ford navigation system including Ford SYNC 3) - including Wi-Fi hotspot
- Transmission: 6-speed transmission
- Heated rear windows
- Front air conditioning including semi-electronic recirculation system
- Alternator/Generator
- Fog light
- Emergency brake light - hazard warning flashing activation during heavy braking
- Sliding door, right and left
- Side protection strips, plastic
- Emergency Brake Assist (EBA)
- Front seat belts height-adjustable - Front seat belt tensioners and force limiters - Warning system for unfastened driver's seat belt
- Seats for passenger compartment: 2nd row of double cab seats - bench seat, 60:40 split, foldable, can be lowered into the footwell
- Power outlet: 12-volt connection on the front center console
- Daytime running light
- Partition wall: Grid partition - movable (to positions behind the 1st and 2nd rows)
- Lashing eyes
- Electronic immobilizer (EPATS)
- Heat-insulating glazing, lightly tinted
- Auxiliary electric heater (PTC), front



Extra equipment

- Adaptive cruise control with intelligent speed limiter, including radar- and camera-based pre-collision assist with pedestrian and cyclist detection, lane keeping assist including lane departure warning and driver drowsiness alert, including traffic sign recognition system, leather multifunction steering wheel with 4 spokes in aluminum trim
- Electrically folding exterior mirrors including electric front windows with quick-up/down function - mirrors fold in automatically when the vehicle is locked.
- Pre-Collision Assist, camera-based with pedestrian and cyclist detection, including Automatic Emergency Braking (AEB), Dynamic Brake Support (DBS), and Forward Collision Warning (FCW).
- Radio: Ford Audio System 10, Ford SYNC 3 with AppLink, 6" touchscreen radio, DAB/DAB+, 2 USB ports, 4 front speakers, Bluetooth hands-free system and audio streaming, Emergency Call Assistance, SMS text-to-speech/send function, voice control for audio and telephony, Android Auto and Apple CarPlay support, 14 languages (graphical and audible), reversing camera including rear parking sensors, phase diversity antenna
- Remote control: 2nd remote control key for central locking - instead of conventional key
- Seats: Seat Package 6 - "Capitol/City" fabric in Ebony (black) - Driver's seat, 3-way manually adjustable (forward/backward, height, backrest) - Single passenger seat, 2-way adjustable (forward/backward/backrest) and foldable - Height-adjustable headrests - Heated seats for driver and passenger - Manual lumbar support (driver) - Map pocket for driver's seat - Airbag package for driver and passenger
- Active parking assistant with parking and exiting function, front and rear parking pilot system.
- Crosswind Assist and Roll Stability Control (RSC)
- DPF regenerator, manual
- Fog lights with static cornering lights
- Front and rear parking pilot system
- Heat-insulating glazing, tinted (from the B-pillar) - side windows from the 2nd row of seats
- High beam assist - including windscreen wipers with rain sensor and automatically dimming interior mirror
- Inductive charging station for mobile devices - according to Qi standard, compatibility depends on the device
- Lane keeping assist including lane keeping assist and driver fatigue warning
- Pre-Collision Assist, radar and camera-based with pedestrian and cyclist detection including Automatic Emergency Braking (AEB), Dynamic Brake Support (DBS), Forward Collision Warning (FCW), Lane Keeping Assist including Lane Departure Warning and Driver Alert System
- Radio: Ford Audio System 9, Ford Navigation System incl. Ford SYNC 3 with AppLink, 6" touchscreen radio (FM/AM), 2 USB ports, audio remote control on the steering wheel, Bluetooth hands-free system and audio streaming, emergency call assistant, SMS text-to-speech function, SMS sending function, voice control, reversing camera, phase diversity antenna, DAB/DAB+, acoustic and visual route guidance, road map for Europe, TMCpro live traffic, detailed 3D visualization, Michelin travel guide for Europe
- Rear parking pilot system
- SORTIMO TKKR
- Tire pressure monitoring system

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.



Value reducing factors

No.	Component group	Description
1	Side panel - rear right side	Side panel - dent(s) - Smooth repair work
2	Mudguard - left side	Mudguard - left side - dent(s) - Smooth repair work
3	Side panel - rear left side	Side panel - Scratched - Smart repair
4	Headlight	Headlight - left side - Scratch(es) - Replace
5	Door - front left side	Door - Deformed - Repair and paint
6	Front bumper	Front bumper (Klarlack abgeblättert) - Paint defect - Repair and paint
7	Vehicle glazing	Windscreen (Rissbildung) - Stone chips - repair according to calculation

Wear and tear

No.	Component group	Description
1	Interior	Interior - Scratch(es) - No deduction
2	Bonnet	Bonnet - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

Equipment - Tirefit filler

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Side - left, Provided by user / customer, from 11 Oct 2023	3.654,25 €
2	Front, Provided by user / customer, from 12 Jun 2023	5.251,69 €

Accident damages

No. Accident

1 Side right

Repainting

No. Repainting

1 Mudguard - left side, Side panel - rear left side, Door - front left side, Professionally carried out, Invoice of repair done Non-existent

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations of light commercial vehicles published by Alphabet Fleet Management GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

Non-repaired previous damages were found at the vehicle. The necessary repair costs are listed in the expert report or if necessary, are listed in detail in a separately enclosed repair cost calculation.

Comments

Wartungshistorie gemäß Auftraggeber Informationen.

Die beigefügte Reparaturkostenkalkulation wurde nach bestem Wissen und Gewissen unter eingeschränkten Besichtigungsbedingung im demontagefreien Zustand erstellt. Es können aufgrund verdeckter Beschädigung erhebliche Mehrkosten und somit Abweichung der für den Unfall ausgewiesenen Reparaturkosten nicht ausgeschlossen werden.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

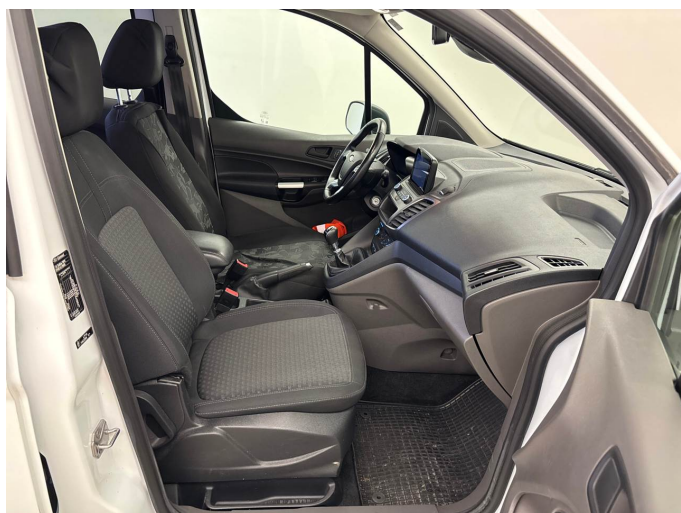


Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres

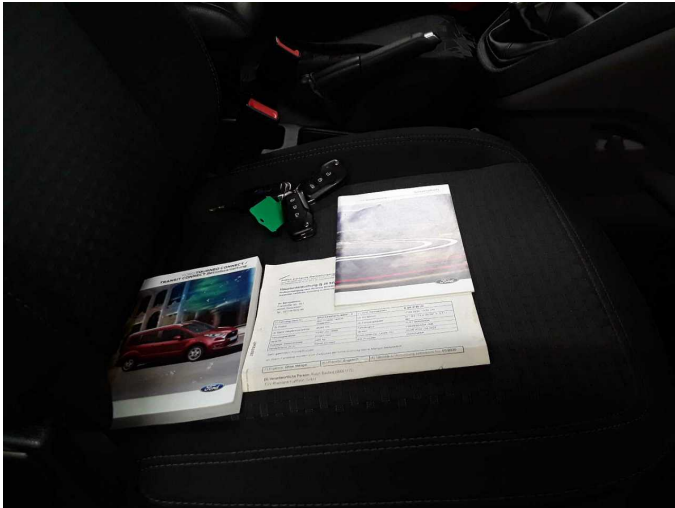


Figure 13: Documents

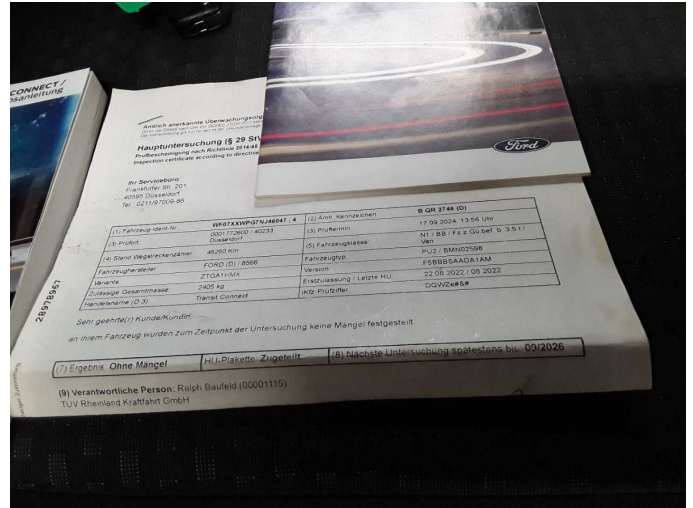


Figure 14: Documents

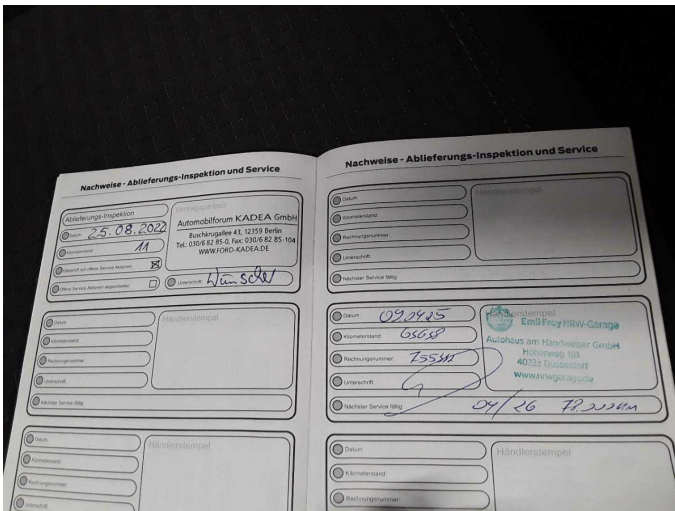


Figure 15: Documents



Figure 16: Additional tyres



Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.




Figure 28: Misc.



Figure 29: Misc.




Figure 30: Misc.

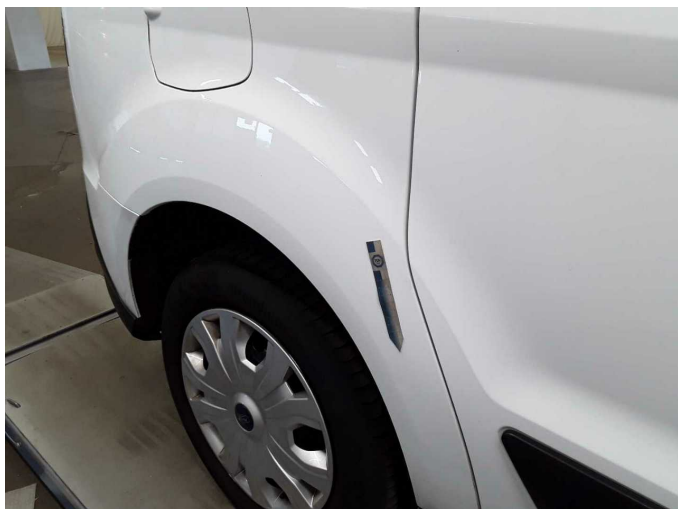


Damage 1: Side panel - rear right side: Side panel - dent(s) - Smooth repair work



Damage 1: Side panel - rear right side: Side panel - dent(s) - Smooth repair work

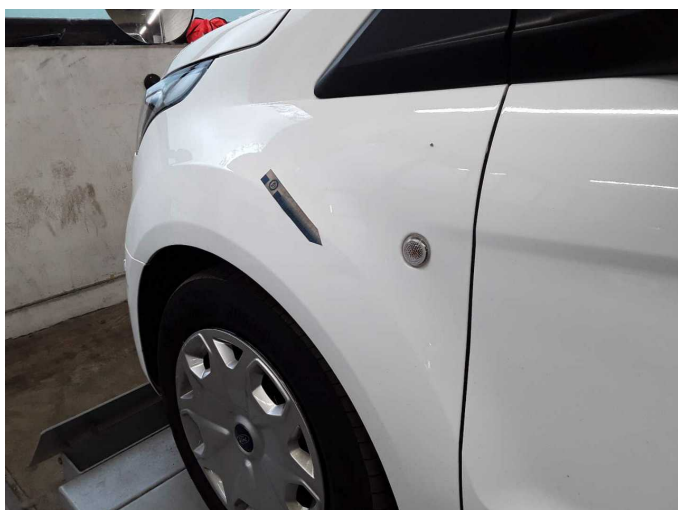


Damage 2: Mudguard - left side: Mudguard - left side - dent(s) - Smooth repair work

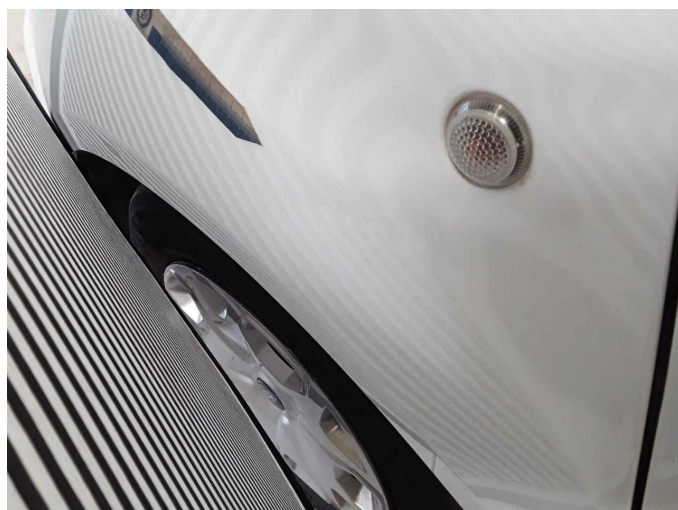


Damage 2: Mudguard - left side: Mudguard - left side - dent(s) - Smooth repair work



Damage 3: Side panel - rear left side: Side panel - Scratched - Smart repair

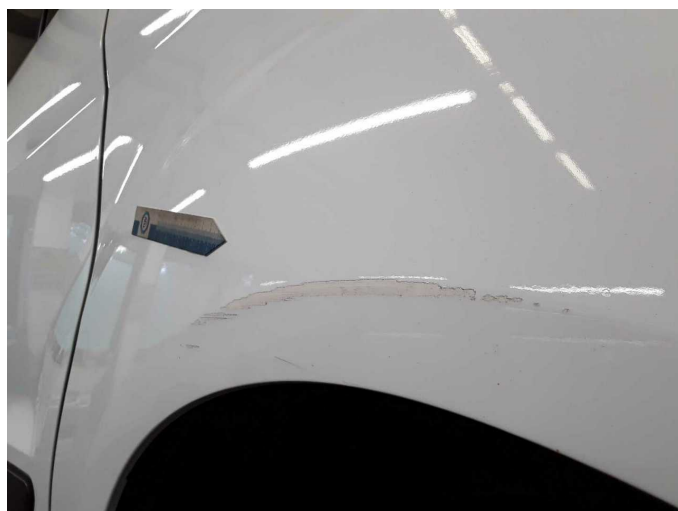

Damage 3: Side panel - rear left side: Side panel - Scratched - Smart repair

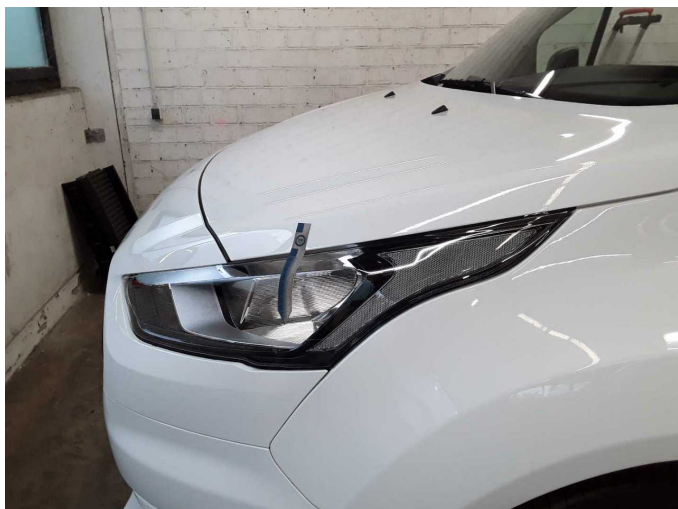

Damage 4: Headlight: Headlight - left side - Scratch(es) - Replace




Damage 4: Headlight: Headlight - left side - Scratch(es) - Replace




Damage 4: Headlight: Headlight - left side - Scratch(es) - Replace



Damage 5: Door - front left side: Door - Deformed - Repair and paint

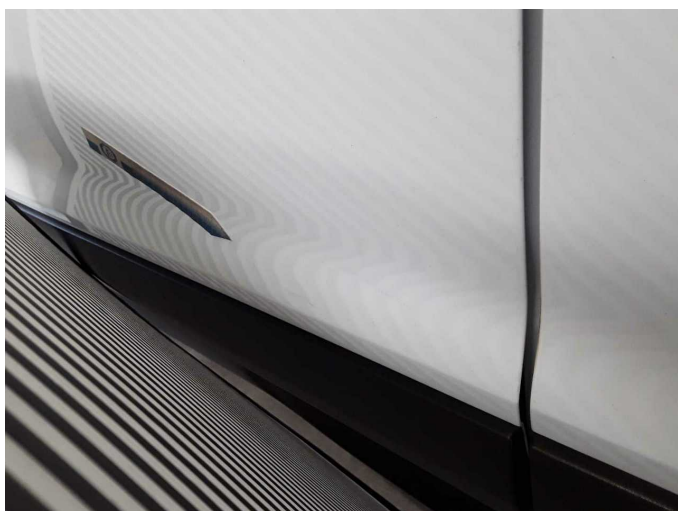


Damage 5: Door - front left side: Door - Deformed - Repair and paint

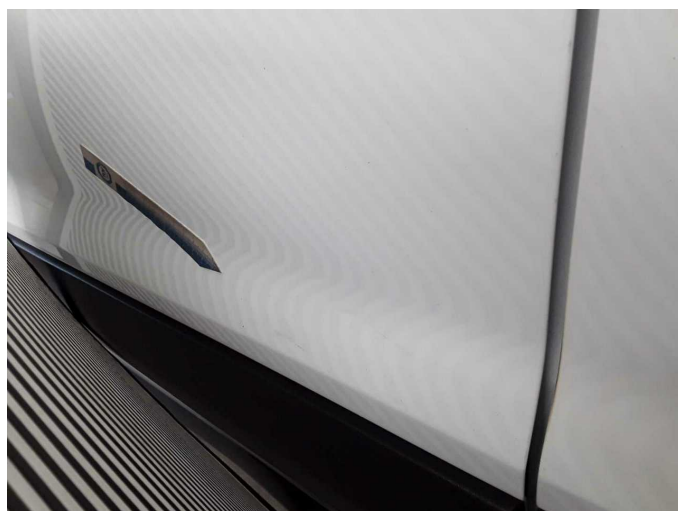


Damage 5: Door - front left side: Door - Deformed - Repair and paint



Damage 6: Front bumper: Front bumper (Klarlack abgeblättert) - Paint defect - Repair and paint

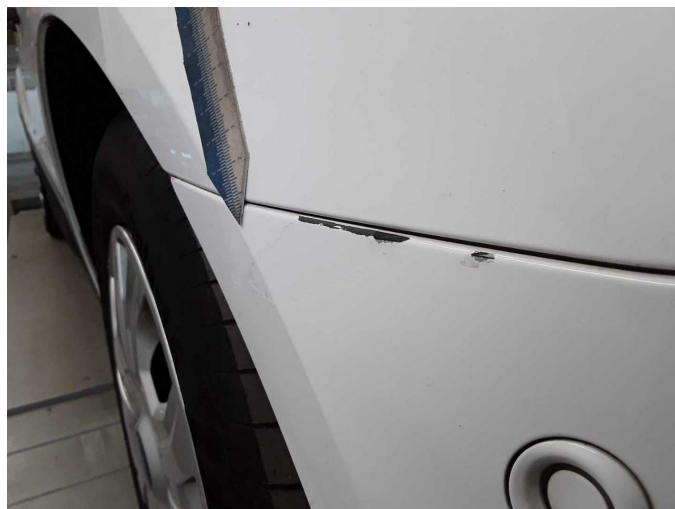

Damage 6: Front bumper: Front bumper (Klarlack abgeblättert) - Paint defect - Repair and paint

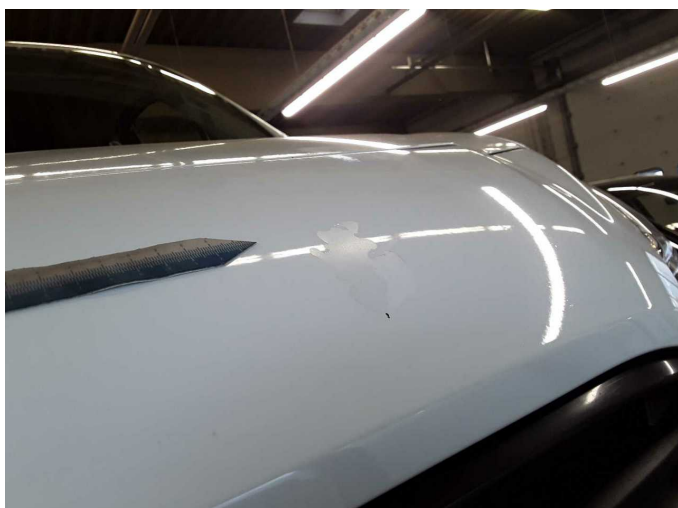


Damage 6: Front bumper: Front bumper (Klarlack abgeblättert) - Paint defect - Repair and paint




Damage 6: Front bumper: Front bumper (Klarlack abgeblättert) - Paint defect - Repair and paint



Damage 7: Vehicle glazing: Windscreen (Rissbildung) - Stone chips - repair according to calculation

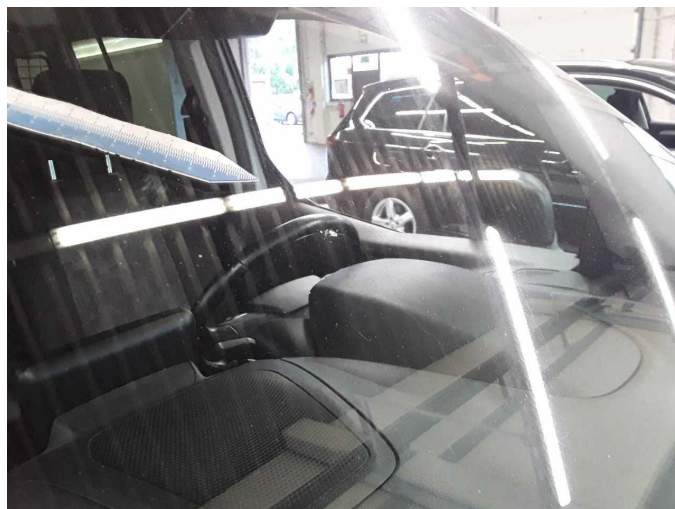

Damage 7: Vehicle glazing: Windscreen (Rissbildung) - Stone chips - repair according to calculation

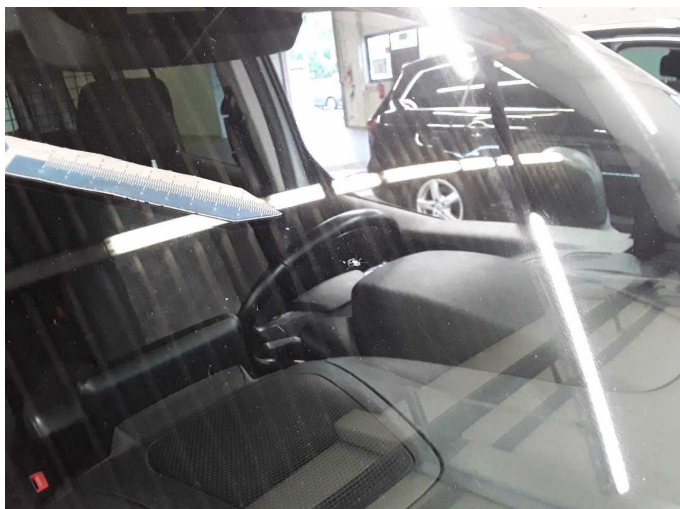

Damage 7: Vehicle glazing: Windscreen (Rissbildung) - Stone chips - repair according to calculation



Accident 1: Side right



Accident 1: Side right



Accident 1: Side right



Accident 1: Side right



Accident 1: Side right



Accident 1: Side right



Accident 1: Side right




Repainting 1: Mudguard - left side, Side panel - rear left side, Door - front left side



Repainting 1: Mudguard - left side, Side panel - rear left side, Door - front left side



Repainting 1: Mudguard - left side, Side panel - rear left side, Door - front left side

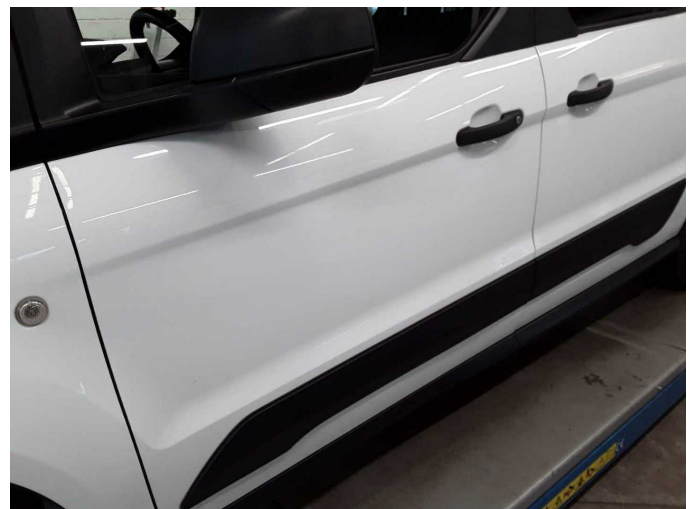

Repainting 1: Mudguard - left side, Side panel - rear left side, Door - front left side



Repainting 1: Mudguard - left side, Side panel - rear left side, Door - front left side



Repainting 1: Mudguard - left side, Side panel - rear left side, Door - front left side



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WF07XXWPG7NJ46047

Hersteller / Modell: FORD FORD Transit Connect 240 L2 LKW Trend

Datum	KM-Stand	Beschreibung
05.05.2026	97.506	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
30.09.2025	79.943	Systemtest/Eigendiagnose
09.04.2025	63.638	Bremsflüssigkeit; Bremsflüssigkeit ern; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Systemtest/Eigendiagnose; Wartung Sonstiges
23.01.2025	29.915	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
29.11.2024	53.379	Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben hinten; Bremsscheiben vorne
17.09.2024	48.260	AU