



Expertise

Protocol number: 46094900
Order No. / Reference: 26319967
Inspection date: 22 Jun 2026

Manufacturer: Audi
VIN: WAUZZZF44PN009533

Model: A4 Limousine 35 TDI S tronic



Vehicle details	
Manufacturer / Type / Model / Equipment	
Audi A4 Limousine 35 TDI S tronic	
Vehicle Identification number	WAUZZZF44PN009533
Mileage (Read)	156,989 km
First registration	11 Jan 2023
Number of holders	1
Power / Engine displacement	120 kw / 1,968 ccm
Fuel type / Cylinder	Hybrid Diesel / E / 4
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	Saloon car
Colour / colour code	Gletscherweiss Metallic (S9R)
Doors / Seats	4 / 5
Upholstery type	Cloth
Colour of upholstery	Black-Anthracite
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	16,900 km
Last service on / at	02/2026 at 154,070 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GP874123
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	0588 / BPJ 00974		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,095 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 96H	Winter tyres on Light alloy	Fulda	5mm / 5mm
2)	205/60 R16 96H	Winter tyres on Light alloy	Goodyear	7mm / 7mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 96V	Summer tyres (Without wheel rim)	Fulda	6mm / 6mm
2)	205/60 R16 96V	Summer tyres (Without wheel rim)	Fulda	6mm / 6mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 09/2026		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- Airbag: Front airbags, passenger airbag can be deactivated
- Anti-lock braking system (ABS)
- Audi connect emergency call & service with Audi connect Remote & Control
- Vehicle tool kit
- Decorative inlays diamond lacquer silver grey
- Tachometer
- Door sill trims with aluminum inlay at the front
- Electronic Differential Lock (EDS)
- Driver information system with color display
- electric window regulator
- Remote key, without SafeLock
- Automatically opening tailgate
- Transmission: S tronic 7-speed
- Top speed limited to 210 km/h
- Camera-based traffic sign recognition
- ISOFIX child seat attachment and Top Tether for the outer rear seats
- Headrests (5)
- LED taillights
- Light/rain sensor
- front center armrest
- Wheel: Alloy wheels, 5-arm
- Tire pressure monitoring system
- Electromechanical power steering
- Lane Departure Warning
- First aid kit with warning triangle
- Electronic immobilizer
- Central locking "Keyless-Go" without deadbolt
- Airbag: Front side airbags and head airbag system
- Accent areas matte black
- Traction control (ASR)
- Audi pre sense city
- Exterior mirror housings in body color
- third brake light, raised
- Diesel particulate filter (DPF)
- Parking assistance plus
- Electromechanical parking brake
- Electronic Stability Control (ESC)
- Chassis: Standard chassis
- Window channel strips in black (rubber)
- front and rear floor mats
- Cruise control system with speed limiter
- Heated rear window
- Interior lighting
- Child lock
- Automatic air conditioning
- boot floor mat
- Manual cargo cover
- Steering column, manually adjustable in height and axis
- Mild hybrid
- Non-smoking version
- Wheel: Tires optimized for rolling resistance, speed-limited
- Tire repair kit
- Seat covers in fabric Intention
- Start-stop system
- Glazing: Windscreen in heat-insulating and acoustic glazing

Extra equipment

- AdBlue tank (24 liters) (larger tank for AdBlue solution to reduce nitrogen oxides in the exhaust gas using an SCR system)
- Audi virtual cockpit plus (Innovative, fully digital instrument cluster with 12.3-inch display, full HD resolution with additional graphic display options: Classic, Sport and Dynamic design - For flexible and needs-based display of the respective information according to the driver's needs: speed/RPM, map display, Audi connect services, radio/media information, etc. - VIEW button in the multifunction steering wheel)
- Front sports seats (with manual adjustment of seat height, seat longitudinal position, seat tilt, backrest tilt, headrest and belt height; with pronounced seat side bolsters for better lateral support in curves, extendable thigh support)
- Hold assist (holds the vehicle indefinitely after stopping on typical road inclines and declines. The system is activated by pressing a button and allows the driver to start off comfortably.)
- Radio accessories: Audi sound system (10 speakers including center speaker and subwoofer - 6-channel amplifier - total output of 180 watts)
- Reversing camera (facilitates maneuvering by displaying the area behind the vehicle on the MMI display with dynamic and static aids. Two modes can be selected: perpendicular parking and, for vehicles with factory-installed trailer hitches, trailer mode. Depending on the selected mode, the calculated lane and guide lines are displayed. The reversing camera is discreetly integrated into the tailgate handle. Activation occurs when reverse gear is engaged.)
- Roof: Electric glass sliding/tilting sunroof (with tinted single-pane safety glass and continuously adjustable sunshade - including integrated wind deflector - comfort closing/opening from the outside via the vehicle key)
- Steering wheel: Leather steering wheel in a 3-spoke design with multifunction plus (The steering wheel impresses with its high-quality look and aluminum trim and feels good in the hand. Height and reach of the steering wheel are manually adjustable. For convenient operation of the extensive standard and optional infotainment features, the steering wheel is equipped with 12 multifunction buttons. It also includes paddle shifters for manually changing gears with an automatic transmission.)
- Telephone: Audi smartphone interface in conjunction with MMI Navigation plus with MMI touch (The Audi smartphone interface (Android Auto and Apple CarPlay) connects your smartphone to your Audi and seamlessly displays your smartphone content directly on the MMI display. Navigation, telephony, music, and selected third-party apps can be conveniently controlled via the MMI touchscreen and voice control. The connection can be established either using a suitable USB cable or wirelessly.)
- Audi connect navigation & infotainment
- Audi pre sense basic (within the system's limits, it initiates preventive safety measures for the occupants by networking and coordinating different vehicle systems. In unstable driving conditions, the front seat belts are electrically tightened. Depending on the situation, the windows close. The hazard warning lights are activated to warn following traffic.)
- Black fabric headliner
- Business package (MMI Navigation plus with MMI touch - Audi phone box - 3-spoke leather steering wheel with multifunction plus - Heated front seats - Frameless, automatically dimming interior mirror - Electrically adjustable, heated and folding exterior mirrors, automatically dimming on both sides - High-beam assistant - Manual sunshade for rear door windows)
- Deletion of model designation and performance/technology lettering
- Electrically adjustable, heated and folding exterior mirrors, automatically dimming on both sides (including curb view function for passenger-side exterior mirror with integrated LED turn signal, including heated windshield washer nozzles; the curb view function folds the passenger-side mirror down when reverse gear is engaged, giving the driver a better view of the curb edge)
- Front seat heating
- Fuel tank with increased filling volume (54 l)
- LED headlights and LED taillights with dynamic turn signals (daytime running lights - low beam - high beam - position lights - turn signals - cornering lights - all-weather lights - maneuvering lights - motorway lights - static cornering lights - automatic dynamic headlight range control - intersection lights (in conjunction with MMI Navigation plus). LED taillights plus include: dynamic rear turn signals - brake lights - taillights - rear license plate lights - reversing lights).
- Paint finish: Metallic
- Power outlet: USB charging port for rear passengers (2 USB charging ports for rear passengers in the rear center console - instead of 12-volt socket in the rear (from non-smoking version))
- Seat covers in fabric system (seat center panels in fabric system black or black-red - seat side bolsters, thigh support, headrests in solid black fabric)
- Seats: 4-way lumbar support (electrically adjustable, horizontally and vertically)
- Seats: Driver's seat electrically adjustable (with electric adjustment of seat height, seat longitudinal position, seat tilt and backrest tilt for the driver's seat - passenger seat manually adjustable)
- Wheel: Audi new car tire warranty (36-month term from vehicle handover to the first customer)



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Rear bumper	Rear bumper - Scratch(es) - Paint
2	Front bumper	Front bumper - Scratch(es) - Paint

Wear and tear

No.	Component group	Description
1	Vehicle glazing	Windscreen - Stone chips - No deduction
2	Door - front right side	Door - dent(s) - No deduction
3	Sill - left side	Sill (Zierleiste) - dent(s) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Front, Provided by user / customer, from 28 May 2023	2.258,82 €
2	Rear, Side right, Provided by user / customer, from 19 Jan 2024	5.264,81 €

Accident damages

No.	Accident
1	Side - left

Repainting

No.	Repainting
1	Bonnet, Professionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Bonnet	298 µm
--------	--------



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

Non-repaired previous damages were found at the vehicle. The necessary repair costs are listed in the expert report or if necessary, are listed in detail in a separately enclosed repair cost calculation.

Comments

Die montierten Winterreifen sind kein Bestandteil der Ausstattung.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

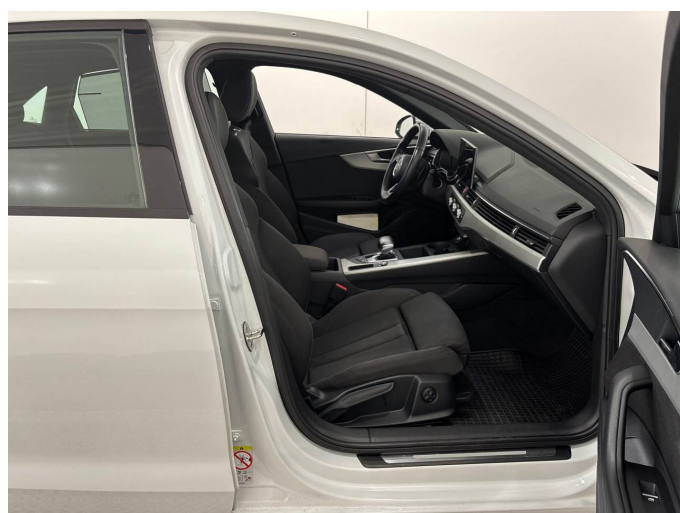


Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

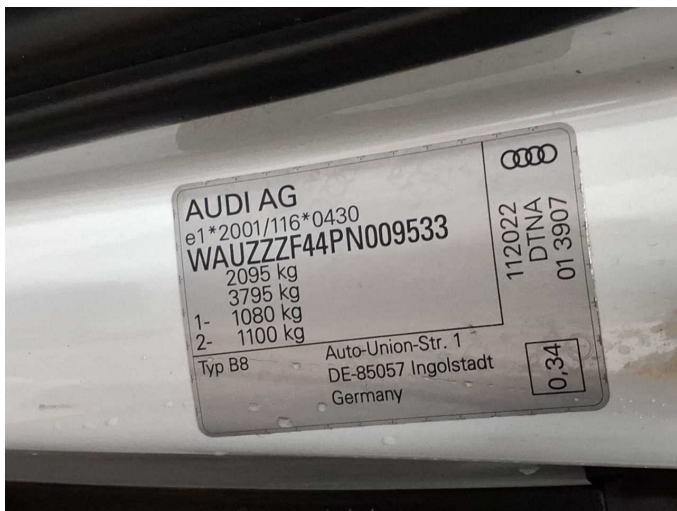


Figure 11: VIN

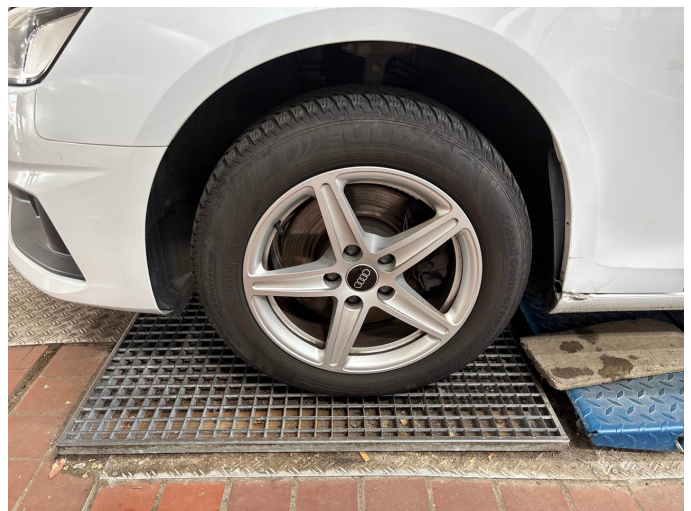


Figure 12: Mounted tyres

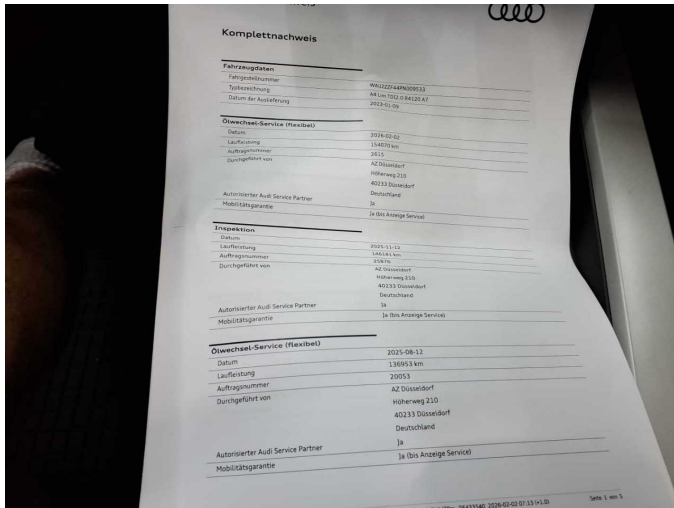


Figure 13: Documents

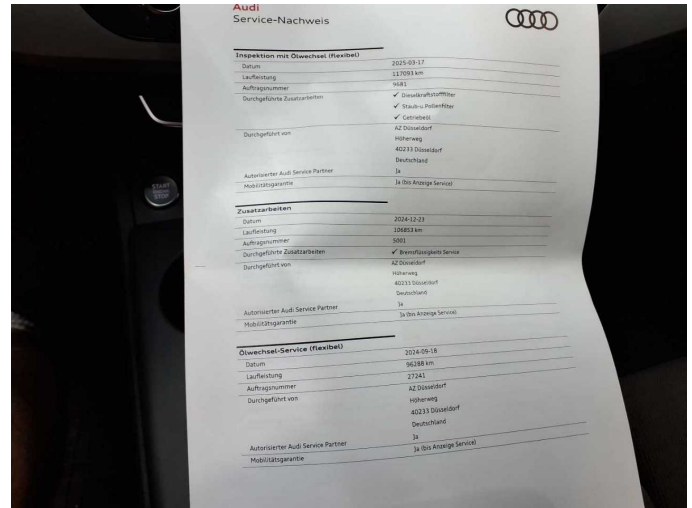


Figure 14: Documents

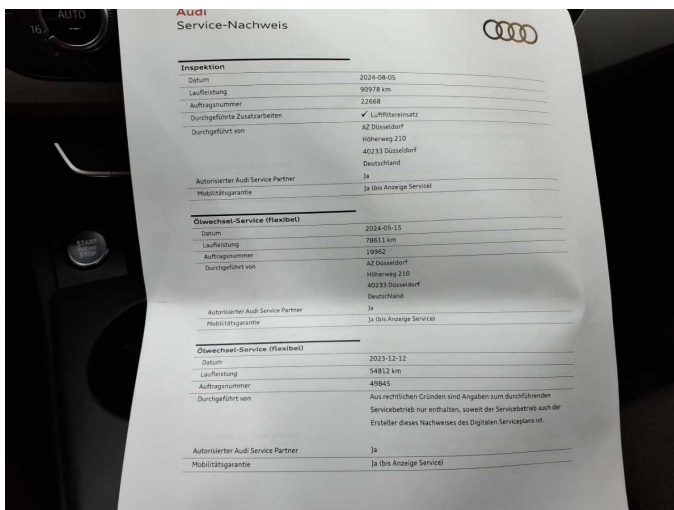


Figure 15: Documents

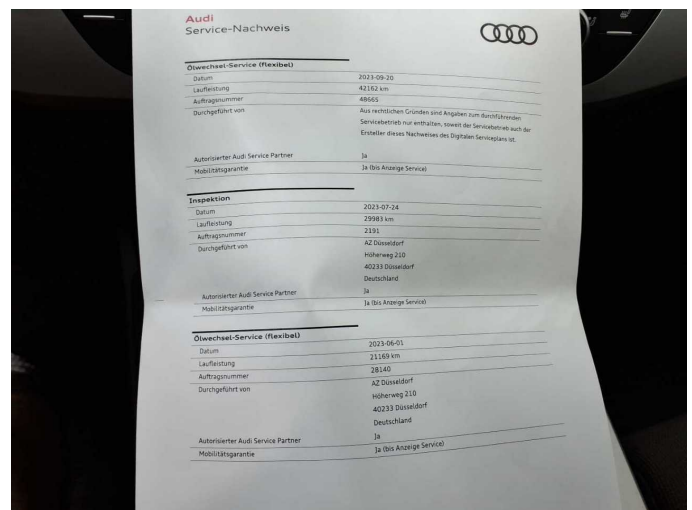


Figure 16: Documents

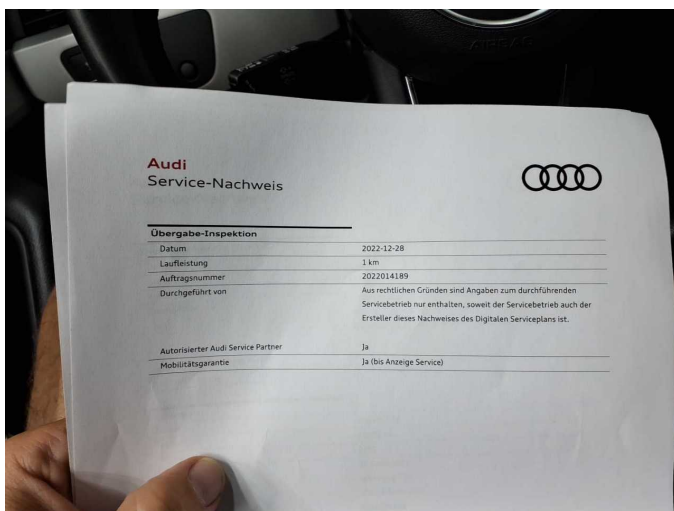


Figure 17: Documents

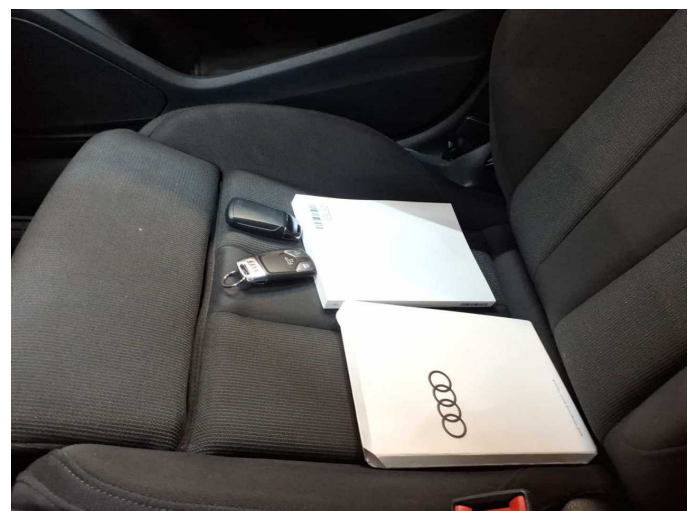


Figure 18: Documents



Figure 19: Documents



Figure 20: Additional tyres



Figure 21: Navigation



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.

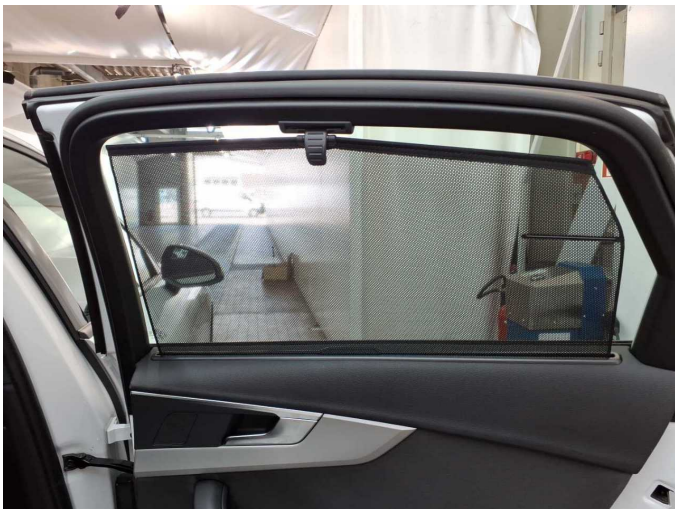


Figure 33: Misc.



Figure 34: Misc.

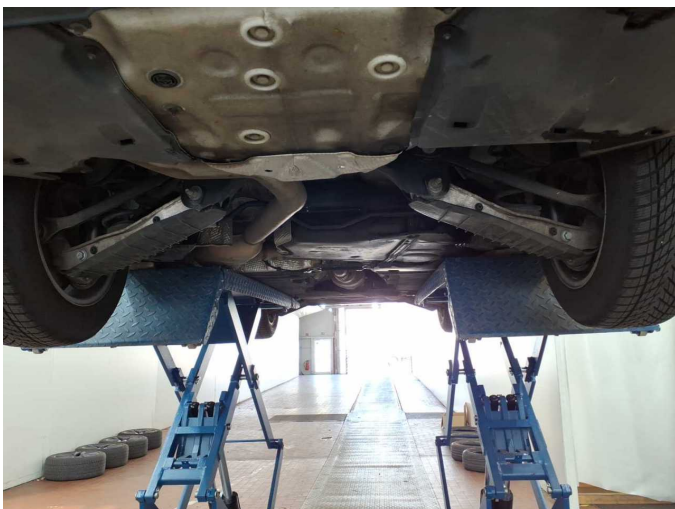


Figure 35: Misc.



Damage 1: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 1: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 1: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 2: Front bumper: Front bumper - Scratch(es) - Paint



Damage 2: Front bumper: Front bumper - Scratch(es) - Paint



Damage 2: Front bumper: Front bumper - Scratch(es) - Paint



Wear and tear 3: Sill - left side: Sill (Zierleiste) - dent(s) - No deduction



Wear and tear 3: Sill - left side: Sill (Zierleiste) - dent(s) - No deduction



Accident 1: Side - left



Accident 1: Side - left



Accident 1: Side - left



Accident 1: Side - left



Accident 1: Side - left



Accident 1: Side - left




Accident 1: Side - left




Accident 1: Side - left



Accident 1: Side - left

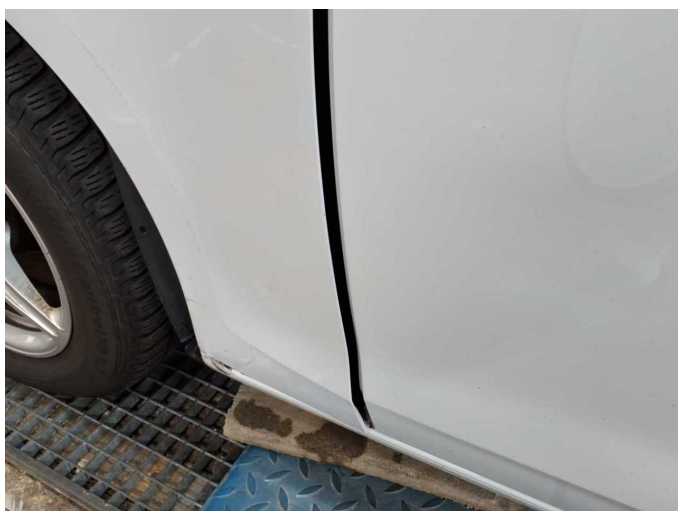

Accident 1: Side - left

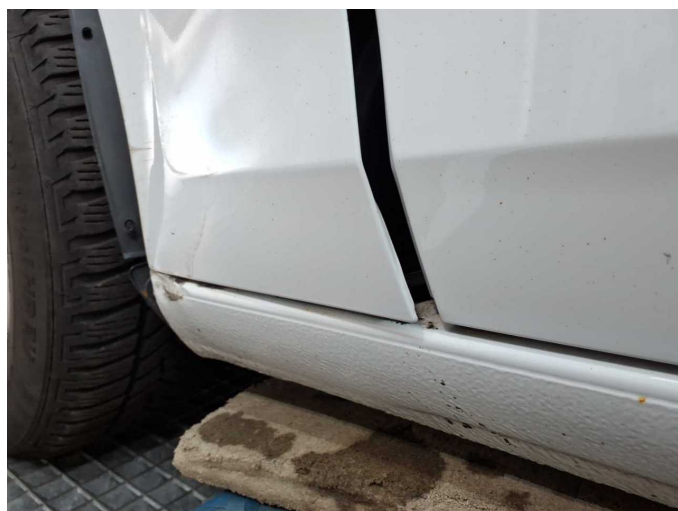

Accident 1: Side - left



Accident 1: Side - left



Repainting 1: Bonnet



Repainting 1: Bonnet