

Peugeot

PEUGEOT 5008 (01.2017->) ALLURE PACK MOTEUR 1,2 LITRE(S) - 96 KW 12V E-THP / PURETECH 5 PORTES

VIN: VF3MRHNSUNS110052



Description

	Registration date 10/08/2022	Odometer 134551 km
Color PEINTURE BLEU CELEBES/METALLISEE VERNIS	Year 2020	Upholstery -
Number of doors 5	Number of seats 7	Generation -
CO2 154	Engine displacement 1199	Gearbox type Automatic
Engine type Combustion	Fuel Type Petrol	Number of gears 8
Drivetrain Front Wheel Drive (FWD)	Max power 96 KW	

Vehicle Equipments

Standard

2nd seat row with 3 single seating (FoldFlatSystem)	3rd seat row with single seating	center armrest front
airbag driver side/passenger side	airbag passenger side deactivatable	sidebag rear
sidebag front	alarm system for seat belts	traction control system (ASR)
lumbar support seat front left, adjustable	head rests rear (3-fold)	head rests rear adjustable
protective strip loading edge (chrome)	roof rails (aluminium)	glove box illuminated
reversing camera with Split View	body: 5-door	automatic air-conditioning system
automatic air-conditioning system (Thermatic 2-zone)	instrument cluster digital (virtual cockpit)	Electronic Stability Control (ESP)
tire pressure control system	power steering electric	light and rain sensor
automatic supplemental lighting function (Coming Home, Leaving Home)	footwell illumination front LED	wheelbase 2840 mm
window frame with chrome trim cover	door trim strips chrome-plated	maintenance: Normal operating conditions
interior equipment air vents chrome look	windshield wiper with rain sensor	turn signal light in exterior mirror integrated
rear lights LED, 3D optic	turn signal lights LED	parking brake electromechanical
disc brakes front vented and disc brakes rear	Light-alloy rims	front skirt chrome-plated
tire repair kit	map light front	rear window heated
window lifter electric front + rear with comfort feature	Type of drive: front-wheel drive	trip computer
child package	roll-up sun protection at door glasses rear	child lock electrically operated
folding table in driver and passenger backrests integrated	sun visors with vanity mirror	driver assistance system: safety system SYNC with automatic emergency call
USB port	power outlet (12V outlet) in trunk/load space	headlight Eco-LED
front fog lights	pyrotechnical seat belt tensioner	storage bag at front seatbacks
radio reception digital (DAB+)	cruise control (cruise control) incl. vehicle speed limiter	electr. brake force distribution (EBD)
exterior mirror with caps vehicle colour	exterior mirror electrically folding	exterior mirror electrically adjustable and heated
interior mirror with automatic dimming	seat covers/upholstery: Alcantara / Sensatec	Audi connect (Emergency and Assistance System)

seat front right folding	seat front right height-adjustable	seat front left height-adjustable
beverage holder front	isofix mounts for child seat at rear seat	audio navigation system NAC 3-D, DAB with colour display
audio system RCC (radio, MP3-compatible)	steering wheel audio control	hands-free system Bluetooth
head airbag system (Sideguard)	head airbag system rear	antilock braking system (ABS)
driver assistance system: active lane-keeping assistant	driver assistance system: hill-start assist (Hill-Holder)	brake assistant
driver assistance system: Active Guard (brake assistant)	driver assistance system: collision warning system with brake function	driver assistance system: alertness assistant
driver assistance system: high-beam assistant	driver assistance system: collision warning system	central locking system / starting system Keyless-Go
start/stop system	keyless door release	central locking system incl. door locking automatic
glazing tinted	side window rear and rear window darkened	steering wheel with multiple function
steering wheel with shift rockers/buttons	ambient lighting LED	daytime running lights LED
Optional		
headlight assist with day/night sensor	Alternateur 150 A (Catégorie 15, UHEA)	front part synthetic design
dual-tone horn	battery 70 Ah	automatic transmission - type: 8F40 (8-speed)
automatic transmission - (8-speed)	catalyst (< 50 PPM)	shift control electric
additional heating	air conditioning with internal heat exchanger (IHX technology)	window lifter switch (neutral)
air-conditioning compressor with coupling	air-conditioning condenser, variant: 23,5 dm², thickness 12 mm	Contrôle dynamique de stabilité (ESP Bosch 9.3)
power steering electric, dual sprocket	trailer coupling	brake discs rear 290 mm
brake discs front 304 mm	starter STTD	interior equipment door covering and instruments with textile decorative trim
Equipement Int. Beige	fuel filter without water separator and coolant level sensor	gasoline particulate filter (GPF)
refrigerant R 1234 YF	fan system: 140 W, fan blade dynamic (2-stage)	Mesure contre le bruit, insonorisant-acoustique amélioré(e), niveau 3
air intake module front, dual	Montage Multiplex R3 ECO	engine (fuel type gasoline)
engine 1,2 liter - 96 kW 12V PureTech catalyst (HNS / EB2ADTS)	low emissions according to emission standard Euro 6 RDE	low emissions according to emission standard Euro 6d
windshield laminated glass	bumper front reinforced	shift unit trailer towing
metallic paintwork	Base engine EB2ADT	USB port + video connection
protection wind deflector under engine (long)	radiator, variant: 28 dm², thickness 28 mm, aluminium soldered	tray instrument panel chrome-plated
model refinement	headlight leveling control	repairability improved
fuel tank with integrated fuel filter	fuel tank without misfueling protection	exterior mirror aspherical, left
Site de production: France (Sochaux, les 2 derniers caractères du n° Org. PR sont 89)	seats front parallel height-adjustable	front spoiler
super-central locking system with remote control	front axle carrier steel reinforced, with longitudinal extensions	audio system with 6 speaker(s)
driver assistance system: traffic sign detection with speed warning indicator	driver assistance system: parking assistant incl. reversing camera	crossbeam Malleable
VarEq-méthode Codage B0E0Q	Steering AV equipment TDI	Vitres lat AV trempé, AR trempé et acoustique
veh. with OBD	Véhicule sans amplificateur	veh. without booster heater
Véhicule sans toit panoramique (toit entièrement vitré)	Climate zones: variant cold countries	

Statement date
31/07/2026

Inspection approval date
03/08/2026

Control

Detected issues

Engine / Sound	✓ Ok	Vehicle leak proofness	✓ Ok
Exhaust / Clarity	✓ Ok		

Defects & corrections

#	Element	Defect	Correction
001	Personal Data / -	None	Cleaning
			
002	Rim / Back Left Material : Aluminium alloy / Rim/Tyre diameter : 18 " / Surface : Machine polished	Scratched	Repair
  			
003	Door sill / Interior Back Left ¹	Scratched	Painting
      			
004	Door panel / Interior Back Left	Dent	Repair
   			
005	Interior tailgate lining / Back	Scratched	Acceptable



006

Rear windscreen / -
Tinted window : Yes

Sticker

Removal



007

Rim / Back Right
Material : Aluminium alloy / Rim/Tyre diameter : 18 " / Surface : Machine polished

Scratched

Repair



008

Door panel / Interior Back Right

Dent

Repair




009

Door sill / Interior Back Right²

Scratched

Painting

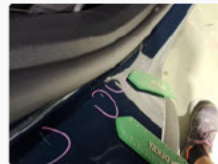

010

Door sill / Interior Front Right

Dent

Acceptable



011

Door panel / Front Right

Dent

Acceptable



012 Wing / Back Right

Dent


Smart repair



013 Wing extension moulding / Back Right
Painted : No

Broken


Replace

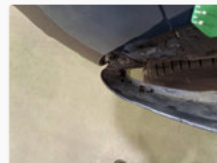

014 Door / Front Right

Dent

Smart repair

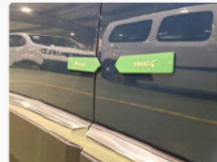

015 Roof / -

Dent

Acceptable



016 Rim / Front Right
Material : Aluminium alloy / Rim/Tyre diameter : 18 " / Surface : Machine polished

Scratched

Repair



017 Rim / Front Left
Material : Aluminium alloy / Rim/Tyre diameter : 18 " / Surface : Machine polished

Scratched

Repair



018	Seat / Interior Front Left Trim material : Combined	Tear	Replace

¹ x4
² x3

Loose Items

- | | | |
|--|--|--|
| ☐ Rear parcel shelf | ☐ Remote key | ☐ Remote control |
| ☒ Tyre repair kit complete | ☐ Security Kit | ☐ Compressor tyre repair kit |
| ☐ Document holder | ☒ Triangle | ☒ First aid kit |
| ☒ Registration certificate owner | ☐ Warranty booklet | ☐ User manual |
| ☐ Toolkit | ☐ Hook /Hicth ball | ☐ Jack |
| ☐ Jack handle crank | ☐ Card key | ☒ Load cover |
| ☐ Slow charging cable (Type 2, Mode 2) | ☐ Locking wheel nuts key | ☐ Refill tyre repair kit |
| ☐ Charging cable bag | ☒ Conformity certificate | ☒ Registration certificate |
| ☒ Spare Key | ☐ Spare wheel tyre | ☐ Satellite navigation |
| ☐ Service book | ☐ Quick charging cable (Type 2, Mode 3) | ☐ In-car tools |
| ☒ Towing hook | ☒ Safety vest | ☐ Locking wheel nut |
| ☐ Cargo net | | |

Main set of tyres

Front Left	CONTINENTAL	225 / 55 / 18 / Summer	5 mm
Front Right	CONTINENTAL	225 / 55 / 18 / Summer	5 mm
Back Left	PIRELLI	225 / 55 / 18 / Summer	6 mm
Back Right	PIRELLI	225 / 55 / 18 / Summer	6 mm

Comments

Pictures



Front left



Rear left



Boot opened



Rear right



Rear passenger compartment



Dashboard from rear seat



Front passenger compartment




Front right



Odometer



Navigation

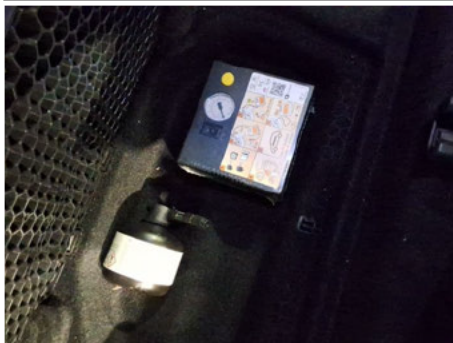

Spare Tyre



Vin



Rim / Back Left / Scratched



Rim / Back Left / Scratched




Rim / Back Left / Scratched




Door sill / Interior Back Left / Scratched



Door sill / Interior Back Left / Scratched

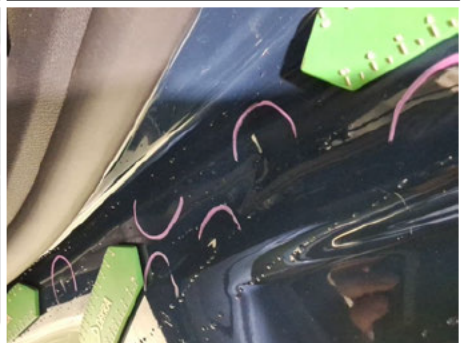

Door sill / Interior Back Left / Scratched

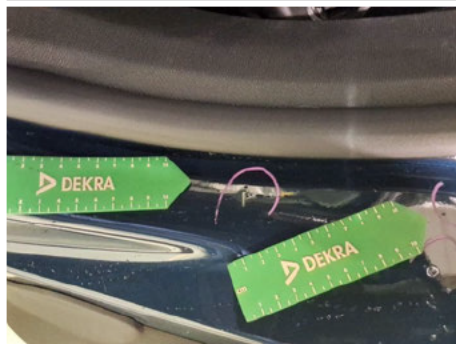

Door sill / Interior Back Left / Scratched



Door sill / Interior Back Left / Scratched



Door sill / Interior Back Left / Scratched



Personal Data / - / None



Door sill / Interior Back Left / Scratched



Door panel / Interior Back Left / Dent



Door panel / Interior Back Left / Dent



Door panel / Interior Back Left / Dent



Door panel / Interior Back Left / Dent



Interior tailgate lining / Back / Scratched



Rear windscreen / - / Sticker



Rear windscreen / - / Sticker



Rim / Back Right / Scratched



Rim / Back Right / Scratched



Rim / Back Right / Scratched




Door panel / Interior Back Right / Dent



Door panel / Interior Back Right / Dent



Door panel / Interior Back Right / Dent

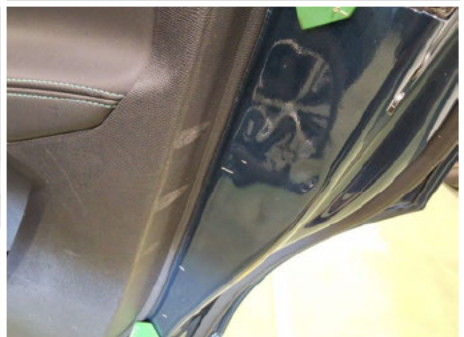

Door panel / Interior Back Right / Dent



Door sill / Interior Back Right / Scratched



Door sill / Interior Back Right / Scratched



Door sill / Interior Back Right / Scratched



Door sill / Interior Back Right / Scratched



Door sill / Interior Front Right / Dent



Door panel / Front Right / Dent




Wing / Back Right / Dent



Wing / Back Right / Dent



Wing extension moulding / Back Right / Broken

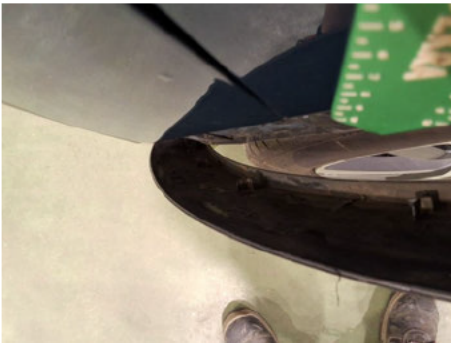

Wing extension moulding / Back Right / Broken



Wing extension moulding / Back Right / Broken



Wing extension moulding / Back Right / Broken



Door / Front Right / Dent



Door / Front Right / Dent



Door / Front Right / Dent



Roof / - / Dent



Rim / Front Right / Scratched



Rim / Front Right / Scratched




Rim / Front Left / Scratched



Rim / Front Left / Scratched



Seat / Interior Front Left / Tear

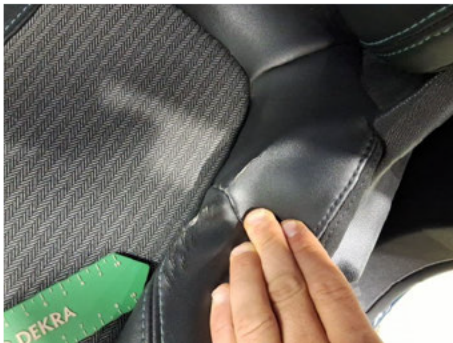

Seat / Interior Front Left / Tear