



Expertise

Protocol number: 46653676
Order No. / Reference: 26663232
Inspection date: 21 Jul 2026

Manufacturer: Skoda
VIN: TMBJJ9NX9MY059549

Model: Octavia Combi 2.0 TDI DSG First Edition



Vehicle details	
Manufacturer / Type / Model / Equipment	
Skoda Octavia Combi 2.0 TDI DSG First Edition	
Vehicle Identification number	TMBJJ9NX9MY059549
Mileage (Read)	159,600 km
First registration	8 Dec 2020
Number of holders	1
Next periodical technical inspection	12/2027
(Report on hand)	
Fuel type	Diesel
Engine displacement / Cylinder	1,968 ccm / 4
Power	110 kW
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Crystal-Black Premium
Doors / Seats	5 / 5
Upholstery type	Leather
Colour of upholstery	Black
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	1,400 km
Last service on / at	04/2026 at 155,185 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	FX220950
Previous damage / Accident	Detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	8004 / AWL 00012		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	1,990 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/45 R18 95Y	Summer tyres on Light alloy	Pirelli	6mm / 6mm
2)	225/45 R18 95Y	Summer tyres on Light alloy	Pirelli	5mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 96H	Winter tyres on Light alloy	Pirelli	6mm / 6mm
2)	205/60 R16 96H	Winter tyres on Light alloy	Pirelli	7mm / 7mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
N	125/70 R18 99M	Summer tyres on Steel	Sonstige	3 mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- Storage compartments (Four roof grab handles, rear with coat hooks; holder for the warning vest under the driver's seat; storage compartments in the front door panels with 1.5l bottle holders; storage compartments in the rear door panels with 0.5l bottle holders; ticket holder on the windshield; coat hooks on the B-pillars; storage compartments in the doors with felt lining)
- Center section of the dashboard with fabric covering
- Electrically adjustable and heated exterior mirrors
- Electrically folding exterior mirrors
- Heated windshield washer nozzles including 5l washer fluid reservoir
- Hydraulic brake assist (HBA)
- Roof rails, anodized
- Digital instrument cluster (Virtual Cockpit) 10.2"
- Third brake light
- Electronic transverse differential lock (XDS+)
- Driving light assistant (Coming Home / Leaving Home function)
- Front radar assistant including city emergency braking function and pedestrian and cyclist detection
- Transmission: 7-speed dual-clutch transmission (DSG)
- Green tec: Start/stop system including brake energy recuperation
- Heated rear window
- Interior mirror automatically dimming
- Kessy, keyless entry and start-stop system
- Electronic child safety lock
- Removable boot cover
- Headrests (5) front and rear height adjustable
- Paint finish: Solid
- LED fog lights
- LED headlights with LED daytime running lights
- Steering wheel: Leather steering wheel with multifunction buttons and paddle shifters (leather steering wheel and gearshift lever with leather elements - infotainment and driver assistance system operation)
- Columbus navigation system with capacitive 10" color display
- Radio accessories: 2 USB-C ports on the front
- Radio accessories: Digital radio reception DAB+
- Rain sensor
- Tire mobility kit (tire repair spray incl. compressor)
- Seat belts (Three three-point seat belts in the rear)
- Seats: Heated front seats
- Seats: Height-adjustable driver and passenger seats (including lumbar support)
- SKODA Care Connect (SOS emergency call function (eCall including automatic activation in the event of an accident with airbag deployment), mobility service (connection for rapid assistance in case of breakdown), information service (connection to the hotline for all questions regarding vehicle functions), free remote vehicle access for 1 year with access to vehicle data and functions via smartphone, e.g., parking position, hazard warning lights activation, current fuel level)
- Airbag for driver and front passenger (passenger airbag can be deactivated)
- Airbag, driver's knee airbag
- Airbag, head airbags
- Airbag, front side airbags
- Anti-lock braking system (ABS)
- Traction control (ASR)
- Automatically dimming exterior mirror (driver's side)
- Exterior mirrors with memory function (boarding spots in the exterior mirrors as well as memory function and mirror lowering)
- Hill start assist including auto-hold function
- Grey headliner
- Diesel particulate filter
- Tachometer
- Electronic parking brake
- Electronic Stability Control (ESC)
- Driving profile selection
- Electric windows front and rear, including anti-pinch protection and child safety lock
- Cruise control system
- Tinted windows
- Rear lights with crystal glass look and animated turn signals
- Rear window wiper including windshield washer system
- ISOFIX preparations on the front passenger seat and the outer rear seats including top tether anchorage
- Climatronic air conditioning (2-zone) (fully automatic, separately adjustable for driver and front passenger and anti-allergen filter & activated carbon filter - air-conditioned and illuminated glove compartment)
- LED taillights
- Steering wheel: height and reach adjustable
- Manual headlight range adjustment
- Rear center armrest with pass-through option
- Front center armrest, including storage compartment
- Engine drag torque control (MSR)
- Front and rear parking sensors
- Upholstery: Cloth
- Radio accessories: 8 speakers
- Radio accessories: Voice control
- Tire pressure monitoring
- Electromechanical power steering
- Safety lights in the front side doors
- Seats: Electrically adjustable front seats with memory function
- Seats: Rear seat backrest split 60:40, foldable
- SKODA Infotainment Online (Online map updates for navigation - display of weather data, news, headlines - petrol station and parking space search)
- Speed limiter
- Lane keeping assistant (Lane Assist)
- Lane change and parking assist as well as exit warning



- Phone: SmartLink (MirrorLink, Apple CarPlay, Android Auto)
- Bluetooth hands-free phone system
- Immobiliser

- 12V socket in the trunk
- Telephone: Phonebox with inductive charging function (connection via external antenna)
- Phone: Wireless SmartLink for Apple CarPlay
- Lashing eyes in the trunk
- Central locking including remote control integrated into the key and EASY Start

Extra equipment

- Airbag, rear side airbags
- Decorative trim in piano black
- Anti-theft alarm system including safe system with interior monitoring and tilt sensor
- Package: Columbus Plus Infotainment Package (Combi) (Columbus Navigation System - Infotainment Online (3-year subscription) - Head-Up Display - Electric Tailgate Operation - Comfort Opening - Luggage Net Partition)
- Package: Parking & Visibility (cornering lights in the fog lights - headlight cleaning system - LED ambient lighting - LED matrix headlights and dynamic high beam assist (AFS) - crystal glass look taillights and animated turn signals - reversing camera - parking assist)
- Panoramic sunroof, electric (deletion of the glasses compartment in the headliner)
- Radio accessories: CANTON sound system and 18" steel spare wheel (12 speakers (10 speakers, 1 central speaker, 1 subwoofer in the spare wheel well) - 18" steel spare wheel (tire 125/70 R18) including jack and wheel wrench)
- Wheels: 18" Perseus alloy wheels, anthracite polished (7.5J x 18, ET 48 with 225/45 R18 tires)
- Ski bag
- Auxiliary heating
- Variable loading floor in the trunk including organizer and aluminum crossbars

- Swiveling trailer hitch including trailer stabilization and adapter
- Paint finish: Premium Metallic
- Steering wheel: Heated steering wheel in a sporty design with paddle shifters
- Package: Comfort & Relax (Combi) (3-zone Climatronic - Sunset (dark tinted rear window and rear side windows) - acoustic glazing in the front side windows - heated front and outer rear seats - heated steering wheel - 230 V socket and 3 x USB charging ports - sunshades in the rear doors - sleeping headrests in the rear - multi-function storage compartment in the boot)
- Package: Travel & Comfort (DSG) (Traveller assistance system: - Traffic sign recognition - Predictive and adaptive cruise control (pACC) - Adaptive lane keeping assist - Emergency and traffic jam assist (with DSG) - Capacitive steering wheel with hands-off detection - Adaptive cruise control (ACC) (control range 210 km/h) - Driver fatigue detection - Driving profile selection - Adaptive chassis control (DCC) - Automatically dimming exterior mirror (driver's side))
- Seats: Ergo-comfort seats in the front (AGR seal of approval) (Massage function - Extendable leg rest - Seat ventilation - Leather interior)
- Heated windscreen

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.



Value reducing factors

No.	Component group	Description
1	Body	Underbody panelling (hinten mitte) - Broken / torn - Replace
2	Door - front left side	Door handle - outside - Scratch(es) - Smart repair
3	Side panel - rear left side	Sill - Dent / paintcoat damage - Smart repair
4	Side panel - rear left side	Side panel - dent(s) - Smart repair
5	Wheel / tyres	Alloy rim - rear left side - Scratch(es) - Loss in value
6	Wheel / tyres	Alloy rim - rear right side - Scratch(es) - Loss in value
7	Side panel - rear right side	Sill - Dent / paintcoat damage - Smart repair
8	Wheel / tyres	Alloy rim - front right side (Materialabtrag) - Functional / admissibility - Replace
9	Door - rear left side	Door - Scratched - Paint
10	Door - front left side	Door - Scratch(es) - Paint
11	Side panel - rear right side	Side panel (+ Kratzer) - Dent / paintcoat damage - Paint
12	Boot lid / rear door	Boot lid (mit Entkleben) - Scratched - Paint
13	Front bumper	Front bumper - Scratched - Paint
14	Bonnet	Bonnet - Dent / paintcoat damage - Paint

Wear and tear

No.	Component group	Description
1	Body	Underbody panelling - Scratch(es) - No deduction
2	Mudguard - right side	Mudguard - right side - Scratch(es) - No deduction
3	Door - front right side	Door - dent(s) - No deduction
4	Mudguard - left side	Mudguard - left side - dent(s) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Rear, Provided by user / customer, from 17 Jan 2025	2.188,76 €

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

- Der beiliegende Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

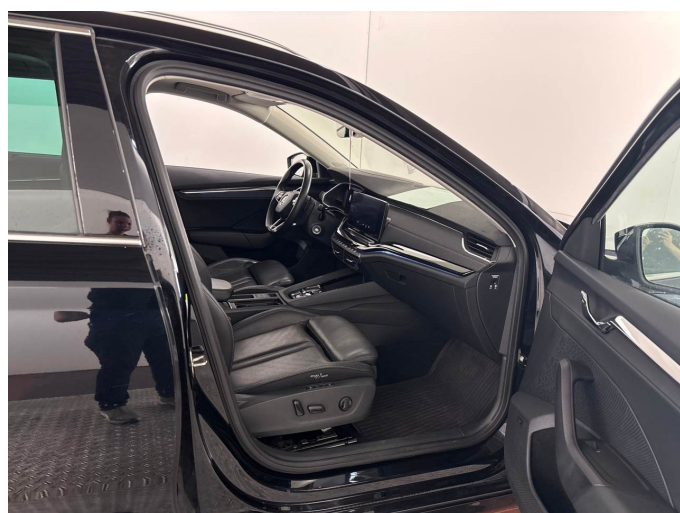


Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Additional tyres



Figure 15: Additional tyres

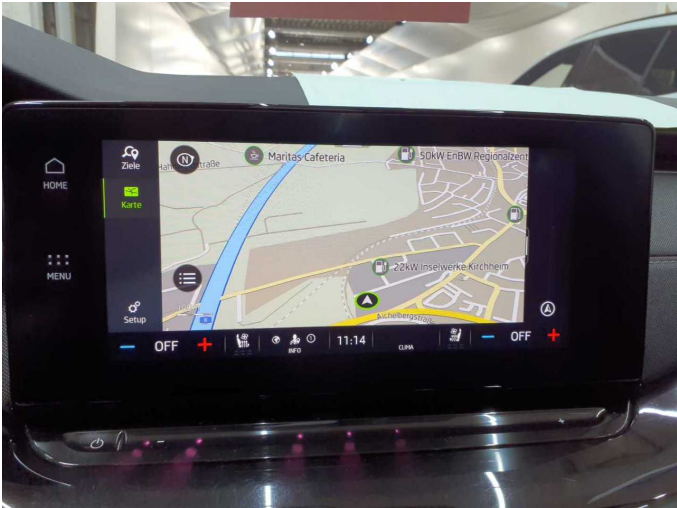


Figure 16: Navigation

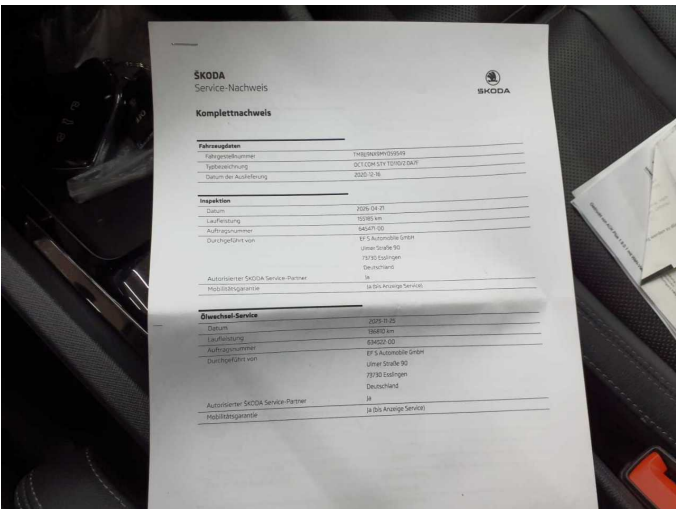


Figure 17: Misc.

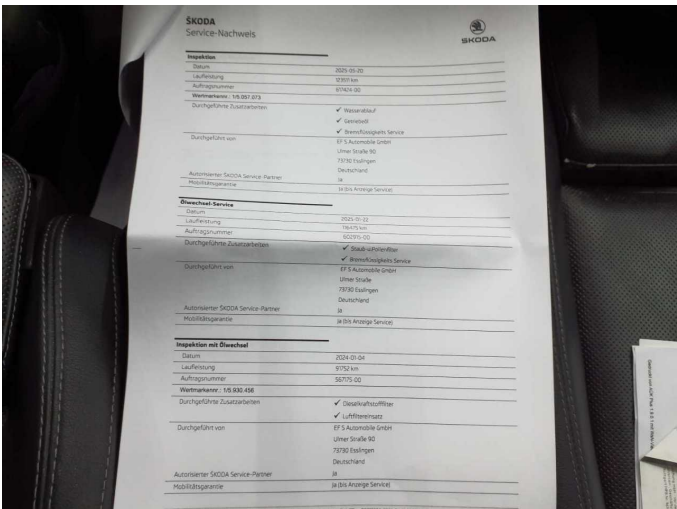


Figure 18: Misc.

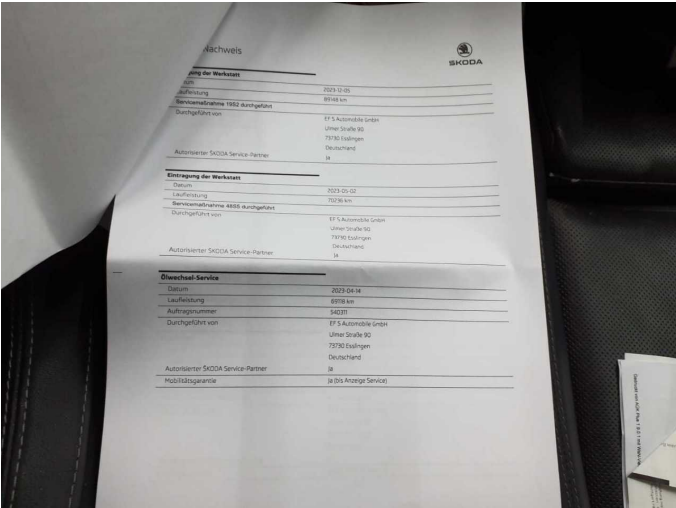


Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.

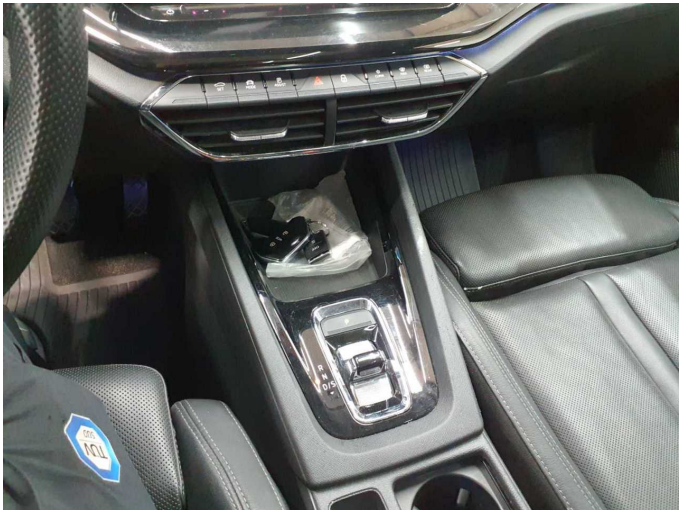


Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.

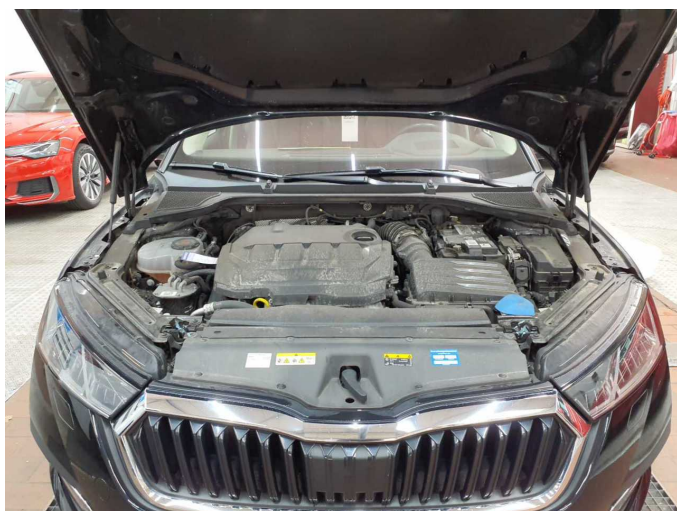


Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.

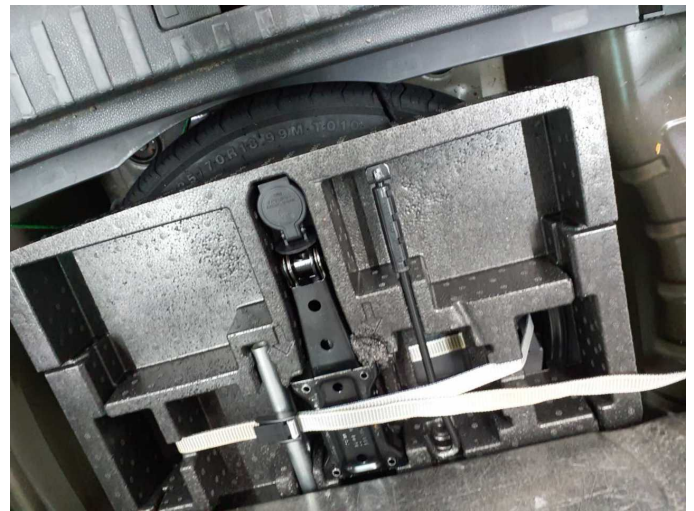


Figure 34: Misc.


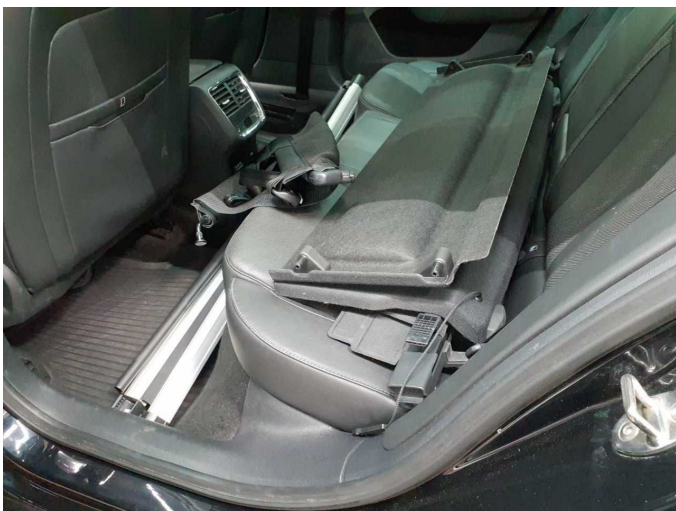


Figure 35: Misc.



Damage 1: Body: Underbody panelling (hinten mitte) - Broken / torn - Replace

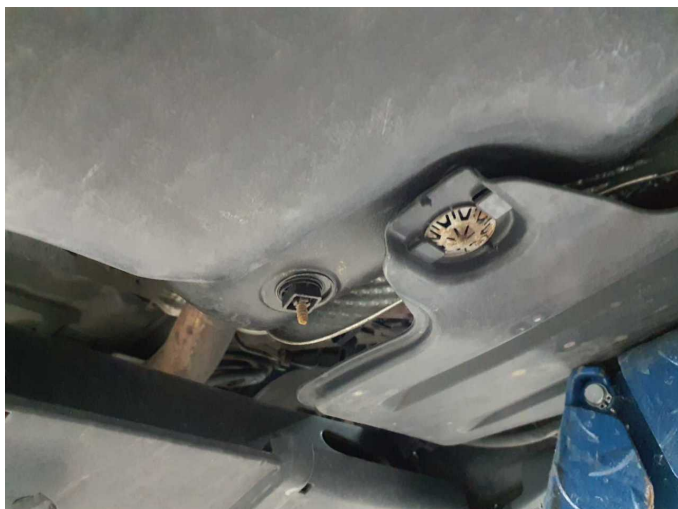

Damage 1: Body: Underbody panelling (hinten mitte) - Broken / torn - Replace



Damage 1: Body: Underbody panelling (hinten mitte) - Broken / torn - Replace




Damage 1: Body: Underbody panelling (hinten mitte) - Broken / torn - Replace




Damage 1: Body: Underbody panelling (hinten mitte) - Broken / torn - Replace




Damage 2: Door - front left side: Door handle - outside - Scratch(es) - Smart repair

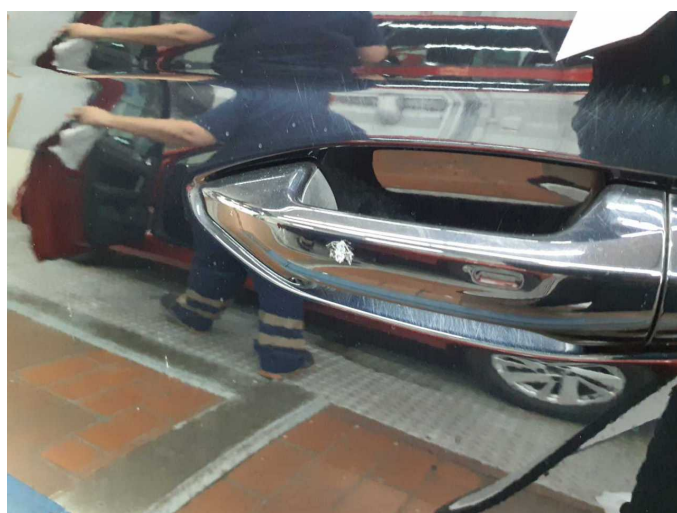


Damage 2: Door - front left side: Door handle - outside - Scratch(es) - Smart repair

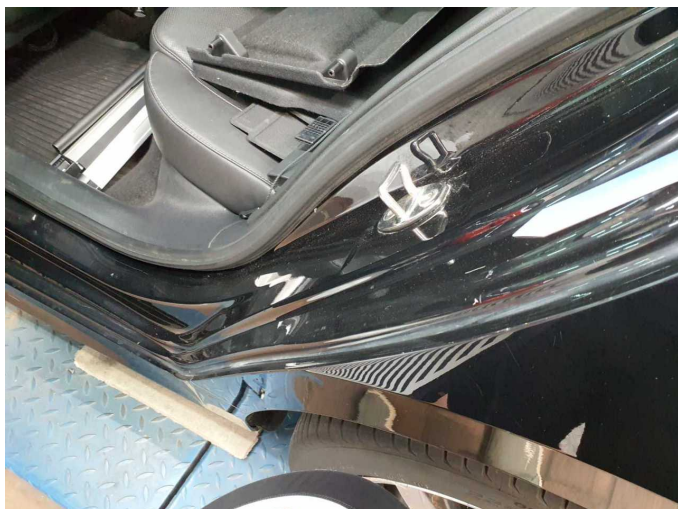

Damage 3: Side panel - rear left side: Sill - Dent / paintcoat damage - Smart repair

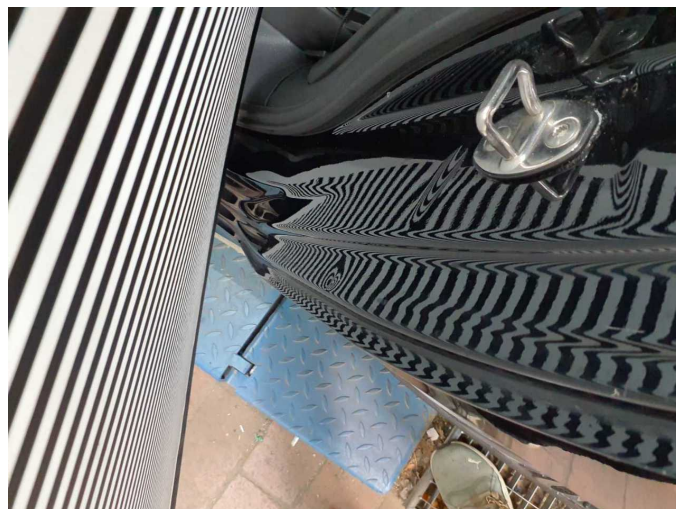


Damage 3: Side panel - rear left side: Sill - Dent / paintcoat damage - Smart repair

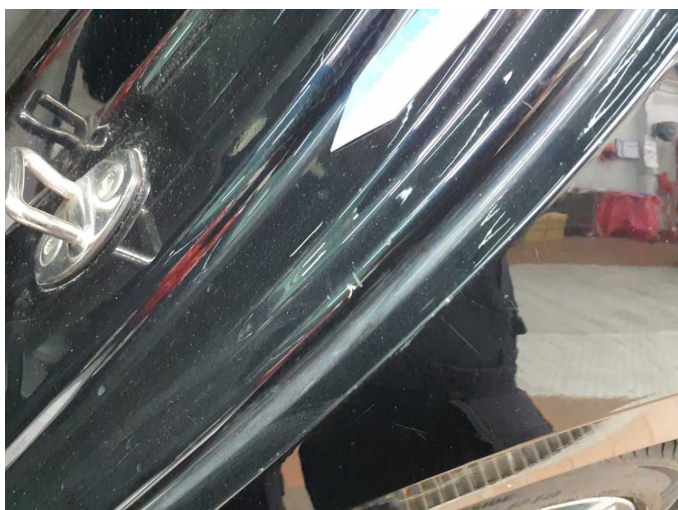

Damage 3: Side panel - rear left side: Sill - Dent / paintcoat damage - Smart repair



Damage 4: Side panel - rear left side: Side panel - dent(s) - Smart repair

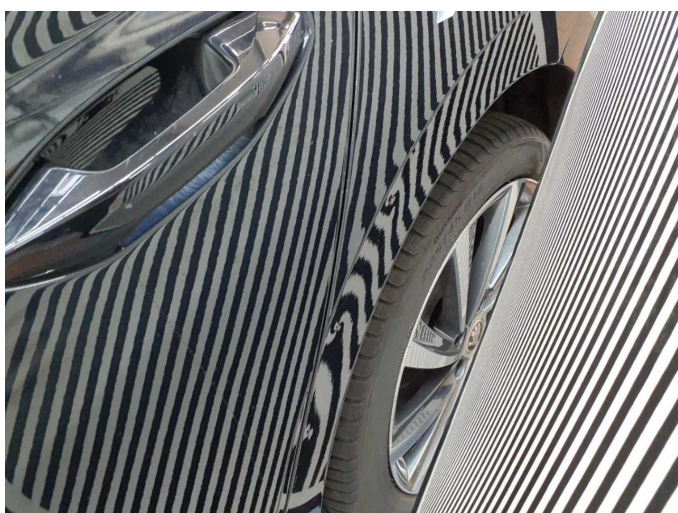

Damage 4: Side panel - rear left side: Side panel - dent(s) - Smart repair



Damage 5: Wheel / tyres: Alloy rim - rear left side - Scratch(es) - Loss in value



Damage 5: Wheel / tyres: Alloy rim - rear left side - Scratch(es) - Loss in value




Damage 6: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Loss in value



Damage 6: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Loss in value




Damage 6: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Loss in value

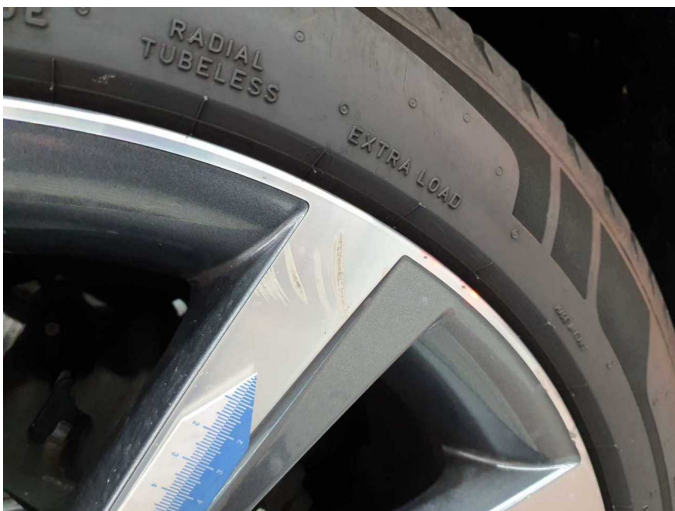


Damage 6: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Loss in value




Damage 7: Side panel - rear right side: Sill - Dent / paintcoat damage - Smart repair

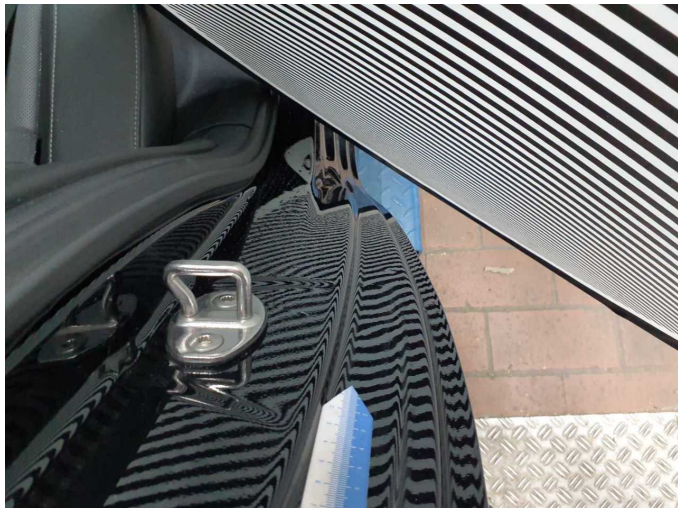


Damage 7: Side panel - rear right side: Sill - Dent / paintcoat damage - Smart repair

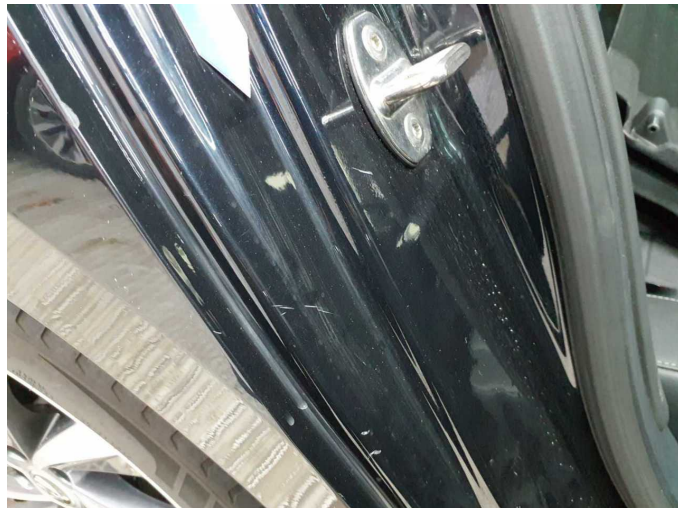

Damage 7: Side panel - rear right side: Sill - Dent / paintcoat damage - Smart repair

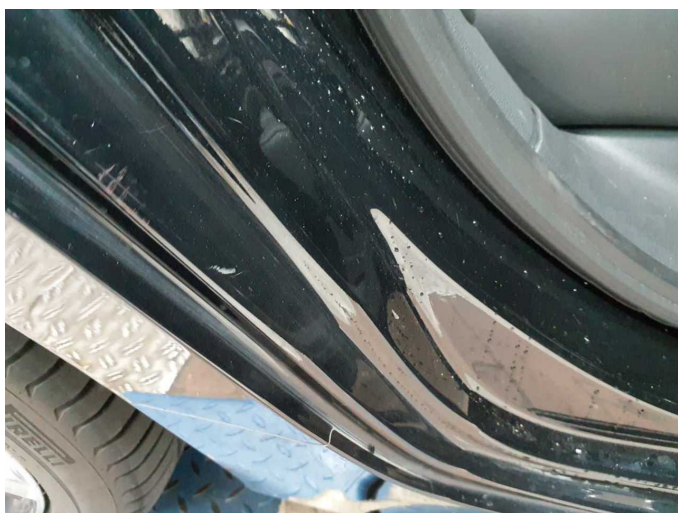

Damage 7: Side panel - rear right side: Sill - Dent / paintcoat damage - Smart repair

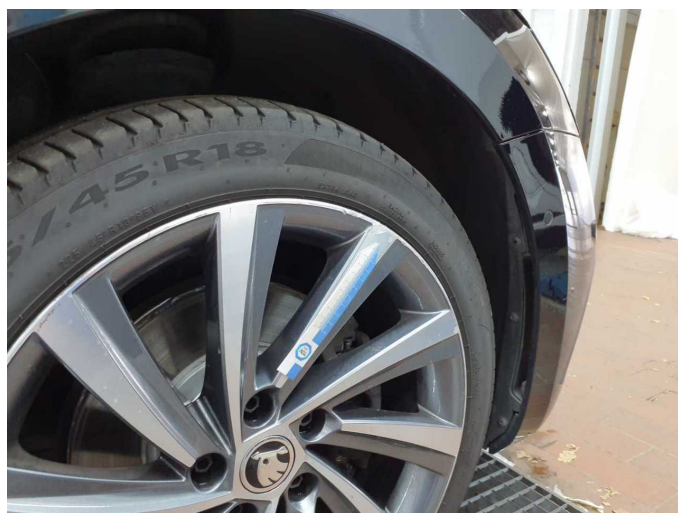

Damage 8: Wheel / tyres: Alloy rim - front right side (Materialabtrag) - Functional / admissibility - Replace



Damage 8: Wheel / tyres: Alloy rim - front right side (Materialabtrag) - Functional / admissibility - Replace




Damage 8: Wheel / tyres: Alloy rim - front right side (Materialabtrag) - Functional / admissibility - Replace



Damage 9: Door - rear left side: Door - Scratched - Paint




Damage 9: Door - rear left side: Door - Scratched - Paint

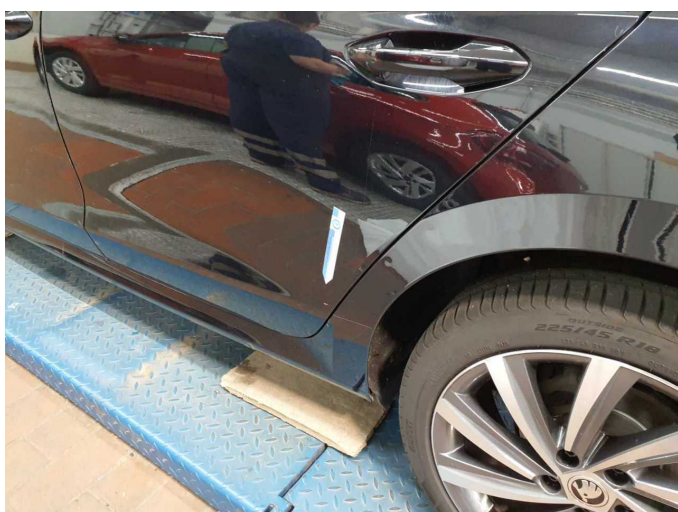


Damage 9: Door - rear left side: Door - Scratched - Paint



Damage 9: Door - rear left side: Door - Scratched - Paint

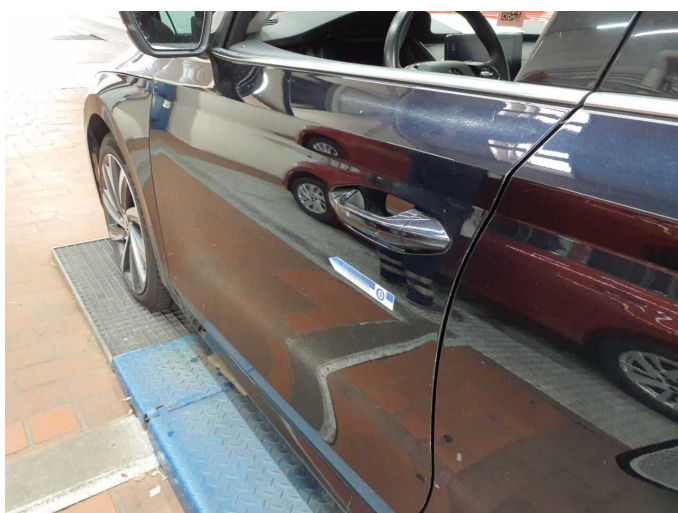

Damage 10: Door - front left side: Door - Scratch(es) - Paint

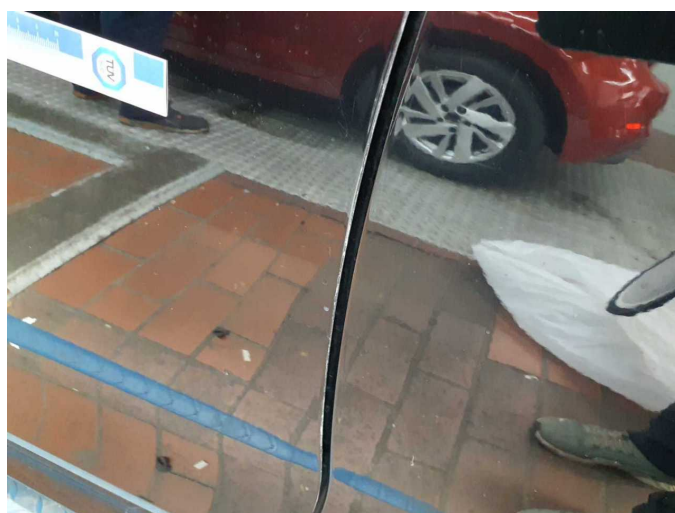

Damage 10: Door - front left side: Door - Scratch(es) - Paint




Damage 10: Door - front left side: Door - Scratch(es) - Paint




Damage 11: Side panel - rear right side: Side panel (+ Kratzer) - Dent / paintcoat damage - Paint



Damage 11: Side panel - rear right side: Side panel (+ Kratzer) - Dent / paintcoat damage - Paint

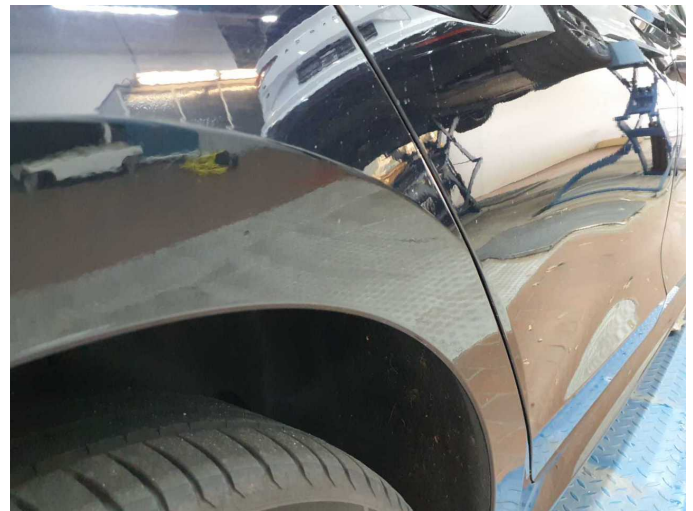


Damage 11: Side panel - rear right side: Side panel (+ Kratzer) - Dent / paintcoat damage - Paint

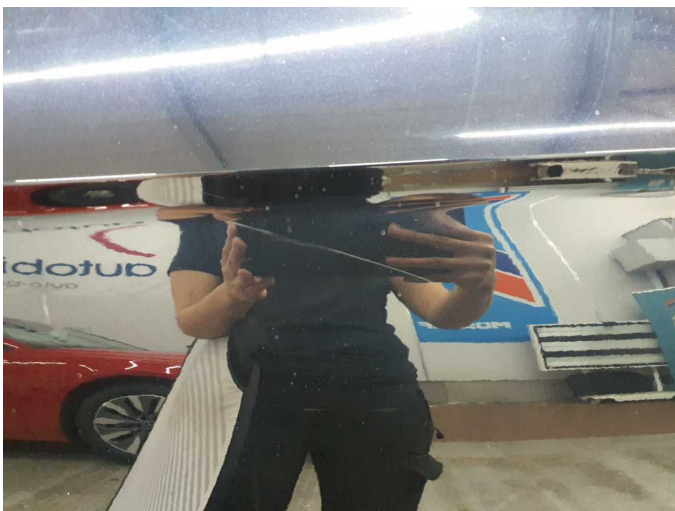

Damage 11: Side panel - rear right side: Side panel (+ Kratzer) - Dent / paintcoat damage - Paint



Damage 11: Side panel - rear right side: Side panel (+ Kratzer) - Dent / paintcoat damage - Paint

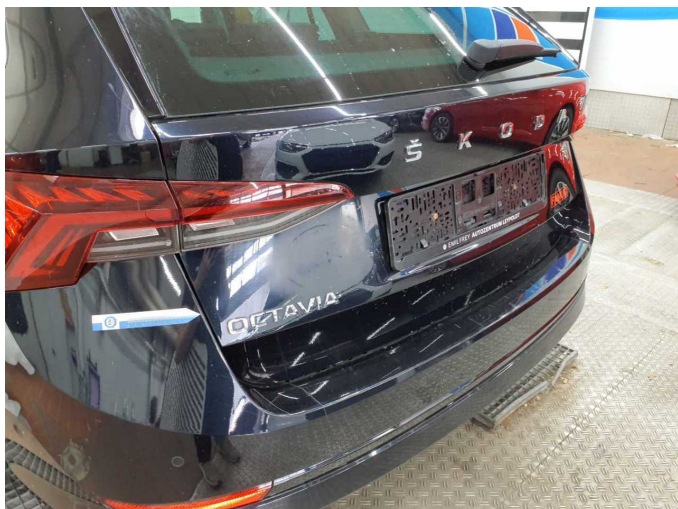

Damage 12: Boot lid / rear door: Boot lid (mit Entkleben) - Scratched - Paint



Damage 12: Boot lid / rear door: Boot lid (mit Entkleben) - Scratched - Paint



Damage 12: Boot lid / rear door: Boot lid (mit Entkleben) - Scratched - Paint



Damage 12: Boot lid / rear door: Boot lid (mit Entkleben) - Scratched - Paint



Damage 13: Front bumper: Front bumper - Scratched - Paint



Damage 13: Front bumper: Front bumper - Scratched - Paint



Damage 13: Front bumper: Front bumper - Scratched - Paint



Damage 13: Front bumper: Front bumper - Scratched - Paint




Damage 13: Front bumper: Front bumper - Scratched - Paint



Damage 13: Front bumper: Front bumper - Scratched - Paint



Damage 14: Bonnet: Bonnet - Dent / paintcoat damage - Paint

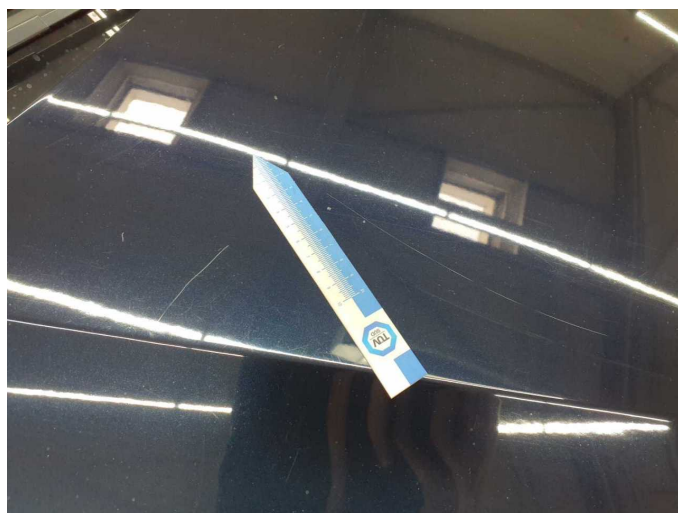

Damage 14: Bonnet: Bonnet - Dent / paintcoat damage - Paint



Damage 14: Bonnet: Bonnet - Dent / paintcoat damage - Paint



Damage 14: Bonnet: Bonnet - Dent / paintcoat damage - Paint



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: TMBJJ9NX9MY059549
Hersteller / Modell: SKODA SKODA Octavia Combi 2.0 TDI DSG First Edition

Datum	KM-Stand	Beschreibung
21.04.2026	155.185	Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben + Klötze h; Bremsscheiben + Klötze v; Bremsscheiben hinten; Bremsscheiben vorne; Regelwartungsdienst; Wartung Sonstiges
16.12.2025	138.557	AU
27.11.2025	136.810	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Systemtest/Eigendiagnose; Wartung Sonstiges
21.05.2025	123.525	Getriebeöl ern/prüfen; Regelwartungsdienst; Wartung Sonstiges
23.01.2025	116.475	Bremse Sonstiges; Bremsflüssigkeit; Bremsflüssigkeit ern; Bremsklötze vorne; Bremsscheiben vorne; Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
28.11.2024	92.353	Batterie ern; Systemtest/Eigendiagnose
05.01.2024	91.752	Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
08.12.2023	89.148	AU; Bremse Sonstiges; Bremsklötze hinten
17.04.2023	69.118	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
13.01.2023	62.765	Bremse Sonstiges; Bremsflüssigkeit; Bremsflüssigkeit ern; Bremsklötze vorne; Regelwartungsdienst
11.07.2022	46.620	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
21.04.2022	30.449	Regelwartungsdienst
06.10.2021	24.330	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges