



Expertise

Protocol number: 46639628
Order No. / Reference: 26620172
Inspection date: 21 Jul 2026

Manufacturer: Mercedes-Benz

Model: E 220 d 9G-TRONIC Exclusive

VIN: W1K2130041B083520



Vehicle details	
Manufacturer / Type / Model / Equipment	
Mercedes-Benz E 220 d 9G-TRONIC Exclusive	
Vehicle Identification number	W1K2130041B083520
Mileage (Read)	134,214 km
First registration	2 Jun 2022
Number of holders	1
Next periodical technical inspection	05/2027
(Report not on hand)	
Fuel type	Hybrid Diesel / E
Engine displacement / Cylinder	1,993 ccm / 4
Power	147 kW
Gearbox / Number of gears	Automatic / 9
Type of drive	Rear drive
Type of vehicle	Saloon car
Colour / colour code	Hightechsilber Metallic
Doors / Seats	4 / 5
Upholstery type	Leather
Colour of upholstery	Black



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	339 Tag(e)
Last service on / at	06/2026 at 133,108 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GJ469200
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	2222 / BEJ 00045		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,490 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/55 R17 97Y	Summer tyres on Light alloy	Pirelli	5mm / 5mm
2)	225/55 R17 97Y	Summer tyres on Light alloy	Pirelli	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/55 R17 97H	Winter tyres on Light alloy	Dunlop	5mm / 5mm
2)	225/55 R17 97H	Winter tyres on Light alloy	Dunlop	6mm / 6mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- ADAPTIVE BRAKE with hill start assist, pre-filling and drying braking in wet conditions
- Airbag: Automatic passenger airbag deactivation
- Airbag: Side airbag for driver and front passenger
- Ambient lighting with 64 colors and 3 color zones
- Foldable armrest for driver and front passenger
- Left and right exterior mirrors, heated and electrically adjustable, painted in body color
- Brake assist, active
- Tachometer
- DYNAMIC SELECT
- Chassis: AGILITY CONTROL chassis with selective damping system and lowered suspension
- Velour floor mats
- Heated rear window with timer
- KEYLESS-GO start function
- LED High Performance Headlights
- Steering column mechanically adjustable in height and length
- Center console piano black finish
- Navigation accessories: Pre-installation for Live Traffic Information
- Package: AVANTGARDE Exterior
- Upholstery: ARTICO man-made leather
- Radio: Extended MBUX functions
- Radio accessories: Digital radio
- Tire pressure monitoring system
- Remote Services Plus
- Power steering
- Seats: Front seats electrically adjustable
- Touchpad
- Electronic immobilizer
- Central locking
- AdBlue tank with a capacity of 23.5 liters
- Airbag for driver and front passenger
- Airbag: Kneebag for driver
- Airbag: Windowbags left/right
- Anti-lock braking system (ABS)
- Attention Assist
- Basic services
- On-board computer
- Diesel particulate filter
- Third brake light
- Electronic Stability Program (ESP)
- Electric window regulator with comfort operation and anti-pinch protection, 4-way
- Transmission: 9-speed automatic, 9G-TRONIC
- Interior headliner in nevagrau fabric
- Headrests (5)
- Steering wheel: Multifunction steering wheel in Nappa leather in a 3-spoke design
- Mercedes-Benz emergency call system
- Center console with on-the-fly storage compartment
- Navigation: Hard disk navigation
- Package: Filing package
- Package: Seating comfort
- PRE-SAFE system
- Radio: MBUX multimedia system
- Radio accessories: Communication module (LTE) for using Mercedes me connect services
- Windscreen wipers with rain sensor
- Seats: i-Size child seat attachment
- Cruise control
- High-visibility vest for drivers
- Green, heat-insulating glass all around
- Decorative elements, light brown open-pored ash wood



Extra equipment

- Instrument panel and door sills in ARTICO man-made leather
- Fuel tank with larger volume 66 l
- Paint finish: Metallic
- Package: Business
- Package: MBUX High-End Package (MBUX Augmented Reality for Navigation - Traffic Sign Assist - Connectivity Package Navigation: Hard drive navigation, Extended navigation services, Destination input via touch function or voice control, Near Field Communication (NFC) - Widescreen Cockpit with 12.3 inches - Wireless charging system for mobile devices - Smartphone integration: merges the mobile phone with the media system via Apple CarPlay and Android Auto - Preparation for digital key handover)
- Radio accessories: Burmester surround sound system (13 high-performance speakers - 9-channel DSP amplifier with a total output of 590 W - Frontbass technology with woofers integrated into the body shell for powerful bass reproduction - Sound optimization for the front and rear seats - Noise cancellation (VNC) - Sound preset: Surround function to generate a virtual surround sound - Multi-channel format support for true surround sound)
- THERMOTRONIC automatic climate control (3-zone automatic climate control: enables individually adjustable climate for driver and front passenger as well as rear seats - 3 climate styles (MEDIUM/ FOCUS/DIFFUSE) - Climate control settings via the infotainment system or the climate control unit in the center console - Automatic recirculation (with navigation) - Sensors for detecting, e.g., interior/ exterior temperature, ... - Fine dust activated carbon filter for filtering dust, soot and pollen - Dew point sensors, defroster nozzles under the windshield - Residual heat function)
- Package: Parking package with reversing camera (The parking package with reversing camera makes it easier to find and select parking spaces, as well as to park and exit in parallel and perpendicular parking spaces or garages. The active parking assistant steers the vehicle into parking spaces, including speed control and automatic gear changes.)
- Seats: Heated seats for driver and front passenger (selectable in three stages - Intelligent and comfortable: The seat heating switches off automatically)
- Power outlet: 2 USB ports in the rear with charging function

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	2nd wheel set	1 alloy rim - Scratched - No deduction
2	Boot lid / rear door	Boot lid - Glued / labelled - De-glue / neutralise
3	Side panel - rear left side	Side panel - dent(s) - Smooth repair work
4	Wheel / tyres	Alloy rim - front left side (Materialabtrag) - Scratched - Replace
5	Wheel / tyres	Alloy rim - rear left side (Materialabtrag) - Scratched - Replace
6	Front bumper	Front bumper - Scratched - Paint
7	Bonnet	Bonnet - Dent / paintcoat damage - Repair and paint

Wear and tear

No.	Component group	Description
1	Rear bumper	Rear bumper - Soiled - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

Wartungshistorie gemäß Auftraggeber Informationen.

- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.

ALPHABET



Figure 1: Diagonal front (left)

ALPHABET



Figure 2: Diagonal front (right)

ALPHABET



Figure 3: Diagonal rear (left)

ALPHABET



Figure 4: Diagonal rear (right)



Figure 5: Interior - front

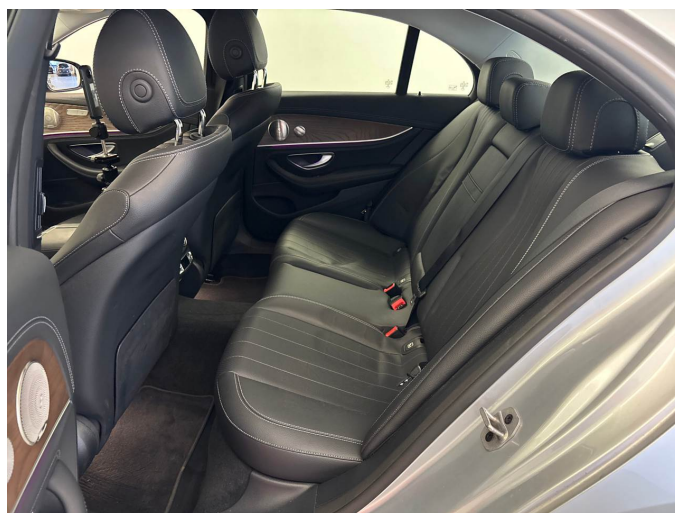


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents



Figure 15: Documents



Figure 16: Additional tyres

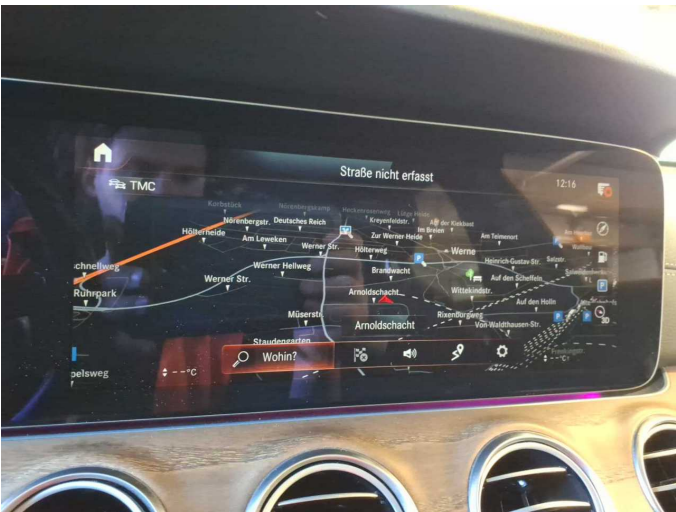


Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.

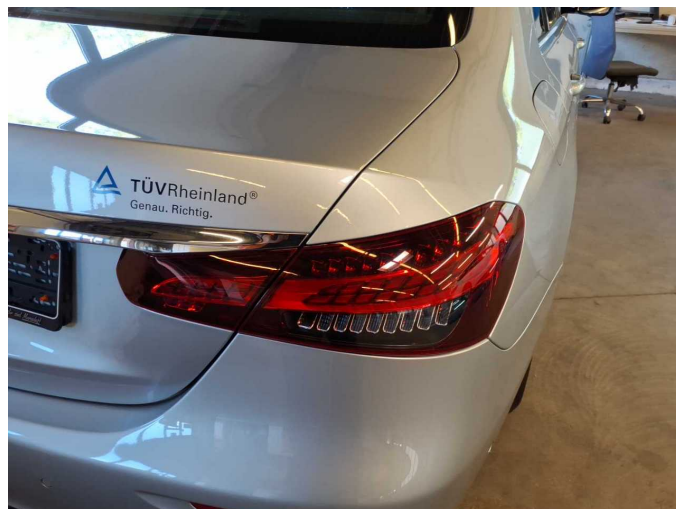


Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.

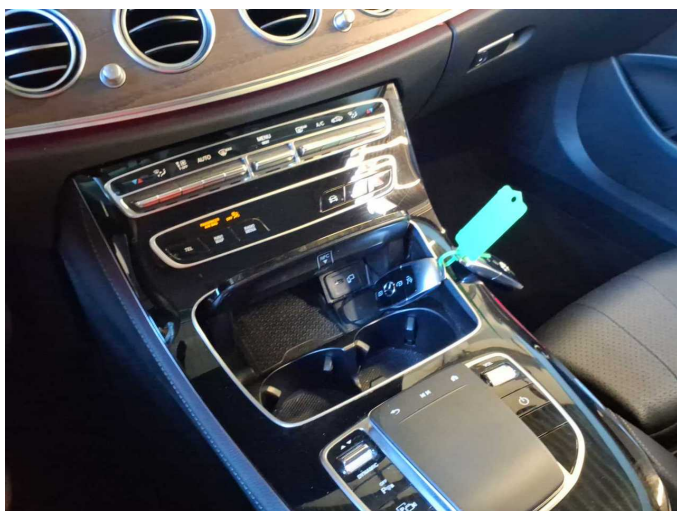


Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Damage 1: 2nd wheel set: 1 alloy rim - Scratched - No deduction



Damage 1: 2nd wheel set: 1 alloy rim - Scratched - No deduction



Damage 2: Boot lid / rear door: Boot lid - Glued / labelled - De-glue / neutralise



Damage 2: Boot lid / rear door: Boot lid - Glued / labelled - De-glue / neutralise



Damage 3: Side panel - rear left side: Side panel - dent(s) - Smooth repair work



Damage 3: Side panel - rear left side: Side panel - dent(s) - Smooth repair work



Damage 4: Wheel / tyres: Alloy rim - front left side (Materialabtrag) - Scratched - Replace



Damage 4: Wheel / tyres: Alloy rim - front left side (Materialabtrag) - Scratched - Replace



Damage 4: Wheel / tyres: Alloy rim - front left side (Materialabtrag) - Scratched - Replace



Damage 5: Wheel / tyres: Alloy rim - rear left side (Materialabtrag) - Scratched - Replace



Damage 5: Wheel / tyres: Alloy rim - rear left side (Materialabtrag) - Scratched - Replace



Damage 5: Wheel / tyres: Alloy rim - rear left side (Materialabtrag) - Scratched - Replace



Damage 6: Front bumper: Front bumper - Scratched - Paint



Damage 6: Front bumper: Front bumper - Scratched - Paint



Damage 6: Front bumper: Front bumper - Scratched - Paint



Damage 6: Front bumper: Front bumper - Scratched - Paint



Damage 6: Front bumper: Front bumper - Scratched - Paint



Damage 6: Front bumper: Front bumper - Scratched - Paint




Damage 7: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint



Damage 7: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint



Damage 7: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint

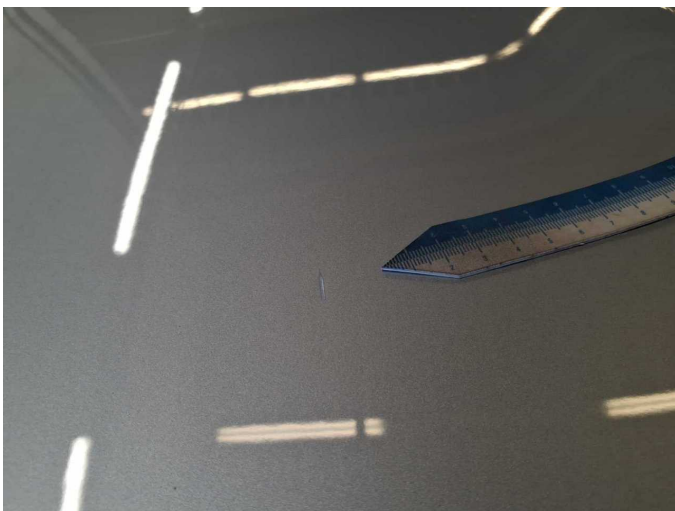

Damage 7: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint



Wear and tear 1: Rear bumper: Rear bumper - Soiled - No deduction



Wear and tear 1: Rear bumper: Rear bumper - Soiled - No deduction



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W1K2130041B083520

Hersteller / Modell: MERCEDES-BENZ MB E 220 d 9G-TRONIC Exclusive

Datum	KM-Stand	Beschreibung
11.06.2026	133.108	Regelwartungsdienst
08.08.2025	106.900	Regelwartungsdienst
09.05.2025	96.078	AU; Reparatur Sonstiges
16.08.2024	80.737	Regelwartungsdienst
13.11.2023	54.267	Regelwartungsdienst
14.02.2023	25.319	Regelwartungsdienst