Audi

2.0 35 TDI S TRONIC BUSINESS EDITION

VIN: WAUZZZF37N1024538



Description

Registration number 2BBC479	**First registration date** 16/09/2021	**Odometer** 163112 km
Color Bleu Navarre Métallisé	**Model year** 2020	**Upholstery** -
Number of doors 5	**Number of seats** 5	**Generation** -
Engine displacement 1968	**Gearbox type** Automatic	**Engine type** Combustion
Number of gears 7	**Drivetrain** Front Wheel Drive (FWD)	**Max power** 110 KW

Vehicle Equipments

Rear-view camera	Climate control	Automatic headlights
Rain-sensitive wipers	Hydraulic tail board	Alloy wheel rims
Cruise control	Electrically foldable door mirrors	SATNAV
Heated seats	Park Assist	Towing

Statement details

Inspection loc PARC HÖDLMAYR TONGEREN	**Statement date** 29/10/2026	**Inspection approval date** 30/10/2026

Control

Detected issues


Engine / Sound	✓ Ok	Vehicle leak proofness	✓ Ok
Exhaust / Clarity	✓ Ok		

Defects & corrections

#	Element	Defect	Correction

All amounts are expressed in values excluding VAT.
This inspection report may contain personal data under GDPR (EU 2016/679). Such data is processed solely to manage vehicle returns, assess condition, and handle related costs. Access is restricted to authorised group entities, relevant service providers, and business customers as required. Any other use or disclosure must comply with data protection laws, and sharing with unauthorised third parties is prohibited.

001	Rim / Front Left Rim/Tyre diameter : 17 "	Scratched	Acceptable

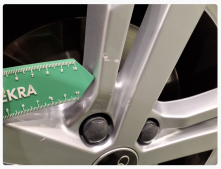
002	Bumper / Back Painted : Yes	Scratched	Painting









003	Door / Back Left	Dent	Acceptable

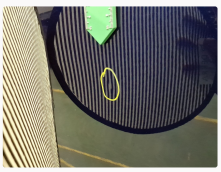004	Door / Front Left [1]	Dent	Repair




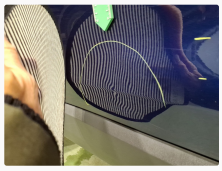


005	Spoiler / Front Painted : No	Scratched	Acceptable




006	Door / Front Right	Dent	Acceptable

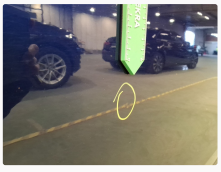All amounts are expressed in values excluding VAT.
This inspection report may contain personal data under GDPR (EU 2016/679). Such data is processed solely to manage vehicle returns, assess condition, and handle related costs. Access is restricted to authorised group entities, relevant service providers, and business customers as required. Any other use or disclosure must comply with data protection laws, and sharing with unauthorised third parties is prohibited.

007	Door / Back Right	Dent	Acceptable





008	Door handles / Back Right	Scratched	Painting




009	Door sill / Back Right	Scratched	Painting





010	Rear windscreen / Back Tinted window : No	Scratched	Replace





011	Roof / - [2]	Dent	Acceptable






012	Seat back plastic trim / Back Left	Scratched	Replace






013	Seat / Back Left	Scratched	Replace

All amounts are expressed in values excluding VAT.
This inspection report may contain personal data under GDPR (EU 2016/679). Such data is processed solely to manage vehicle returns, assess condition, and handle related costs. Access is restricted to authorised group entities, relevant service providers, and business customers as required. Any other use or disclosure must comply with data protection laws, and sharing with unauthorised third parties is prohibited.

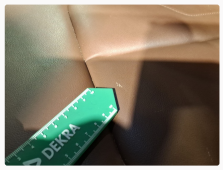

014	Interior complete / -	Stained	Cleaning




015	Tailgate / Boot door / -	Rust	Painting




016	Spoiler / Back Painted : No	Scratched	Acceptable




[1] Avec rayures

[2] 4x

Loose Items

- [x] Conformity certificate
- [x] Registration certificate
- [x] Registration certificate owner
- [x] Card key
- [x] Compressor tyre repair kit
- [x] Hook /Hicth ball
- [x] Spare Key

Main set of tyres

Front Left	MICHELIN	215/65/17 Summer	4 mm
Front Right	MICHELIN	215/65/17 Summer	4 mm
Back Left	MICHELIN	215/65/17 Summer	7 mm
Back Right	MICHELIN	215/65/17 Summer	7 mm

All amounts are expressed in values excluding VAT.
This inspection report may contain personal data under GDPR (EU 2016/679). Such data is processed solely to manage vehicle returns, assess condition, and handle related costs. Access is restricted to authorised group entities, relevant service providers, and business customers as required. Any other use or disclosure must comply with data protection laws, and sharing with unauthorised third parties is prohibited.

Comments

All amounts are expressed in values excluding VAT.
This inspection report may contain personal data under GDPR (EU 2016/679). Such data is processed solely to manage vehicle returns, assess condition, and handle related costs. Access is restricted to authorised group entities, relevant service providers, and business customers as required. Any other use or disclosure must comply with data protection laws, and sharing with unauthorised third parties is prohibited.

Pictures


Front left


Rear left


Boot opened


Rear right


Rear passenger compartment


Dashboard from rear seat


Front passenger compartment


Front right



Odometer




Navigation


Spare Tyre




Vin


All amounts are expressed in values excluding VAT.
This inspection report may contain personal data under GDPR (EU 2016/679). Such data is processed solely to manage vehicle returns, assess condition, and handle related costs. Access is restricted to authorised group entities, relevant service providers, and business customers as required. Any other use or disclosure must comply with data protection laws, and sharing with unauthorised third parties is prohibited.

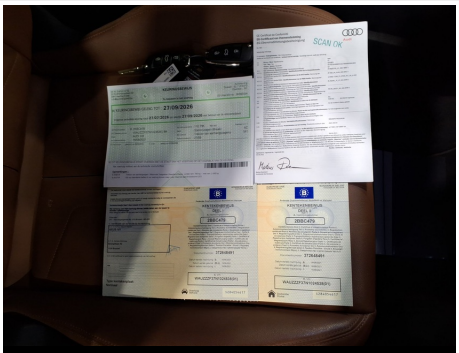

Other

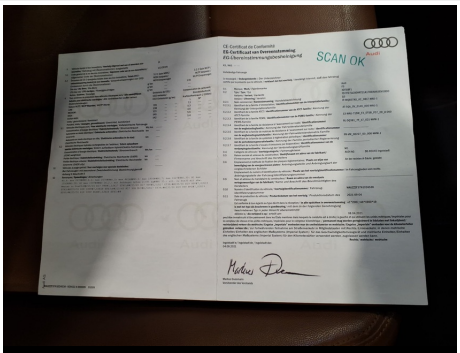

Other

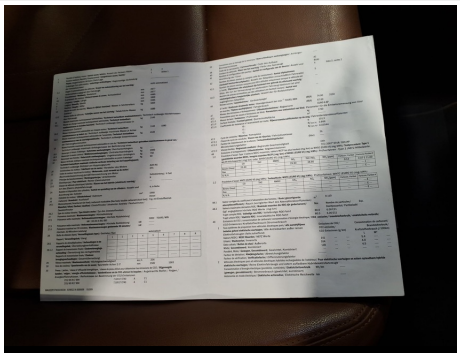


Other



Other



Rim / Front Left / Scratched

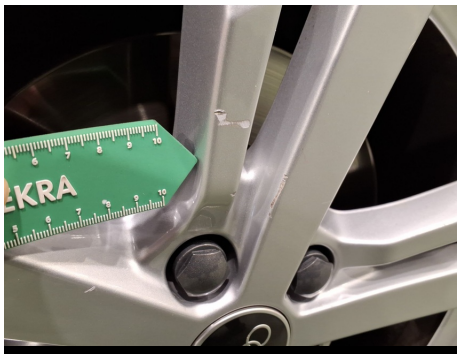

Rim / Front Left / Scratched



Bumper / Back / Scratched




Bumper / Back / Scratched



Bumper / Back / Scratched



Bumper / Back / Scratched

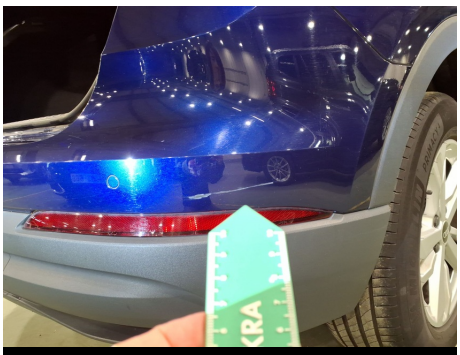


Bumper / Back / Scratched



Bumper / Back / Scratched



Door / Back Left / Dent

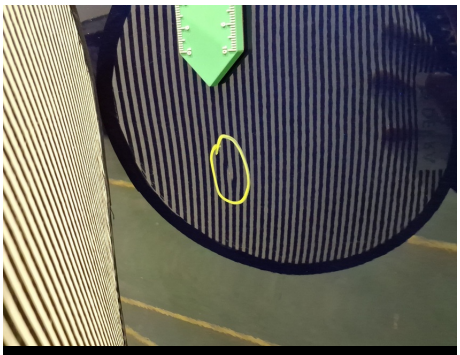

Door / Back Left / Dent



Door / Front Left / Dent

All amounts are expressed in values excluding VAT.
This inspection report may contain personal data under GDPR (EU 2016/679). Such data is processed solely to manage vehicle returns, assess condition, and handle related costs. Access is restricted to authorised group entities, relevant service providers, and business customers as required. Any other use or disclosure must comply with data protection laws, and sharing with unauthorised third parties is prohibited.



Door / Front Left / Dent



Door / Front Left / Dent



Door / Front Left / Dent




Spoiler / Front / Scratched



Spoiler / Front / Scratched



Door / Front Right / Dent

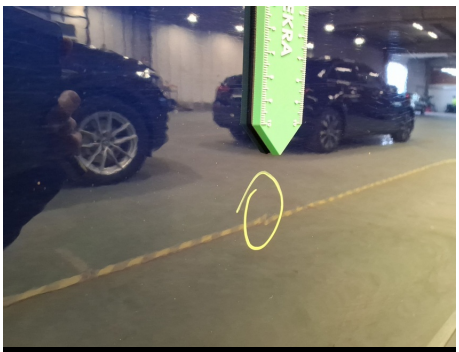


Door / Front Right / Dent



Door / Back Right / Dent



Door / Back Right / Dent

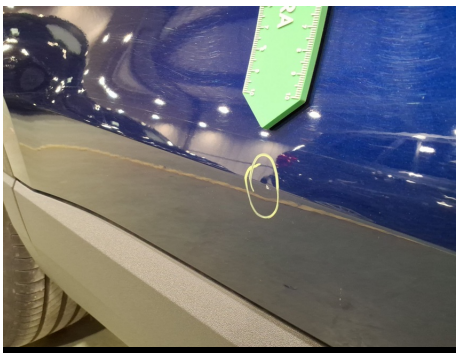

Door / Back Right / Dent



Door handles / Back Right / Scratched



Door handles / Back Right / Scratched



Door sill / Back Right / Scratched




Door sill / Back Right / Scratched



Door sill / Back Right / Scratched

All amounts are expressed in values excluding VAT.
This inspection report may contain personal data under GDPR (EU 2016/679). Such data is processed solely to manage vehicle returns, assess condition, and handle related costs. Access is restricted to authorised group entities, relevant service providers, and business customers as required. Any other use or disclosure must comply with data protection laws, and sharing with unauthorised third parties is prohibited.

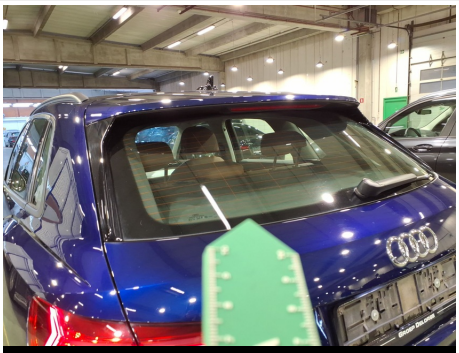

Rear windscreen / Back / Scratched



Rear windscreen / Back / Scratched




Rear windscreen / Back / Scratched



Roof / - / Dent



Roof / - / Dent

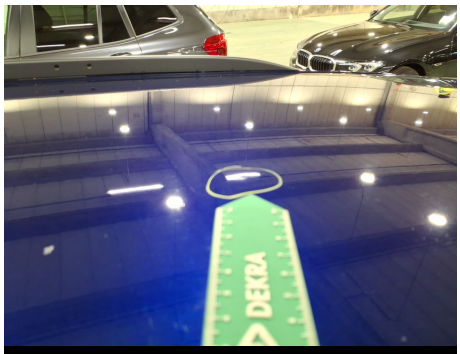

Roof / - / Dent



Roof / - / Dent



Seat back plastic trim / Back Left / Scratched



Seat back plastic trim / Back Left / Scratched



Seat back plastic trim / Back Left / Scratched



Seat / Back Left / Scratched



Seat / Back Left / Scratched



Seat / Back Left / Scratched



Seat / Back Left / Scratched



Interior complete / - / Stained

All amounts are expressed in values excluding VAT.
This inspection report may contain personal data under GDPR (EU 2016/679). Such data is processed solely to manage vehicle returns, assess condition, and handle related costs. Access is restricted to authorised group entities, relevant service providers, and business customers as required. Any other use or disclosure must comply with data protection laws, and sharing with unauthorised third parties is prohibited.



Interior complete / - / Stained



Tailgate / Boot door / - / Rust



Tailgate / Boot door / - / Rust



Spoiler / Back / Scratched



Spoiler / Back / Scratched

All amounts are expressed in values excluding VAT.
This inspection report may contain personal data under GDPR (EU 2016/679). Such data is processed solely to manage vehicle returns, assess condition, and handle related costs. Access is restricted to authorised group entities, relevant service providers, and business customers as required. Any other use or disclosure must comply with data protection laws, and sharing with unauthorised third parties is prohibited.