



PEUGEOT 308 SW

Vinnumber:	VF3LCYHZRJS484235	Versionname:	1.5 BlueHDi 130 DPF S&S EAT8 Active
First Registrationdate:	12/02/2019	Fiscalpower:	
Expertise Mileage:	103800	Power Kw:	96
Bodytype:		Body colour:	Grey
Gearbox:	Automatic	Type of rims (mounted):	Aluminium
Transmission:		Parking lot:	11126
Fueltype:	Diesel		
Type of rims (mounted):	Aluminium		
Certificate of Conformity:	Yes		
Category:	Passenger Car		
Registration Certificate Car (BE):	Yes		

Options

Number of keys total	1	Luggage cover	
Cruise Control		Front parking sensors	
Steering wheel multifunctional		Rear parking sensors	
Radio multimedia		Type of Tow bar	Tow bar fixed
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining fabrics		
Type of climate control	Autom climate control		

Limited Technical Inspection


Tyres







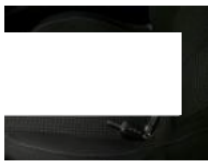


205/55/16/92 H				
Summer tyres:	Fr.L.	Firestone: 5 mm	Fr.R.	Firestone: 5 mm
	Re.L.	Fulda: 5 mm	Re.R.	Fulda: 5 mm
Tyre profile depth FL				5.0
Tyre profile depth FR				5.0
Tyre profile depth RL				5.0
Tyre profile depth RR				5.0
Tyre size FL				205/55 R 16 92 H
Tyre size FR				205/55 R 16 92 H
Tyre size RL				205/55 R 16 92 H
Tyre size RR				205/55 R 16 92 H
Tyre type FL				Summer
Tyre type FR				Summer
Tyre type RL				Summer
Tyre type RR				Summer
Tyre make FL				258
Tyre make FR				258
Tyre make RL				2484
Tyre make RR				2484

Assistance equipment

Emergency spare wheel	Yes	Jack	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Total cost ex VAT	4331,58
Ignition key, Missing, Replace	350,09



Seat cover FL, Burned, Replace	355,78
	
Alloy rim RL, Scratch(es), Acceptable	0,00
	
Door FL, Dent(s), Acceptable	0,00
	
Outside rear-view mirror housing L, Scratch(es), Acceptable	0,00
	
Alloy rim FL, Scratch(es), Acceptable	0,00
	
Outer sill L, Dent(s) and scratch(es), Repair and paint (complete)	434,80
	
Door RL, Scratch(es), Acceptable	0,00
	
Bumper R, Deformed / Strained, Replace and paint	1078,40
	
Rear window, Scratch(es), Acceptable	0,00
	
Tailgate / Boot, Bad repair, Check	0,00



Alloy rim FR, Scratch(es), Replace 363,34



Outside rear-view mirror housing R, Scratch(es), Acceptable 0,00



Door FR, Scratch(es), Repair and paint (complete) 445,79



Wing RR, Dent(s) and scratch(es), Repair and paint (complete) 491,09



Alloy rim RR, Scratch(es), Repair and paint (complete) 133,03



Roof, Chemical pollution, Repair and paint (complete) 674,26



Interior, Not original part, Replace 5,00

