

Condition Report / Loss of Value Assessment II



Process

Your order dated	2026-06-30
Date of inspection	2026-07-07
Reference numbers	9999999999 - 9600955953 - 0015944865 - 9600955953

Vehicle information

		Vehicle ident. no.	WAUZZZF12SD016095
Type of vehicle	Motor car - Kabrio-Limousine	Color / finish	Black / metallic
Manufacturer	Audi	Next main inspection	01/2028
Type / sales designation	Q8 45 TDI	Kilometres read	28,577 km
First registration date	2025-07-30	Emissions class	Euro 6
Gearbox / no. of gears	automatic / 8	Seats / doors	5 / 5
Axles / driven	2 / 2	No. of owners	no details
Engine	Hybrid / Diesel / electric	Displacement / kW	2,967 ccm / 170 KW
Continuous power		Maximum power	
Charging plug		Battery capacity	

Vehicle information was communicated by the client and verified and supplemented on the vehicle.

Fitted wheels:					
Position	Type of tyre	Type of rim	Manufacturer	Dimensions	Thread depth
front left	winter tyre	alloy wheel	Continental	265/50R20 111H	7 mm
front right	winter tyre	alloy wheel	Continental	265/50R20 111H	7 mm
rear right	winter tyre	alloy wheel	Continental	265/50R20 111H	7 mm
rear left	winter tyre	alloy wheel	Continental	265/50R20 111H	7 mm
Type of spare tyre: Tire Fit					

Common / Condition	
✓ Vehicle is in running order	✗ Underbody check conducted
✗ Vehicle is registered	✓ Main key included (no: 1)
✓ Battery is functioning	Secondary key is stored centrally
✗ Service manual included	
✗ Test drive performed.	
First service not yet due. Remaining mileage 1500 Kilometers.	

Legende : ✓ Yes ✗ No ○ not verifiable ⊗ not included

Repaired previous damage	The previous damage was professionally and correctly rectified	Declaration
Door rear right damaged	yes	
Engine hood damaged	yes	
Bumpers front damaged	yes	
Headlights left damaged	yes	
Headlights right damaged	yes	

Remarks
Satz Sommerräder fehlen

Equipment according to VIN query

Standard equipment

airbag driver side/passenger side	airbag passenger side deactivatable
antilock braking system (ABS)	Type of drive: all-wheel drive
Audi Application Store and Smartphone Interface	Audi connect (web-based services)
Audi connect (Emergency and Assistance System)	Audi Drive Select
Audi music interface	exterior mirror with automatic curb-view tilting, right
exterior mirror vehicle colour	control elements glass look, incl. extended aluminium look
braking system with recovery system, 12,5 V	roof edge spoiler
scuff rails with aluminium insert	first-aid kit / first-aid kit
driver assistance system: start-up assistant (hold-assist)	driver assistance system: brake assistant (Audi pre sense front)
front camera (glass)	driver assistance system: high-beam assistant
driver assistance system: passenger protection system (Audi pre sense basic)	driver assistance system: park assist
parking aid plus front, sideways and rear, acoustic and optical with environment view	driver assistance system: lane-departure warning
driver assistance system: traffic sign detection	driver assistance system: speed limit display
windshield heat protection glazing	floor mats velours
baggage/cargo space cover electric	loading edge protector (stainless steel)
cargo space partition (net)	cargo space lid electrically operated (open+close)
automatic transmission - Tiptronic (8-speed)	Shine package
urea tank (SCR) 24 liter	interior equipment decorative trim inserts diamond paint Silver gray
interior equipment interior elements top with contrast seam	interior mirror with automatic dimming
Isofix mounts for child seat	body: 5-door
comfort key with sensor controlled liftgate release incl. (open+close)	head airbag system (Sideguard)
lumbar support front, electrically adjustable	steering wheel (sport/leather - 3-spokes) with multiple function and shift function
steering column (steering wheel) mech. height/longitudinal adjustment	Mild-hybrid 170 kW (engine 3,0 liter - 170 kW V6 24V TDI)
center armrest front comfort equipment	model refinement
multi-media Interface MMI Navigation Plus with MMI Touch	non-smoking package
radio reception digital (DAB)	wheelbase 2998 mm
tire repair kit	tire pressure indicator
diesel particulate filter	windshield washer jets heated
SCR system (AdBlue technology)	sidebag front
power steering electromechanical	seat occupancy detection for seat belts
seat heating front	sun visors with mirror (illuminated)
sound system DSP / Audi sound system	start/stop system
immobilizer (electronic)	heat protection glazing (sideways / rear)
heat protection glazing green-tinted (sideways / rear)	central locking system / starting system Keyless-Go

Special features

adaptive windshield wiper, heated	trailer coupling (ball head electrically pivoted)
Assistance package parking	driver assistance system: parking assistant plus

Special features

reversing camera	camera system surround view (Top View)
Assistance package city	driver assistance system: 360 degree all-round protection (Audi pre sense 360°)
driver assistance system: passenger protection system (Audi pre sense basic) incl. Audi pre sense rear	driver assistance system: intersection assistant
driver assistance system: lane change assistant (Side Assist) incl. Audi pre sense rear	driver assistance system: egress alert
driver assistance system: intersection assistant rear end	Assistance package Tour
vehicle speed limiter	driver assistance system: collision avoidance assistant
driver assistance system: cornering assistant left	driver assistance system: lane-departure warning incl. emergency assistant
driver assistance system: emergency assistant with automatic emergency call	driver assistance system: adaptive drive assistant
driver assistance system: adaptive cruise control system (Adaptive Cruise Control) with automatic distance control	driver assistance system: automatic distance control (Adaptive Cruise Control) with Stop&Go incl. Audi pre sense front
exterior mirror electrically adjustable, heated + folding, with automatic dimming and Memory	Bluetooth hands-free system with voice recognition (Audi Phone Box)
roof liner cloth, black	roof rails (aluminium)
suspension (adaptive air suspension)	HD matrix LED headlights
rear lights LED with dynamic flasher	head-up display
Isofix mounts for child seat at passenger seat	automatic air-conditioning system 4-zone
instrument cluster digital (virtual cockpit plus)	comfort key with sensor controlled liftgate release and anti-theft warning system incl. (open+close)
anti-theft warning system + intrusion protection / towing protection	Kontur / ambient lighting package (plus)
light alloy rims 8,5x20 (5-V-spokes design, for winter tires)	metallic paintwork
styling package black	radiator grille single-frame look black
rear seat backrest split/folding, sliding (40:20:40)	headlight washer system (headlight washer system)
sidebag rear	seat covers/upholstery: leather Cricket
seats front electrically adjustable (left with Memory)	seat heating front and rear
bumper compl. / sill cover / wheel arch trim covers vehicle-coloured (full paintwork)	glazing rear darkened (privacy tinting)

Condition / damage

Front

headlight cleaning system cover, missing, replace (Image 21, Image 22)

engine hood, paintwork flaked, smart repair (Image 23, Image 24)

side left

door rear left, scratched, disassemble, grind, polish (Image 19, Image 20)

Inspection conditions

The inspection involved an appraisal of the exterior on the full assembled vehicle which took into account the inspection conditions at the time. No assurance of properties can be given of non-inspected areas or areas that cannot be fully inspected.

This document has an appendix with photo documentation with 24 photos.

—

Photo appendix



Picture 1



Picture 2

Photo appendix




Picture 3



Picture 4

Photo appendix

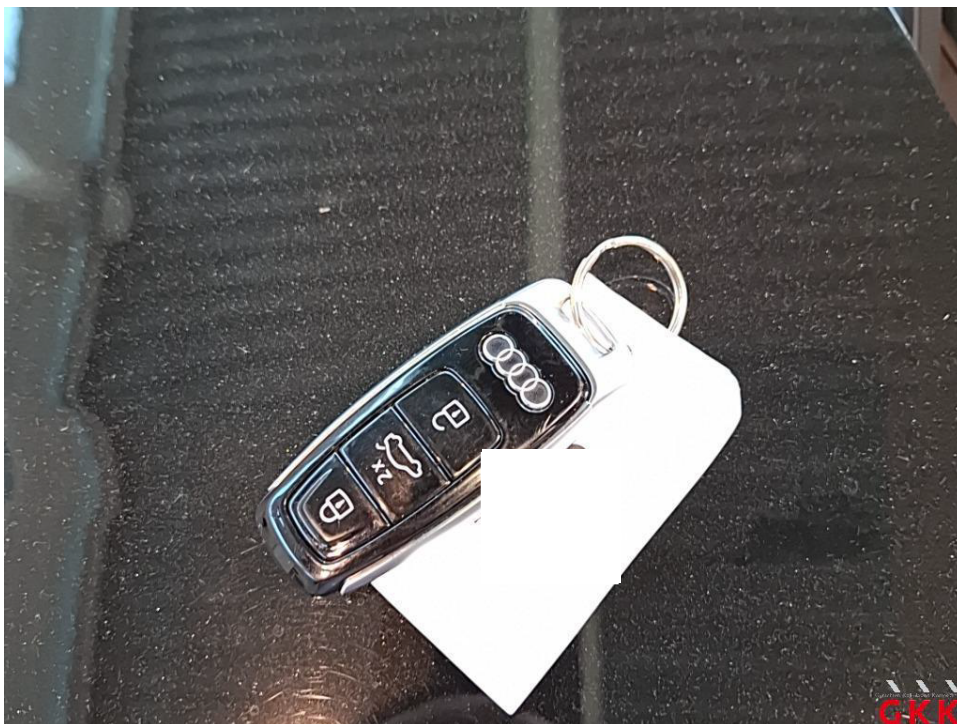

Picture 5



Picture 6

Photo appendix



Picture 7



Picture 8

Photo appendix



Picture 9



Picture 10

Photo appendix



Picture 11



Picture 12

Photo appendix




Picture 13



Picture 14

Photo appendix

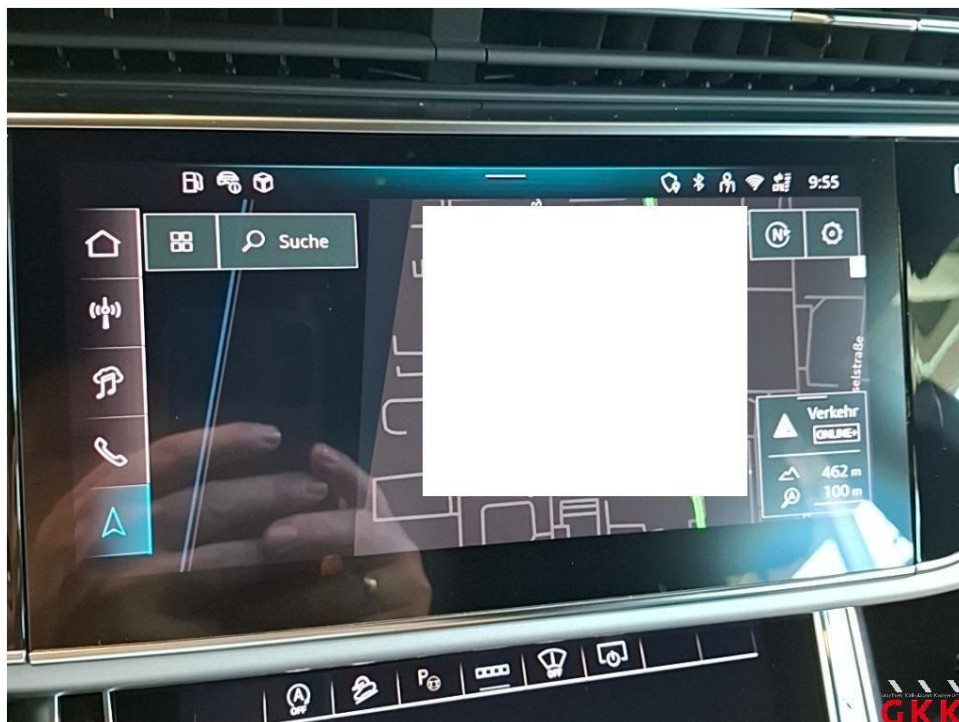


Picture 15



Picture 16

Photo appendix

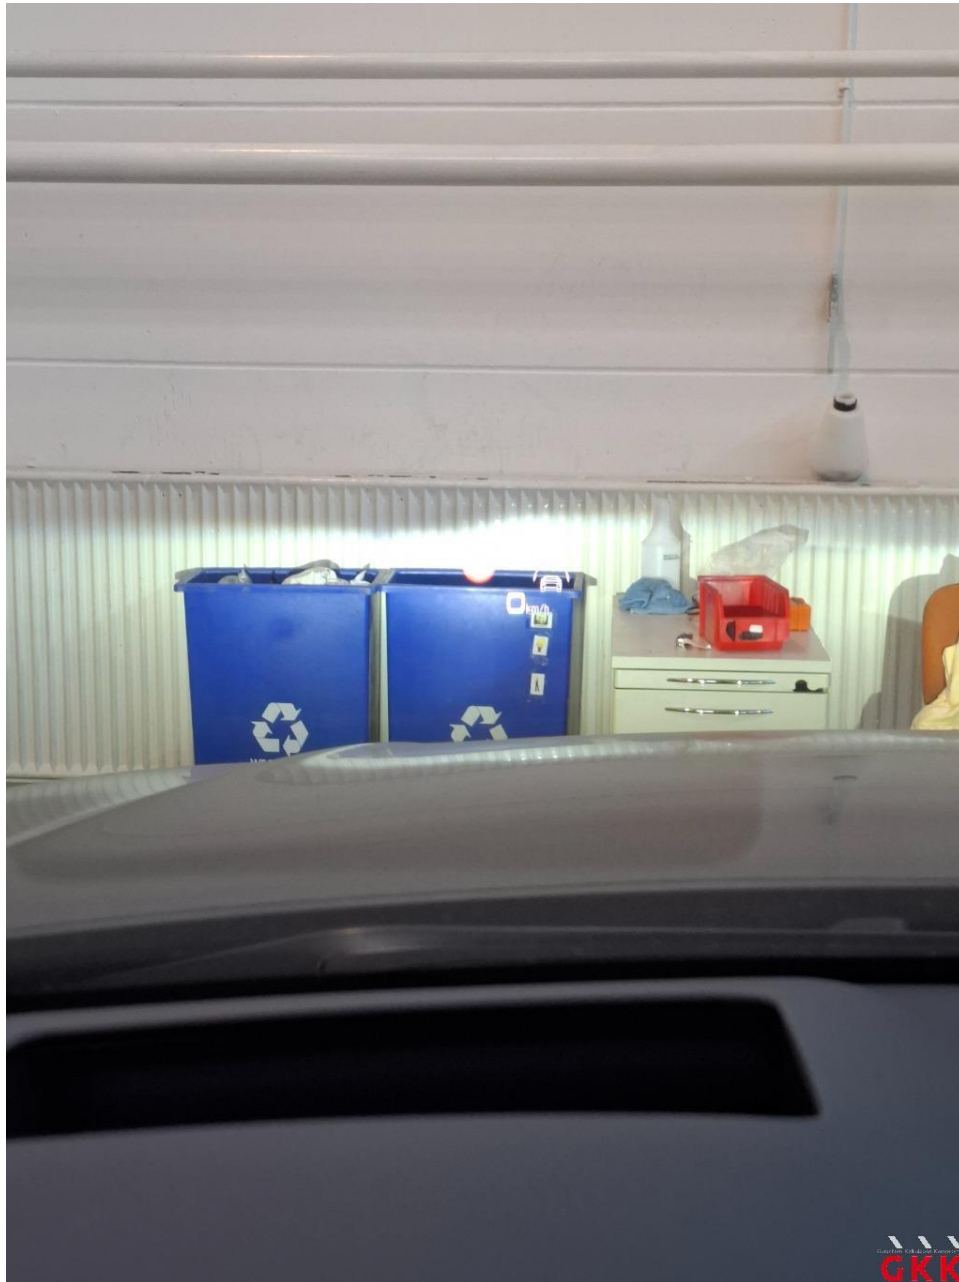

Picture 17

Photo appendix



Picture 18



Picture 19 door rear left, scratched, disassemble, grind, polish

Photo appendix



Picture 20 door rear left, scratched, disassemble, grind, polish




Picture 21 headlight cleaning system, cover, missing, replace

Photo appendix




Picture 22 headlight cleaning system, cover, missing, replace

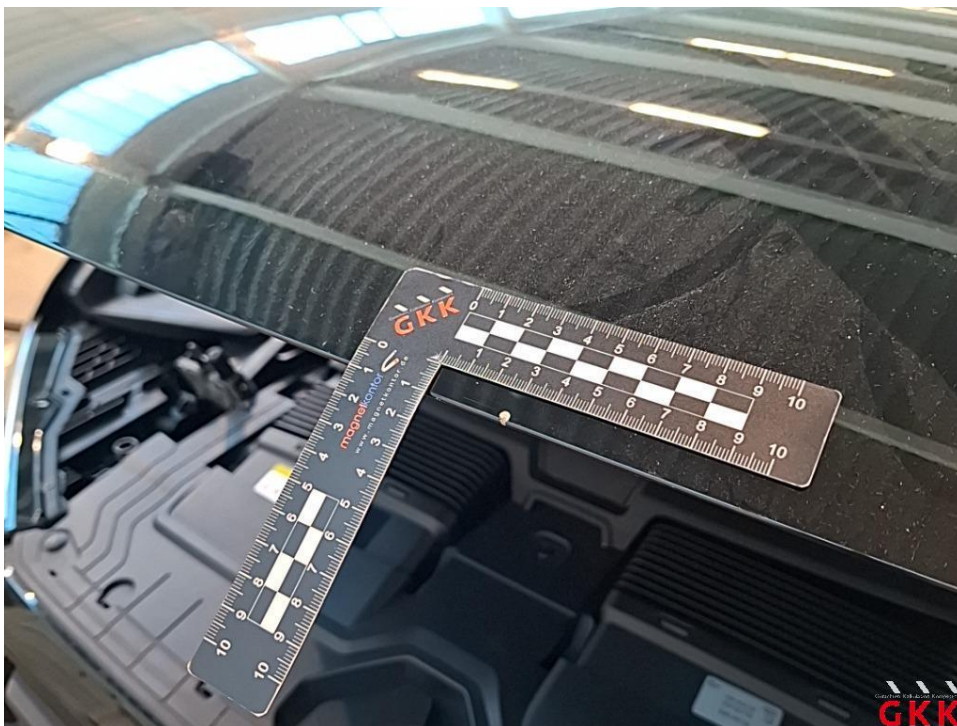

Picture 23 engine hood, paintwork flaked, smart repair

Photo appendix

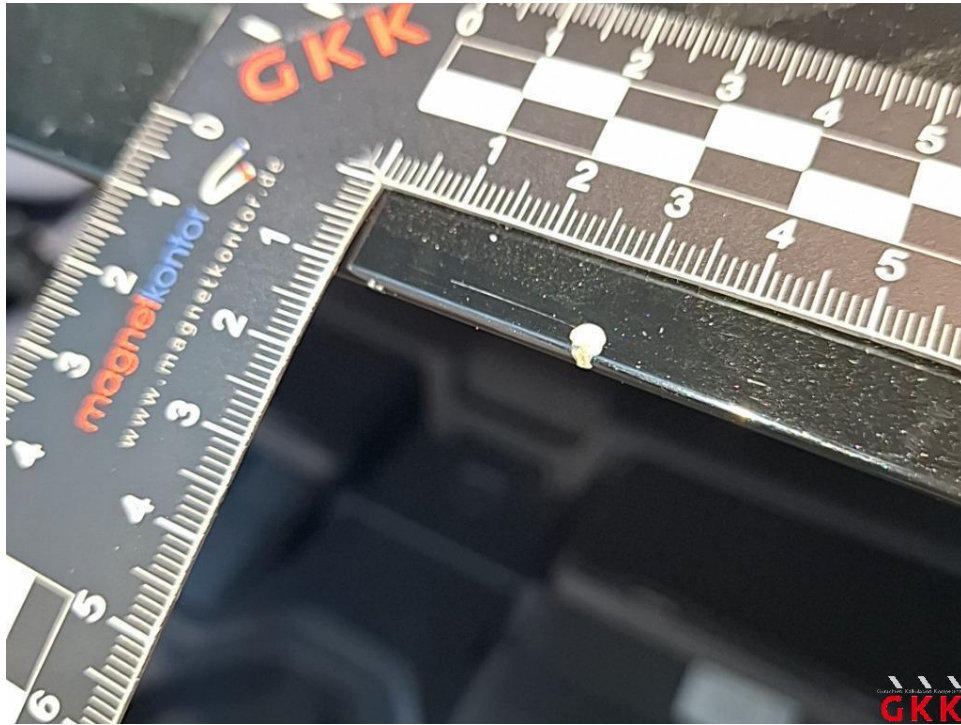

Picture 24 engine hood, paintwork flaked, smart repair