



Expertise

Protocol number: 46444523
Order No. / Reference: 26612461
Inspection date: 10 Jul 2026

Manufacturer: Renault

Model: Megane EV60 220hp optimum charge Evolution

VIN: VF1RCB00170614333



Vehicle details

Manufacturer / Type / Model / Equipment

Renault Megane EV60 220hp optimum charge Evolution

Vehicle Identification number VF1RCB00170614333
Mileage (Read) 8,867 km
First registration 9 Jun 2023
Number of holders 1
Next periodical technical inspection 06/2028
(Report on hand)

Power / Engine displacement 55 kw /
Fuel type / Cylinder Electric / 0
Gearbox / Number of gears Direct drive / 1
Type of drive Front drive
Type of vehicle SUV

Colour / colour code Arktis-Weiß
Doors / Seats 5 / 5
Upholstery type Cloth
Colour of upholstery Grey

Vehicle with smoke odor no



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	4 Monat(e)
Last service on / at	11/2025 at 5,433 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GT016508
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	3333 / BPN 00020		
Emission standard	2017/1151;WLTP;reine Elektrofz	fine dust sticker	
Permitted total weight	2,158 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	195/60 R18 96H	Summer tyres on Light alloy	Michelin	6mm / 6mm
2)	195/60 R18 96H	Summer tyres on Light alloy	Michelin	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	195/60 R18 96H	Winter tyres on Light alloy	Continental	6mm / 6mm
2)	195/60 R18 96H	Winter tyres on Light alloy	Continental	7mm / 7mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Airbag: Airbag for driver and front passenger (passenger airbag can be deactivated)
- Anti-lock braking system (with electronic brake force distribution (EBD))
- Exterior mirrors painted in car color
- 12-inch digital speedometer display
- Rear parking sensors
- Electric window regulators front and rear (with momentary switch and pinch protection)
- Heated rear window
- Interior harmony Equilibre in grey fabric
- ISOFIX i-Size child seat attachment
- Climate: Heat pump
- Headrests (5)
- Charging cable Type 2/Type 2 (Mode 3) 5m length - 2.3 to 22kW AC
- Steering wheel: Heated steering wheel
- Steering wheel: Steering wheel adjustable for reach and height
- Light and rain sensor
- Fatigue detection
- Fog light
- Emergency Lane Keeping Assist
- Upholstery: Fabric "Anthracite"
- Radio accessories: 2 USB ports in the front and rear seat rows
- Tires: Direct tire pressure monitoring system
- Wheels: 18" Oston alloy wheels (tires 195/60 R18)
- Wheels: Tire repair kit
- Seat belts (3-point seat belts on all rear seats - seat belt warning for front and rear seats)
- Seats: Driver's seat height-adjustable with electric lumbar support
- Bumper in body color F1 Blade
- Traffic sign recognition with speed adjustment
- Central locking with remote control
- Airbag: Front side airbags (front and rear windowbags and front center airbag)
- Dashboard in grey - textile
- Exterior mirrors (2) electrically adjustable and heated
- Connected Services
- eCall emergency call system
- Electronic Stability Program (ESP) (with hill start assist)
- Sound simulator
- Transmission: Automatic reduction gearbox
- Inductive smartphone charging pad
- Interior mirror with manual dimming function
- Keycard Handsfree
- 2-zone automatic climate control
- Paint finish: Solid
- LED light signature
- LED daytime running lights
- Steering wheel: Leather steering wheel
- Steering wheel: Paddle shifters on the steering wheel for recuperation
- Center console with storage compartment and center armrest
- Emergency braking assistant with pedestrian, cyclist and intersection detection
- Radio: OpenR link infotainment system with 12-inch touchscreen (Arkamys Auditorium sound system - 6 speakers - navigation system with Google Maps - integrated Google - wireless Android Auto & Apple CarPlay - voice-controlled Google Assistant)
- Rear view camera
- Safety distance warning system
- Seats: Driver and passenger seats are heated
- Seats: Rear bench seat folds down asymmetrically (1/3 to 2/3 foldable)
- Cruise control (with speed limiter)
- Full LED headlights LED PURE VISION

Extra equipment

- Front, rear and side parking assistance
- Package: City & Advanced Driving Assist Package Evolution (Exit Assist - Adaptive Cruise Control - Active Driver Assist - Blind Spot Warning with Active Steering Intervention - Front, Rear and Side Parking Aid - Traffic Sign Recognition with Speed Warning)



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Roof	Stub aerial - Damage caused by marten / rodent - Replace
2	Front bumper	Spoiler - Scratch(es) - Smart repair
3	Body	Body - Glued / labelled - De-glue / neutralise

Wear and tear

No.	Component group	Description
1	Mudguard - left side	Mudguard - left side - dent(s) - No deduction
2	Vehicle glazing	Windscreen - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres

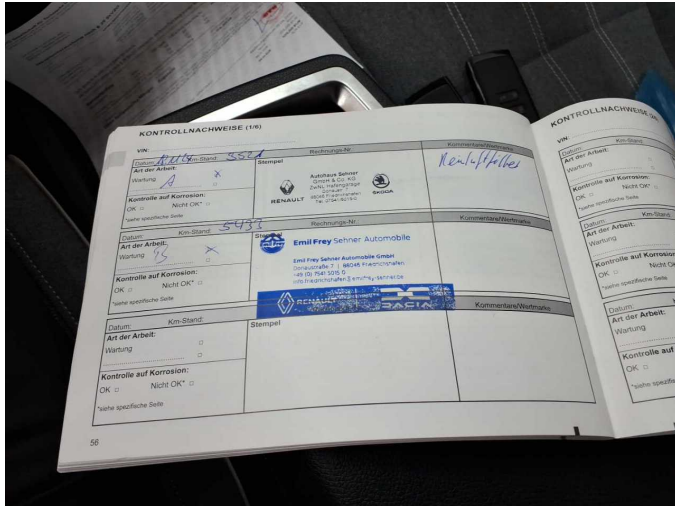


Figure 13: Documents

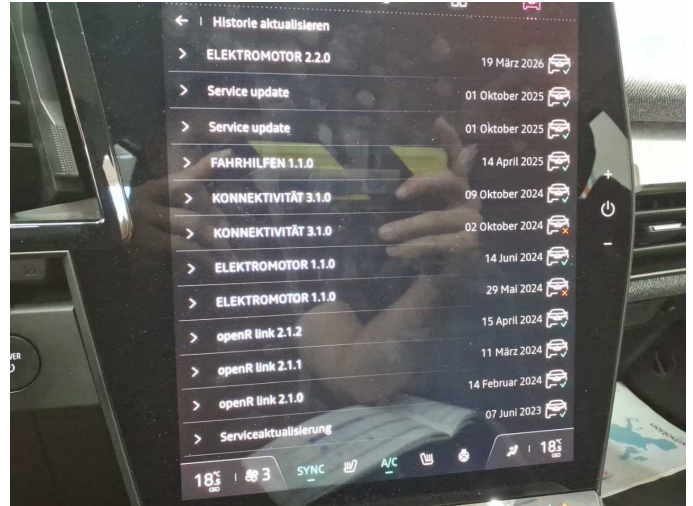


Figure 14: Documents

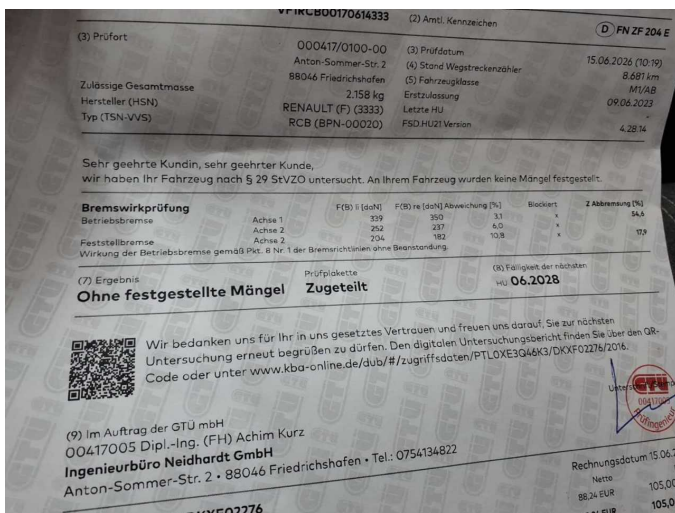


Figure 15: Documents

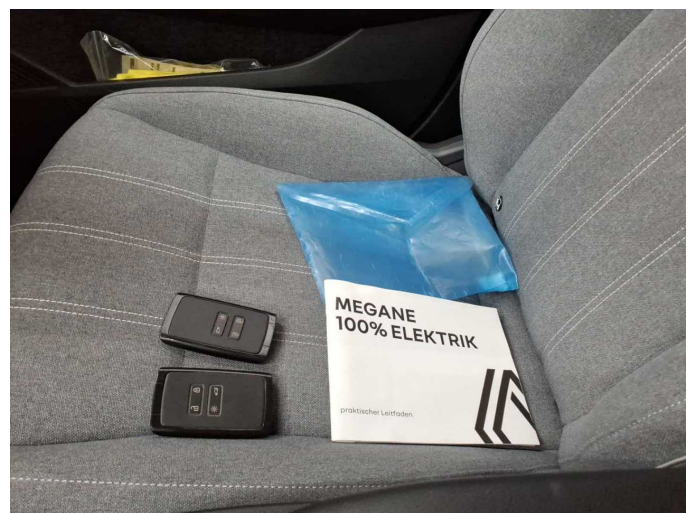


Figure 16: Documents

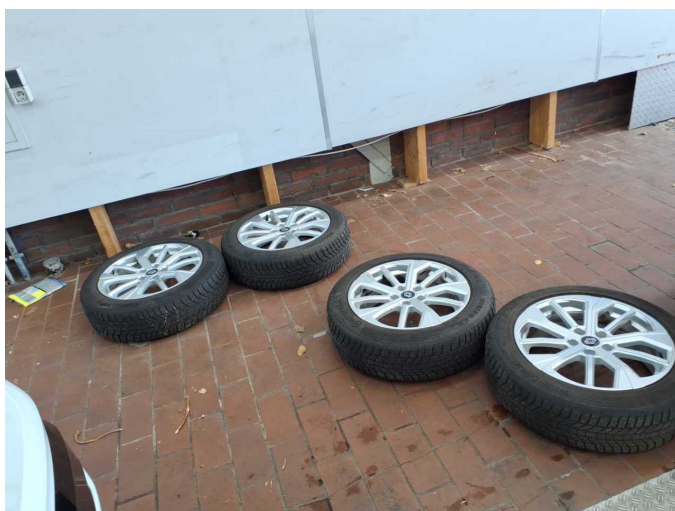


Figure 17: Additional tyres

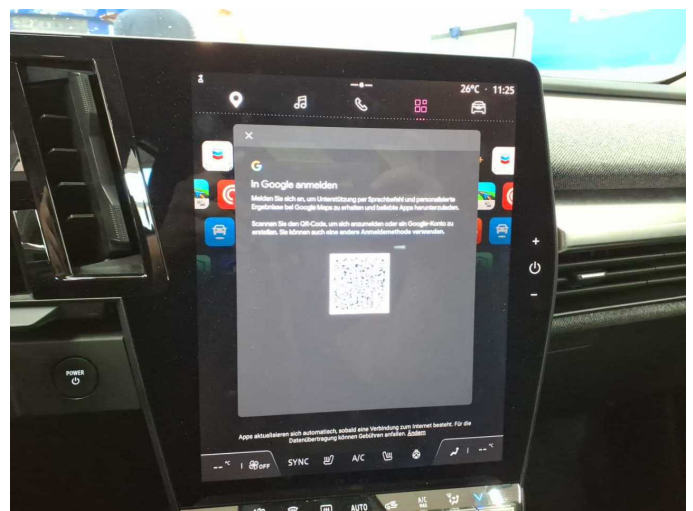


Figure 18: Navigation



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.

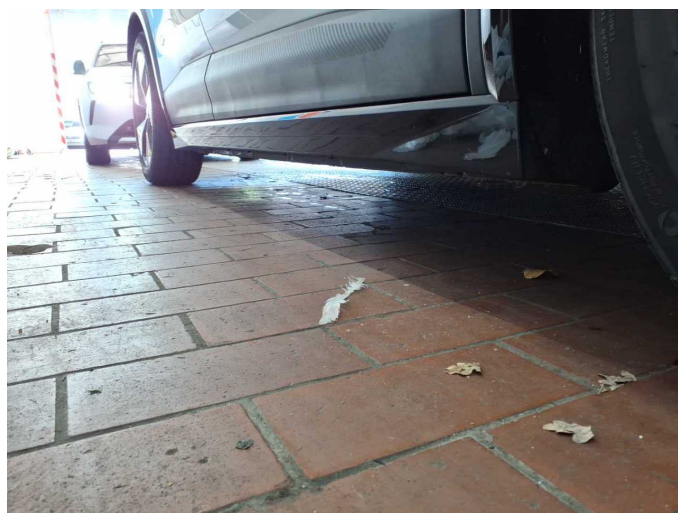


Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.

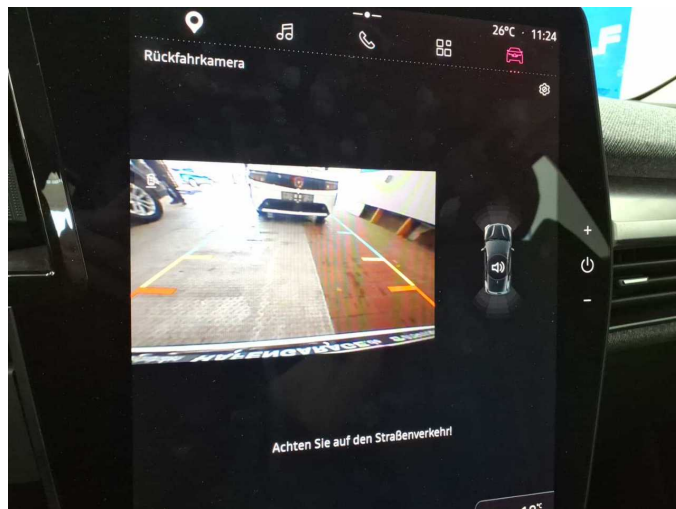


Figure 26: Misc.

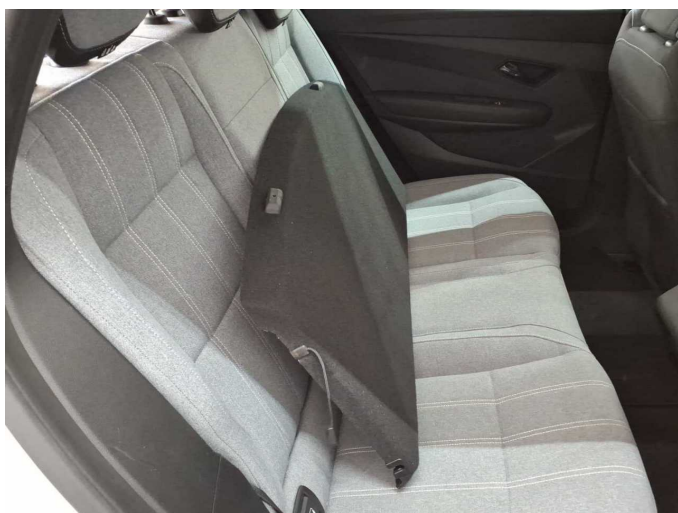


Figure 27: Misc.



Figure 28: Misc.

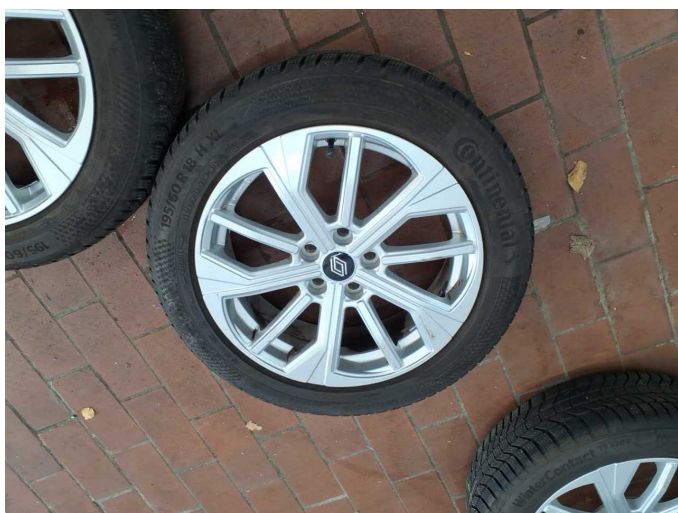


Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Damage 1: Roof: Stub aerial - Damage caused by marten / rodent - Replace



Damage 1: Roof: Stub aerial - Damage caused by marten / rodent - Replace



Damage 2: Front bumper: Spoiler - Scratch(es) - Smart repair



Damage 2: Front bumper: Spoiler - Scratch(es) - Smart repair



Damage 3: Body: Body - Glued / labelled - De-glue / neutralise



Damage 3: Body: Body - Glued / labelled - De-glue / neutralise



Damage 3: Body: Body - Glued / labelled - De-glue / neutralise



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: VF1RCB00170614333

Hersteller / Modell: RENAULT RENAULT Megane EV60 220hp optimum charge
Evolution

Datum	KM-Stand	Beschreibung
26.11.2025	5.433	Regelwartungsdienst
18.11.2024	3.521	Regelwartungsdienst