



Expertise

Protocol number: 46584484
Order No. / Reference: 26678748
Inspection date: 16 Jul 2026

Manufacturer: Volkswagen	Model: Golf Variant 2.0 TDI SCR DSG Style
VIN: WVVZZZCD5PW543111	



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volkswagen Golf Variant 2.0 TDI SCR DSG Style	
Vehicle Identification number	WVVZZZCD5PW543111
Mileage (Reported)	122,743 km
First registration	23 Jun 2023
Number of holders	1
Next periodical technical inspection	06/2028
(Report on hand)	
Fuel type	Diesel
Engine displacement / Cylinder	1,968 ccm / 4
Power	110 kW
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Atlantic Blue Metallic (C5B)
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black-Anthracite
Vehicle with smoke odor	no
readiness to drive	Roadworthy



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	542 Tag(e)
Last service on / at	06/2026 at 120,099 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GV165509
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	short drive on the company premises	Engine function test	Performed
readiness to drive	Roadworthy		
Manufacturer key number/ type code number	0603 / CNN 01995		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,060 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/45 R17 91Y	Summer tyres on Light alloy	Continental	4mm / 4mm
2)	225/45 R17 91W	Summer tyres on Light alloy	Nexen	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/50 R17 93H	Winter tyres on Light alloy	Bridgestone	5mm / 4mm
2)	205/50 R17 93H	Winter tyres on Light alloy	Bridgestone	7mm / 7mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 07/2027		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- 12-volt power outlet in the luggage compartment
- Adaptive Cruise Control ACC "stop & go" (Adaptive Cruise Control ACC incl. speed limiter - Emergency braking assistant "Front Assist" with pedestrian and cyclist detection)
- Airbag for driver and front passenger (with passenger airbag deactivation)
- Ambient lighting 30-color (LED light in the front footwell, light color selectable)
- Bumpers in body color
- Car2X (Using the WLANp ITS G5 standard, all Car2X-enabled vehicles and traffic systems such as traffic lights can transmit data at high speed without using the mobile network. This works over a distance of around 800 meters - enough to warn of an invisible traffic jam.)
- Central locking without safe locking, with remote control and 2 remote folding keys
- Digital Cockpit Pro, multicolor (various info profiles selectable)
- Electronic differential lock XDS
- Electronic immobilizer
- Electronic stability program and electromechanical brake booster (Anti-lock braking system with brake assist - Electronic brake force distribution - Traction control - Electronic differential lock - Engine drag torque control - Trailer stabilization)
- Emergency call service (no registration required, service is activated upon delivery)
- Exterior mirror housings and door handles in body color
- Fatigue detection (detects signs of possible driver fatigue based on characteristic steering behavior, time of day and driving duration and issues a visual and audible warning)
- Front center armrest adjustable in height and length
- Front headrests (safety-optimized)
- Illuminated strip between headlights and door handle recesses
- ISOFIX mounting points (for child seats on the outer rear seats and on the front passenger seat, i-Size compatible)
- Keyless start system without safe locking
- LED reading lights at the front (2) and 2 at the rear
- LED taillights
- Radio "Composition" (touchscreen with 21 cm screen diagonal - 4+1 speakers - output power 4 x 20 watts - FM radio reception - dual tuner with phase diversity for the best possible radio reception - Radio Data System (RDS) - MP3 playback - USB-C interface with Apple compatibility - DAB+ digital radio reception - telephone interface (hands-free system, Bluetooth audio))
- Rear headrests (3)
- Seat belts: Three-point automatic seat belt for the middle rear seat
- Seat belts: Three-point automatic seat belts at the front with height adjustment and belt tensioner
- Start-stop system (with brake energy recuperation)
- Telephone interface with inductive charging function
- 2 USB charging ports on the rear of the center console
- 2 USB-C ports on the front
- Air conditioning system "Air Care Climatronic" (with active combination filter, rear controls and 3-zone temperature control)
- Airbags: Front and rear head airbags, front side airbags, center airbag
- Ambient lighting with logo projection
- App-Connect (selected apps for Android smartphones and Apple iPhones can be displayed and operated on the touchscreen of the radio or navigation system)
- Automatic headlight control, with LED daytime running lights (as well as welcome and farewell lights)
- black roof rails
- Chrome strip at the bottom of the side windows
- Decorative inlays "New Brushed Dark Metal" (for instrument panel and front door panels)
- Diesel particulate filter and SCR catalyst
- Driving assistant "Travel Assist" and lane keeping assistant "Lane Assist"
- Electric windows, front and rear
- Electrically adjustable and heated exterior mirrors with memory function and passenger-side mirror lowering function.
- Electromechanical power steering (speed-dependent control)
- Electronic parking brake including auto-hold function
- Emergency braking assistant "Front Assist" with pedestrian and cyclist detection (detects critical distance situations to other vehicles and helps to shorten the stopping distance - warns the driver visually and audibly in dangerous situations as well as with a preventive braking jolt with pedestrian and cyclist detection - also reacts to pedestrians and cyclists)
- Green thermal insulation glazing, sides and rear
- LED Plus headlights (LED headlights for low and high beam - dynamic headlight range control - bad weather light and cornering light)
- luggage compartment cover
- Non-smoking version (storage compartment and 12V socket at the front)
- Paint finish: Solid
- Parking aid (acoustic warning signals for obstacles in the front and rear area)
- Pedestrian protection measures expanded
- Rear bench seat undivided, backrest asymmetrically split and foldable with center armrest
- Rear window heated
- Rear window wiper with intermittent function
- Seat belts: Three-point automatic seat belts for the outer rear seats



- Textile floor mats front and rear
- Transmission: 7-speed DSG (7-speed dual-clutch transmission DSG)
- Wheels: Tire Mobility Set (12-volt compressor and tire sealant)
- Windscreen made of laminated safety glass, heat and sound insulating

- Seats: ergoActive seat with 14-way adjustment and memory function on the driver's side (driver's seat with electric adjustment, memory function and sliding thigh support - lumbar support in the front, electrically adjustable on the driver's side, massage function on the driver's side - sport comfort seats in the front, center panels of the front seats and outer rear seats in microfleece "ArtVelours")
- Steering wheel: Multifunction leather steering wheel with paddle shifters
- third brake light
- Tire pressure monitoring system (passive)
- Wheels: Alloy wheels (4) "Nottingham" 7.5 J x 17 (tires 225/45 R17)

Extra equipment

- Airbag: Front and rear side airbags including proactive occupant protection system (front and rear head and side airbags, center airbag - proactive occupant protection system in conjunction with "Front Assist")
- Package: Business Premium incl. navigation system (DSG) (6+1 speakers, App-Connect incl. App-Connect Wireless for Apple CarPlay, Android Auto, automatic distance control, adaptive cruise control (ACC) stop/go, speed limiter, emergency brake, pedestrian detection, travel assist, lane assist, emergency assist, leather multifunction steering wheel, heated, with shift paddles, multifunction camera, Discover Media navigation incl. streaming & internet (MP3, touchscreen, USB), cargo net partition, radio, heated windshield washer system, voice control, telephone interface, Comfort with inductive charging, textile floor mats, traffic sign recognition, heated front seats)
- Anti-theft alarm system "Plus" (anti-theft alarm system with interior monitoring, backup horn and tow-away protection - keyless start system "Keyless Start" with safe locking)
- Paint finish: Metallic
- Package: Light and Sight Package incl. High Beam Control "Light Assist" (High Beam Control "Light Assist" - Automatically Dimming Interior Mirror - Multifunction Camera - Rain Sensor)
- Package: Winter (DSG) (Multifunction steering wheel in leather, heated, with shift paddles - Windscreen washer nozzles automatically heated - Front seats heated)
- Wheels: Winter wheels (additional), alloy, "Nottingham" 6.5 J x 17 (4 alloy wheels 6.5 J x 17 - wheel wrench and jack - winter tires 205/50 R 17 H)
- Rear View reversing camera

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	A short maneuvering and shunting exercise was carried out on the company premises.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was roadworthy at the time of inspection.

Value reducing factors

No.	Component group	Description
1	Rear bumper	Rear bumper - Scratch(es) - Smart repair
2	Vehicle glazing	Windscreen - Stone chips - Smart repair
3	Front bumper	Front bumper - Scratched - Paint
4	Roof	Roof - Scratch(es) - Paint



Wear and tear

No.	Component group	Description
1	2nd wheel set	1 tyre (Über 4mm Profiltiefe) - No deduction
2	Bonnet	Bonnet - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Side right, Provided by user / customer, from 31 Oct 2025	1.862,04 €

Repainting

No.	Repainting
1	Mudguard - right side, Professionally carried out, Invoice of repair done Available
2	Side panel - rear right side, Professionally carried out, Invoice of repair done Non-existent
3	Door - rear right side, Professionally carried out, Invoice of repair done Non-existent
4	Door - front right side, Professionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Mudguard - right side	210 µm	Side panel - rear right side	188 µm
Door - rear right side	210 µm	Door - front right side	205 µm

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents

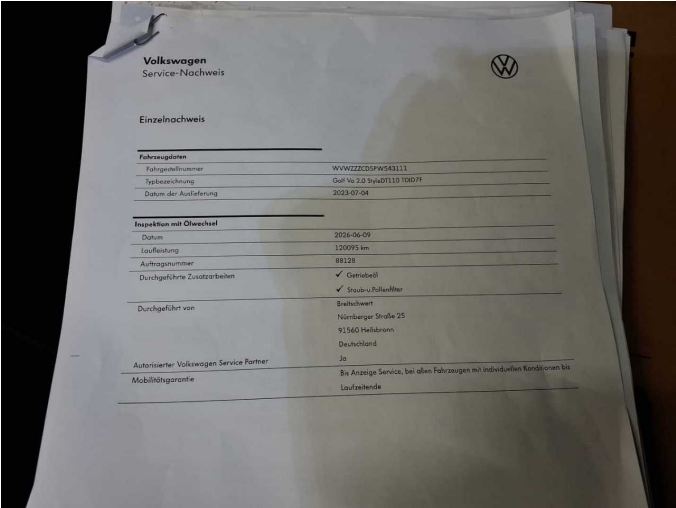


Figure 15: Documents



Figure 16: Documents

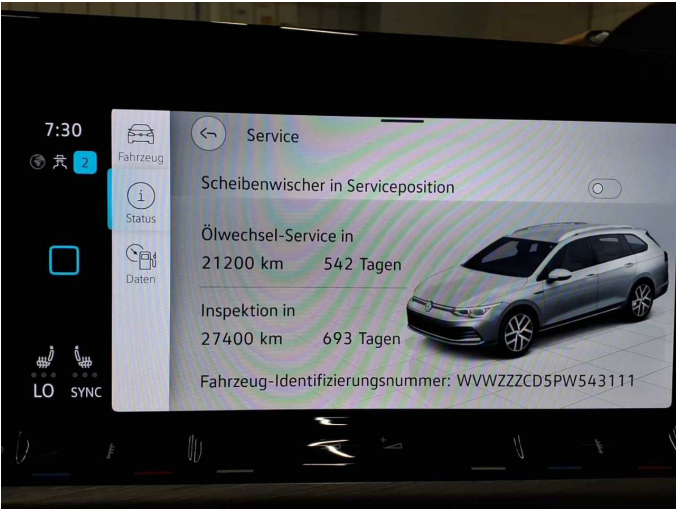


Figure 17: Documents



Figure 18: Additional tyres



Figure 19: Navigation



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.

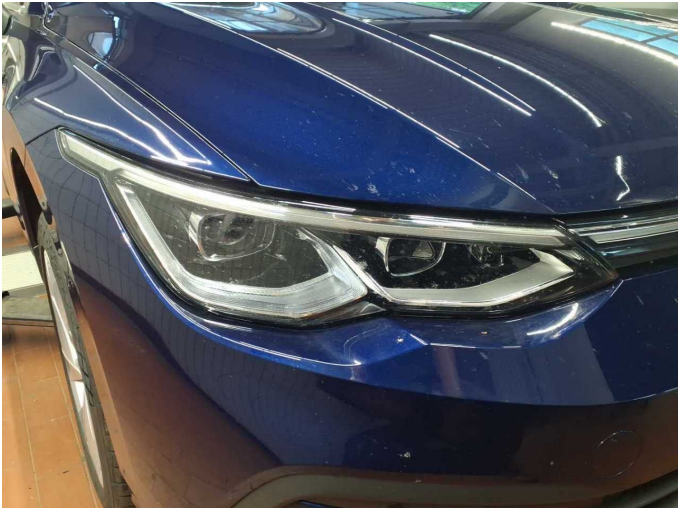


Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.



Figure 34: Misc.




Damage 1: Rear bumper: Rear bumper - Scratch(es) - Smart repair



Damage 1: Rear bumper: Rear bumper - Scratch(es) - Smart repair



Damage 2: Vehicle glazing: Windscreen - Stone chips - Smart repair

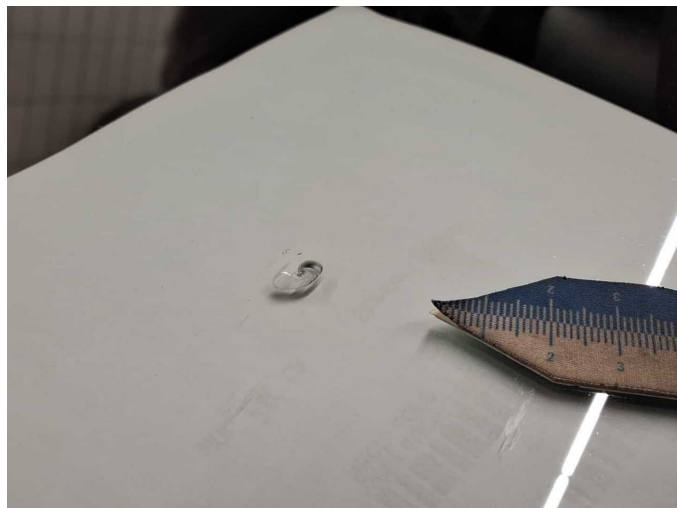

Damage 2: Vehicle glazing: Windscreen - Stone chips - Smart repair




Damage 3: Front bumper: Front bumper - Scratched - Paint



Damage 3: Front bumper: Front bumper - Scratched - Paint



Damage 3: Front bumper: Front bumper - Scratched - Paint

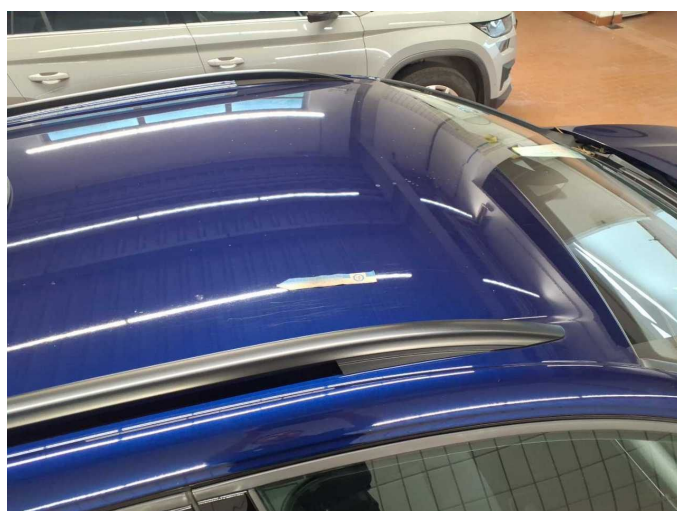

Damage 4: Roof: Roof - Scratch(es) - Paint



Damage 4: Roof: Roof - Scratch(es) - Paint



Repainting 1: Mudguard - right side



Repainting 2: Side panel - rear right side



Repainting 3: Door - rear right side



Repainting 4: Door - front right side



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WVVZZZCD5PW543111

Hersteller / Modell: VOLKSWAGEN VOLKSWAGEN Golf Variant 2.0 TDI SCR DSG
Style

Datum	KM-Stand	Beschreibung
10.06.2026	120.099	AU; Getriebeöl ern/prüfen; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Reparatur Sonstiges; Wartung Sonstiges
18.02.2026	101.592	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Reparatur Sonstiges; Systemtest/Eigendiagnose; Wartung Sonstiges
18.08.2025	88.804	Bremsflüssigkeit; Bremsflüssigkeit ern; Kraftstofffilter ern; Luftfiltereinsatz ern; Regelwartungsdienst; Systemtest/Eigendiagnose; Wartung Sonstiges
17.04.2025	75.168	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
03.12.2024	60.659	Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben hinten; Bremsscheiben vorne; Regelwartungsdienst; Reparatur Sonstiges; Wartung Sonstiges
04.10.2024	53.059	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
22.03.2024	30.672	Regelwartungsdienst
15.02.2024	26.671	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges