



VOLVO XC60: 9559-MGR

Vinnumber:	YV1UZH1V4P1389160	Versionname:	2.0 T6 AWD Recharge Core Auto todoterreno 257kW 5P automática
First Registrationdate:	9/05/2023	Fiscalpower:	
Expertise Mileage:	260456	Power Kw:	
Bodytype:	SUV	Body colour	Dark Brown
Gearbox:	Automatic	Type of rims (mounted)	Steel
Transmission:			
Fueltype:	Hybrid		
Engine functioning	Yes		
Battery functioning	Yes		
Vehicle running	Yes		
Number of seats	5		
Number head rests	5		
Type of rims (mounted)	Steel		
Certificate of Conformity	Yes		
Category	Passenger Car		
Registration Certificate Car (BE)	No		

Options

Number of keys total	2	Radio
Number keys remote	2	Seats electric F L
GPS big screen color		Seats electric F R
Windows electric F		Central consol F
Windows electric R		Luggage cover
Cruise Control		Front parking sensors
Steering wheel multifunctional		Rear parking sensors
Steering wheel leather		Roof bar alu
Seats F heated		
Radio multimedia		
Type of climate control	Autom climate control	

Tyres


	235/60/18/107 W			
Summer tyres:	Fr.L.	Goodyear: 6 mm	Fr.R.	Goodyear: 6 mm
	Re.L.	Goodyear: 7 mm	Re.R.	Goodyear: 7 mm
Tyre profile depth FL	6.0			
Tyre profile depth FR	6.0			
Tyre profile depth RL	7.0			
Tyre profile depth RR	7.0			
Tyre size FL	235/60 R 18 107 W			
Tyre size FR	235/60 R 18 107 W			
Tyre size RL	235/60 R 18 107 W			
Tyre size RR	235/60 R 18 107 W			
Tyre type FL	Summer			
Tyre type FR	Summer			
Tyre type RL	Summer			
Tyre type RR	Summer			
Tyre make FL	259			
Tyre make FR	259			
Tyre make RL	259			
Tyre make RR	259			

Assistance equipment

Repair kit	Yes
Number of charging cables (normal)	1
Number of charging cables (rapid charge)	1



Bumper F, Scratch(es), Repair and paint (complete)

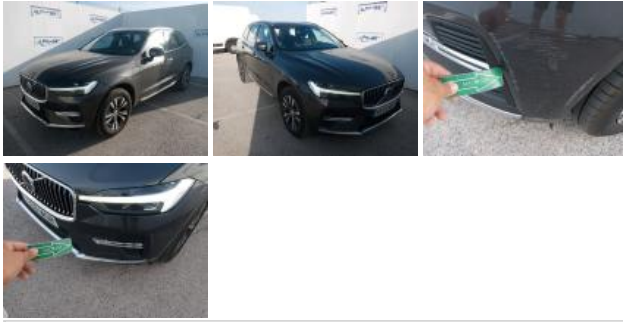

Bonnet, Dent(s) and scratch(es), Repair and paint (complete)




Bumper moulding FL, Broken, Replace



Bumper moulding FL, Broken, Replace



Bumper spoiler F, Scratch(es), Paint

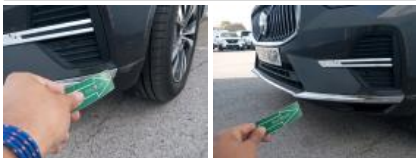

Bumper moulding FR, Broken, Replace



Windscreen, Stone chip(s), Replace



Windscreen glue kit, Required to install glazing, Repair/replace (lump sum)



Alloy rim FR bitone/polychrome, Scratch(es), Repair/replace (lump sum)



Outside rear-view mirror housing R, Scratch(es), Acceptable



Door FR, Scratch(es), Acceptable



Door RR, Dent(s) and scratch(es), Repair and paint (complete)



Wing RR, Dent(s), Acceptable



Tyres, No damage, Check



Datos del vehículo

Marca	Matrícula
Modelo	VIN
Versión	

Histórico

Fecha	Descripción	Kilómetros	Taller

Datos del vehículo

Marca

Modelo

Versión

Matrícula

VIN

Histórico

Fecha	Descripción	Kilómetros	Taller