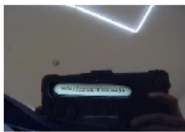


Vehicle details

VIN	WAUZZZGE1 KB004484	Brand	AUDI	Maintenance date	-
Licence Plate		Model	e-tron 55 quattro advanced	Maintenance mileage	-
Registration date	22/03/2019	Year	2019	Exterior Color	Black Metallic
Odometer	128 127 km	Engine size	-	Interior Color	Grey
Fuel	Electric	Body Type	-	Next technical inspection	-
Seats	5	Transmission	Automatic	CO2	-
Doors	5	Gears	-		

Inspection Details

Inspection date	08/07/2026	Inspection loc.			
					
					
					
					

Generic equipment

Automated air-conditioning	✓
Cruise control	✓
Leather	✓
GPS system	✓
Sliding roof	✓
Panoramic roof	✓
Alloy wheel rims	✓
Automatic Gearbox	✓
Heating seats	✓
Electric seats	✓
Metallic paint	✓
Central locking	✓
Electric windows	✓
4x4	✓
Side rails	✓
Park Distance Control	✓
Audio System	✓
Led lighting	✓

Removable element


Spare wheel kit	✓
Load cover	✓
Vehicle charger	✓
Wireless charger	✗

Technical Document

User manual	✓
Warranty booklet	✓
Spare key	✓
Key	✓
Remote key	✓
Sat Nav CD ROM Software	✓

Tyres

Hankook 285/35/21 Summer 7.1 mm

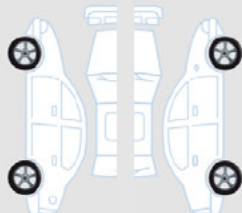

Hankook 285/35/21 Summer 7.1 mm



Continental 285/35/21 Summer 4.5 mm



Continental 285/35/21 Summer 4.5 mm

Exterior

2



Part Alloy wheel 18"
Position Front left
Damages Scratched
Severity -
Repair mode Lumpsum repair

3




Part Mudflap
Position Front left
Damages Missing
Severity -
Repair mode Replace

4



Part Door
Position Back left
Damages Scratched
Severity -
Repair mode Repair

5

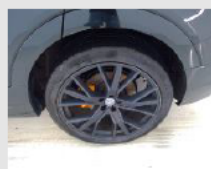

Part Alloy wheel 18"
Position Back left
Damages Scratched
Severity -
Repair mode Lumpsum repair

6



Part Wing
Position Back left
Damages Chemical deposit
Severity -
Repair mode Lumpsum repair

7



Part Bumper
Position Back
Damages Scratched
Severity -
Repair mode Repair

8



Part Alloy wheel 18"
Position Back right
Damages Scratched
Severity -
Repair mode Lumpsum repair

9



Part Door
Position Back right
Damages Dent & Chips
Severity -
Repair mode Repair

10



Part Sill cover
Position Front right
Damages Scratched
Severity -
Repair mode Repair

11



Part Alloy wheel 18"
Position Front right
Damages Scratched
Severity -
Repair mode Lumpsum repair

12




Part Mudflap
Position Front right
Damages Missing
Severity -
Repair mode Replace

13



Part Spoiler
Position Front
Damages Broken
Severity Length (cm) > 10
Repair mode Repair

14

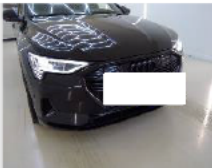

PartBumper

PositionFront

DamagesDent & Chips

Severity-

Repair modeRepair

Others

1



PartWireless charger

Position-

DamagesMissing

Severity-

Repair modeFor info