



Expertise

Protocol number: 46901169  
Order No. / Reference: 26758217  
Inspection date: 5 Aug 2026

Manufacturer: Opel

Model: Astra 1.5 D Start/Stop Sports Tourer Automatik Edition

VIN: W0VBD8EV2M8009716



| Vehicle details                                             |                   |
|-------------------------------------------------------------|-------------------|
| Manufacturer / Type / Model / Equipment                     |                   |
| Opel Astra 1.5 D Start/Stop Sports Tourer Automatik Edition |                   |
| Vehicle Identification number                               | W0VBD8EV2M8009716 |
| Mileage (Read)                                              | 87,571 km         |
| First registration                                          | 1 Apr 2021        |
| Number of holders                                           | 2                 |
| Next periodical technical inspection                        | 04/2028           |
| (Report on hand)                                            |                   |
| Fuel type                                                   | Diesel            |
| Engine displacement / Cylinder                              | 1,496 ccm / 3     |
| Power                                                       | 90 kW             |
| Gearbox / Number of gears                                   | Automatic / 9     |
| Type of drive                                               | Front drive       |
| Type of vehicle                                             | Station wagon     |
| Colour / colour code                                        | Schneeweiß        |
| Doors / Seats                                               | 5 / 5             |
| Upholstery type                                             | Cloth             |
| Colour of upholstery                                        | Black-Grey        |
| Re-import                                                   | no                |
| readiness to drive                                          | Roadworthy        |



## Vehicle details

|                                                  |                          |                                |                                                            |
|--------------------------------------------------|--------------------------|--------------------------------|------------------------------------------------------------|
| <b>Maintenance booklet / proof</b>               | digital proof / complete | <b>Next maintenance in</b>     | 54 %                                                       |
| <b>Last service on / at</b>                      | 02/2026 at 80,640 km     |                                |                                                            |
| <b>Key is / should be</b>                        | 2 / 2                    | <b>FZG documents</b>           | ZB#2 (B) was available (copy), ZB#1 (S) was not available. |
|                                                  |                          | <b>Letter No.</b>              | HL742446                                                   |
| <b>Previous damage / Accident</b>                | None detectable          | <b>Repainting</b>              | Detectable                                                 |
| <b>Inspection conditions</b>                     | sufficient               | <b>Lifting equipment / pit</b> | yes                                                        |
| <b>Test drive</b>                                | Not performed            | <b>Engine function test</b>    | Performed                                                  |
| <b>readiness to drive</b>                        | Roadworthy               |                                |                                                            |
| <b>Manufacturer key number/ type code number</b> | 1844 / ALM 00167         |                                |                                                            |
| <b>Emission standard</b>                         | EURO6                    | <b>fine dust sticker</b>       |                                                            |
| <b>Permitted total weight</b>                    | 1,980 kg                 | <b>Empty weight</b>            |                                                            |

## Tyres

### Mounted tyres

| #  | Tyre size      | Type of tyre                | Manufacturer | Tread depth |
|----|----------------|-----------------------------|--------------|-------------|
| 1) | 205/55 R16 91V | Summer tyres on Light alloy | Continental  | 4mm / 4mm   |
| 2) | 205/55 R16 91V | Summer tyres on Light alloy | Continental  | 4mm / 4mm   |

### Additional tyres

| #  | Tyre size      | Type of tyre          | Manufacturer                | Tread depth |
|----|----------------|-----------------------|-----------------------------|-------------|
| 1) | 205/55 R16 91H | Winter tyres on Steel | unterschiedliche Hersteller | 4mm / 7mm   |
| 2) | 205/55 R16 91H | Winter tyres on Steel | Continental                 | 6mm / 6mm   |

### Replacement

| Typ | Tyre size | Type of tyre            | Manufacturer | Tread depth |
|-----|-----------|-------------------------|--------------|-------------|
|     | Tirefit   | Expiration date 05/2029 |              |             |

**Legend:** Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



## Equipment

### Equipment

- Klimaanlage

### Standard equipment

- 2 ignition keys
- Airbag for driver and passenger side
- Airbag: Head airbags, 1st and 2nd row (outer seats)
- Anti-lock braking system (ABS)
- Electrically adjustable and heated exterior mirrors for driver and passenger side
- third brake light
- black roof rails
- Diesel particulate filter (DPF)
- Electronic Stability Program Plus (ESP Plus)
- Speed controller with limiter
- Back window, heater
- Interior lighting, front and rear
- Air conditioning
- trunk light
- Front headrests
- LED headlights
- Light alloy wheels 7 J x 16 in "5-twin-spoke" design
- Lighting equipment
- Pedals: Disengaging safety pedals
- Quickheat rapid heating system
- Radio: Multimedia radio with 7" touchscreen color display
- Tire pressure monitoring system
- Power steering
- Luggage compartment safety net
- Start/Stop System
- Traction Control (TC) Plus
- Immobiliser
- Central locking with remote control and interior switches

### Extra equipment

- Paintwork: Solid special color Snow White
- Electric parking brake
- Parkpilot, front and rear parking aid (with acoustic warning signal when parking forwards and backwards)
- Seats: Ergonomic active seat (certified by the Campaign for Healthy Backs (AGR) Driver's seat: - Length, height and tilt adjustable - Electropneumatic lumbar support adjustable in height and length - Extendable thigh support - Pocket on the back of the front seats, driver and front passenger)

- Storage compartments
- Airbag: Chest-pelvis side airbag for driver and front passenger side
- Automatic activation of the hazard warning lights
- Hill Start Assist
- On-board computer
- Roof design line, above in black
- Decorative trim strips Antelao Sand/Polar Silver
- Tachometer
- Electric windows front and rear
- Transmission: 9-speed automatic transmission
- rear window wiper
- Instruments, black, with high-gloss chrome rings, 3.5" driver information display
- Rear headrests (3)
- Cargo area cover
- LED daytime running lights
- Steering column, height and reach adjustable
- Sliding center armrest, front
- Upholstery: Cloth
- Radio: Digital radio reception DAB/DAB+/DMB-R
- Tire repair kit
- Rear seat backrest folds forward in a 60:40 split
- Seat belts: Three-point seat belts in all seats
- Visibility equipment
- 12V power outlet in the center console
- Pre-installation for child seat mounting system "ISOFIX"
- Heat-insulating glazing, green tinted, and windshield

- Steering wheel: Heated leather steering wheel and seat heating, multi-stage, driver and front passenger (including rear footwell heating)
- Radio: Multimedia Navi Pro with 8" color touchscreen display (Edition) (Multimedia radio with voice control for audio, telephone, and navigation. Navigation system with SD card storage. Road map for over 30 European countries. Map display in 2D and 3D. Dynamic route guidance via map and/or arrow display and voice prompts. Dynamic destination guidance via extended TMCpro. Connected Nav service. Predictive navigation (recognition of preferred destinations). Online map updates. Real-time traffic information. Parking information. Digital 8" driver information display, selectable Sport or Tour mode and customizable theme selection.)



## Brief expert findings

|                      |                                                                                                                                                                              |
|----------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| Documents submitted  | At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy) |
| VIN comparison       | The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.    |
| Inspection           | The inspection conditions were sufficient for the assessment of the vehicle.<br>Lifting equipment and/or a pit were available for examining the vehicle.                     |
| Test drive           | No test drive/shunting maneuver was carried out during the inspection of the vehicle.                                                                                        |
| Engine function test | An engine test run was performed.                                                                                                                                            |
| readiness to drive   | The vehicle was roadworthy at the time of inspection.                                                                                                                        |

## Value reducing factors

| No. | Component group              | Description                                                                    |
|-----|------------------------------|--------------------------------------------------------------------------------|
| 1   | Body                         | Body - Glued / labelled - De-glue / neutralise                                 |
| 2   | Side panel - rear right side | Side panel - dent(s) - Smooth repair work                                      |
| 3   | Door - rear right side       | Door edge - Scratch(es) - Smart repair                                         |
| 4   | Sill - left side             | Sill - Scratch(es) - Smart repair                                              |
| 5   | Boot lid / rear door         | Boot lid - dent(s) - Smooth repair work                                        |
| 6   | Sill - right side            | Sill - dent(s) - Repair and paint                                              |
| 7   | Mudguard - left side         | Mudguard - left side (Delle auf der Kante) - dent(s) - Repair and paint        |
| 8   | Rear bumper                  | Rear bumper - Scratched - Paint                                                |
| 9   | Front bumper                 | Front bumper (Inklusive Steinschläge) - Scratched - Paint                      |
| 10  | Door - rear left side        | Door - Scratched - Paint                                                       |
| 11  | Vehicle glazing              | Windscreen (viele kleine Steinschläge im Sichtbereich) - Stone chips - Replace |

## Repainting

### No. Repainting

|   |                                                                                                                                                                      |
|---|----------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| 1 | Roof rail - right side, Bonnet, Side panel - rear left side, Side panel - rear right side, Door - rear left side, Door - rear right side, Professionally carried out |
|---|----------------------------------------------------------------------------------------------------------------------------------------------------------------------|

## Paint coat thickness measurement

|                             |        |                              |        |
|-----------------------------|--------|------------------------------|--------|
| Roof rail - right side      | 216 µm | Bonnet                       | 202 µm |
| Side panel - rear left side | 298 µm | Side panel - rear right side | 298 µm |
| Door - rear left side       | 209 µm | Door - rear right side       | 201 µm |

## Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features  
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.  
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle



## Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

## Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

## Comments

- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.





**Figure 1:** Diagonal front (left)



**Figure 2:** Diagonal front (right)



**Figure 3:** Diagonal rear (left)



**Figure 4:** Diagonal rear (right)



**Figure 5:** Interior - front



**Figure 6:** Interior - rear





Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

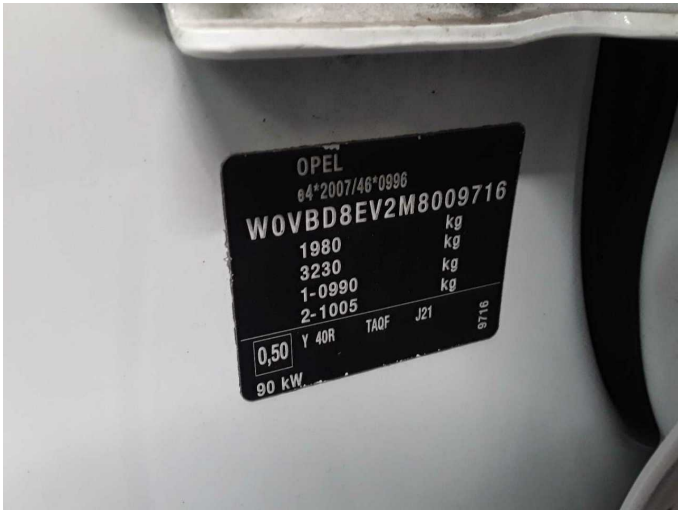


Figure 11: VIN



Figure 12: Mounted tyres



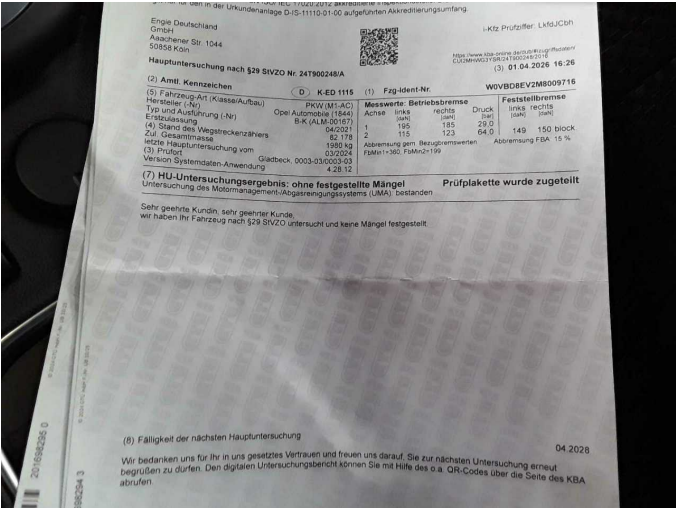


Figure 13: Documents



Figure 14: Documents



Figure 15: Additional tyres



Figure 16: Additional tyres

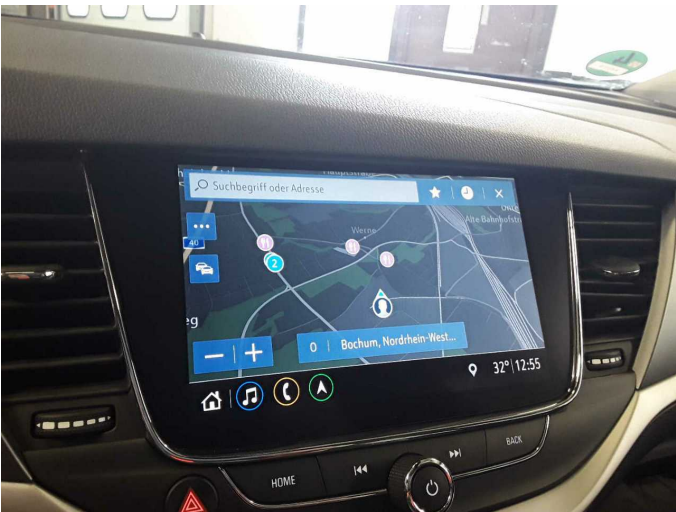


Figure 17: Navigation



Figure 18: Misc.





Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.

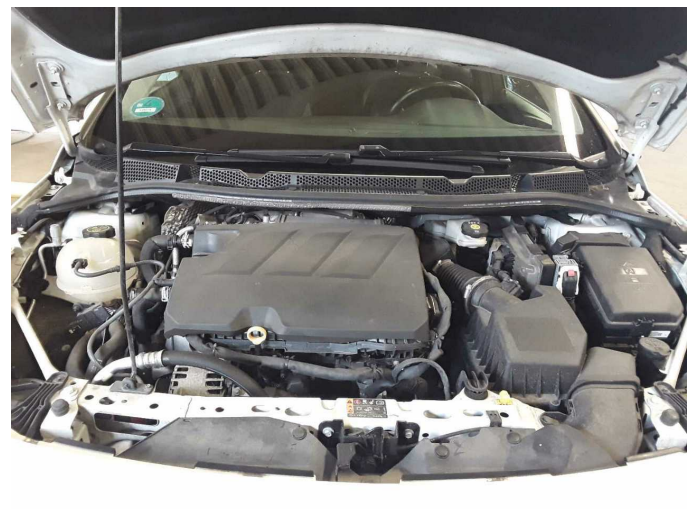


Figure 24: Misc.





Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.




Figure 29: Misc.




Figure 30: Misc.



**Damage 1:** Body: Body - Glued / labelled - De-glue / neutralise

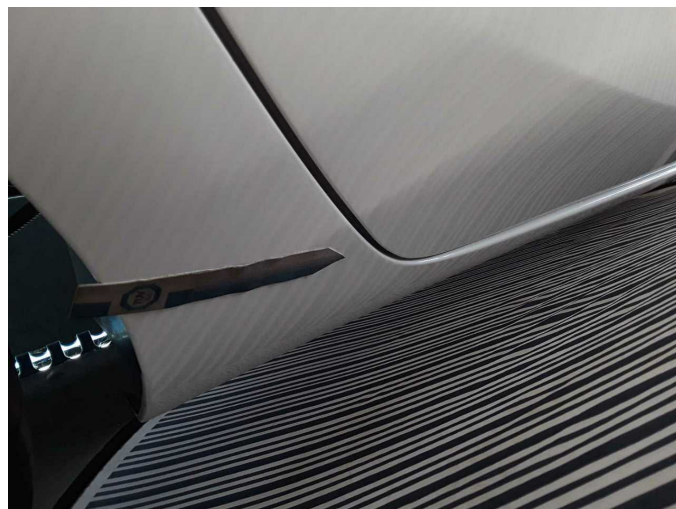

**Damage 2:** Side panel - rear right side: Side panel - dent(s) - Smooth repair work

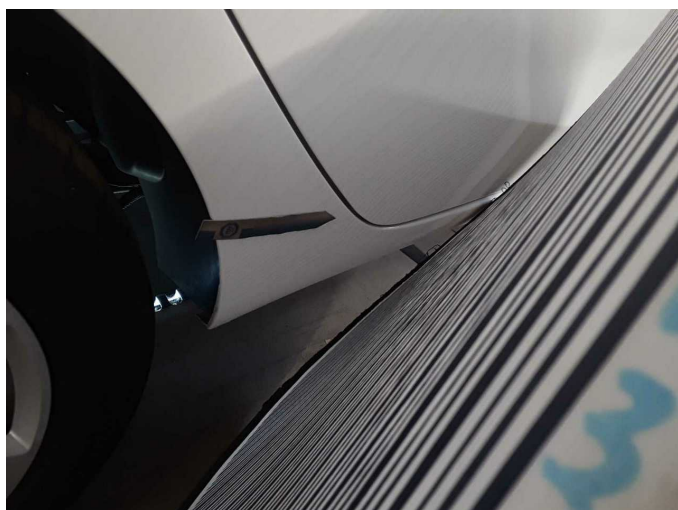

**Damage 2:** Side panel - rear right side: Side panel - dent(s) - Smooth repair work



**Damage 3:** Door - rear right side: Door edge - Scratch(es) - Smart repair



**Damage 3:** Door - rear right side: Door edge - Scratch(es) - Smart repair



**Damage 4:** Sill - left side: Sill - Scratch(es) - Smart repair






**Damage 4:** Sill - left side: Sill - Scratch(es) - Smart repair



**Damage 5:** Boot lid / rear door: Boot lid - dent(s) - Smooth repair work

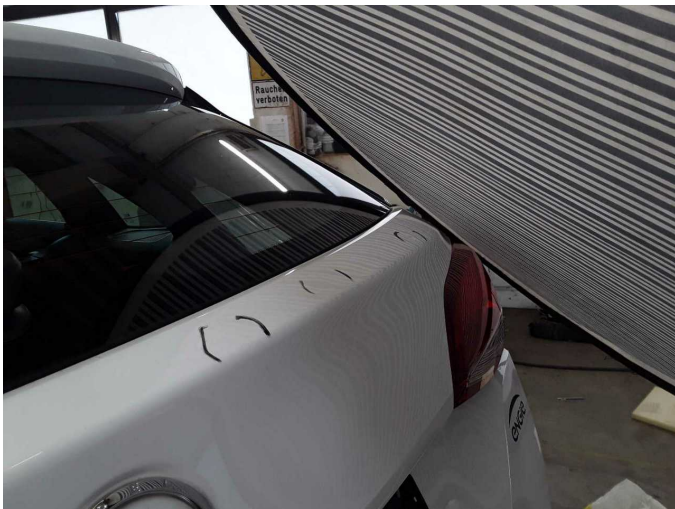

**Damage 5:** Boot lid / rear door: Boot lid - dent(s) - Smooth repair work



**Damage 5:** Boot lid / rear door: Boot lid - dent(s) - Smooth repair work



**Damage 6:** Sill - right side: Sill - dent(s) - Repair and paint



**Damage 6:** Sill - right side: Sill - dent(s) - Repair and paint




**Damage 7:** Mudguard - left side: Mudguard - left side (Delle auf der Kante) - dent(s) - Repair and paint



**Damage 7:** Mudguard - left side: Mudguard - left side (Delle auf der Kante) - dent(s) - Repair and paint




**Damage 7:** Mudguard - left side: Mudguard - left side (Delle auf der Kante) - dent(s) - Repair and paint

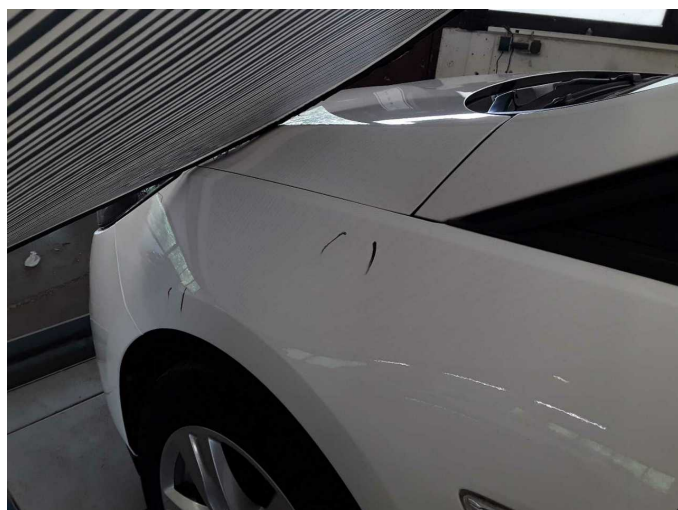

**Damage 7:** Mudguard - left side: Mudguard - left side (Delle auf der Kante) - dent(s) - Repair and paint



**Damage 8:** Rear bumper: Rear bumper - Scratched - Paint

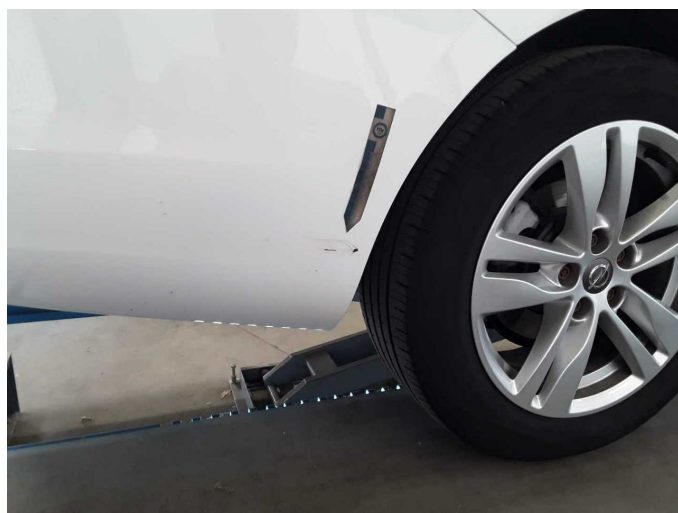


**Damage 8:** Rear bumper: Rear bumper - Scratched - Paint





**Damage 9:** Front bumper: Front bumper (Inklusive Steinschläge) - Scratched - Paint

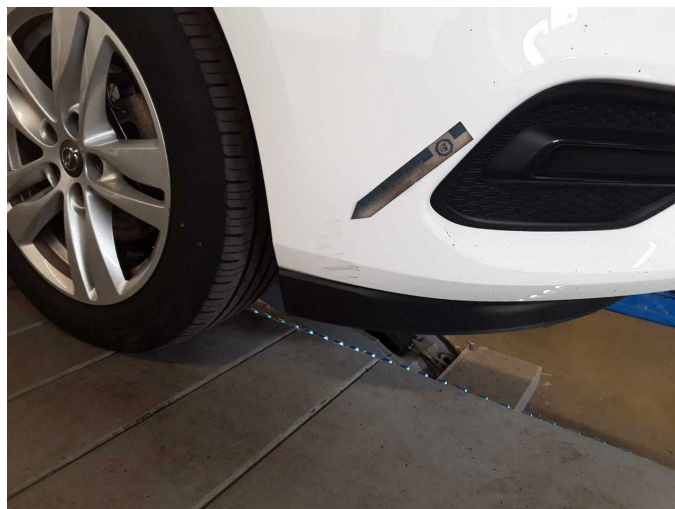

**Damage 9:** Front bumper: Front bumper (Inklusive Steinschläge) - Scratched - Paint



**Damage 9:** Front bumper: Front bumper (Inklusive Steinschläge) - Scratched - Paint



**Damage 9:** Front bumper: Front bumper (Inklusive Steinschläge) - Scratched - Paint



**Damage 10:** Door - rear left side: Door - Scratched - Paint



**Damage 10:** Door - rear left side: Door - Scratched - Paint






**Damage 11:** Vehicle glazing: Windscreen (viele kleine Steinschläge im Sichtbereich) - Stone chips - Replace



**Damage 11:** Vehicle glazing: Windscreen (viele kleine Steinschläge im Sichtbereich) - Stone chips - Replace

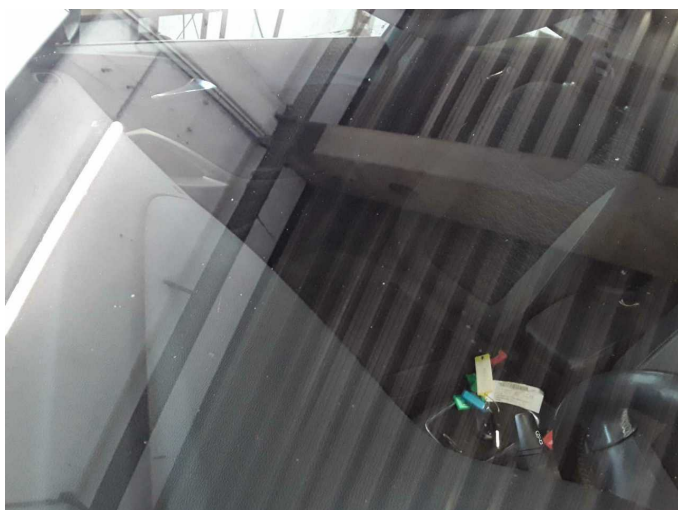

**Damage 11:** Vehicle glazing: Windscreen (viele kleine Steinschläge im Sichtbereich) - Stone chips - Replace




**Roof rail - right side:** 216 µm



**Bonnet:** 202 µm



**Side panel - rear left side:** 298 µm

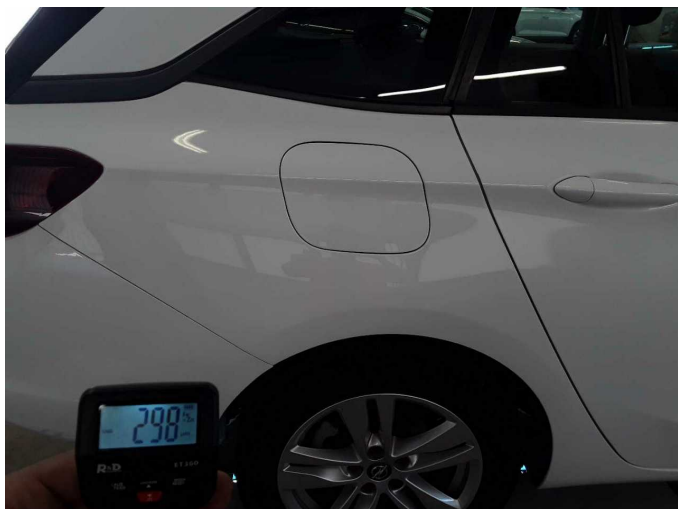

**Side panel - rear right side: 298 µm**



**Door - rear left side: 209 µm**



**Door - rear right side: 201 µm**





# Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W0VBD8EV2M8009716

Hersteller / Modell: OPEL OPEL Astra 1.5 D Start/Stop Sports Tourer Automatik Edition

| Datum      | KM-Stand | Beschreibung                                                                                                                                                     |
|------------|----------|------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| 17.02.2026 | 80.640   | Bremse Sonstiges; Bremsscheiben + Klötze h; Bremsscheiben hinten; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges                       |
| 18.02.2025 | 62.134   | Bremse Sonstiges; Bremsscheiben + Klötze v; Bremsscheiben vorne; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges |
| 18.06.2024 | 46.200   | Systemtest/Eigendiagnose                                                                                                                                         |
| 25.03.2024 | 43.472   | HU + AU                                                                                                                                                          |
| 12.12.2023 | 38.200   | Bremsflüssigkeit; Bremsflüssigkeit ern; Kraftstofffilter ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges                           |
| 22.12.2022 | 24.812   | Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges                                                                                                   |
| 19.04.2022 | 17.711   | Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges                                                                                         |