TÜV SÜD Auto Partner GmbH
Gutenbergstraße 13
70771 Leinfelden-Echterdingen

Inspection location
ARS Altmann AG Automobillogistik
Römerstraße 3
64560 Riedstadt

Expertise

Protocol number: 48389300
Order No. / Reference: 27241505
Inspection date: 26 Oct 2026

Manufacturer: Mercedes-Benz	Model: GLC-Coupe 400 d 4Matic 9G-TRONIC AMG Line Plus
VIN: W1N0J2DB1PG155476	





Vehicle details

Manufacturer / Type / Model / Equipment	
Mercedes-Benz GLC-Coupe 400 d 4Matic 9G-TRONIC AMG Line Plus	
Vehicle Identification number	W1N0J2DB1PG155476
Mileage (Read)	82,139 km
First registration	11 Apr 2023
Number of holders	1
Next periodical technical inspection	04/2028
(Report on hand)	
Fuel type	Diesel
Engine displacement / Cylinder	2,925 ccm / 6
Power	243 kW
Gearbox / Number of gears	Automatic / 9
Type of drive	All-wheel drive
Type of vehicle	SUV
Colour / colour code	Schwarz
Doors / Seats	5 / 5
Upholstery type	Artificial leather
Colour of upholstery	Black-Red

Vehicle details

Maintenance booklet / proof	digital proof / complete	**Next maintenance in**	96 Tag(e)
Last service on / at	01/2026 at 68,494 km		
Key is / should be	2 / 2	**FZG documents**	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GQ146738
Previous damage / Accident	None detectable	**Repainting**	None detectable
Inspection conditions	sufficient	**Lifting equipment / pit**	No
Test drive	Not performed	**Engine function test**	Performed
Manufacturer key number/ type code number	2222 / AKS 00091		
Emission standard	EURO6	**fine dust sticker**	
Permitted total weight	2,585 kg	**Empty weight**	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	255/45 R20 105Y	Summer tyres on Light alloy	Michelin	6mm / 6mm
2)	285/40 R20 108Y	Summer tyres on Light alloy	Michelin	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/60 R18 107H	Winter tyres on Light alloy	Goodyear	7mm / 7mm
2)	235/60 R18 107H	Winter tyres on Light alloy	Goodyear	7mm / 7mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Storage compartments
- Airbag: Kneebag for driver
- Airbag: Windowbags
- 4MATIC all-wheel drive
- Anti-lock braking system (ABS)
- ATTENTION ASSIST
- Heated exterior mirrors (left and right), electrically adjustable from inside
- Tachometer
- DYNAMIC SELECT
- EASY-Pack cargo cover (removable)
- Electronic Stability Program (ESP)
- Electric windows (4-way)
- Black floor mats with AMG lettering
- Rear window heated
- Instrument panel and door sills in ARTICO man-made leather
- Instrument cluster with 2 tubular round instruments, 13.97 cm (5.5") large multifunction display
- Headrests 5-way
- Fuel tank with larger volume 66 l
- LED High Performance Headlights
- Steering wheel: Multifunction sports steering wheel in Nappa leather/ DINAMICA microfiber
- Mercedes-Benz emergency call system
- Navigation accessories: Extended MBUX functions
- Package: AMG Line Plus exterior
- Package: Interior light
- Upholstery: ARTICO leatherette/DINAMICA microfiber, black with red contrast stitching
- Radio accessories: Touchpad
- Remote Services Plus
- Windscreen wipers with rain sensor
- Seat: Front sports seats
- Seats: i-Size child restraint system on the outer rear seats
- Cruise control
- High-visibility vest for drivers
- Heat and sound insulating acoustic glass
- Decorative elements: AMG aluminum with dark longitudinal grain/ open-pore black ash wood
- Airbag for driver and front passenger
- Airbag: Side airbag for driver and front passenger
- Active Brake Assist
- AMG pedal assembly made of brushed stainless steel with rubber studs
- Automatic passenger airbag deactivation
- On-board computer
- Diesel particulate filter
- Third brake light in LED technology
- EASY-Pack tailgate with electric operation for opening and closing
- Driving light assistant
- electric parking brake
- Transmission: 9G-TRONIC
- Black fabric headliner
- KEYLESS-GO start function
- Climate: THERMATIC automatic climate control with 2 climate zones
- Communication module (LTE) for the use of Mercedes me connect services
- Paint finish: Solid
- Steering wheel: Multifunction sports steering wheel in 3-spoke design in black Nappa leather
- Steering column mechanically adjustable in height and length
- Package: Storage
- Package: Chrome
- Package: Night for AMG Line Plus Exterior
- Radio accessories: Digital radio
- Radio accessories: Remote Online
- Tire pressure monitoring system (TPMS)
- Rear view camera
- designo safety belts in red
- Seats: Rear seat backrests foldable
- Seats: Front seats electrically adjustable
- Pre-installation for roof rack systems
- Immobiliser
- Central locking

Extra equipment

- Ambient lighting (Design the interior according to your personal preference or current mood. With a total of 64 colors, the ambient lighting offers almost unlimited possibilities for lighting design and has the right color for every situation. Illuminated door sills on the driver and passenger sides.)
- Chassis: AIR BODY CONTROL air suspension (with continuously adjustable damping)
- KEYLESS-GO
- Package: Business (Advanced Parking Package: Active Parking Assist PARKTRONIC with reversing camera; Advanced Infotainment Package: Media display with touch operation, smartphone integration - Apple CarPlay and Android Auto, connectivity package navigation, traffic sign assist; Comfort Package: Heated seats for driver and front passenger, seat comfort package - electric and manual adjustment options for the front seats; larger fuel tank capacity)
- Package: High End Park (Parking package with 360° camera, Active Parking Assist with PARKTRONIC)
- Radio accessories: Advanced sound system (4 midrange speakers - 2 tweeters - 2 front bass speakers - 1 center speaker - 225 W amplifier power)
- Towbar with ESP trailer stabilization (fully electrically foldable and retractable)
- Wheels: Winter complete wheels M+S 4-way 45.7 cm (18") light alloy wheels in 5-twin-spoke design (45.7 cm (18") light alloy wheels in 5-twin-spoke design, Himalayan grey matt painted and polished with 235/60 R 18 on 8.0 J x 18 ET 38)
- Auxiliary heating including auxiliary ventilation in summer
- Multifunction telephony 899
- Package: High End Assistance (Mirror package: Electrically folding exterior mirrors, lowering right exterior mirror, automatic dimming function; Driving assistance package: Active Distance Assist DISTRONIC, Active Steering Assist, Active Brake Assist, Evasive Steering Assist, Active Lane Keeping Assist, Active Blind Spot Assist, PRE-SAFE PLUS)
- Package: High-end infotainment (Media display with touch controls, smartphone integration: Apple CarPlay and Android Auto, connectivity package, navigation, traffic sign assistant: thanks to intelligent linking of camera and map data, it can recognize not only speed limits, no-overtaking zones and their cancellation, but also fully digital instrument display, wireless charging system for mobile devices in the storage compartment)
- Trailer Maneuvering Assist (Trailer Maneuvering Assist can only be activated when the vehicle is stationary and only up to a maximum gradient of 15% a. The speed in trailer manoeuvring mode is limited to 5 km/h. The articulation angle protection is only active during assisted reversing. For trailers with a stabilizing system to prevent swaying, the trailer or the towing device may be damaged if a trailer coupling with Trailer Maneuvering Assist is used.)
- URBAN GUARD Vehicle Protection Plus (The URBAN GUARD Vehicle Protection package offers comprehensive monitoring. It includes an anti-theft alarm system and tow-away protection that can detect changes in position. Movements inside the vehicle also trigger visual and audible warnings. Locating stolen vehicles increases the chances of recovering your property.)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Wear and tear

No.	Component group	Description
1	Front bumper	Front bumper - Stone chips - No deduction
2	Bonnet	Bonnet - Stone chips - No deduction
3	Vehicle glazing	Windscreen - Stone chips - No deduction
4	Interior	Interior - Soiled - No deduction
5	Rear bumper	Rear bumper - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

TÜV SÜD Auto Partner GmbH
Gutenbergstraße 13
70771 Leinfelden-Echterdingen

Inspection location
ARS Altmann AG Automobillogistik
Römerstraße 3
64560 Riedstadt

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
  (Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
  (Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

- Die Unterbodenbesichtigung war nur ebenerdig & eingeschränkt möglich. Mehrkosten sind möglich.

TÜV SÜD Auto Partner GmbH
Gutenbergstraße 13
70771 Leinfelden-Echterdingen

Inspection location
ARS Altmann AG Automobillogistik
Römerstraße 3
64560 Riedstadt



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Cargo area



Figure 10: VIN



Figure 11: Mounted tyres

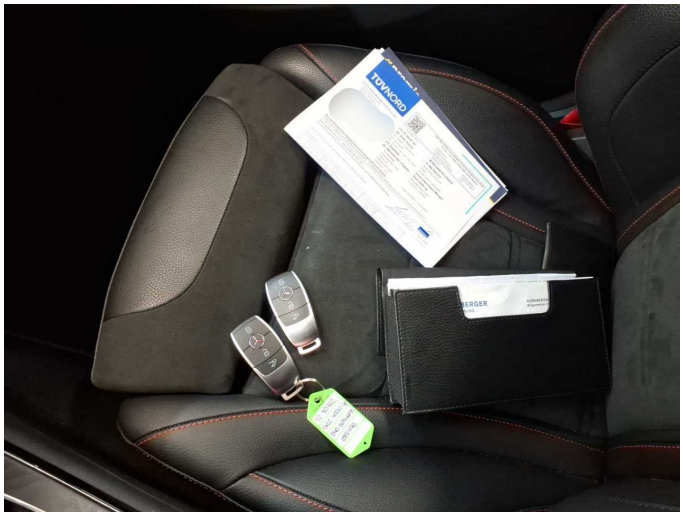


Figure 12: Documents

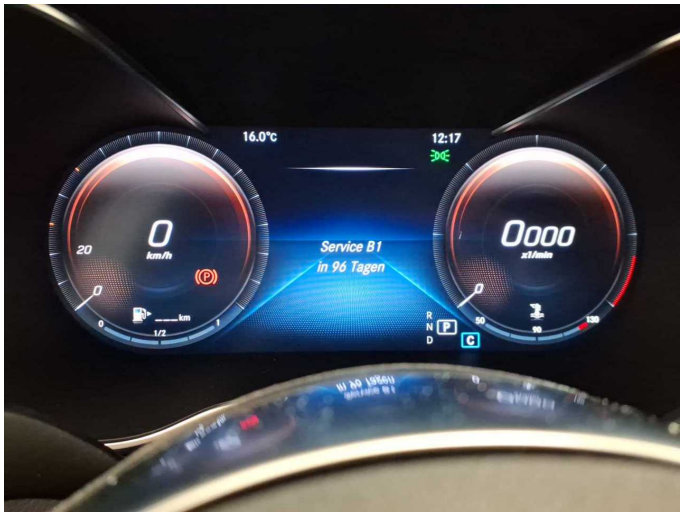


Figure 13: Documents

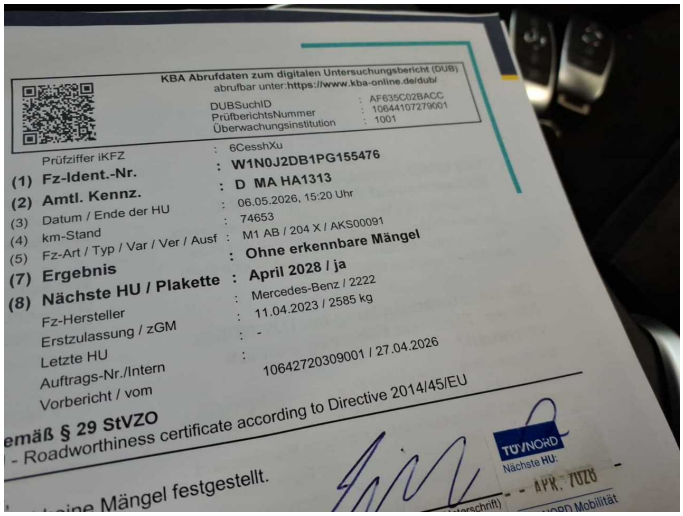


Figure 14: Documents



Figure 15: Additional tyres



Figure 16: Navigation



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.

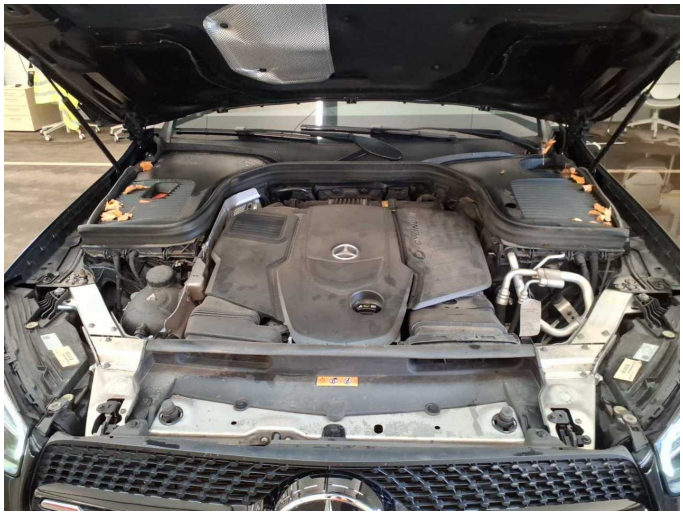


Figure 22: Misc.

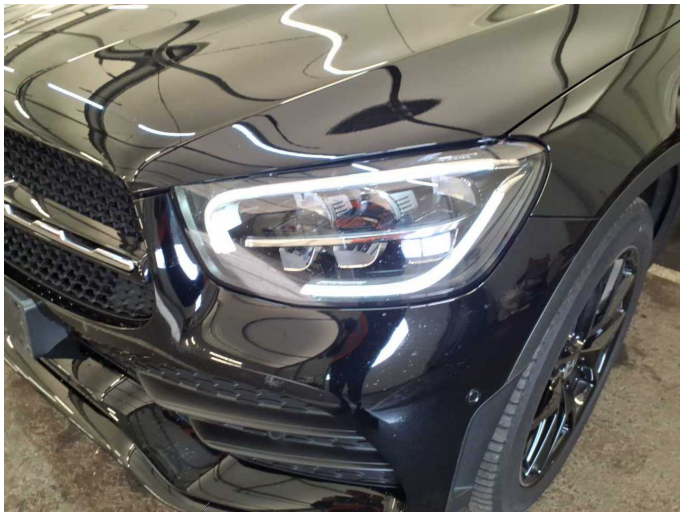


Figure 23: Misc.

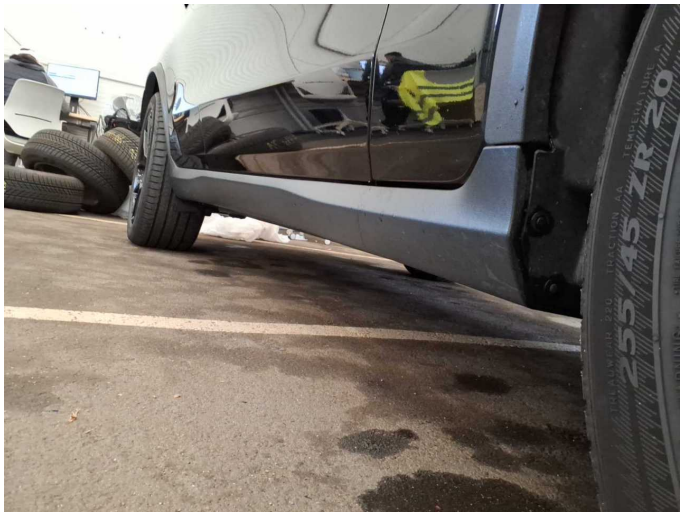


Figure 24: Misc.

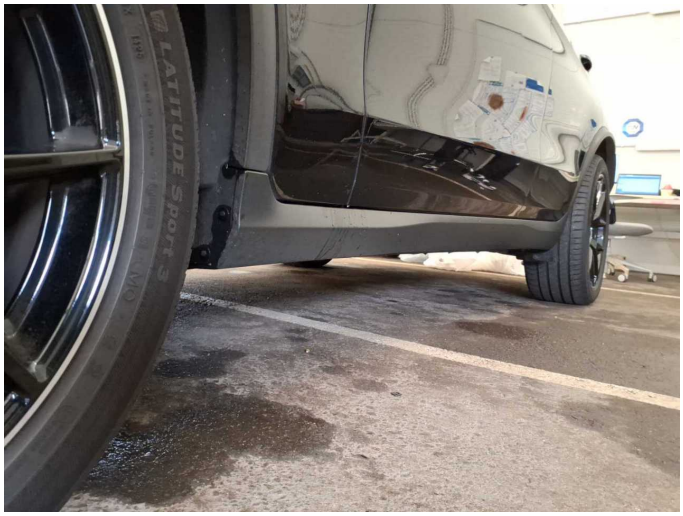


Figure 25: Misc.



Figure 26: Misc.