



Expertise

Protocol number: 46382511
Order No. / Reference: 26553685
Inspection date: 7 Jul 2026

Manufacturer: Volkswagen

Model: Tiguan 2.0 TDI SCR 4MOTION DSG Life

VIN: WVGZZZ5NZNW033652



Vehicle details

Manufacturer / Type / Model / Equipment

Volkswagen Tiguan 2.0 TDI SCR 4MOTION DSG Life

Vehicle Identification number WVGZZZ5NZNW033652
Mileage (Read) 64,998 km
First registration 13 Apr 2022
Number of holders 1
Next periodical technical inspection 05/2027
(Report not on hand)

Power / Engine displacement 110 kw / 1,968 ccm
Fuel type / Cylinder Diesel / 4
Gearbox / Number of gears Automatic / 7
Type of drive All-wheel drive
Type of vehicle SUV

Colour / colour code Nightshade Blue Metallic (P5J)
Doors / Seats 5 / 5
Upholstery type Cloth
Colour of upholstery Anthracite-Black



Vehicle details			
Maintenance booklet / proof	digital proof / complete	Next maintenance in	24,000 km
Last service on / at	03/2026 at 62,055 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GJ038360
Previous damage / Accident	Detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	0603 / BZI 05740		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,260 kg	Empty weight	

Tyres				
Mounted tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/55 R18 100V	Summer tires (with run-flat tires) on Light alloy	Pirelli	4mm / 4mm
2)	235/55 R18 100V	Summer tires (with run-flat tires) on Light alloy	Pirelli	6mm / 6mm
Additional tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/55 R18 104H	Winter tyres on Light alloy	Bridgestone	4mm / 4mm
2)	235/55 R18 104H	Winter tyres on Light alloy	Bridgestone	6mm / 6mm
Replacement				
Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 01/2025		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- Airbag for driver and front passenger including knee airbag on the driver's side
- Permanent 4MOTION all-wheel drive
- Electrically adjustable and heated exterior mirrors
- third brake light
- Diesel particulate filter
- Parking assistance
- Electronic Stability Program with counter-steering support
- Driving profile selection
- Electric windows front and rear
- Windscreen made of laminated safety glass, heat and sound insulating
- Rear window heated
- Interior mirror automatically dimming
- LED license plate lighting
- Combination instrument cluster with electronic speedometer
- LED reading lights, 2 in the front and 2 in the rear
- Steering wheel: Multifunction steering wheel in leather, with paddle shifters
- front center armrest
- Fatigue detection
- Emergency call service
- Radio "Composition"
- Rain sensor
- Wheels: AirStop tires 235/55 R 18, rolling resistance class A
- Drawers under the front seats
- Seat belts: Three-point automatic seat belts at the front with height adjustment and belt tensioner
- Seats: Comfort seats in the front
- Seats: Rear bench seat asymmetrically split
- Lane keeping assistant "Lane Assist"
- 12-volt socket
- Textile floor mats front and rear
- Electronic immobilizer
- Central locking without safe locking, with remote control and 2 remote keys
- Airbag: Head airbag system for front and rear passengers including front side airbags
- Adaptive Cruise Control (ACC) (DSG)
- Hill descent control
- black roof rails
- Tachometer
- Electronic parking brake including auto-hold function
- Automatic headlight control, with LED daytime running lights
- High beam control Light Assist
- Pedestrian detection
- Transmission: 7-speed DSG
- rear window wiper
- ISOFIX mounting points, also for i-Size child car seats
- Air conditioning system "Air Care Climatronic"
- Rear headrests (3)
- Front headrests
- LED headlights with LED daytime running lights
- Light in the front footwell
- Manual headlight range adjustment
- Multifunction display "Premium"
- Non-smoking version
- Upholstery: Cloth
- Radio accessories: 8 speakers
- Tire pressure monitoring system
- Wheels: Light alloy (4) "Frankfurt" 7 J x 18
- Gearshift knob in leather
- electromechanical power steering
- Seats: Front passenger seat backrest folds down completely
- Seats: Lumbar support in the front
- Seats: Front seats with height adjustment
- Start-stop system with brake energy recuperation
- Power outlet: 2 USB-C ports on the front
- First aid kit, warning triangle and high-visibility vest
- Green thermal insulation glazing, sides and rear



Extra equipment

- Trailer maneuvering assistant "Trailer Assist" including parking assist "Park Assist" and parking aid
- Chassis: Adaptive chassis control DCC (including driving profile selection)
- Paint finish: Metallic
- Navigation system "Discover Media" incl. "Streaming & Internet" (20.3 cm TFT touchscreen - FM radio reception - Dual tuner with phase diversity for best possible radio reception - Radio Data System (RDS) - Radio station logos - MP3 playback - USB-C interface with Apple compatibility - 4 x 20 watt output power - Map with 2D display - 3-band sound control - Telephone interface - Traffic sign recognition - Points of interest - DAB+ digital radio reception)
- Package: Chrome package (chrome trim on the side windows - silver anodized roof rails)
- Progressive steering
- Tire pressure monitoring system
- Wheels: Light alloy (4) "Nice" 7 J x 18 AirStop tires 235/55 R 18 (in black, surface polished - Airstop tires 235/55 R 18 - wheel locks with enhanced theft protection)
- Rear View reversing camera
- Electrically adjustable, folding, and heated exterior mirrors, ambient lighting, passenger-side mirror lowering function
- Tailgate with electric opening and closing, adjustable opening angle
- LED matrix headlights (LED matrix headlights with LED daytime running lights and cornering lights - dynamic headlight range control, with dynamic cornering lights - bad weather lights and turning lights)
- Package: Business Premium (DSG) (App-Connect incl. App-Connect Wireless for Apple CarPlay and Android Auto - Leather multifunction steering wheel, heated, with shift paddles - Automatically heated front windscreen washer nozzles - Voice control - "Comfort" telephone interface with inductive charging function - Heated front seats)
- Package: Driver assistance package "Plus" (Driving assistant "Travel Assist", lane keeping assistant "Lane Assist" and "Emergency Assist" - parking steering assistant "Park Assist" incl. parking aid - proactive occupant protection system in conjunction with "Front Assist" - lane change assistant "Side Assist" and parking assistant - traffic sign recognition)
- Windows: Rear side windows and rear window tinted

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Equipment	Tirefit filler - Expired - Replace
2	Side panel - rear right side	Sill - dent(s) - Smooth repair work
3	Sill - left side	Sill - dent(s) - Smooth repair work
4	Side panel - rear left side	Sill - Scratch(es) - Smart repair
5	Door - rear left side	Door - Dent / paintcoat damage - Smart repair
6	Door - rear right side	Door - Dent / paintcoat damage - Smart repair
7	Door - front left side	Door - Dent / paintcoat damage - Smart repair
8	Door - rear left side	Brightware - lower - Scratch(es) - Replace
9	Vehicle glazing	Rear window - Scratch(es) - Replace



Wear and tear

No.	Component group	Description
1	Bonnet	Bonnet - Stone chips - No deduction
2	Side panel - rear left side	Side panel - dent(s) - Smooth repair work

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Rear, Provided by user / customer, from 22 May 2025	922,30 €

Paint coat thickness measurement

Roof	100 µm	Roof rail - left side	102 µm
Roof rail - right side	99 µm	Boot lid / rear door	107 µm
Mudguard - left side	116 µm	Mudguard - right side	111 µm
Bonnet	121 µm	Side panel - rear left side	106 µm
Side panel - rear right side	91 µm	Door - rear left side	115 µm
Door - rear right side	130 µm	Door - front left side	109 µm
Door - front right side	123 µm		

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.



Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel

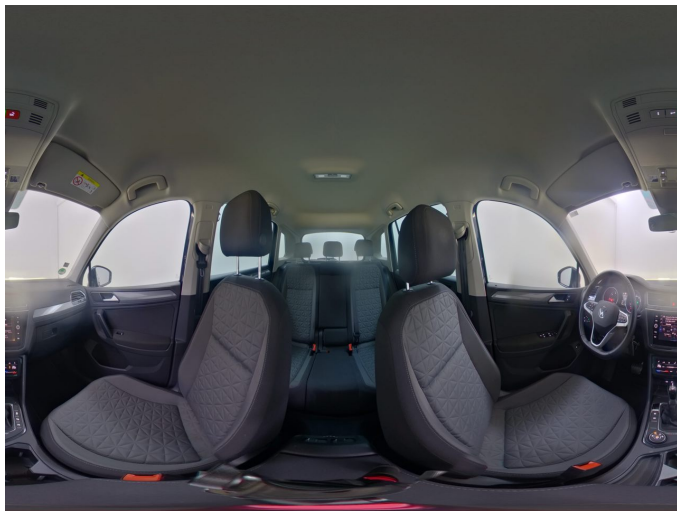


Figure 9: Interior 360° view



Figure 10: Cargo area

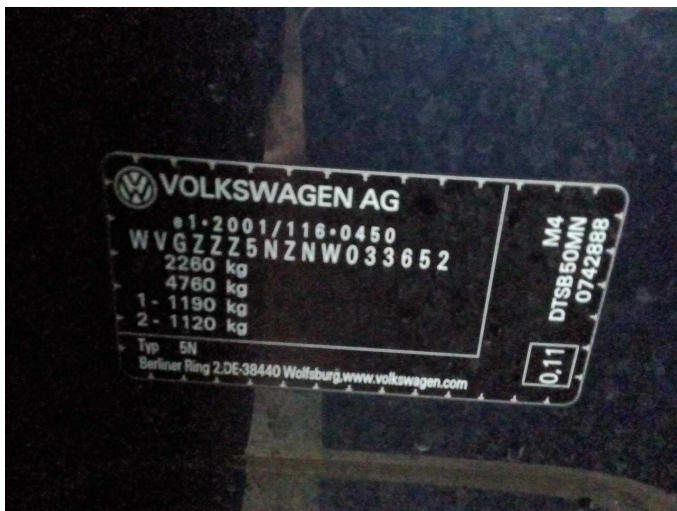


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

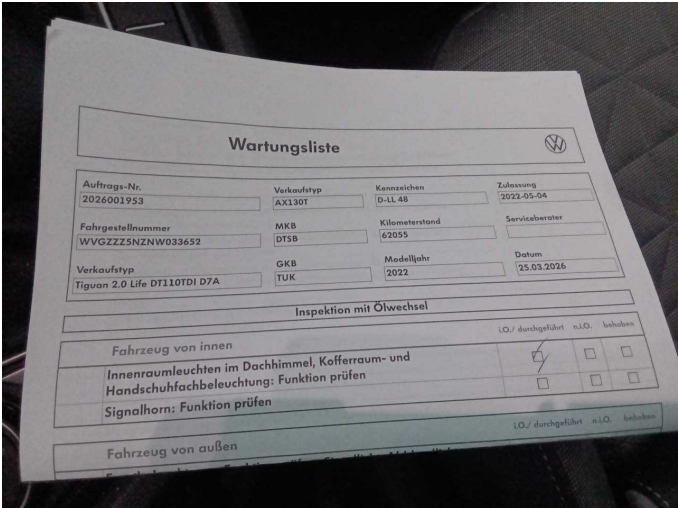


Figure 14: Documents



Figure 15: Additional tyres

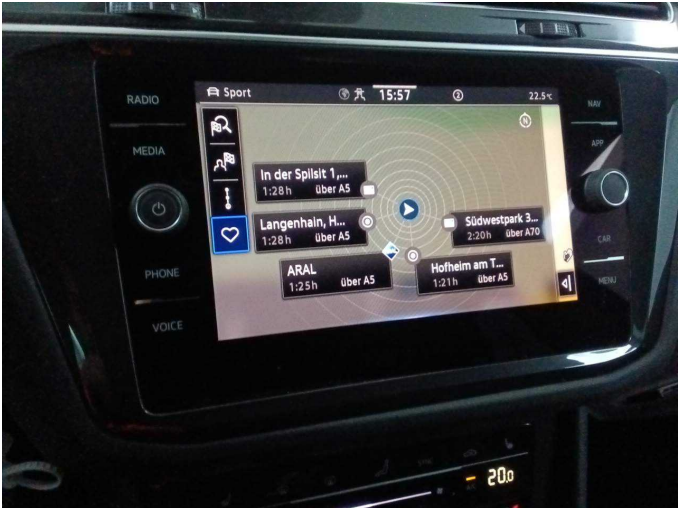


Figure 16: Navigation

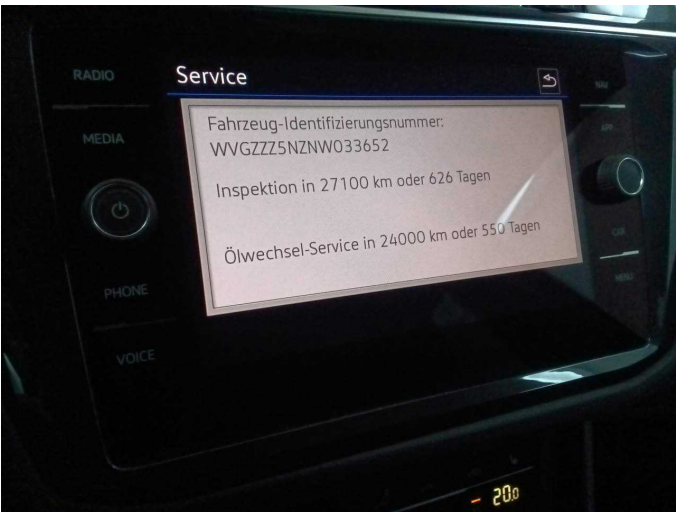


Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.

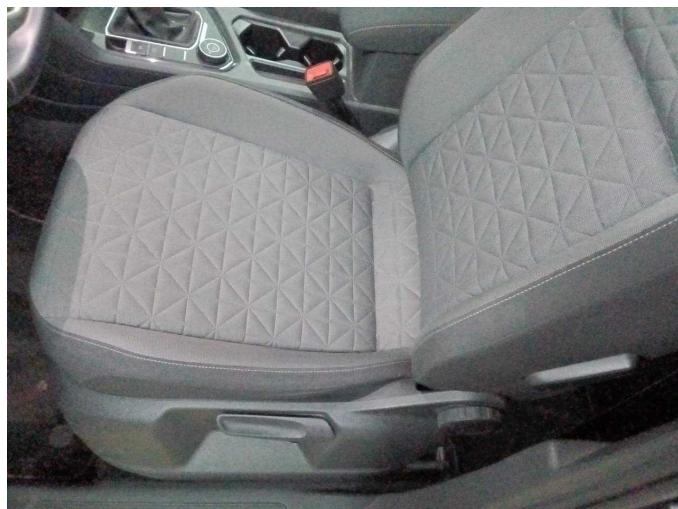


Figure 20: Misc.

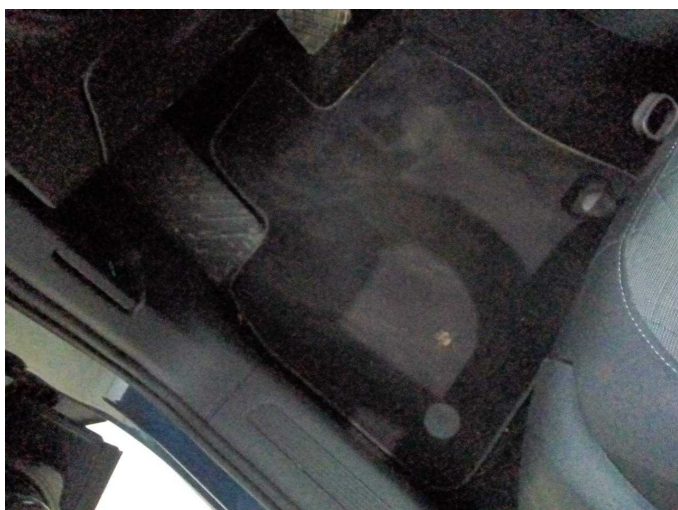


Figure 21: Misc.



Figure 22: Misc.

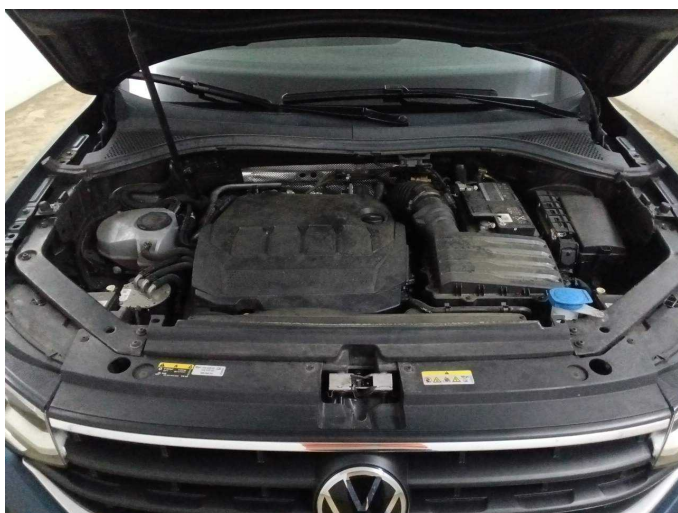


Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.

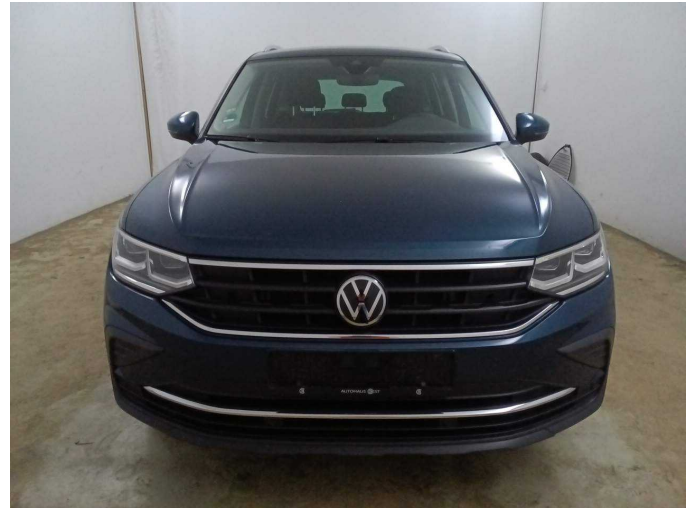


Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.

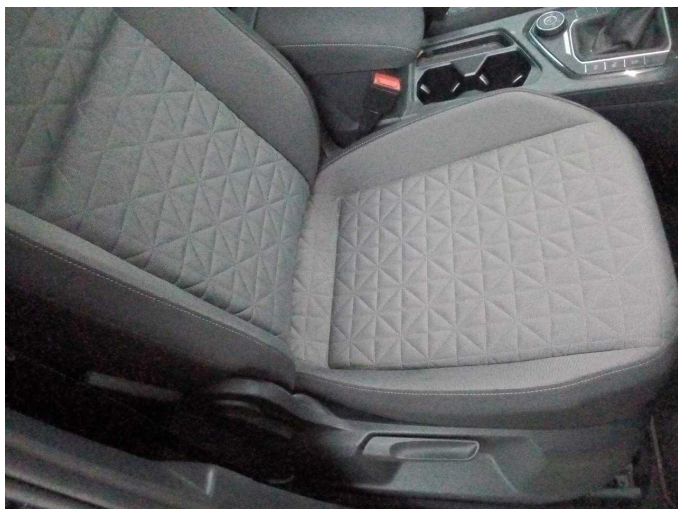


Figure 31: Misc.

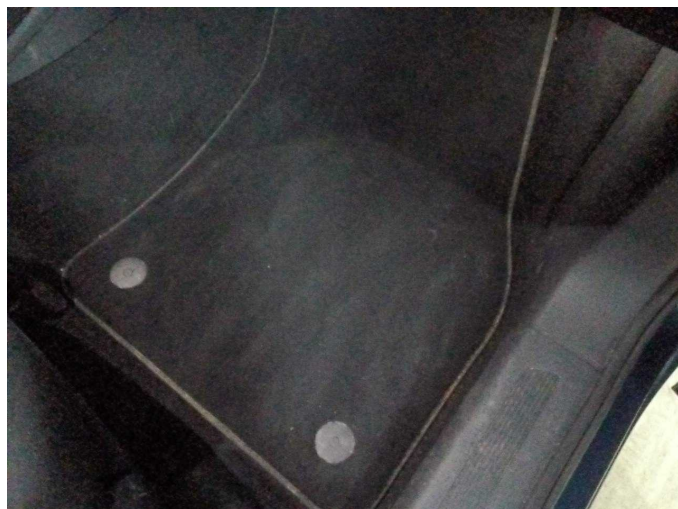


Figure 32: Misc.

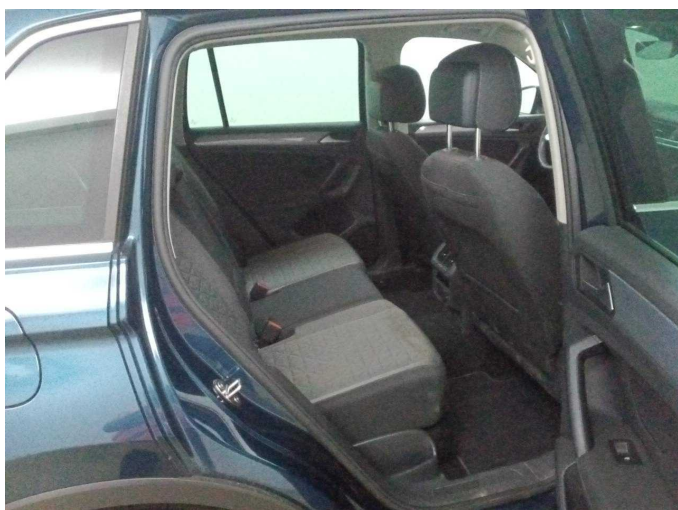


Figure 33: Misc.

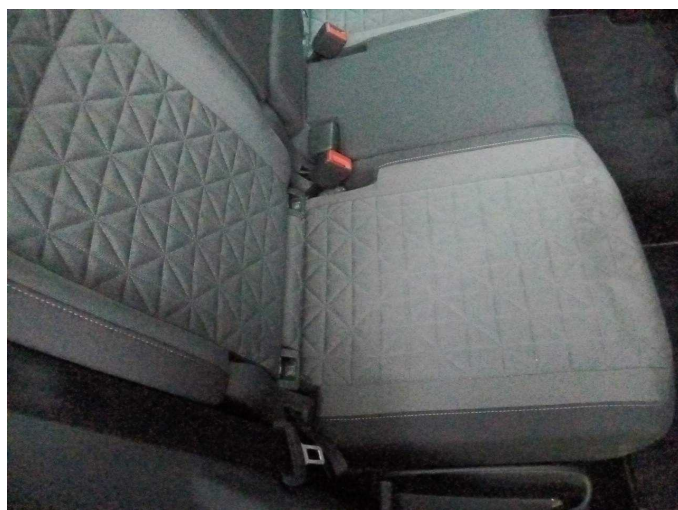


Figure 34: Misc.

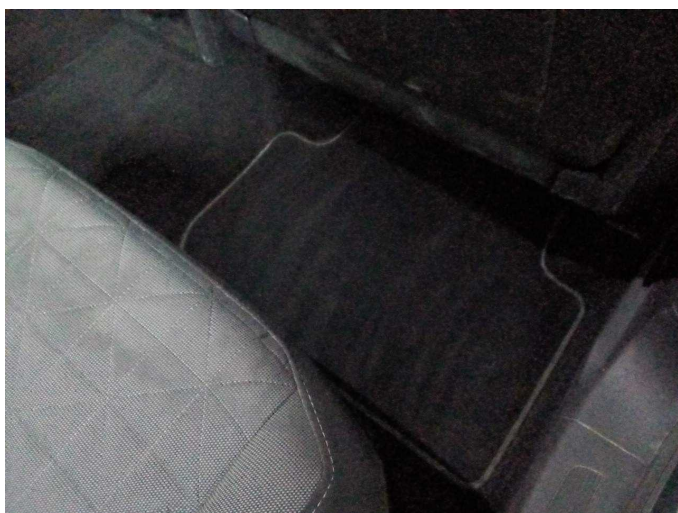


Figure 35: Misc.



Figure 36: Misc.



Figure 37: Misc.



Figure 38: Misc.



Figure 39: Misc.



Figure 40: Misc.



Figure 41: Misc.



Figure 42: Misc.



Figure 43: Misc.



Figure 44: Misc.

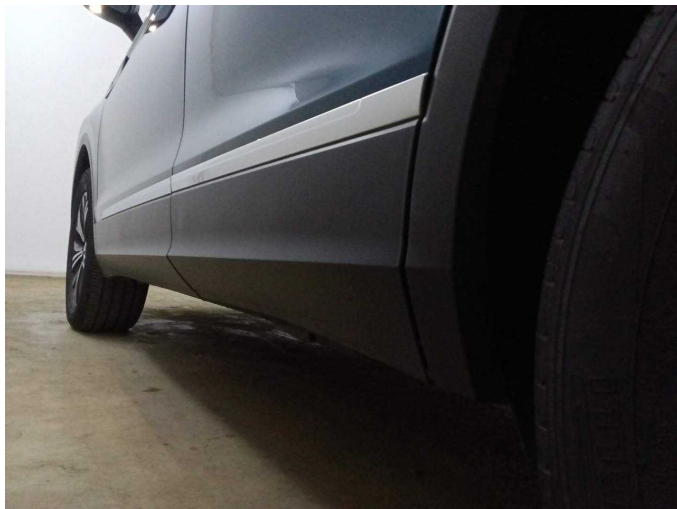


Figure 45: Misc.



Figure 46: Misc.

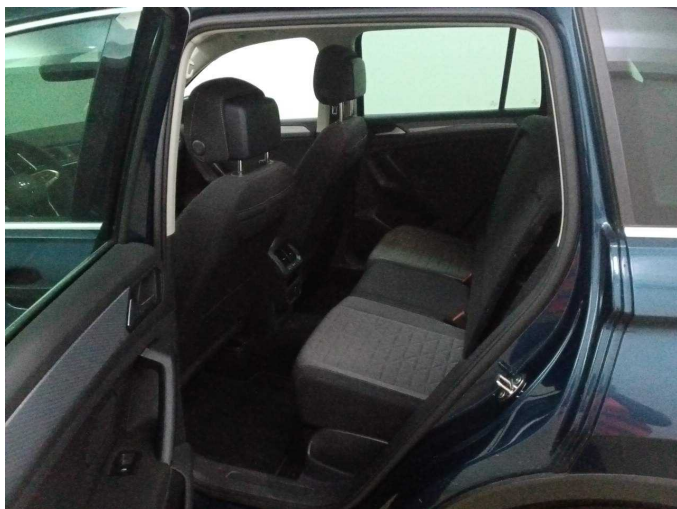


Figure 47: Misc.

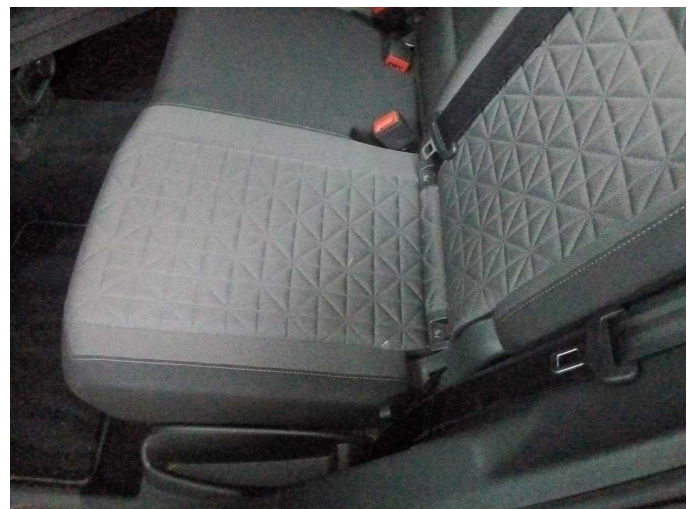


Figure 48: Misc.




Figure 49: Misc.




Figure 50: Misc.




Damage 1: Equipment: Tirefit filler - Expired - Replace

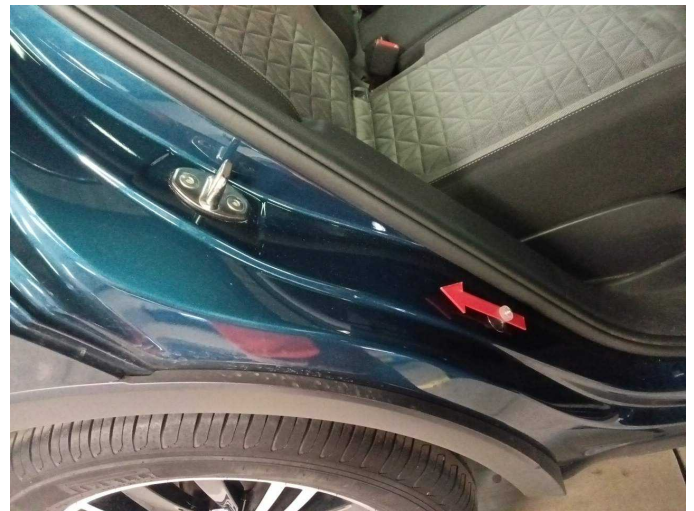

Damage 2: Side panel - rear right side: Sill - dent(s) - Smooth repair work

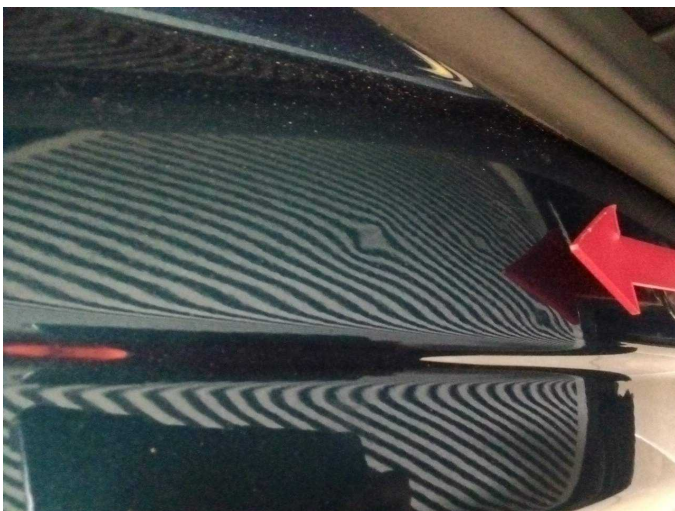

Damage 2: Side panel - rear right side: Sill - dent(s) - Smooth repair work

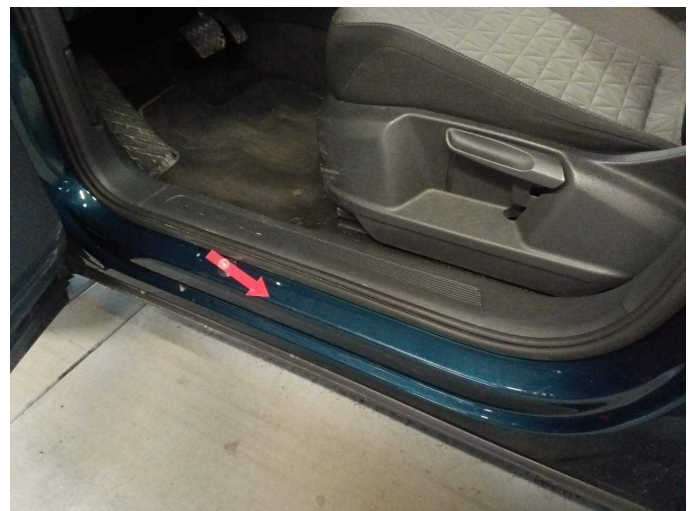

Damage 3: Sill - left side: Sill - dent(s) - Smooth repair work




Damage 3: Sill - left side: Sill - dent(s) - Smooth repair work



Damage 4: Side panel - rear left side: Sill - Scratch(es) - Smart repair



Damage 4: Side panel - rear left side: Sill - Scratch(es) - Smart repair

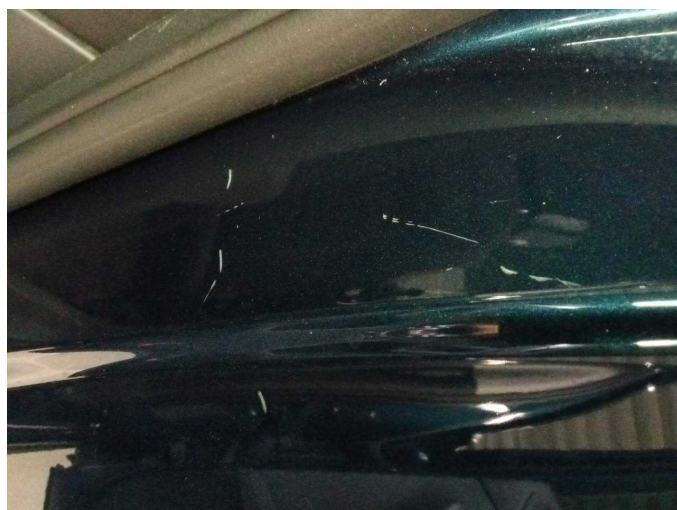

Damage 4: Side panel - rear left side: Sill - Scratch(es) - Smart repair



Damage 5: Door - rear left side: Door - Dent / paintcoat damage - Smart repair




Damage 5: Door - rear left side: Door - Dent / paintcoat damage - Smart repair




Damage 5: Door - rear left side: Door - Dent / paintcoat damage - Smart repair



Damage 6: Door - rear right side: Door - Dent / paintcoat damage - Smart repair

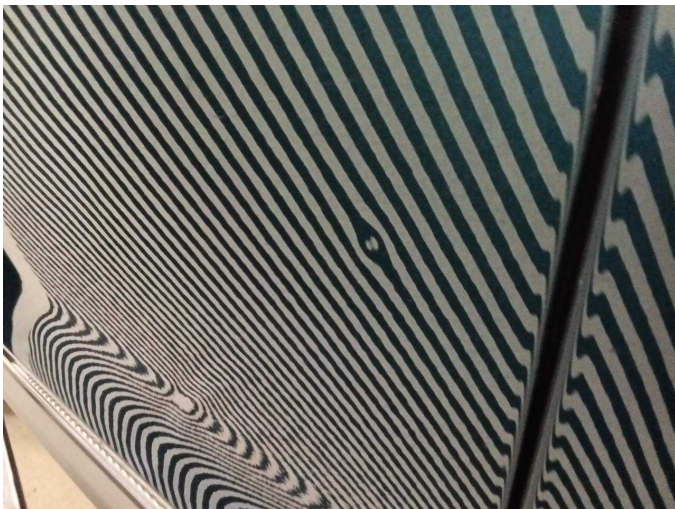


Damage 6: Door - rear right side: Door - Dent / paintcoat damage - Smart repair

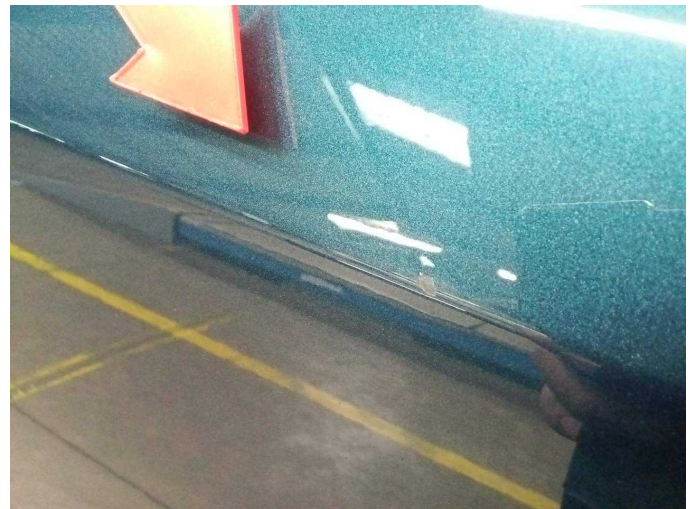

Damage 6: Door - rear right side: Door - Dent / paintcoat damage - Smart repair




Damage 6: Door - rear right side: Door - Dent / paintcoat damage - Smart repair

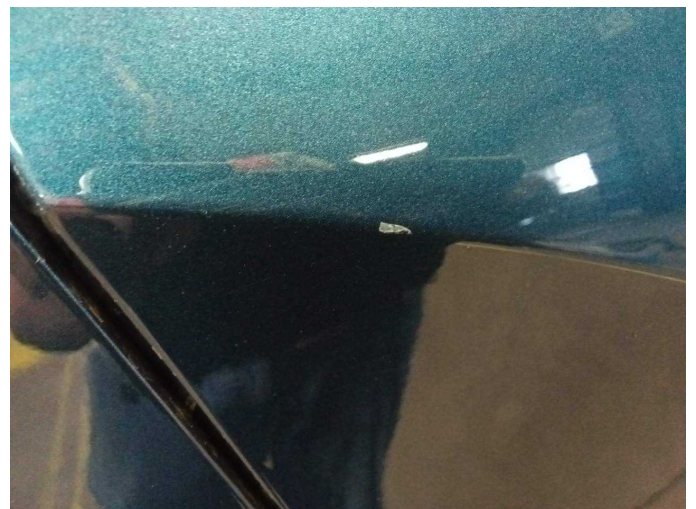


Damage 6: Door - rear right side: Door - Dent / paintcoat damage - Smart repair




Damage 7: Door - front left side: Door - Dent / paintcoat damage - Smart repair

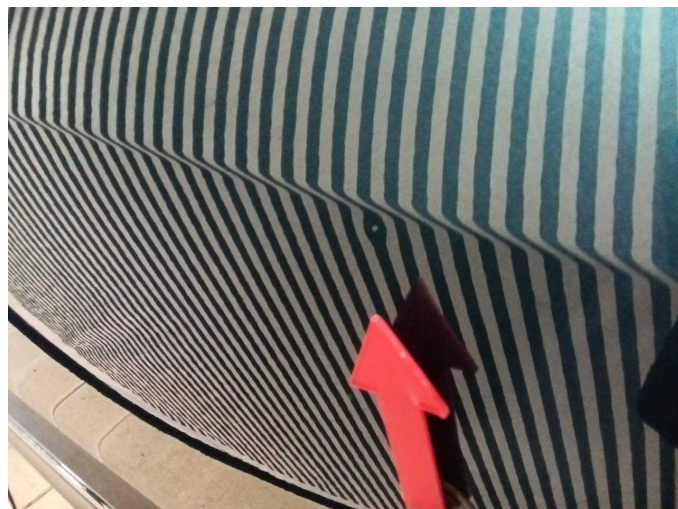


Damage 7: Door - front left side: Door - Dent / paintcoat damage - Smart repair

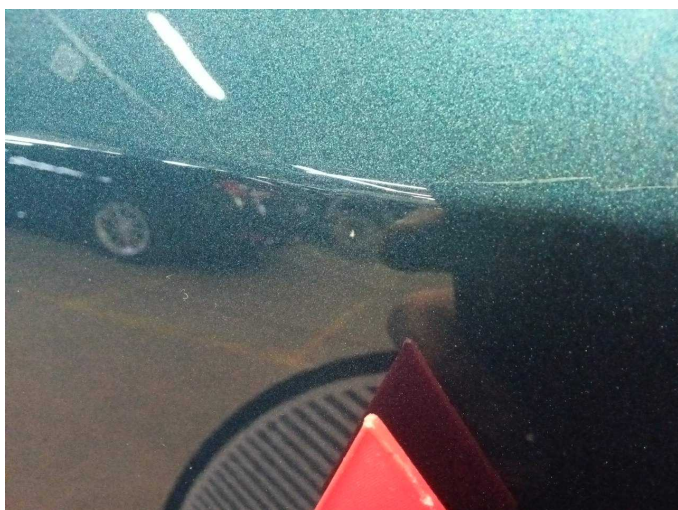


Damage 7: Door - front left side: Door - Dent / paintcoat damage - Smart repair

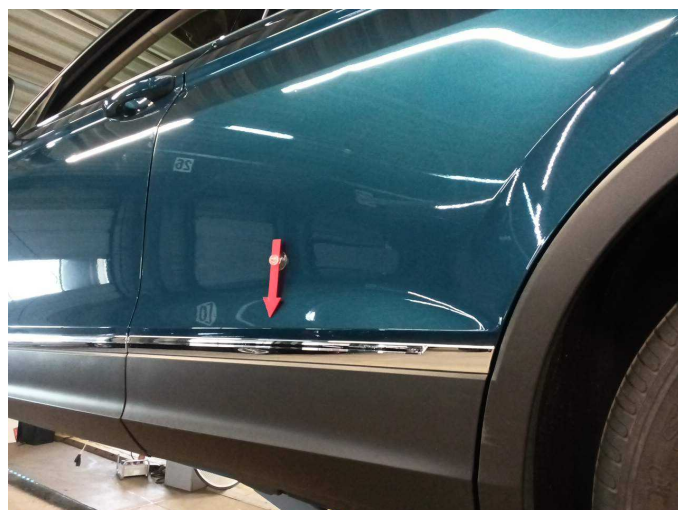


Damage 8: Door - rear left side: Brightware - lower - Scratch(es) - Replace

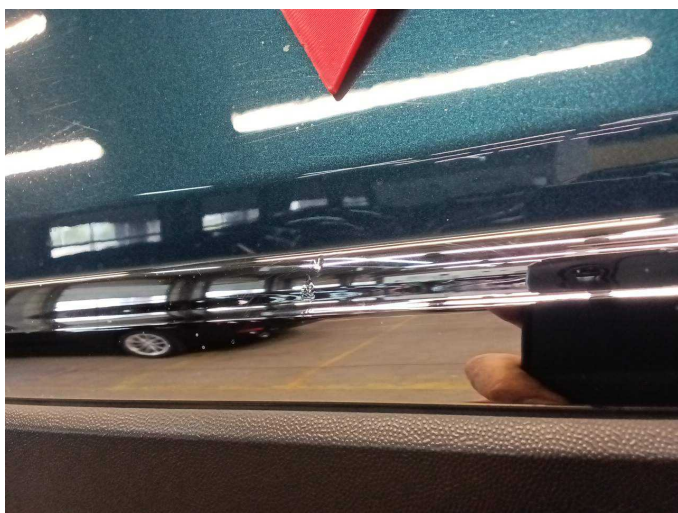


Damage 8: Door - rear left side: Brightware - lower - Scratch(es) - Replace

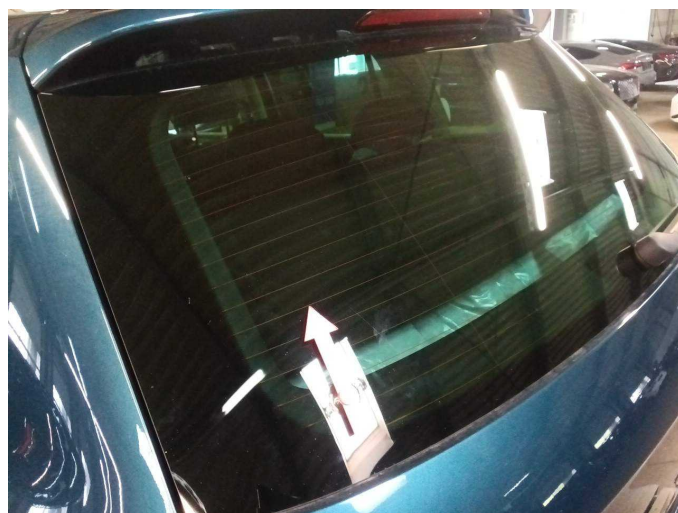


Damage 9: Vehicle glazing: Rear window - Scratch(es) - Replace

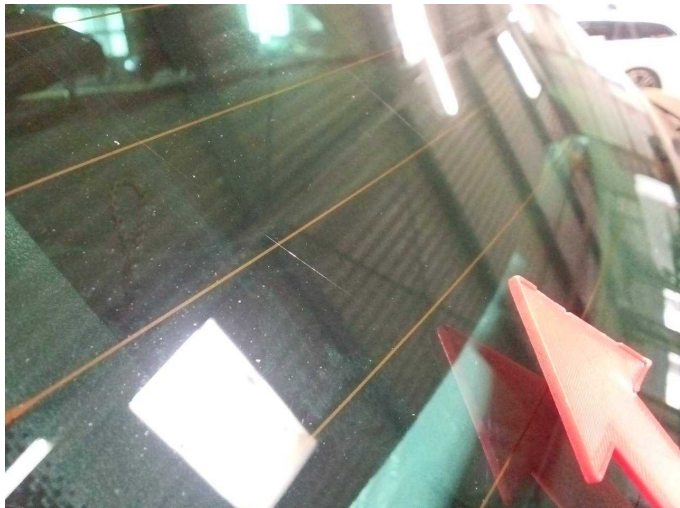


Damage 9: Vehicle glazing: Rear window - Scratch(es) - Replace

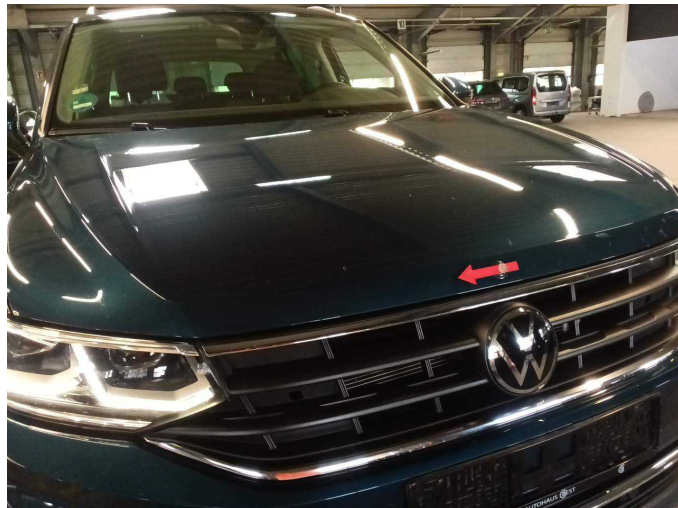


Wear and tear 1: Bonnet: Bonnet - Stone chips - No deduction

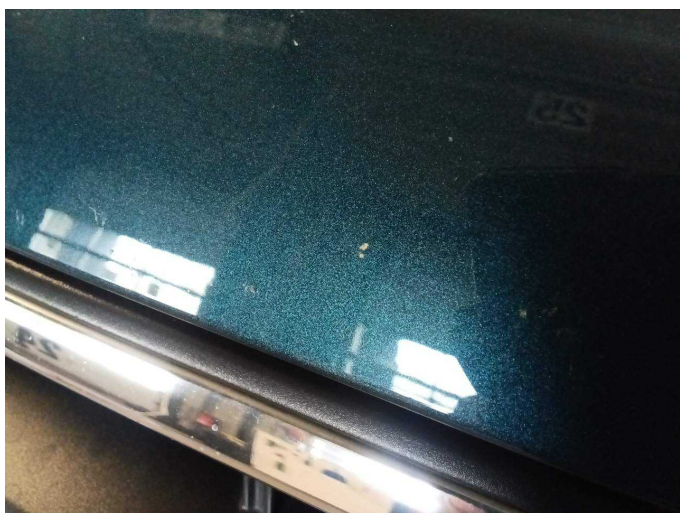

Wear and tear 1: Bonnet: Bonnet - Stone chips - No deduction

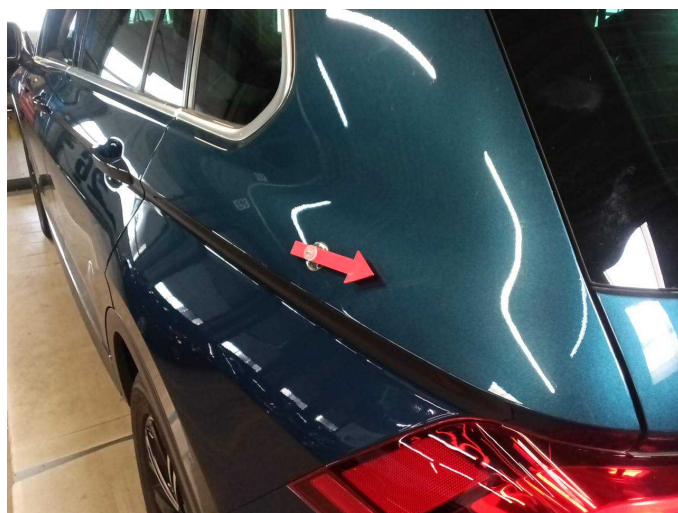

Wear and tear 2: Side panel - rear left side: Side panel - dent(s) - Smooth repair work

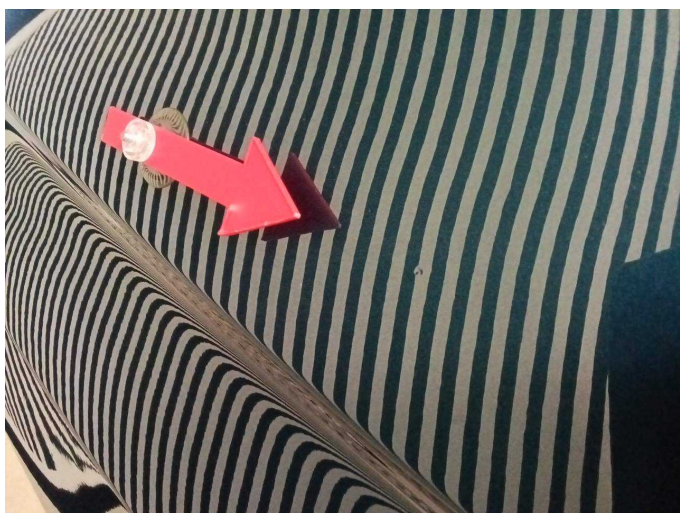

Wear and tear 2: Side panel - rear left side: Side panel - dent(s) - Smooth repair work



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WVGZZZ5NZNW033652
Hersteller / Modell: VOLKSWAGEN VOLKSWAGEN Tiguan 2.0 TDI SCR 4MOTION
DSG Life

Datum	KM-Stand	Beschreibung
25.03.2026	62.055	Bremsflüssigkeit; Bremsflüssigkeit ern; Motoröl b. Wartung; Ölfilter ern; Ölwechsel - Hinterachse; Regelwartungsdienst; Reparatur Sonstiges; Systemtest/Eigendiagnose; Wartung Sonstiges
23.10.2025	56.279	Bremse Sonstiges; Bremsklötze hinten; Bremsscheiben + Klötze h; Bremsscheiben hinten
12.05.2025	48.157	AU
19.12.2024	42.195	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
17.04.2024	30.764	Bremsflüssigkeit; Bremsflüssigkeit ern; Getriebeöl ern/prüfen; Ölwechsel - Hinterachse; Reparatur Sonstiges
04.12.2023	24.775	Regelwartungsdienst
21.08.2023	19.381	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges