



Expertise

Protocol number: 46510584
Order No. / Reference: 26569848
Inspection date: 14 Jul 2026

Manufacturer: Mercedes-Benz

Model: E 300 de T 9G-TRONIC Avantgarde

VIN: W1K2132161A953353



Vehicle details	
Manufacturer / Type / Model / Equipment	
Mercedes-Benz E 300 de T 9G-TRONIC Avantgarde	
Vehicle Identification number	W1K2132161A953353
Mileage (Read)	97,057 km
First registration	4 Mar 2021
Number of holders	1
Power / Engine displacement	143 kw / 1,950 ccm
Fuel type / Cylinder	Hybr.D/E ext.aufl / 4
Gearbox / Number of gears	Automatic / 9
Type of drive	Rear drive
Type of vehicle	Station wagon
Colour / colour code	GRAPHITGRAU - METALLICLACK
Doors / Seats	5 / 5
Upholstery type	Cloth / leather combination
Colour of upholstery	Black-Anthracite
Re-import	no
readiness to drive	Not roadworthy / moveable



Vehicle details

Maintenance booklet / proof	Non-existent	Next maintenance in	135 Tag(e)
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GA343257
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
readiness to drive	Not roadworthy / moveable		
Manufacturer key number/ type code number	2222 / AEN 00025		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,820 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	245/45 R18 100V	Winter tyres on Light alloy	Pirelli	5mm / 5mm
2)	275/40 R18 103V	Winter tyres on Light alloy	Pirelli	4mm / 4mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	245/45 R18 100Y	Summer tyres on Light alloy	Goodyear	3mm / 3mm
2)	275/40 R18 103Y	Summer tyres on Light alloy	Goodyear	3mm / 3mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 04/2026		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- ADAPTIVE BRAKE with hill start assist, pre-filling and drying braking in wet conditions
- Airbag: Automatic passenger airbag deactivation
- Airbag: Side airbag for driver and front passenger
- Acoustic environmental protection
- AMG sports pedal assembly made of brushed stainless steel with rubber studs
- Foldable armrest for driver and front passenger
- Left and right exterior mirrors, heated and electrically adjustable, painted in body color
- Brake assist, active
- Tachometer
- DYNAMIC SELECT
- EASY-PACK tailgate
- Chassis: AGILITY CONTROL chassis with selective damping system
- Velour floor mats
- Transmission: 9-speed automatic, 9G-TRONIC
- rear window wiper
- KEYLESS START
- THERMATIC automatic climate control
- Headrests 5-way adjustable for driver and front passenger, 4-way adjustable, and 2-way adjustable in the rear.
- LED High Performance Headlights
- Steering column mechanically adjustable in height and length
- Center console piano black finish
- Navigation accessories: Pre-installation for Live Traffic Information
- Package: AVANTGARDE Exterior (for plug-in hybrid)
- Upholstery: ARTICO leatherette/Norwich fabric
- Radio: Extended MBUX functions
- Radio accessories: Digital radio
- Remote Services Plus
- Power steering
- Seats: Rear seat backrests foldable, 40/20/40 split
- Touchpad
- Electronic immobilizer
- Central locking
- AdBlue tank with a capacity of 23.5 liters
- Airbag for driver and front passenger
- Airbag: Kneebag for driver
- Airbag: Windowbags left/right
- Premium ambient lighting with 64 colors and 3 color zones
- Anti-lock braking system (ABS)
- Traction control (ASR)
- ATTENTION ASSIST
- Basic services
- On-board computer
- Diesel particulate filter
- Third brake light
- EASY-PACK cargo cover including EASY-PACK safety net
- Electronic Stability Program (ESP)
- Chassis: Air suspension on the rear axle with level control
- Electric window regulator with comfort operation and anti-pinch protection, 4-way
- Heated rear window with timer
- Interior headliner in nevagrau fabric
- Climate: Pre-conditioning
- Communication module (LTE) for the use of Mercedes me connect services
- Charging cable for household socket, 5m, smooth
- Charging system: AC charging system 7.4 kW
- Steering wheel: Multifunction steering wheel in Nappa leather in a 3-spoke design
- Mercedes-Benz emergency call system
- Center console with on-the-fly storage compartment
- Navigation: Hard disk navigation
- Package: Storage compartment (for plug-in hybrid)
- Package: Seating comfort
- PRE-SAFE system
- Radio: MBUX multimedia system
- Tire pressure monitoring system
- Windscreen wipers with rain sensor
- Seats: i-Size child seat attachment
- Power outlet: 12V socket in the cargo area
- High-visibility vest for drivers
- Green, heat-insulating glass all around
- Decorative elements: aluminum with longitudinal brushing, light finish



Extra equipment

- Black fabric headliner
- Charging cable for wallbox and public charging stations, 5m, smooth (This charging cable, also called Mode 3 cable, allows you to charge the vehicle battery at the wallbox or at public charging stations with up to 11 kW (Type 2, 3-phase, 20 A).)
- Package: Night for AVANTGARDE exterior (for hybrid vehicles) (45.7 cm (18") 5-spoke light-alloy wheels, painted high-gloss black and polished with front axle 245/45 R 18 on 8 J x 18 ET 43, rear axle 275/40 R 18 on 9 J x 18 ET 53 - front bumper with trim element in high-gloss black - beltline trim strip, window surround and trim strip in the rear bumper in high-gloss black - exterior mirror housings in high-gloss black - roof rails in black - heat-insulating dark tinted glass from the B-pillar)
- Package: Public Charging (charging cable for wallbox and public charging stations, 5m, smooth (charging the vehicle battery at the wallbox or at public charging stations with up to 11 kW (Type 2, 3-phase, 20 A)) - Remote and Charging Services Plus)
- Package: Lane Keeping Assist Package (Consisting of Blind Spot Assist and Active Lane Keeping Assist. Blind Spot Assist and Active Lane Keeping Assist can warn the driver visually and audibly of vehicles in the blind spot and indicate an unintentional lane departure. Active Lane Keeping Assist can help avoid collisions by applying the brakes.)
- Seats: Heated seats for driver and front passenger (selectable in three stages - Intelligent and comfortable: The seat heating switches off automatically)
- TIREFIT with tire inflation compressor
- Glazing: Heat-insulating dark tinted glass all around from the B-pillar (the use of heat-insulating dark tinted glass for the rear side windows and rear window protects rear passengers from prying eyes and direct sunlight - the dark tint also emphasizes the sportiness of the vehicle)
- Paint finish: Metallic
- Package: Business (MBUX High-End Package - Connectivity Package Navigation - Traffic Sign Assist - Smartphone Integration - Pre-installation for Car Sharing - Widescreen Cockpit - Wireless Charging System for Mobile Devices - MBUX Augmented Reality for Navigation - Heated Seats for Driver and Front Passenger - Parking Package with Rearview Camera - Fuel Tank with 66 Liter Capacity (916) (60l for Diesel Plug-in Hybrids).)
- Package: Parking package with reversing camera (The parking package with reversing camera makes it easier to find and select parking spaces, as well as to park and exit in parallel and perpendicular parking spaces or garages. The active parking assistant steers the vehicle into parking spaces, including speed control and automatic gear changes.)
- Package: Mirrors (both exterior mirrors electrically foldable (button in the driver's door control panel) - automatic lowering of the passenger-side mirror glass to parking position when reverse gear is engaged - interior mirror and driver's side exterior mirror automatically dimming continuously - ambient lighting of the exterior mirror to illuminate the entry area)
- Wheels: 45.7 cm (18") light alloy wheels in 5-spoke design, painted high-gloss black (gloss-turned front axle: 8 J x 18 ET 43, tire size 245/45 R 18 rear axle: 9 J x 18 ET 53, tire size 275/40 R 18)
- Power outlet: 2 USB ports in the rear with charging function
- Telephone accessories: Multifunctional telephony in conjunction with MBUX High-End package (wireless connection of a compatible mobile phone to the external antenna - wireless charging for compatible mobile phones - Bluetooth and WLAN pairing wirelessly via NFC (Near Field Communication) technology)
- Decorative elements in light-colored, longitudinally brushed aluminum in conjunction with designo interior

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was not capable of driving under its own power at the time of inspection, but can be moved on its own axle with the aid of assistance.



Value reducing factors

No.	Component group	Description
1	Misc.	Inspection / maintenance (Keine Historie) - No evidence - No deduction
2	Equipment	Tirefit filler - Expired - Replace
3	Bonnet	Emblem - Broken / torn - Replace
4	Bonnet	Bonnet - dent(s) - Smooth repair work
5	Steering system	Steering wheel - Abrasion - Smart repair
6	Door - front left side	Strip - outer (Alle) - Paint defect - Smart repair
7	2nd wheel set	3 tyres (Flanke, lauffläche) - Damaged - Replace
8	Side panel - rear left side	Side panel - Dent / paintcoat damage - Repair and paint
9	Rear bumper	Rear bumper - Scratched - Paint
10	Front bumper	Front bumper - Scratched - Repair and paint

Wear and tear

No.	Component group	Description
1	Wheel / tyres	Tyre - front right side - Damaged - No deduction
2	Misc.	Main inspection - No evidence - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

Equipment - charging cable (Haushaltstecker Schuko)

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

- Für den montierten Radsatz wurde kein Nachweis erbracht.
- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

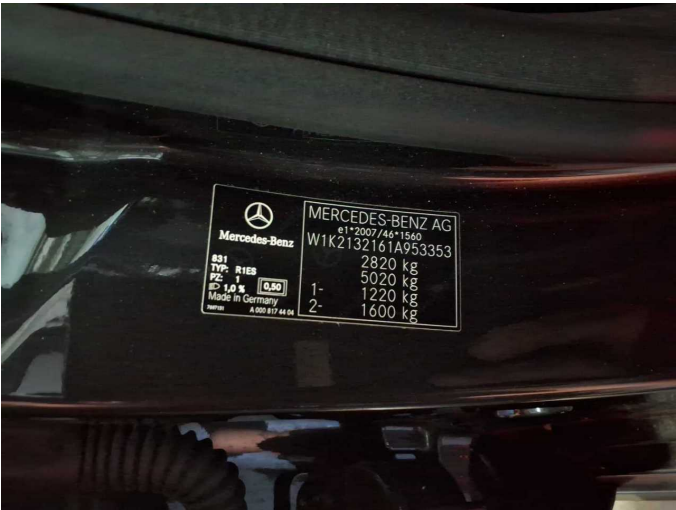


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Additional tyres

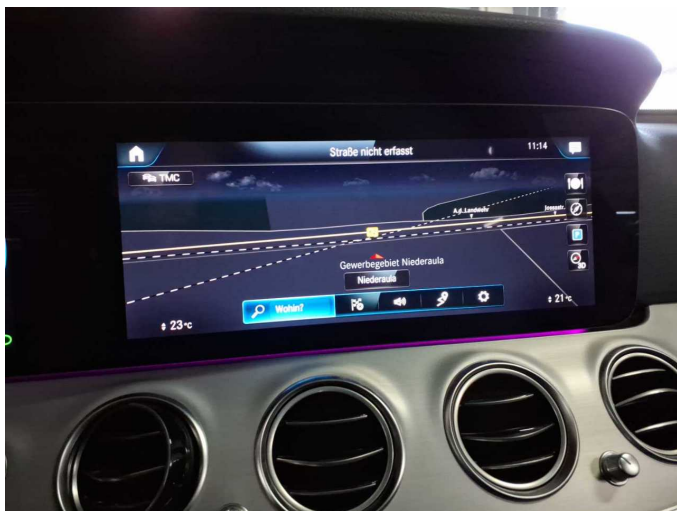


Figure 15: Navigation



Figure 16: Misc.



Figure 17: Misc.



Figure 18: Misc.

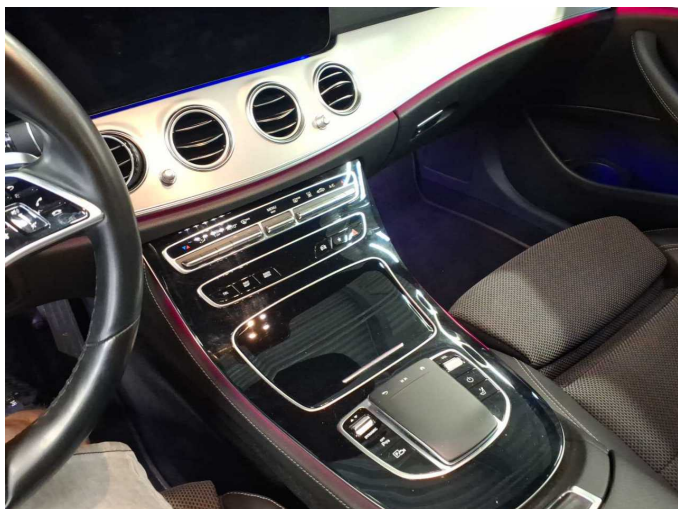


Figure 19: Misc.

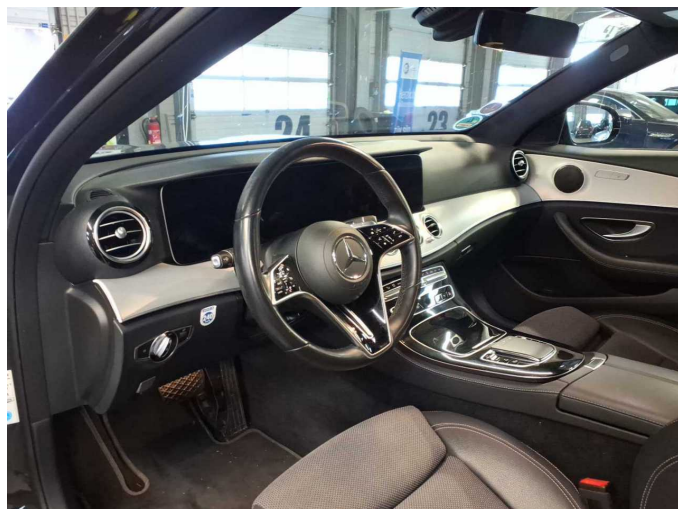


Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.




Figure 25: Misc.




Figure 26: Misc.




Damage 2: Equipment: Tirefit filler - Expired - Replace

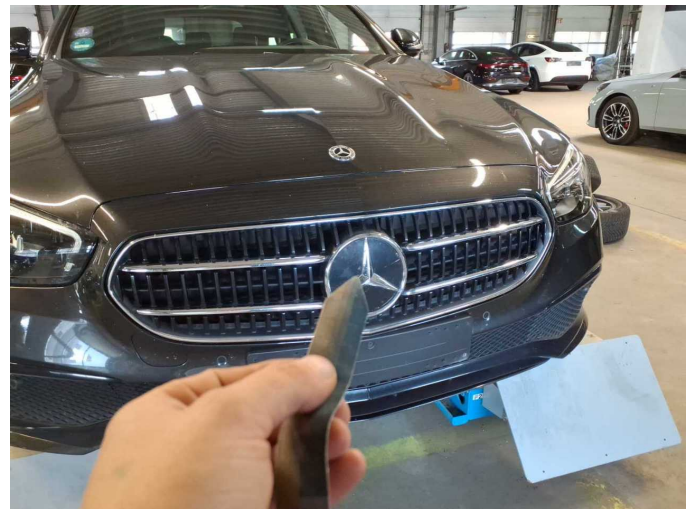

Damage 3: Bonnet: Emblem - Broken / torn - Replace

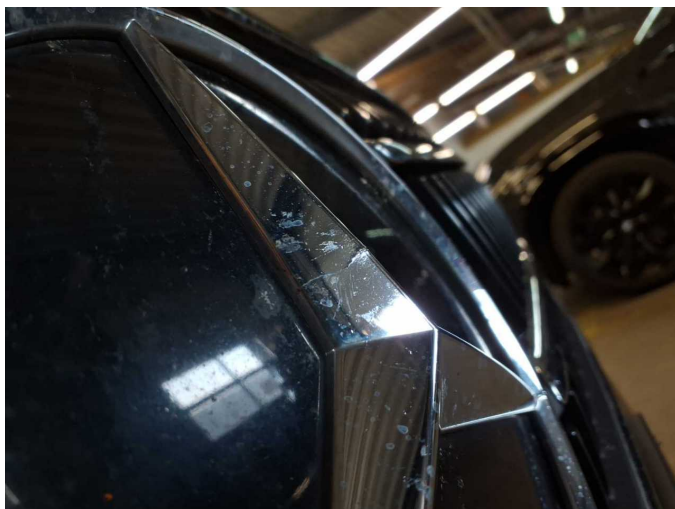

Damage 3: Bonnet: Emblem - Broken / torn - Replace

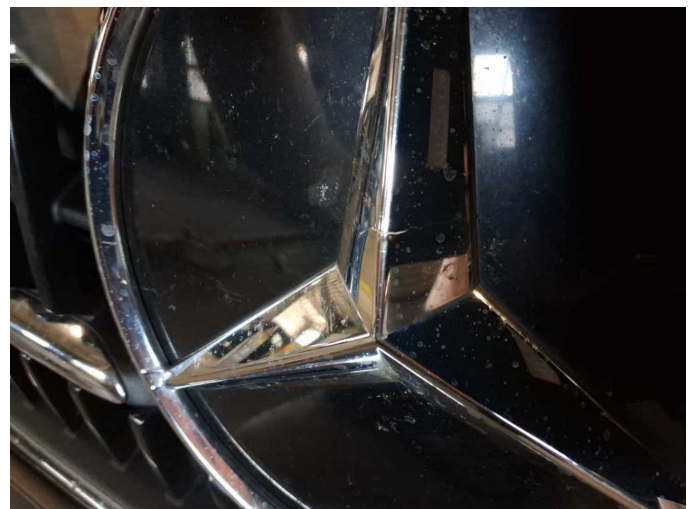

Damage 3: Bonnet: Emblem - Broken / torn - Replace



Damage 4: Bonnet: Bonnet - dent(s) - Smooth repair work



Damage 4: Bonnet: Bonnet - dent(s) - Smooth repair work




Damage 4: Bonnet: Bonnet - dent(s) - Smooth repair work



Damage 4: Bonnet: Bonnet - dent(s) - Smooth repair work



Damage 4: Bonnet: Bonnet - dent(s) - Smooth repair work

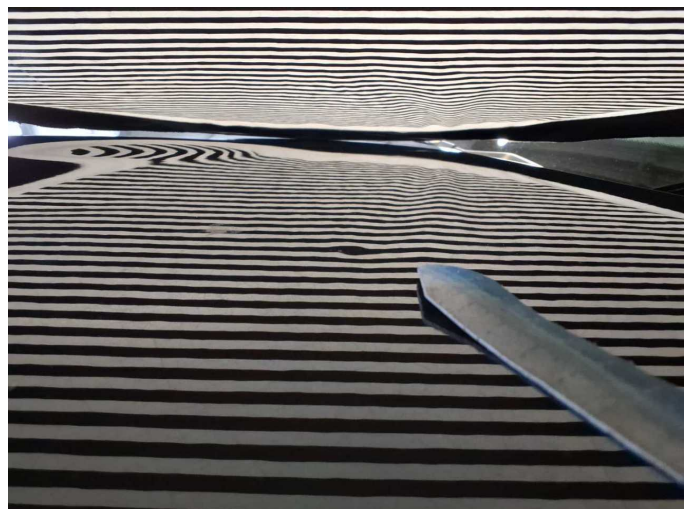


Damage 4: Bonnet: Bonnet - dent(s) - Smooth repair work



Damage 5: Steering system: Steering wheel - Abrasion - Smart repair



Damage 5: Steering system: Steering wheel - Abrasion - Smart repair

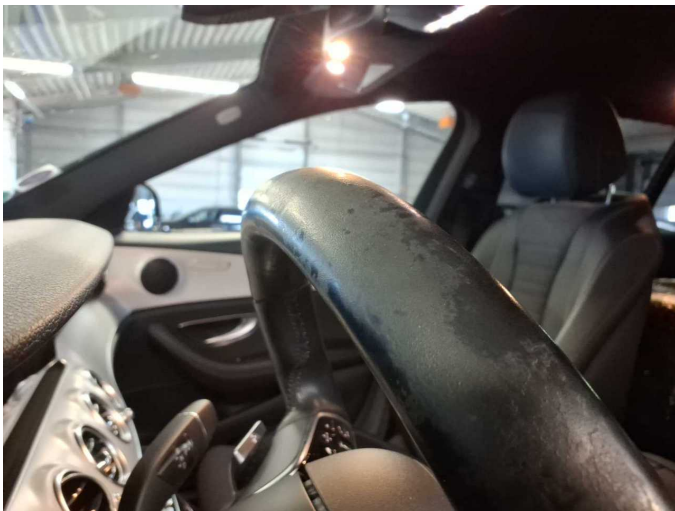

Damage 5: Steering system: Steering wheel - Abrasion - Smart repair



Damage 6: Door - front left side: Strip - outer (Alle) - Paint defect - Smart repair



Damage 6: Door - front left side: Strip - outer (Alle) - Paint defect - Smart repair



Damage 6: Door - front left side: Strip - outer (Alle) - Paint defect - Smart repair



Damage 6: Door - front left side: Strip - outer (Alle) - Paint defect - Smart repair



Damage 7: 2nd wheel set: 3 tyres (Flanke, lauffläche) - Damaged - Replace



Damage 7: 2nd wheel set: 3 tyres (Flanke, lauffläche) - Damaged - Replace



Damage 7: 2nd wheel set: 3 tyres (Flanke, lauffläche) - Damaged - Replace



Damage 7: 2nd wheel set: 3 tyres (Flanke, lauffläche) - Damaged - Replace



Damage 7: 2nd wheel set: 3 tyres (Flanke, lauffläche) - Damaged - Replace



Damage 7: 2nd wheel set: 3 tyres (Flanke, lauffläche) - Damaged - Replace




Damage 7: 2nd wheel set: 3 tyres (Flanke, lauffläche) - Damaged - Replace



Damage 7: 2nd wheel set: 3 tyres (Flanke, lauffläche) - Damaged - Replace



Damage 8: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint

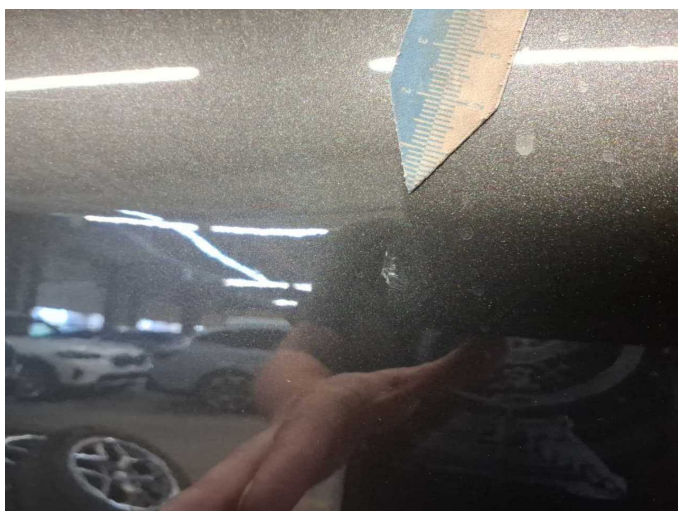

Damage 8: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint




Damage 8: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint



Damage 8: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint



Damage 8: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint

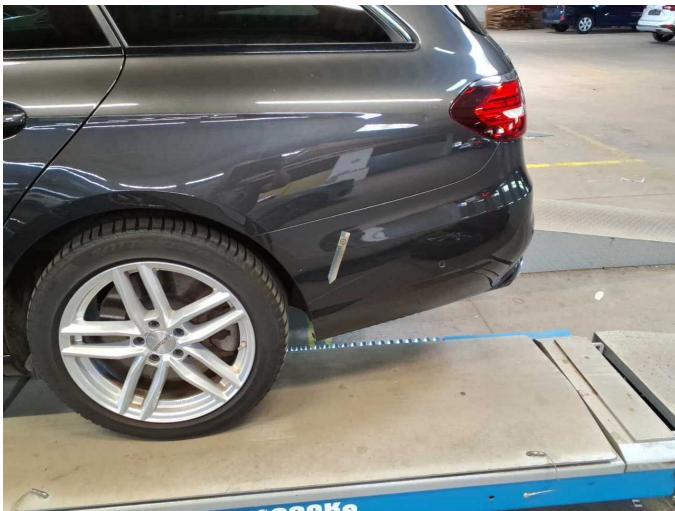

Damage 9: Rear bumper: Rear bumper - Scratched - Paint



Damage 9: Rear bumper: Rear bumper - Scratched - Paint



Damage 9: Rear bumper: Rear bumper - Scratched - Paint



Damage 9: Rear bumper: Rear bumper - Scratched - Paint




Damage 9: Rear bumper: Rear bumper - Scratched - Paint



Damage 9: Rear bumper: Rear bumper - Scratched - Paint



Damage 9: Rear bumper: Rear bumper - Scratched - Paint

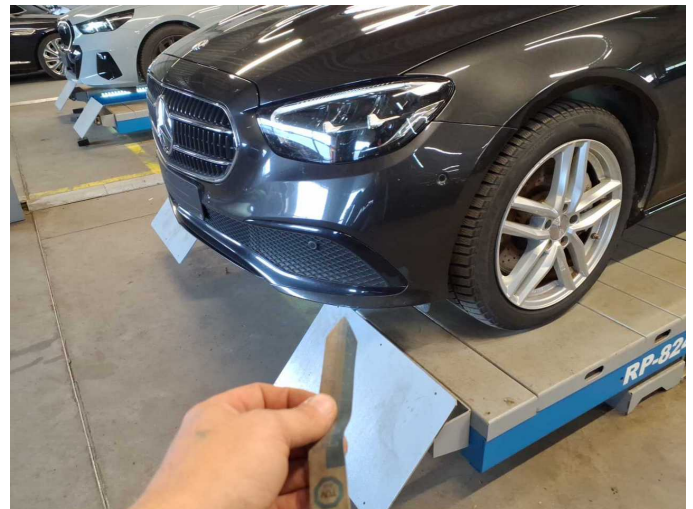

Damage 10: Front bumper: Front bumper - Scratched - Repair and paint




Damage 10: Front bumper: Front bumper - Scratched - Repair and paint



Damage 10: Front bumper: Front bumper - Scratched - Repair and paint



Damage 10: Front bumper: Front bumper - Scratched - Repair and paint

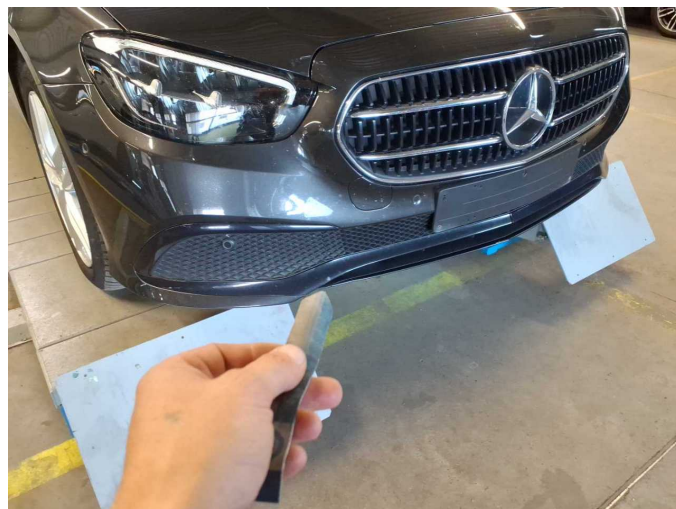


Damage 10: Front bumper: Front bumper - Scratched - Repair and paint



Damage 10: Front bumper: Front bumper - Scratched - Repair and paint



Damage 10: Front bumper: Front bumper - Scratched - Repair and paint

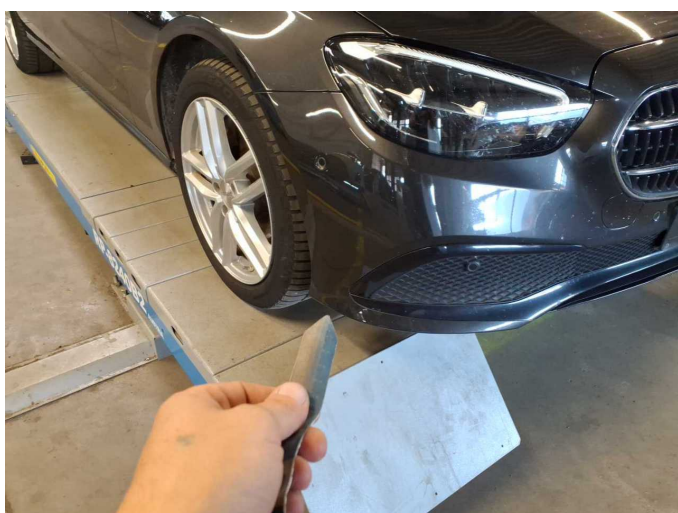

Damage 10: Front bumper: Front bumper - Scratched - Repair and paint




Damage 10: Front bumper: Front bumper - Scratched - Repair and paint



Damage 10: Front bumper: Front bumper - Scratched - Repair and paint



Wear and tear 1: Wheel / tyres: Tyre - front right side - Damaged - No deduction

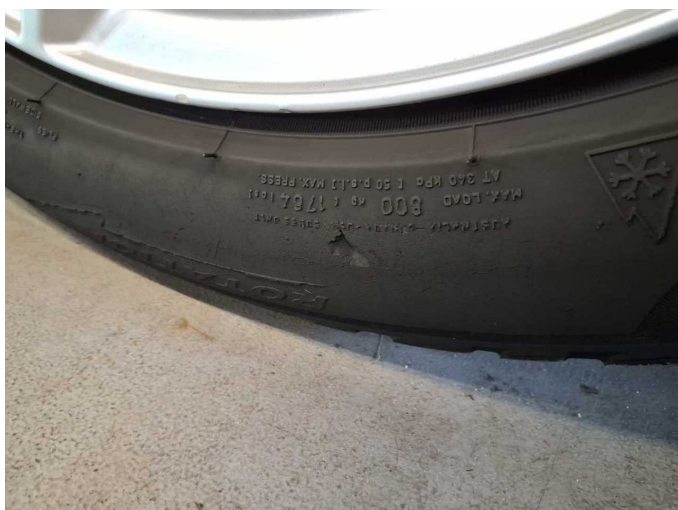

Wear and tear 1: Wheel / tyres: Tyre - front right side - Damaged - No deduction



Missing part 1: Equipment: charging cable (Haushaltstecker Schuko) - Missing - Replace