



Expertise

Protocol number: 45898795  
Order No. / Reference: 26361393  
Inspection date: 11 Jun 2026

Manufacturer: Mercedes-Benz  
VIN: W1N4N1CB5PJ501338

Model: GLA 200 d 8G-DCT AMG Line



| Vehicle details                         |                                |
|-----------------------------------------|--------------------------------|
| Manufacturer / Type / Model / Equipment |                                |
| Mercedes-Benz GLA 200 d 8G-DCT AMG Line |                                |
| Vehicle Identification number           | W1N4N1CB5PJ501338              |
| Mileage (Read)                          | 143,140 km                     |
| First registration                      | 16 Mar 2023                    |
| Number of holders                       | 1                              |
| Power / Engine displacement             | 110 kw / 1,950 ccm             |
| Fuel type / Cylinder                    | Diesel / 4                     |
| Gearbox / Number of gears               | Automatic / 8                  |
| Type of drive                           | Front drive                    |
| Type of vehicle                         | SUV                            |
| Colour / colour code                    | NACHTSCHWARZ<br>UNILACK        |
| Doors / Seats                           | 5 / 5                          |
| Upholstery type                         | Cloth / leather<br>combination |
| Colour of upholstery                    | Black                          |
| Vehicle with smoke odor                 | no                             |



## Vehicle details

|                                                      |                              |                                |                                                            |
|------------------------------------------------------|------------------------------|--------------------------------|------------------------------------------------------------|
| <b>Maintenance booklet / proof</b>                   | digital proof / complete     | <b>Next maintenance in</b>     | 244 Tag(e)                                                 |
| <b>Last service on / at</b>                          | 02/2026 at 135,782 km        |                                |                                                            |
| <b>Key is / should be</b>                            | 2 / 2                        | <b>FZG documents</b>           | ZB#2 (B) was available (copy), ZB#1 (S) was not available. |
|                                                      |                              | <b>Letter No.</b>              | GS683952                                                   |
| <b>Previous damage / Accident</b>                    | None detectable              | <b>Repainting</b>              | None detectable                                            |
| <b>Inspection conditions</b>                         | sufficient                   | <b>Lifting equipment / pit</b> | yes                                                        |
| <b>Test drive</b>                                    | Not performed                | <b>Engine function test</b>    | Performed                                                  |
| <b>Manufacturer key number/<br/>type code number</b> | 2222 / APX 00069             |                                |                                                            |
| <b>Emission standard</b>                             | EURO6;WLTP;AP;PI/CI; M, N1 I | <b>fine dust sticker</b>       |                                                            |
| <b>Permitted total weight</b>                        | 2,135 kg                     | <b>Empty weight</b>            |                                                            |

## Tyres

### Mounted tyres

| #  | Tyre size      | Type of tyre                | Manufacturer | Tread depth |
|----|----------------|-----------------------------|--------------|-------------|
| 1) | 235/50 R19 99H | Winter tyres on Light alloy | Bridgestone  | 5mm / 5mm   |
| 2) | 235/50 R19 99H | Winter tyres on Light alloy | Bridgestone  | 5mm / 5mm   |

### Additional tyres

| #  | Tyre size      | Type of tyre                     | Manufacturer | Tread depth |
|----|----------------|----------------------------------|--------------|-------------|
| 1) | 235/50 R19 99W | Summer tyres (Without wheel rim) | Continental  | 4mm / 4mm   |
| 2) | 235/50 R19 99W | Summer tyres (Without wheel rim) | Continental  | 4mm / 4mm   |

**Legend:** Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

## Equipment

### Standard equipment

- ADAPTIVE BRAKE with HOLD function, hill start assist, pre-filling and drying brakes in wet conditions
- Airbag: Kneebag for driver
- Airbag: Windowbags
- Active Lane Keeping Assist
- AMG floor mats
- Anti-lock braking system (ABS)
- Center console armrest for driver and front passenger with integrated storage compartment
- Outdoor temperature display
- Roof rails in polished aluminum
- Double cup holder
- Third brake light in LED technology
- ECO start/stop function
- Electronic Stability Program (ESP)
- Electric windows (4-way)
- Windscreen laminated glass
- Speed Limit Assistant
- Halogen headlights including integrated LED daytime running lights
- Rear window wiper with intermittent function
- Interior headliner fabric crystal grey
- KEYLESS-GO start function
- Climate: THERMATIC automatic climate control
- Rear headrests (3)
- Paint finish: Solid
- Steering wheel: Multifunction sports steering wheel in Nappa leather
- Mercedes-Benz emergency call system
- Package: Light and Visibility Package
- Package: Seating comfort
- Radio: MBUX multimedia system
- Radio accessories: Touchpad
- Tire pressure monitoring system
- Wheels: 48.3 cm (19") AMG light-alloy wheels, 4 in 5-twin-spoke design
- Seats: Rear seat backrests foldable
- Sport pedal assembly made of brushed stainless steel with rubber studs
- High-visibility vest for drivers
- Heat-insulating glass, green all around
- Decorative elements carbon structure
- Adaptive brake light flashing
- Airbag for driver and front passenger
- Airbag: Side airbag for driver and front passenger
- Active Brake Assist
- AMG front apron with chrome front splitter
- AMG rear apron with diffuser look and chrome trim element
- Traction control (ASR)
- Automatic passenger airbag deactivation
- Heated exterior mirrors (left and right), electrically adjustable from inside
- Diesel particulate filter
- Tachometer
- DYNAMIC SELECT
- Door sills with "Mercedes-Benz" lettering
- Chassis: Comfort chassis with lowered suspension
- electric parking brake
- Luggage net on driver and passenger seatbacks
- Transmission: 8G-DCT dual-clutch automatic transmission, 8-speed
- Illuminated glove box
- Heated rear window with timer
- ISOFIX child seat anchorages with Top Tether in the rear
- Mechanical child safety lock
- Communication module (LTE) for the use of Mercedes me connect services
- Cargo area cover
- Steering column mechanically adjustable in height and length
- Navigation accessories: Extended MBUX functions
- Package: Non-smoking
- Upholstery: ARTICO leatherette/MICROCUT microfiber
- Radio accessories: Digital radio
- Rain and light sensor
- Remote Services Plus
- Service interval indicator ASSYST
- GLA-Class seat belts
- Seats: Sports seats
- 12V power outlet in center console
- Cruise control
- Electronic immobilizer
- Central locking



## Extra equipment

- Ambient lighting in 64 colors (Stage the interior according to your personal preference or current mood. The 64 colors of the ambient lighting create fascinating color worlds, for example in the illuminated air vents, doors or the instrument panel.)
- Steering: Direct steering
- Package: Business (Hard drive navigation - Smartphone integration - Traffic sign assistant - Preparation for digital key handover - Connectivity package navigation - Seat heating for driver and front passenger - Parking assistant with PARKTRONIC - Preparation for live traffic information)
- Package: MBUX Advanced Package (Hard drive navigation - Smartphone integration - Traffic sign assistant - Preparation for digital key handover - Connectivity package navigation - Preparation for live traffic information)
- Panoramic sliding sunroof (electrically operated in glass design with comfort and automatic rain closing, electric sunshade, anti-pinch protection and PRE-SAFE closing function)
- Type designation removed from luggage compartment lid
- Black fabric headliner
- Paint finish: Special paint finish, solid color
- LED High Performance headlights (low beam in LED projection technology - high beam with LED reflector technology - daytime running lights, position lights and direction indicators in LED technology - automatic adjustment of the light intensity of the rear lights to the surroundings)
- Package: KEYLESS-GO Comfort (vehicle key with KEYLESS-GO functionality - KEYLESS-GO access and drive authorization system - start/stop button - comfort opening and closing - door handles with chrome inlay - HANDS-FREE ACCESS - handle recess lighting - remote trunk lid closing - EASY-PACK trunk lid)
- Package: Parking package with reversing camera (Active Parking Assist with PARKTRONIC)
- Radio accessories: Advanced sound system (with 10 speakers and 225 watts system power)
- Heated seats for driver and front passenger
- Dark tinted heat-insulating glass (rear side windows and rear window)

## Brief expert findings

|                      |                                                                                                                                                                              |
|----------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| Documents submitted  | At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy) |
| VIN comparison       | The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.    |
| Inspection           | The inspection conditions were sufficient for the assessment of the vehicle.<br>Lifting equipment and/or a pit were available for examining the vehicle.                     |
| Test drive           | No test drive/shunting maneuver was carried out during the inspection of the vehicle.                                                                                        |
| Engine function test | An engine test run was performed.                                                                                                                                            |

## Value reducing factors

| No. | Component group | Description                                               |
|-----|-----------------|-----------------------------------------------------------|
| 1   | Wheel / tyres   | Alloy rim - front left side - Scratch(es) - Loss in value |
| 2   | Bonnet          | Bonnet - Stone chips - Paint                              |

## Wear and tear

| No. | Component group | Description                             |
|-----|-----------------|-----------------------------------------|
| 1   | Vehicle glazing | Windscreen - Stone chips - No deduction |

The vehicle shows signs of wear and tear commensurate with its age and use.



## Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features  
*(Delivery by third-party service providers)*
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.  
*(Functional testing of driver assistance systems is not included in the scope of services!)*
- a photographic documentation of the vehicle

## Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

## Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

## Comments

- Winterreifensatz ist kein Bestandteil des Auslieferungsumfangs.

ALPHABET



Figure 1: Diagonal front (left)

ALPHABET



Figure 2: Diagonal front (right)

ALPHABET



Figure 3: Diagonal rear (left)

ALPHABET



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



**Figure 8: Instrument panel**



**Figure 10: Cargo area**



**Figure 12: Mounted tyres**



Figure 13: Documents

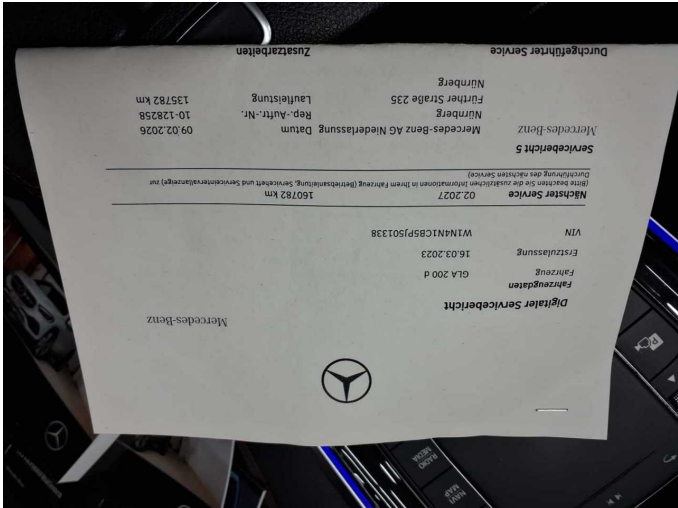


Figure 14: Documents

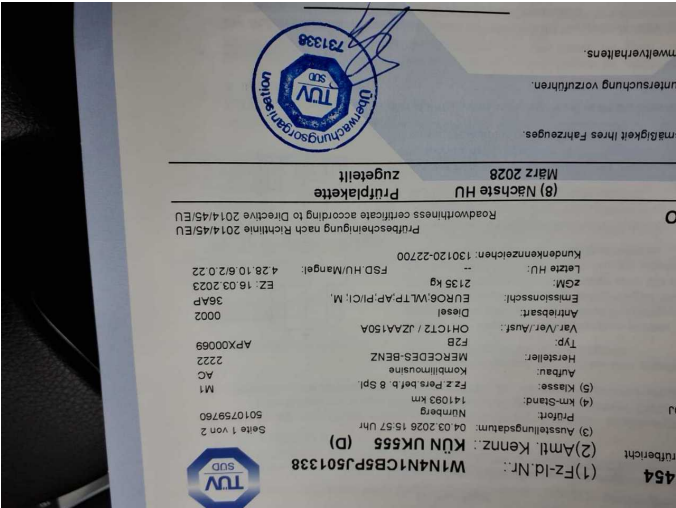


Figure 15: Documents



Figure 16: Documents



Figure 17: Additional tyres



Figure 18: Additional tyres



Figure 19: Navigation



Figure 20: Misc.



Figure 21: Misc.

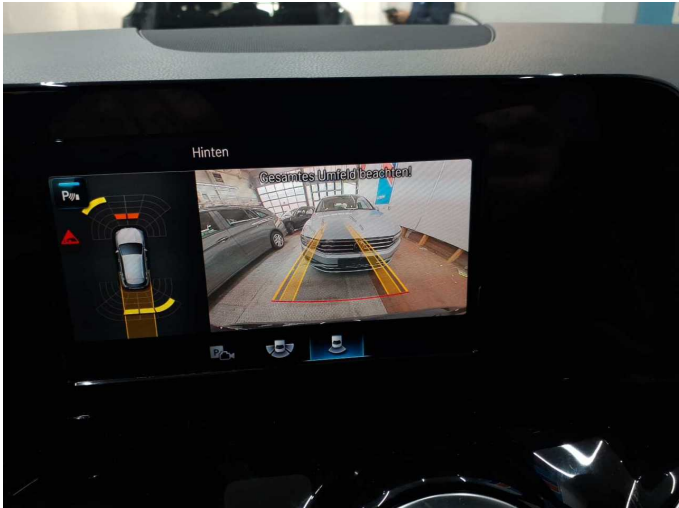


Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.

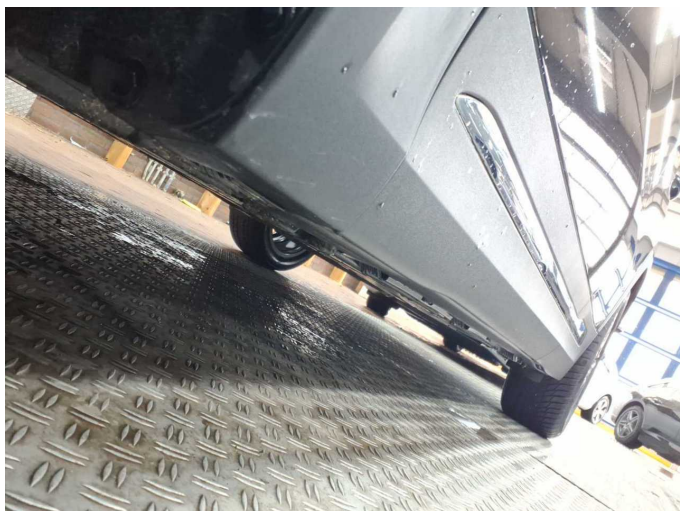


Figure 25: Misc.



Figure 26: Misc.

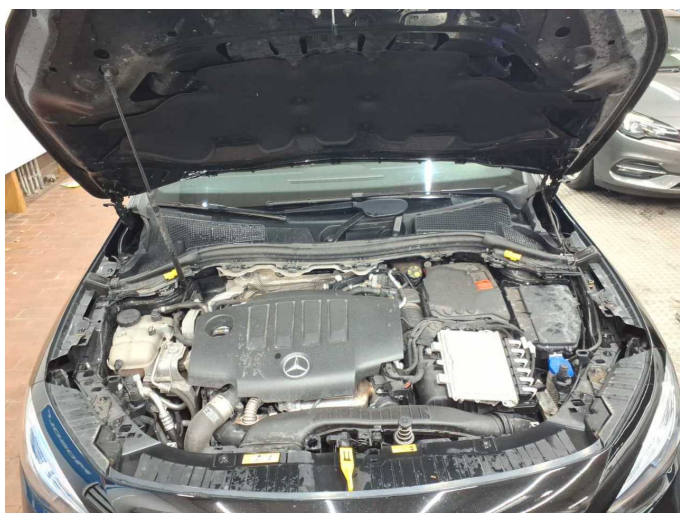


Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.

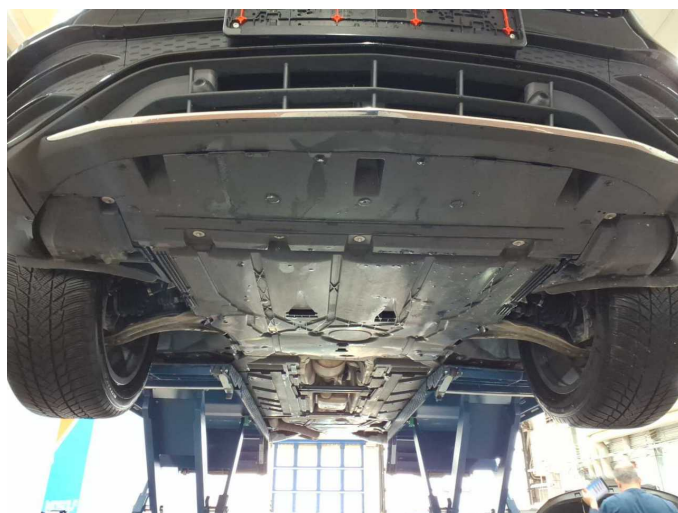


Figure 30: Misc.




**Damage 1:** Wheel / tyres: Alloy rim - front left side - Scratch(es) - Loss in value




**Damage 1:** Wheel / tyres: Alloy rim - front left side - Scratch(es) - Loss in value




**Damage 2:** Bonnet: Bonnet - Stone chips - Paint

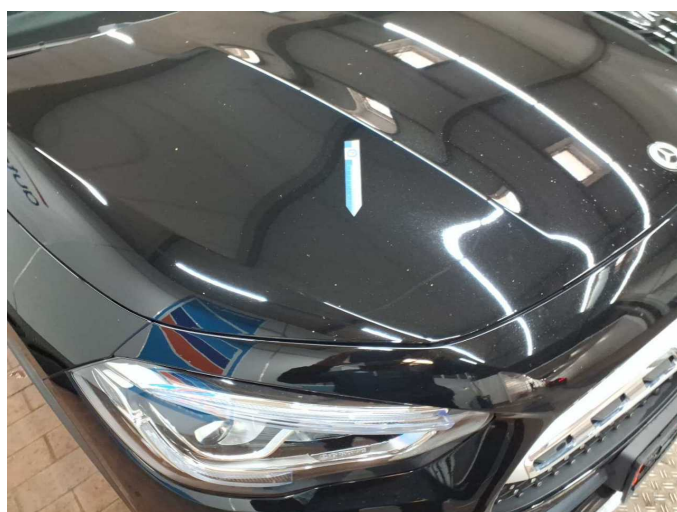


**Damage 2:** Bonnet: Bonnet - Stone chips - Paint

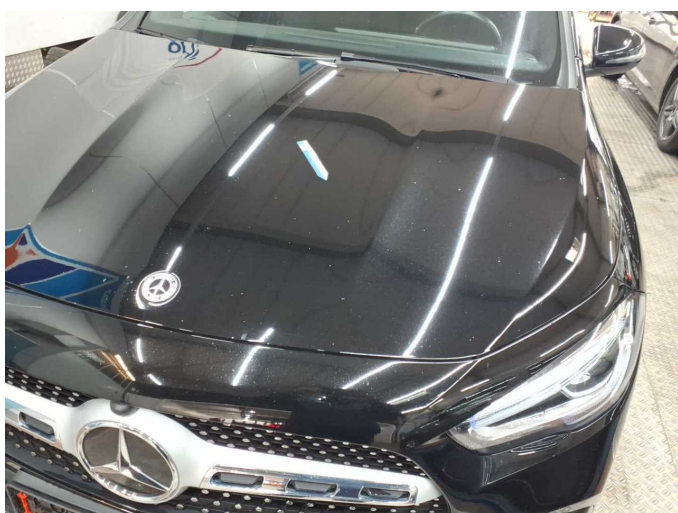


**Damage 2:** Bonnet: Bonnet - Stone chips - Paint

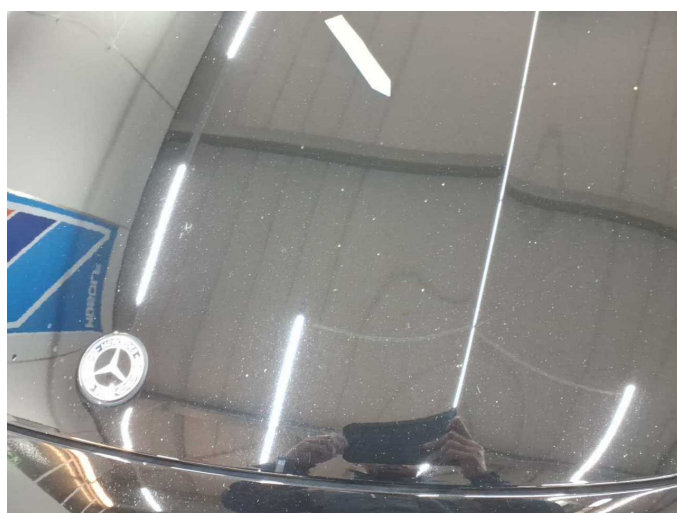

**Damage 2:** Bonnet: Bonnet - Stone chips - Paint

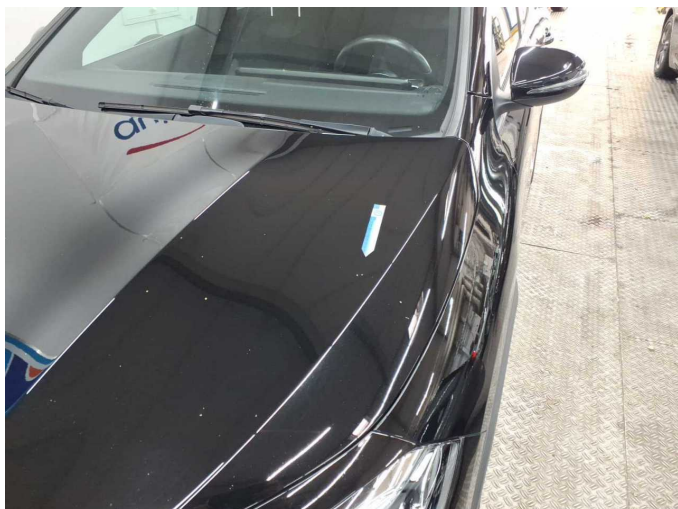

**Damage 2:** Bonnet: Bonnet - Stone chips - Paint

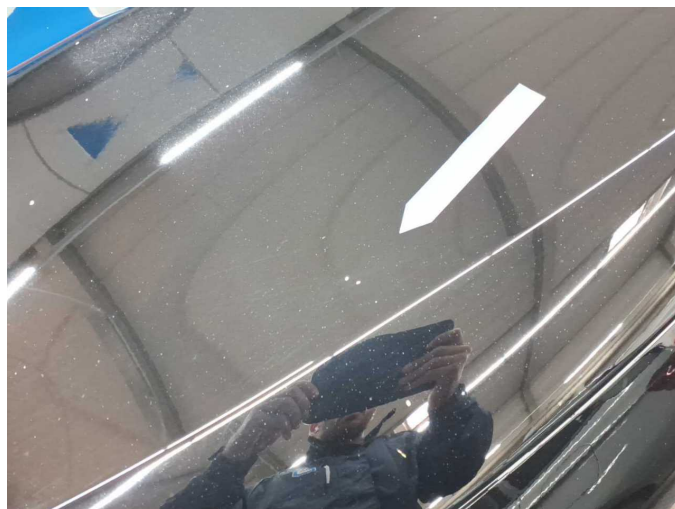

**Damage 2:** Bonnet: Bonnet - Stone chips - Paint