



Expertise

Protocol number: 46694035
Order No. / Reference: 26701192
Inspection date: 24 Jul 2026

Manufacturer: Toyota

Model: Aygo X S-CVT Play

VIN: JTDAGNAC000112481



Vehicle details	
Manufacturer / Type / Model / Equipment	
Toyota Aygo X S-CVT Play	
Vehicle Identification number	JTDAGNAC000112481
Mileage (Read)	77,874 km
First registration	31 May 2023
Number of holders	1
Next periodical technical inspection	05/2028
(Report on hand)	
Fuel type	Petrol
Engine displacement / Cylinder	998 ccm / 3
Power	53 kW
Gearbox / Number of gears	Automatic / 1
Type of drive	Front drive
Type of vehicle	Saloon car
Colour / colour code	Schneeweiß
Doors / Seats	5 / 4
Upholstery type	Cloth
Colour of upholstery	Black-Grey
Vehicle with smoke odor	no



Vehicle details			
Maintenance booklet / proof	digital proof / complete	Next maintenance in	12,186 km
Last service on / at	04/2026 at 75,009 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GV454432
Previous damage / Accident	Detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	7104 / AAL 00018		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	1,360 kg	Empty weight	

Tyres				
Mounted tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	175/65 R17 87H	All-season tyres on Steel rim with wheel cover	Goodyear	4mm / 4mm
2)	175/65 R17 87H	All-season tyres on Steel rim with wheel cover	Goodyear	6mm / 6mm

Replacement				
Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 03/2029		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- | | |
|--|---|
| <ul style="list-style-type: none"> • Automatic low beam • Anti-lock braking system (ABS) • Brake light: third in LED • Light grey headliner • Bicycle carrier preparation • High Beam Assist (AHB) • Fresh air and pollen filter • Speed limiter • Transmission: continuously variable automatic transmission • Heated rear window • Interior mirror dimming • Headrests (4) • LED daytime running lights • Steering wheel integrated controls • Radio: Toyota Touch multimedia system (Apple CarPlay and Android Auto - DAB (Digital Audio Broadcast) - USB port - Bluetooth hands-free system) • Wheels: Steel rims 5 J x 17" (with tires 175/65) • Split-folding rear seat backrest • Manual headlight height adjustment • Makeup mirror in sun visor on driver's side • Seats: Driver's seat • 12V socket, front • Toyota Safety Sense • Door handles painted in car color • Immobiliser | <ul style="list-style-type: none"> • Airbags: 6 airbags • Electrically adjustable and heated exterior mirrors • Dynamic brake light • eCall emergency call system • electric front windows • Follow-me-home function • luggage compartment cover • Adaptive cruise control (ACC) • Cup holders, front and rear • Front and rear seatbelt warning system, visual and audible • rear window wiper • ISOFIX child seat attachment • Paint finish: Solid • Steering wheel: 3-spoke leather steering wheel • Upholstery: Cloth • Radio accessories: 4 speakers • Tire Pressure Monitoring System (TPWS) • Tire repair kit • Reversing camera with guide lines • Windscreen wipers with interval setting • Makeup mirror in the sun visor on the passenger side • Power steering • Start-stop system • Bumpers in body color • Traction control (TRC) • Door lock with child safety lock at the rear • Central locking |
|--|---|

Extra equipment

- | | |
|---|---|
| <ul style="list-style-type: none"> • All-weather tires | <ul style="list-style-type: none"> • Package: Comfort Package Play (8-inch touch multimedia display - automatic climate control - rain sensor - heated seats for driver and front passenger - smart key system - keyless opening/closing of the vehicle via driver and front passenger doors and tailgate - starting the engine via start/stop button) |
|---|---|

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.



Value reducing factors

No.	Component group	Description
1	Rear bumper	Rear bumper - Scratch(es) - Smart repair
2	Door - rear right side	Door - dent(s) - Smart repair
3	Wheel / tyres	Tyre - front - does not meet manufacturer specifications - Replace
4	Sill - right side	Trim - Scratched - Replace

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Rear, Side right, Provided by user / customer, from 4 Jul 2024	2.559,82 €

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front

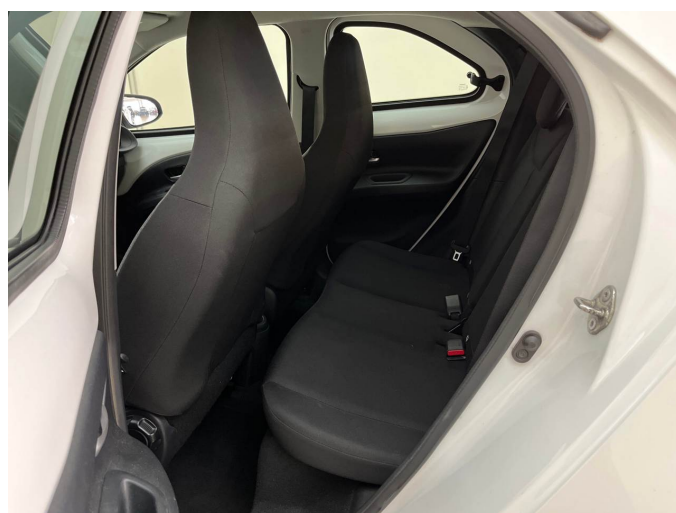


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

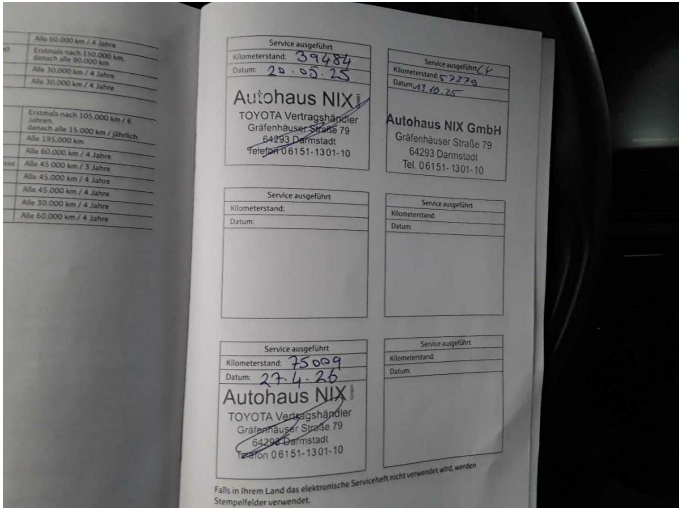


Figure 14: Documents

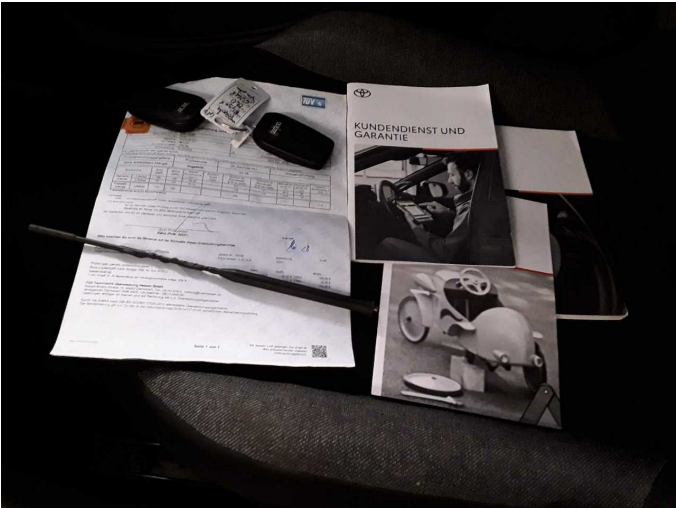


Figure 15: Documents



Figure 16: Documents



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.




Figure 22: Misc.




Figure 23: Misc.



Figure 24: Misc.

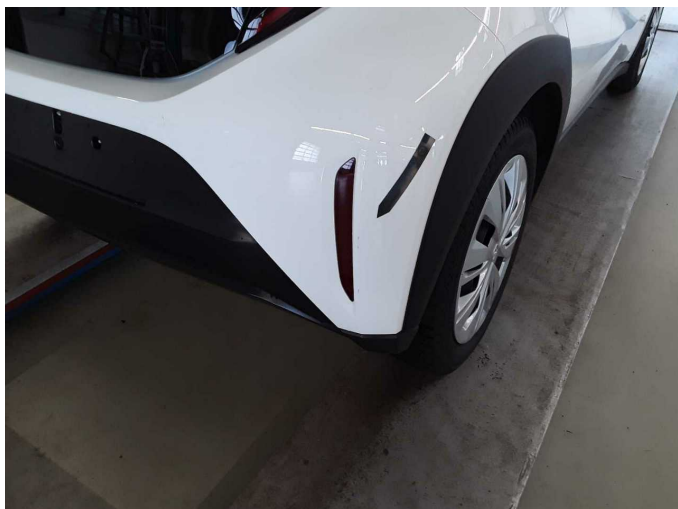


Damage 1: Rear bumper: Rear bumper - Scratch(es) - Smart repair

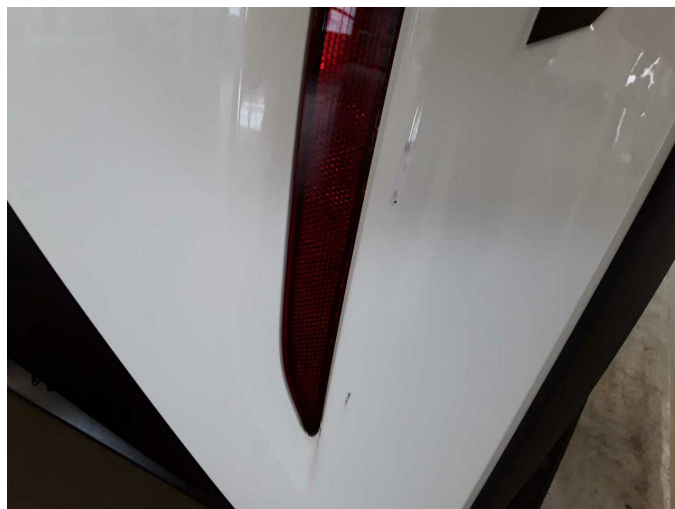

Damage 1: Rear bumper: Rear bumper - Scratch(es) - Smart repair



Damage 2: Door - rear right side: Door - dent(s) - Smart repair

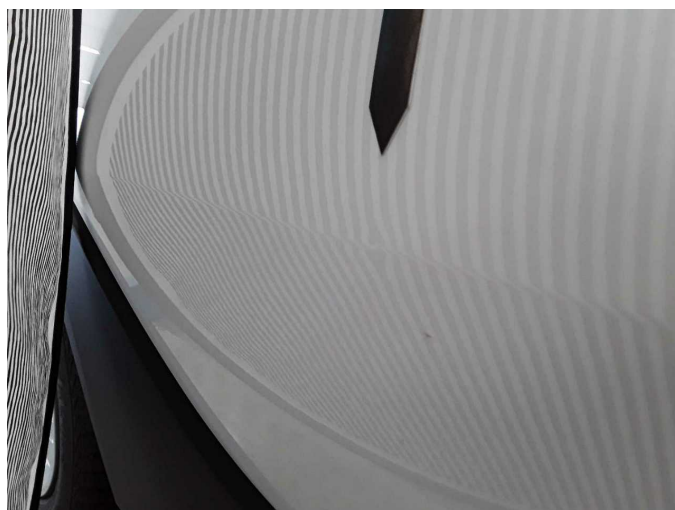


Damage 2: Door - rear right side: Door - dent(s) - Smart repair



Damage 3: Wheel / tyres: Tyre - front - does not meet manufacturer specifications - Replace



Damage 3: Wheel / tyres: Tyre - front - does not meet manufacturer specifications - Replace

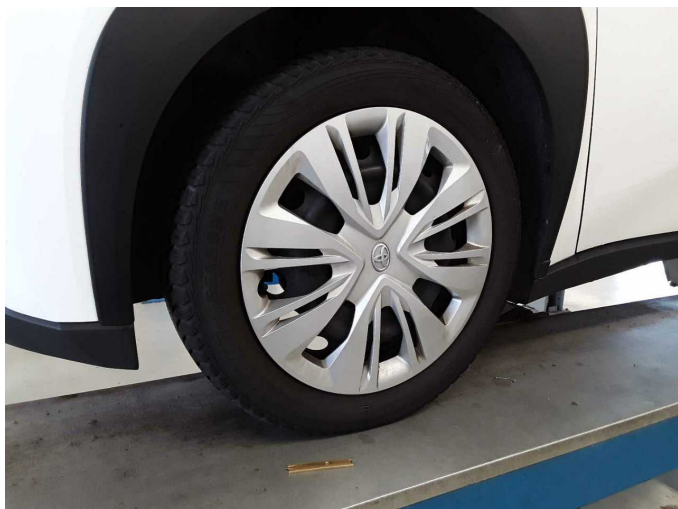

Damage 3: Wheel / tyres: Tyre - front - does not meet manufacturer specifications - Replace



Damage 3: Wheel / tyres: Tyre - front - does not meet manufacturer specifications - Replace



Damage 4: Sill - right side: Trim - Scratched - Replace



Damage 4: Sill - right side: Trim - Scratched - Replace



Damage 4: Sill - right side: Trim - Scratched - Replace



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: JTDAGNAC000112481
Hersteller / Modell: TOYOTA TOYOTA Aygo X S-CVT Play

Datum	KM-Stand	Beschreibung
27.05.2026	76.123	AU
27.04.2026	75.009	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
17.12.2025	57.379	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
20.05.2025	39.484	Bremsflüssigkeit ern; Motoröl b. Wartung; Regelwartungsdienst