



Expertise

Protocol number: 45793478
Order No. / Reference: 26319267
Inspection date: 4 Jun 2026

Manufacturer: Audi

Model: A4 Avant 40 TDI S tronic advanced

VIN: WAUZZZF47RA024716



Vehicle details	
Manufacturer / Type / Model / Equipment	
Audi A4 Avant 40 TDI S tronic advanced	
Vehicle Identification number	WAUZZZF47RA024716
Mileage (Read)	58,784 km
First registration	25 Oct 2023
Number of holders	1
Power / Engine displacement	150 kw / 1,968 ccm
Fuel type / Cylinder	Hybrid Diesel / E / 4
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Manhattangrau Metallic (X7L)
Doors / Seats	5 / 5
Upholstery type	Part leather
Colour of upholstery	Black



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	1,300 km
Last service on / at	04/2025 at 31,594 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GY304161
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	0588 / BWG 00721		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,175 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/50 R17 94H	Summer tyres on Light alloy	Michelin	4mm / 4mm
2)	225/50 R17 94H	Summer tyres on Light alloy	Michelin	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/50 R17 98H	Winter tyres on Light alloy	Dunlop	4mm / 4mm
2)	225/50 R17 98H	Winter tyres on Light alloy	Dunlop	6mm / 6mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
N	125/70 R19	Summer tyres on Light alloy		3 mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- AdBlue tank (12 liters)
- Airbag: Front side airbags and head airbag system
- Anti-lock braking system (ABS)
- Audi connect emergency call & service with Audi connect Remote & Control
- Electrically adjustable and heated exterior mirrors
- Vehicle tool kit
- Fabric headliner
- Decorative inlays diamond lacquer silver grey
- Tachometer
- Door sill trims with aluminum inlay at the front
- Electronic Differential Lock (EDS)
- Driver information system with color display
- electric window regulator
- Remote key, without SafeLock
- Cruise control system with speed limiter
- rear window wiper
- Interior lighting
- Camera-based traffic sign recognition
- ISOFIX child seat attachment and Top Tether for the outer rear seats
- Headrests (5)
- Manual cargo cover
- Steering wheel: Leather steering wheel in 3-spoke design with multifunction
- Mild hybrid
- Non-smoking version
- Wheel: Tires optimized for rolling resistance, speed-limited
- Radio: MMI Radio plus
- Headlights using LED technology
- Seats: Standard front seats
- Seats: Front seats manually adjustable
- Start-stop system
- Glazing: Windscreen in heat-insulating and acoustic glazing
- Airbag for driver and front passenger
- Accent areas matte black
- Traction control (ASR)
- Audi drive select
- Audi pre sense city
- Exterior mirror housings in body color
- third brake light, raised
- Black roof rails
- Diesel particulate filter (DPF)
- Parking assistance plus
- Electromechanical parking brake
- Electronic Stability Control (ESC)
- Chassis: Standard chassis
- Window channel strips in black (rubber)
- front and rear floor mats
- Transmission: S tronic 7-speed
- Top speed limited to 210 km/h
- Interior mirror dimming
- Child lock
- Automatic air conditioning
- boot floor mat
- Loading floor
- LED taillights
- Steering column, manually adjustable in height and axis
- Light/rain sensor
- front center armrest
- Wheel: Alloy wheels, 5-arm dynamic (size 7.5J x 17 with tires 225/50 R17)
- Tire pressure monitoring system
- Electromechanical power steering
- Seats: Rear seat backrest foldable
- Lane Departure Warning
- First aid kit with warning triangle
- Electronic immobilizer
- Central locking "Keyless-Go" without deadbolt



Extra equipment

- Electrically adjustable, heated and folding exterior mirrors, automatically dimming on both sides (including curb view function for passenger-side exterior mirror with integrated LED turn signal, including heated windshield washer nozzles; the curb view function folds the passenger-side mirror down when reverse gear is engaged, giving the driver a better view of the curb edge)
- Electrically operated tailgate (The tailgate can be opened electrically by pressing the button on the vehicle key, in the driver's door, or the soft-touch button on the tailgate handle. Closing the tailgate is just as easy and convenient: simply press the button on the inside of the tailgate, the button in the driver's door, or the button on the vehicle key. A soft-close mechanism makes manual closing easier when necessary.)
- Interior design selection package
- MMI Navigation plus with MMI touch (navigation system with 10.1-inch color display, 3D map display, MMI search, MMI touch, online traffic information, online map updates, driver information system with 7-inch display, Audi connect navigation & infotainment, country information, extended 3D city models, detailed route information, personal route assistance, voice control, MMI Radio plus, USB interface, Bluetooth interface (hands-free calling and streaming))
- On-board tools and jack (in the luggage compartment)
- Wheel: Winter light alloy wheels 5-parallel spokes (size 7.0 J x 17 with winter tires 225/50 R 17 - suitable for snow chains, maximum permissible speed 210 km/h)
- Assistance package city package with assistance package parking
- Decorative inlay in grey aluminum ellipse
- High-beam assist (within the system's limitations, it automatically detects oncoming headlights, taillights of other road users, and light sources in built-up areas. Depending on the traffic situation, the high beams are automatically switched on or off. The system thus improves the driver's visibility and increases comfort.)
- Hold assist (holds the vehicle indefinitely after stopping on typical road inclines and declines. The system is activated by pressing a button and allows the driver to start off comfortably.)
- Interior mirror, automatically dimming, frameless
- Paint finish: Metallic
- Seat covers in leather/artificial leather mono.pur 550 combination (for standard seats: - center section of the front seats and outer rear seats, driver's side bolster in the entry area in leather - side bolsters, headrests, center armrest and middle rear seat in artificial leather mono.pur 550)
- Steering wheel: Sport contour leather steering wheel in 3-spoke design, flattened at the bottom with multifunction plus (with more contoured steering wheel rim; adjustable in height and distance; with 12 multifunction buttons for convenient operation of the available infotainment features with shift paddles for manual gear changes in automatic transmissions)
- Wheel: Spare wheel, space-saving

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Body	Body (Lackaufbereitung) - Soiled - Clean
2	Vehicle glazing	Rear window - Scratch(es) - Loss in value
3	2nd wheel set	2 tyres - Does not meet the leasing specifications - Replace
4	Door - front left side	Door - Scratch(es) - Repair and paint
5	Vehicle glazing	Windscreen - Stone chips - Replace
6	Front bumper	Front bumper - Deformed - Replace



Wear and tear

No.	Component group	Description
1	Rear bumper	Rear bumper - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

ALPHABET



Figure 1: Diagonal front (left)

ALPHABET



Figure 2: Diagonal front (right)

ALPHABET



Figure 3: Diagonal rear (left)

ALPHABET



Figure 4: Diagonal rear (right)

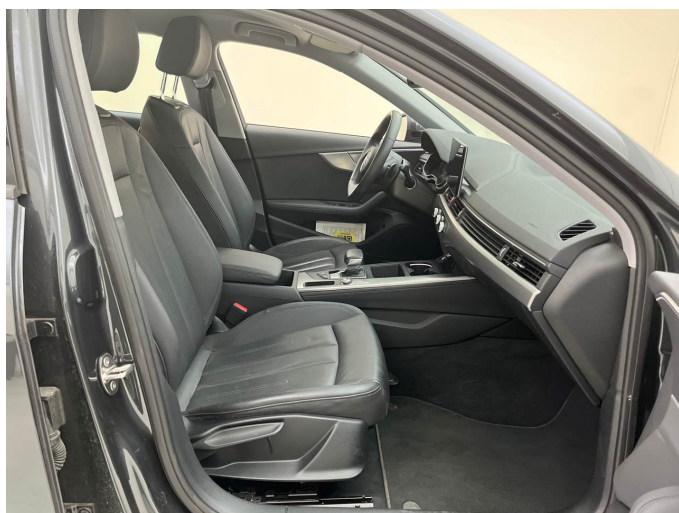


Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

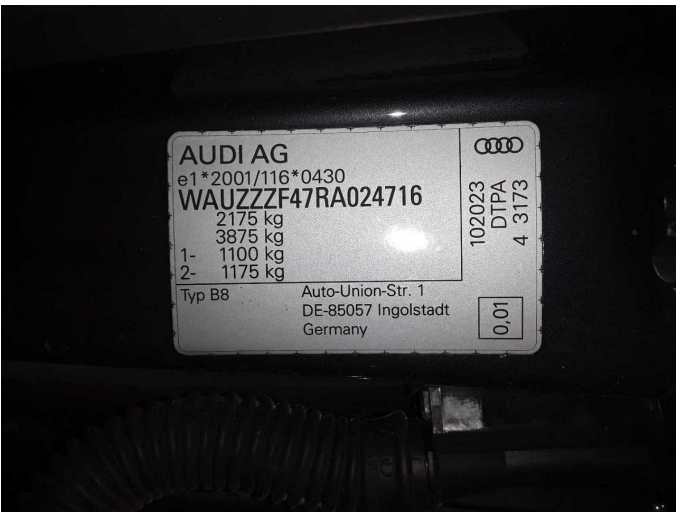


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents



Figure 15: Documents



Figure 16: Additional tyres

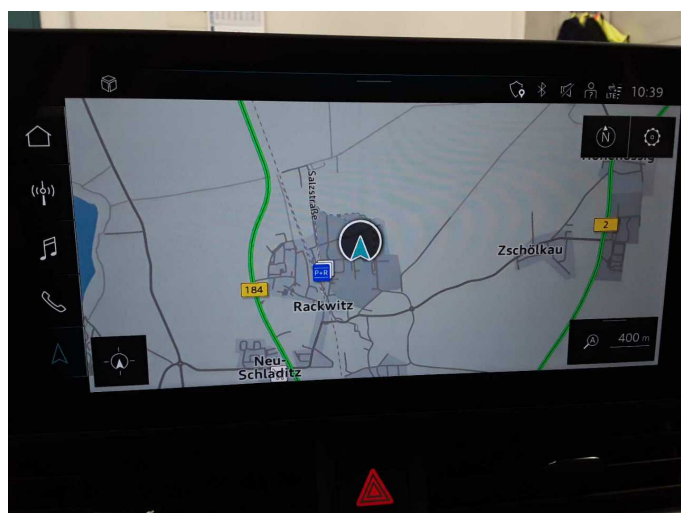


Figure 17: Navigation

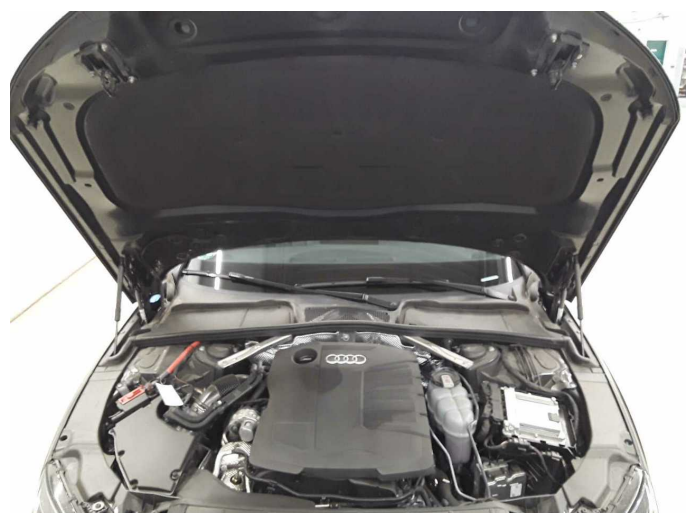


Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.

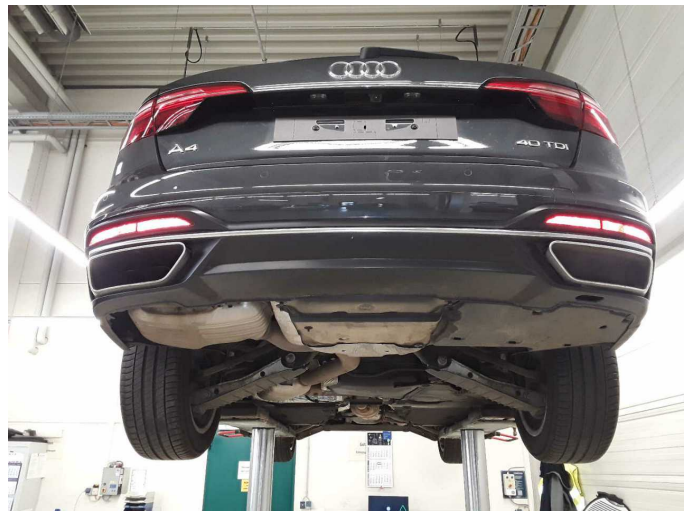


Figure 22: Misc.

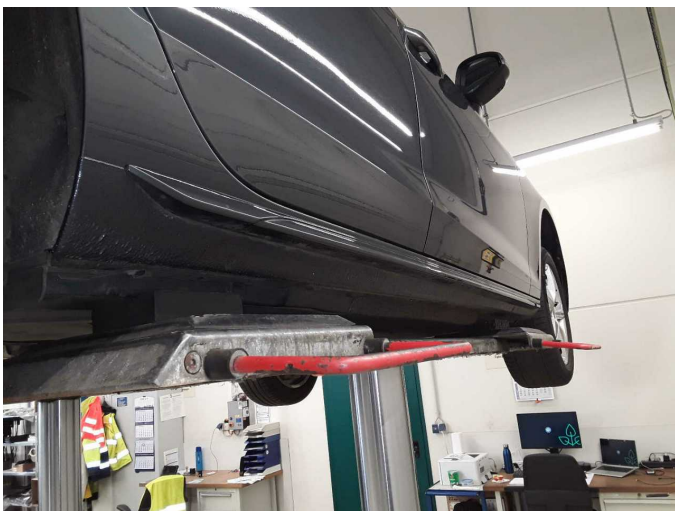


Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Damage 1: Body: Body (Lackaufbereitung) - Soiled - Clean



Damage 1: Body: Body (Lackaufbereitung) - Soiled - Clean



Damage 1: Body: Body (Lackaufbereitung) - Soiled - Clean



Damage 1: Body: Body (Lackaufbereitung) - Soiled - Clean




Damage 1: Body: Body (Lackaufbereitung) - Soiled - Clean




Damage 1: Body: Body (Lackaufbereitung) - Soiled - Clean




Damage 2: Vehicle glazing: Rear window - Scratch(es) - Loss in value

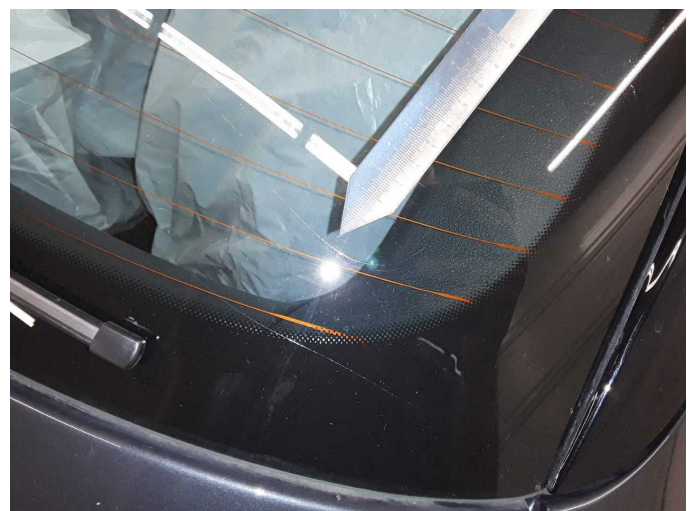

Damage 2: Vehicle glazing: Rear window - Scratch(es) - Loss in value

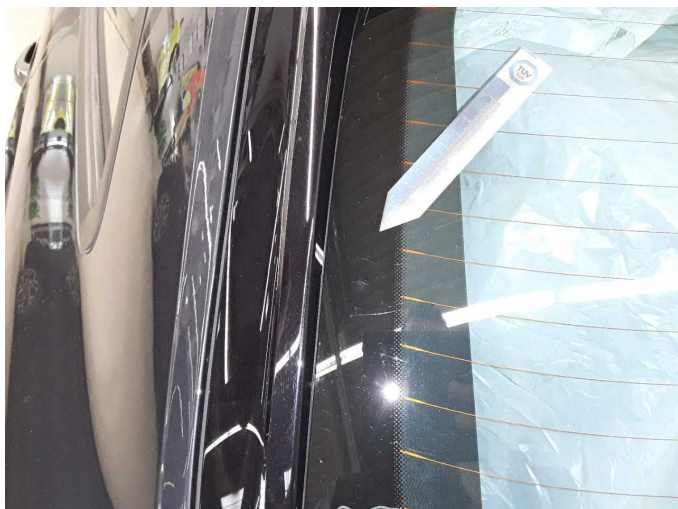


Damage 2: Vehicle glazing: Rear window - Scratch(es) - Loss in value

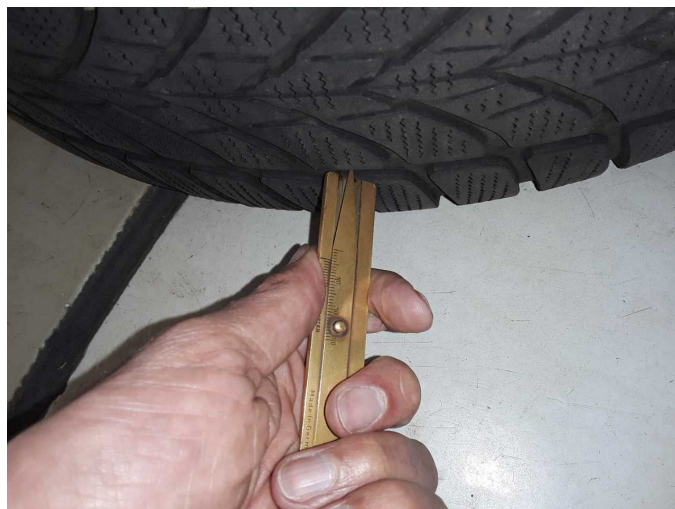

Damage 3: 2nd wheel set: 2 tyres - Does not meet the leasing specifications - Replace




Damage 3: 2nd wheel set: 2 tyres - Does not meet the leasing specifications - Replace

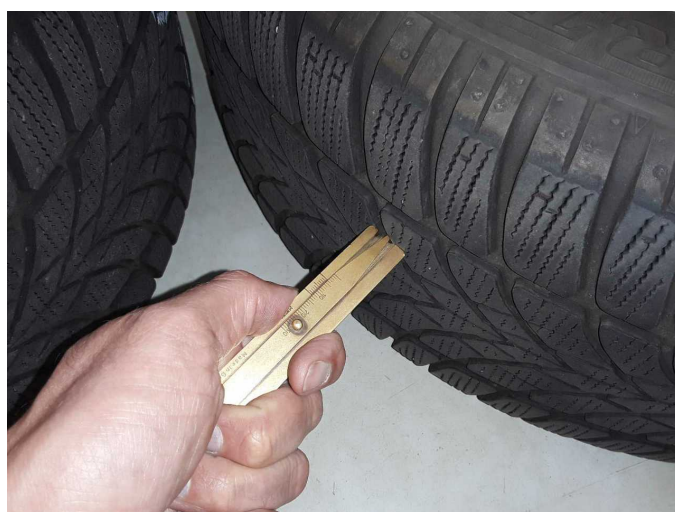


Damage 3: 2nd wheel set: 2 tyres - Does not meet the leasing specifications - Replace



Damage 3: 2nd wheel set: 2 tyres - Does not meet the leasing specifications - Replace

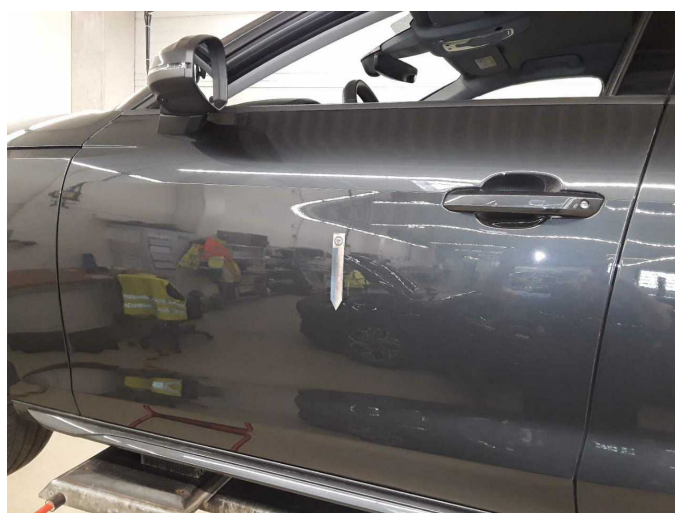

Damage 4: Door - front left side: Door - Scratch(es) - Repair and paint

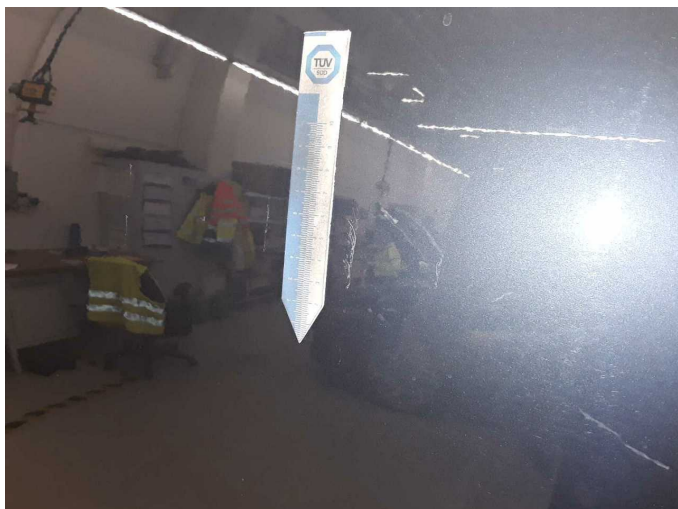

Damage 4: Door - front left side: Door - Scratch(es) - Repair and paint




Damage 4: Door - front left side: Door - Scratch(es) - Repair and paint



Damage 5: Vehicle glazing: Windscreen - Stone chips - Replace



Damage 5: Vehicle glazing: Windscreen - Stone chips - Replace

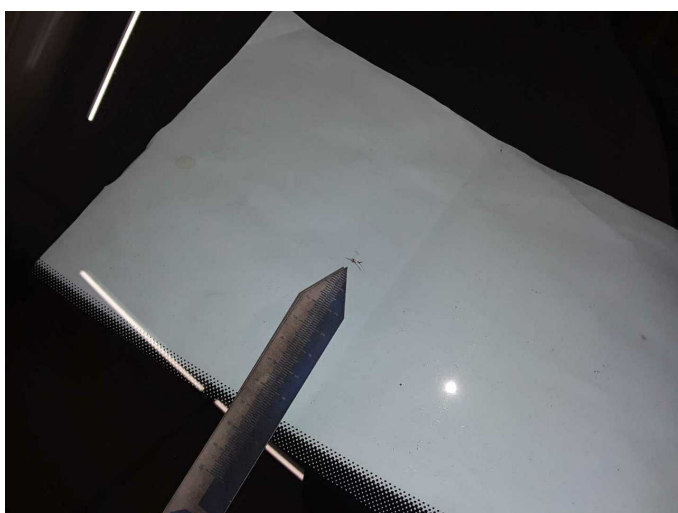

Damage 5: Vehicle glazing: Windscreen - Stone chips - Replace



Damage 6: Front bumper: Front bumper - Deformed - Replace



Damage 6: Front bumper: Front bumper - Deformed - Replace



Damage 6: Front bumper: Front bumper - Deformed - Replace



Damage 6: Front bumper: Front bumper - Deformed - Replace



Damage 6: Front bumper: Front bumper - Deformed - Replace



Damage 6: Front bumper: Front bumper - Deformed - Replace



Damage 6: Front bumper: Front bumper - Deformed - Replace



Damage 6: Front bumper: Front bumper - Deformed - Replace



Damage 6: Front bumper: Front bumper - Deformed - Replace



Damage 6: Front bumper: Front bumper - Deformed - Replace



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WAUZZZF47RA024716

Hersteller / Modell: AUDI AUDI A4 Avant 40 TDI S tronic advanced

Datum	KM-Stand	Beschreibung
10.12.2025	49.306	Bremsflüssigkeit; Bremsflüssigkeit ern
24.04.2025	31.594	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges