



Expertise

Protocol number: 45624623
Order No. / Reference: 26484856
Inspection date: 27 May 2026

Manufacturer: Audi	Model: A6 40 TDI quattro S tronic sport
VIN: WAUZZZF23PN025964	



Vehicle details	
Manufacturer / Type / Model / Equipment	
Audi A6 40 TDI quattro S tronic sport	
Vehicle Identification number	WAUZZZF23PN025964
Mileage (Read)	101,224 km
First registration	14 Nov 2022
Number of holders	1
Next periodical technical inspection	10/2027
(Report on hand)	
Power / Engine displacement	150 kw / 1,968 ccm
Fuel type / Cylinder	Hybrid Diesel / E / 4
Gearbox / Number of gears	Automatic / 7
Type of drive	All-wheel drive
Type of vehicle	Saloon car
Colour / colour code	Brillantschwarz
Doors / Seats	4 / 5
Upholstery type	Cloth / leather combination
Colour of upholstery	Black-Anthracite
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	2,500 km
Last service on / at	11/2025 at 90,200 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GP812443
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	short drive on the company premises	Engine function test	Performed
Manufacturer key number/ type code number	0588 / BTO 02253		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,325 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/60 R17 103V	Winter tyres on Light alloy	Pirelli	4mm / 4mm
2)	225/60 R17 103V	Winter tyres on Light alloy	Pirelli	3mm / 3mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	245/45 R19 102Y	Summer tyres on Light alloy	Pirelli	5mm / 5mm
2)	245/45 R19 102Y	Summer tyres on Light alloy	Pirelli	5mm / 5mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 12/2027		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- AdBlue tank (12 liters)
- Airbag: Front side airbags and head airbag system
- Anti-lock braking system (ABS)
- Audi connect emergency call & service m.connect remote & control
- Electrically adjustable and heated exterior mirrors
- third brake light
- Decorative inlays aluminum fragment
- Tachometer
- Door sills with aluminum inlay front and rear
- Driver information system with color display
- Automatically opening luggage compartment lid/manually opening luggage compartment lid
- Interior lighting
- ISOFIX child seat attachment and Top Tether for the outer rear seats
- Paint finish: Solid
- Steering wheel: Leather steering wheel, 3-spoke, with multifunction and paddle shifters
- MMI navigation with MMI touch response
- Non-smoking package
- Wheel: Alloy wheels, 5-arm design
- Wheel: Tire repair kit
- Radio accessories: 8 speakers (passive) front and rear
- Seats: 4-way lumbar support
- Sun visor on driver and passenger side
- Start-stop system
- Glazing: Rear window, rear door and side windows in clear glass
- Central locking
- Airbag for driver and front passenger
- "quattro" all-wheel drive with ultra technology
- Audi connect navigation & infotainment
- Audi drive select
- Audi pre sense front
- Exterior mirror housings in body color
- Fabric headliner
- Diesel particulate filter (DPF) with nitrogen oxide catalyst and AdBlue tank
- Electronic Stability Control (ESC)
- key fob
- Cruise control system including speed limiter
- Transmission: S tronic 7-speed
- Interior mirror dimming
- 2-zone automatic climate control
- Headrests (4)
- LED headlights
- Steering column, manually adjustable in height and axis
- front center armrest
- Package Gloss
- Progressive steering
- Wheel: Tire pressure monitoring system
- Radio: MMI Radio plus with MMI touch response
- Seat covers in fabric
- Seats: Front sports seats
- Lane Departure Warning
- Glazing: Windscreen in heat-insulating glazing
- Electronic immobilizer
- Thermal insulation glazing on the sides and rear



Extra equipment

- Audi virtual cockpit plus (3 individual display options: Dynamic, Sport and Classic - operation via the multifunction steering wheel - configuration of on-board computer values in the tachometer - display of the navigation map as a 3D terrain model on the high-resolution 12.3-inch full HD color display - permanent display of navigation information in the speedometer area when route guidance is active - break recommendation)
- Fuel tank (73 liters) (fuel tank for 73 liters of gasoline/diesel fuel)
- Assistance Package Tour
- Audi pre sense Rear Package (Side airbags in the rear as a supplement to the front side airbags and the head airbag system. The reversible rear seat belt tensioners are a supplement to the reversible front seat belt tensioners included in Audi pre sense basic. In emergency and dangerous braking situations and in extreme driving dynamics, a preventive tightening of the seat belts is initiated in addition to the measures included in Audi pre sense basic, in order to reduce forward or lateral movement of the rear occupants.)
- Black Optics Package (black accents in the area of the Audi Singleframe, the trim strips on the side windows, the front and rear bumpers including tailpipe trims - exterior mirror housings in black)
- S line Sport package (5-arm alloy wheels (S design), 8.5J x 19 with 245/45 R19 tires, sport suspension, illuminated front and rear door sills, front door sills with S lettering, S line emblem on front fenders, 3-spoke sport leather steering wheel with multifunction controls and shift paddles, steering wheel grips and selector lever knob with S emblem in perforated leather, S line seat covers in fabric/leather combination with S embossing on the front seat backrests, brushed dark aluminum trim, interior, dashboard and headliner in black, stainless steel footrest and pedals, floor mats)
- Seats: Split-folding rear seat backrest
- Front and rear seat heating (heats seat and backrest center panels; with leather upholstery, sport seats and sport seats plus also seat side bolsters - individually adjustable in multiple stages for driver and front passenger on the climate control unit - additionally for the outer rear seats, separately adjustable in multiple stages)
- Glazing: Sun protection glazing, tinted (rear window, rear door and side windows tinted)
- Electrically adjustable, heated and folding exterior mirrors, automatically dimming on both sides
- Decorative inlay in dark, matt brushed aluminum
- Parking aid plus with surround view
- High beam assist
- Instrument panel and door trim, two-piece, single/multi-color
- Interior elements in synthetic leather (top and bottom) (instrument panel and door sills in synthetic leather black or granite grey; armrest in the doors; center console trim in synthetic leather black, okapi brown, pearl beige; in conjunction with S line sport package: black with contrast stitching in rock grey or rotor grey with contrast stitching in anthracite; in conjunction with Audi design selection: black with contrast stitching in rock grey or pearl beige with contrast stitching in agate grey or sardine brown with contrast stitching in steel grey)
- Business Package (Assistance Package Tour: Adaptive Driving Assistant supports the driver with acceleration, braking, maintaining speed and distance, and lane keeping. Adaptive Cruise Control, Speed Limiter. Efficiency Assistant supports the driver with predictive driving. Parking Aid Plus, 4-zone automatic climate control, heated front seats, Audi phone box, automatically dimming interior mirror, automatically dimming exterior mirrors, adaptive windscreen wipers with integrated washer nozzles, high-beam assistant)
- Package: Storage package (2 cup holders in the rear center armrest, luggage compartment net for fixing to the lashing eyes on the luggage compartment floor)
- Wheel: Light alloy wheels, 10-spoke dynamic design
- Radio accessories: Audi sound system (10 speakers including center speaker and subwoofer - 6-channel amplifier - total output of 180 watts)
- Headlight cleaning system
- Seat covers in fabric combination Sequenz/leather with S-embossing
- Phone: Audi Phone Box
- Telephone: Audi smartphone interface (The Audi smartphone interface (Android Auto and Apple CarPlay) connects your smartphone to your Audi and seamlessly displays your smartphone content directly on the MMI display via USB. Navigation, telephony, music and selected third-party apps can be conveniently controlled via the MMI touchscreen as well as via voice control on your smartphone.)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	A short maneuvering and shunting exercise was carried out on the company premises.
Engine function test	An engine test run was performed.



Value reducing factors

No.	Component group	Description
1	Wing mirror - right side	Cap - Scratch(es) - Smart repair
2	Side panel - rear left side	Side panel - Scratch(es) - Smart repair
3	Body	Underbody panelling - Broken / torn - Replace
4	Body	Underbody panelling - Broken / torn - Replace
5	Headlight	Headlight - left side - Scratch(es) - Loss in value

Wear and tear

No.	Component group	Description
1	Wheel / tyres	Tyres - complete set (4mm) - Does not meet the leasing specifications - No deduction
2	Body	Body - Scratch(es) - No deduction
3	Door - front right side	Door edge - Scratch(es) - No deduction
4	Rear bumper	Spoiler - Scratch(es) - No deduction
5	Door - front left side	Door edge - Scratch(es) - No deduction
6	Bonnet	Bonnet - Scratch(es) - No deduction
7	Vehicle glazing	Windscreen - Stone chips - No deduction
8	Roof	Roof - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Front, Side - left, Professionally repaired, Invoice of repair done Non-existent, from 7 May 2023	18.945,69 €

Repainting

No.	Repainting
1	Roof rail - right side, Professionally carried out, Invoice of repair done Non-existent
2	Boot lid / rear door, Professionally carried out, Invoice of repair done Non-existent
3	Mudguard - right side, Professionally carried out, Invoice of repair done Non-existent
4	Bonnet, Professionally carried out, Invoice of repair done Non-existent
5	Side panel - rear left side, Professionally carried out, Invoice of repair done Non-existent
6	Door - front left side, Professionally carried out, Invoice of repair done Non-existent
7	Door - front right side, Professionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Roof rail - right side	184 µm	Boot lid / rear door	392 µm
Mudguard - right side	222 µm	Bonnet	210 µm
Side panel - rear left side	200 µm	Door - front left side	199 µm
Door - front right side	174 µm		



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

Professionally repaired previous damages were found at the vehicle.

Comments

Der montierte Winterradsatz ist kein Bestandteil der Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN

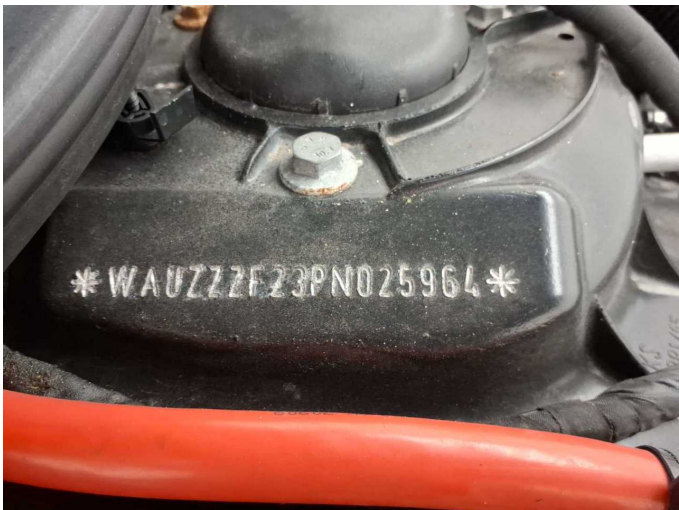


Figure 12: VIN



Figure 13: Mounted tyres



Figure 14: Documents



Figure 15: Documents



Figure 16: Documents



Figure 17: Additional tyres



Figure 18: Navigation



Figure 19: Misc.

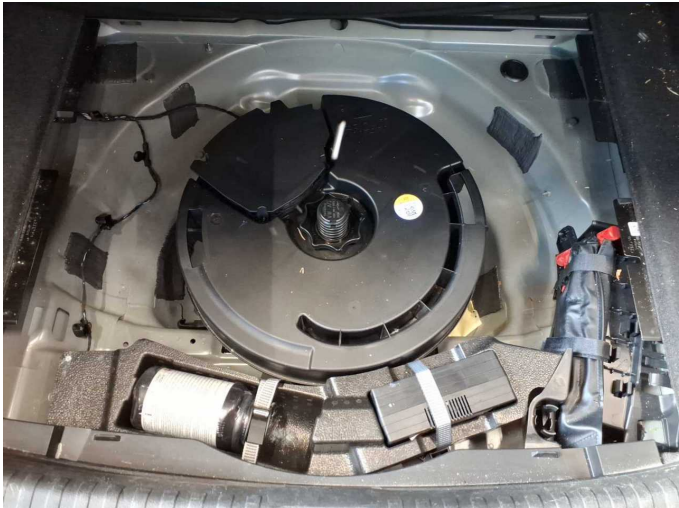


Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.

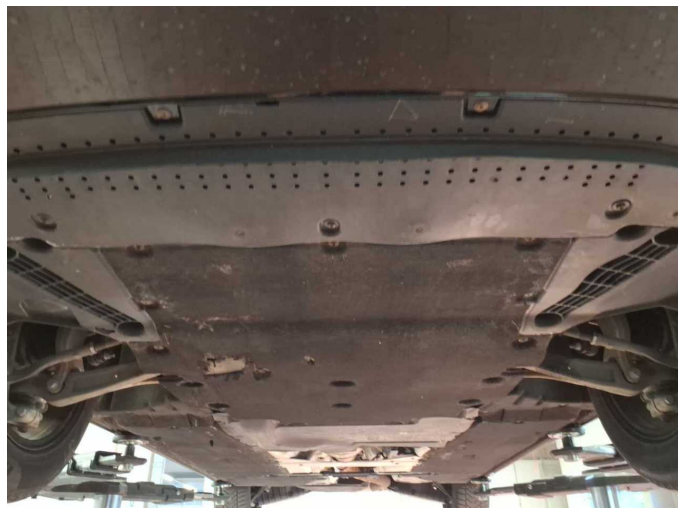


Figure 32: Misc.



Damage 1: Wing mirror - right side: Cap - Scratch(es) - Smart repair



Damage 1: Wing mirror - right side: Cap - Scratch(es) - Smart repair



Damage 2: Side panel - rear left side: Side panel - Scratch(es) - Smart repair



Damage 2: Side panel - rear left side: Side panel - Scratch(es) - Smart repair



Damage 3: Body: Underbody panelling - Broken / torn - Replace



Damage 3: Body: Underbody panelling - Broken / torn - Replace




Damage 4: Body: Underbody panelling - Broken / torn - Replace



Damage 4: Body: Underbody panelling - Broken / torn - Replace



Damage 4: Body: Underbody panelling - Broken / torn - Replace

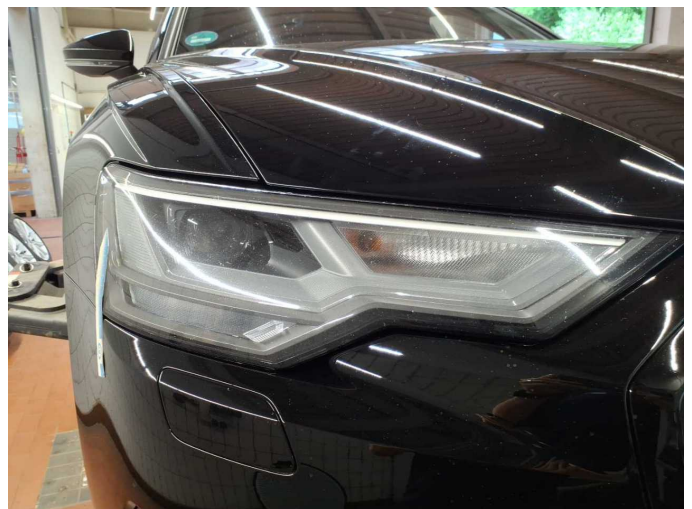

Damage 5: Headlight: Headlight - left side - Scratch(es) - Loss in value



Damage 5: Headlight: Headlight - left side - Scratch(es) - Loss in value



Repainting 1: Roof rail - right side




Repainting 2: Boot lid / rear door



Repainting 3: Mudguard - right side



Repainting 4: Bonnet

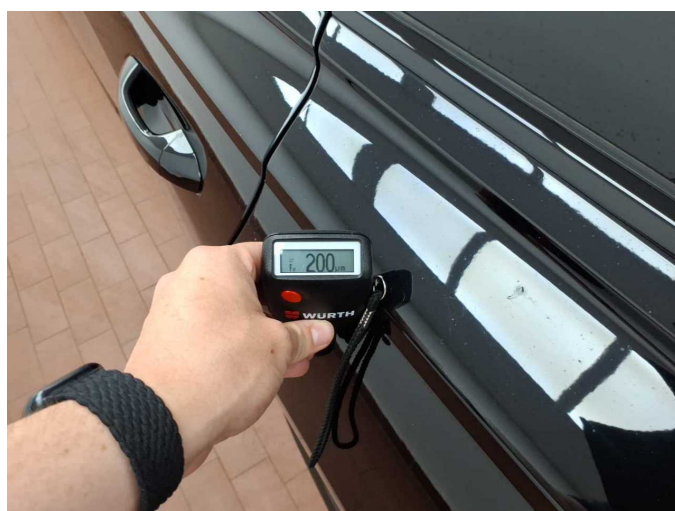

Repainting 5: Side panel - rear left side



Repainting 6: Door - front left side



Repainting 7: Door - front right side



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WAUZZZF23PN025964
Hersteller / Modell: AUDI AUDI A6 40 TDI quattro S tronic sport

Datum	KM-Stand	Beschreibung
07.11.2025	90.200	AU; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
07.02.2025	73.652	Bremsbelagfühler ern; Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben + Klötze h; Bremsscheiben + Klötze v; Bremsscheiben hinten; Bremsscheiben vorne; Regelwartungsdienst
22.11.2024	67.946	Bremsflüssigkeit; Bremsflüssigkeit ern; Getriebeöl ern/prüfen; Kraftstofffilter ern; Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Reparatur Sonstiges; Wartung Sonstiges
05.01.2024	40.247	Bremsbelagfühler ern; Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges