



Expertise

Protocol number: 46299111
Order No. / Reference: 26562482
Inspection date: 3 Jul 2026

Manufacturer: Ford	Model: Tourneo Custom 320 L1H1 VA Aut. Titanium
VIN: WF03XXTTG3MK26582	



Vehicle details	
Manufacturer / Type / Model / Equipment	
Ford Tourneo Custom 320 L1H1 VA Aut. Titanium	
Vehicle Identification number	WF03XXTTG3MK26582
Mileage (Read)	94,184 km
First registration	1 Dec 2021
Number of holders	1
Next periodical technical inspection	12/2026
(Report not on hand)	
Power / Engine displacement	136 kw / 1,995 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 6
Type of drive	Front drive
Type of vehicle	Van
Colour / colour code	Frozen White
Doors / Seats	5 / 8
Upholstery type	Leather
Colour of upholstery	Grey-Black
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	4,000 km
Last service on / at	01/2025 at 77,800 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GH382527
Previous damage / Accident	Detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	8566 / BRS 01807		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	3,240 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/60 R17 109T	Winter tyres on Light alloy	Kleber	8mm / 8mm
2)	215/60 R17 109T	Winter tyres on Light alloy	Hankook	8mm / 8mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/60 R17 109T	Summer tyres on Light alloy	Michelin	7mm / 7mm
2)	215/60 R17 109T	Summer tyres on Light alloy	Michelin	9mm / 9mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
E	215/65 R16 109T C	Summer tyres on Steel	Goodyear	9 mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- 2 batteries
- Anti-lock braking system with electronic brake force distribution (EBD)
- roof, flat
- Headliner in driver's cab
- Tachometer
- Electronic Stability Program (ESP) with Traction Control System (TCS)
- Electric front windows
- Ford Easy Fuel
- Generator, 240 A
- Transmission: 6-speed SelectShift automatic transmission
- Rear swing door with heated rear window and wiper/washer system
- Paint finish: Solid color paint
- leather steering wheel
- Emergency brake assist including emergency brake light
- Package: Style color package (Exterior mirror caps painted in body color - Side protection strips and rear bumper painted in body color - Door handles and tailgate handles painted in body color)
- Radio: Audio system 23: Ford audio system including Ford SYNC 3 with AppLink and DAB/DAB+ (Radio (FM/AM) - FordPass Connect incl. live traffic information and Wi-Fi - 8" TFT multifunction display - 10 speakers, antenna, 8 USB ports - Integrated control panel and audio remote control on the steering wheel - Ford SYNC 3 (communication and entertainment system, Bluetooth and USB, integration of various telephony functions and hands-free system, voice control, SMS readout/sending function, private mode, emergency call assistant...) - AppLink - Support for Android Auto and Apple CarPlay)
- Sliding door: Sliding door, right and left
- Front mud flaps
- Power steering
- Seats: 2 rows of seats (3-3) (in the 2nd row with 3 individual seats (removable and reversible) with adjustable backrests, height-adjustable headrests, outer armrest and 2 ISOFIX anchor points (each on the outer seat) - in the 3rd row with 3 individual seats (removable and reversible) with adjustable backrests, height-adjustable headrests, outer armrest and 2 ISOFIX anchor points (each on the outer seat))
- Auxiliary heater, electric
- Driver and passenger side airbags
- Flooring: Carpet
- On-board computer
- Roof lining in the passenger compartment
- Theft alarm system
- Third brake light
- Windows, 2nd row: Awning windows in the side windows
- Windows: Windows in the 3rd row of the passenger compartment, fixed, right and left
- Warranty: 2-year Ford new car warranty including Ford Assistance mobility guarantee
- Grab handles (B-pillar)
- Lockable glove compartment with lid
- Interior lighting front and rear with delay function
- Air conditioning front and rear (including rear water heating)
- Adjustable steering column
- Package: Visibility Package II (Heated windshield - Windscreen washer sensor - Windscreen wipers with rain sensor - Headlight assistant with day/night sensor)
- Front and rear parking pilot system
- Particulate filter: diesel particulate filter
- Tire Pressure Monitoring System (TPMS)
- Wheels/Tires: Spare wheel
- Wheels: Alloy wheels 7 J x 17 with 215/60 R 17 tires including 17" spare wheel (10-spoke design, silver painted)
- Headlight dipped beam with switch-off delay with headlight assistant with day/night sensor (halogen projector headlights with LED daytime running lights and fog lights with cornering lights)
- Sliding door entry light automatically illuminates when the door is opened
- Rear mud flaps
- Side protection strips
- Seat belts
- Sunshade roller blinds
- Start-stop system
- Power outlet: 12-volt connection
- Lashing eyes 2
- Immobiliser
- Heat-insulating glazing, medium tint level of the side window(s) of the 2nd row.
- Central locking with remote control



Extra equipment

- Electrically adjustable, heated and folding exterior mirrors with blind spot assist (with integrated turn signals - blind spot assist incl. cross traffic alert - trailer function)
- Seats: Seat Package 36 (Tourneo Custom) (Driver's seat, 5-way electrically adjustable (forward/backward, backrest, seat cushion tilt, height); single passenger seat, 4-way manually adjustable (forward/backward, backrest, seat cushion tilt, height); height-adjustable headrests; heated seats for driver and front passenger; interior armrest for driver and front passenger; electric lumbar support (driver's seat); manual lumbar support (front passenger seat); head/shoulder airbags and front side airbags; leather upholstery: seat center panels and side bolsters in leather, remaining upholstery in synthetic leather)
- Adaptive cruise control including Pre-Collision Assist (distance display and warning system, collision warning system, emergency braking assist, active lane keeping assist)
- Air suspension: Additional air suspension for the rear axle (including weight reduction to 310)
- Programmable, fuel-operated auxiliary heater
- Reversing camera with image display in the multifunction display
- Winter wheels, alloy, 17 inch

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Side panel - rear left side	Wheel arch - Scratch(es) - Smart repair
2	Bonnet	Bonnet - Paint defect - Paint

Wear and tear

No.	Component group	Description
1	Door - front left side	Door - dent(s) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

Documents - Owner's manual

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Rear, Provided by user / customer, from 18 Mar 2025	1.782,39 €



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

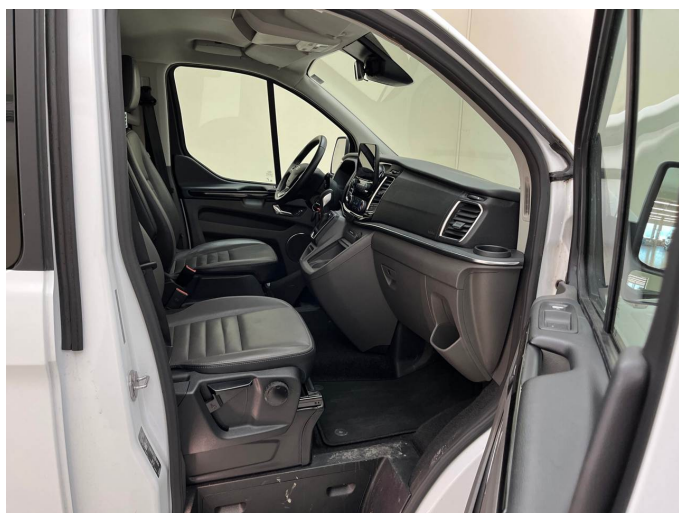


Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

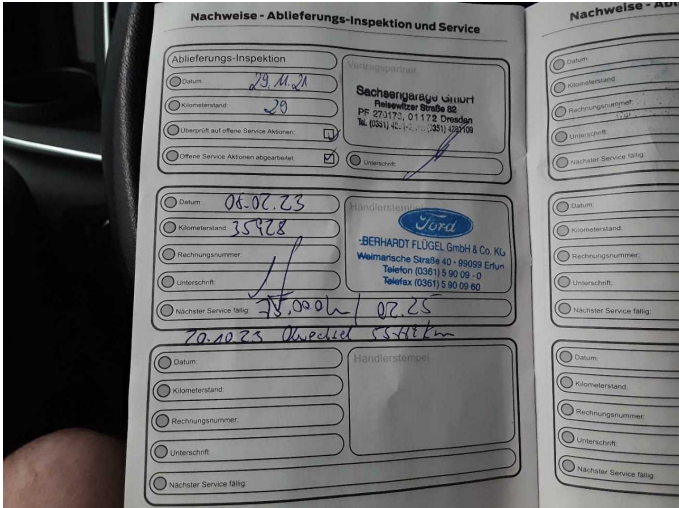


Figure 14: Documents



Figure 15: Documents



Figure 16: Additional tyres



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.

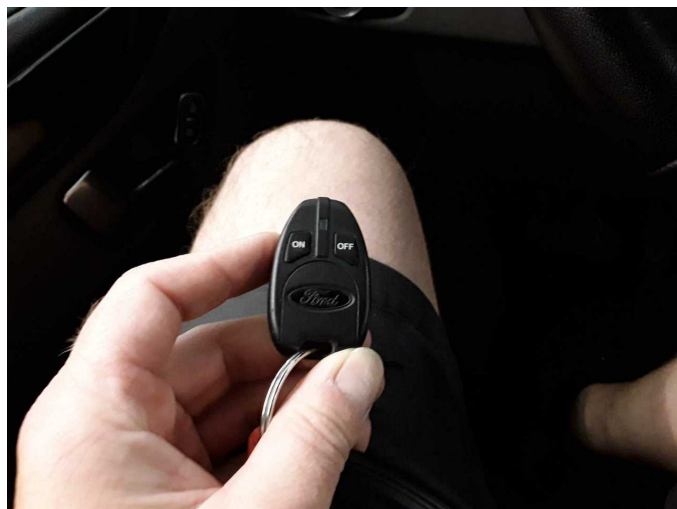


Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.

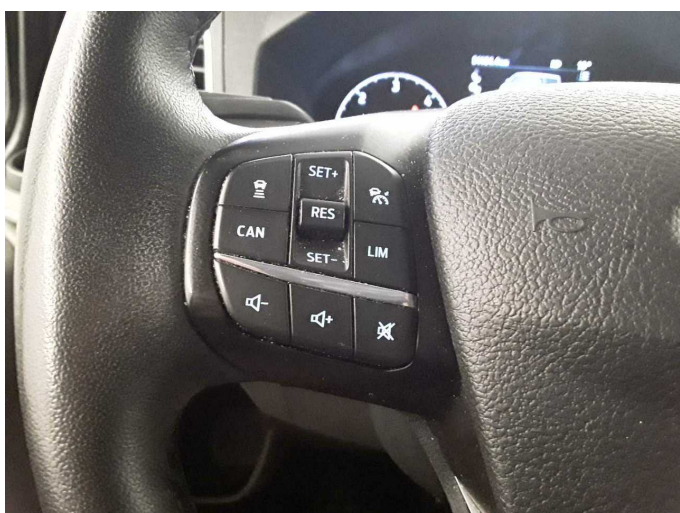


Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Damage 1: Side panel - rear left side: Wheel arch - Scratch(es) - Smart repair



Damage 1: Side panel - rear left side: Wheel arch - Scratch(es) - Smart repair




Damage 1: Side panel - rear left side: Wheel arch - Scratch(es) - Smart repair



Damage 2: Bonnet: Bonnet - Paint defect - Paint



Damage 2: Bonnet: Bonnet - Paint defect - Paint

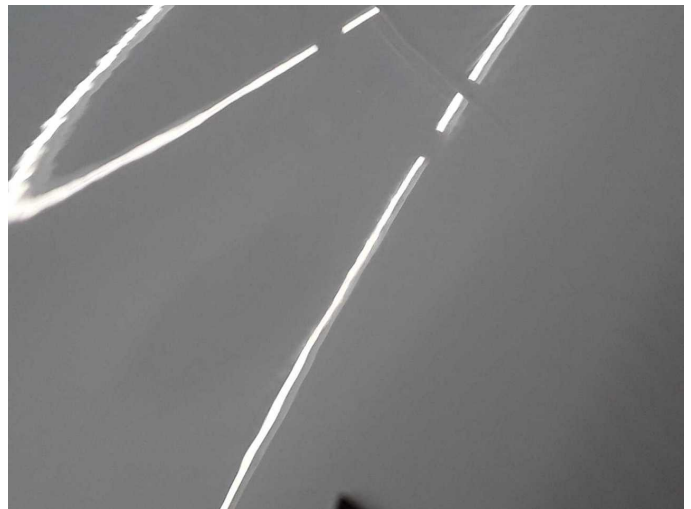

Damage 2: Bonnet: Bonnet - Paint defect - Paint



Damage 2: Bonnet: Bonnet - Paint defect - Paint



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WF03XXTTG3MK26582

Hersteller / Modell: FORD FORD Tourneo Custom 320 L1H1 VA Autm. Titanium

Datum	KM-Stand	Beschreibung
23.06.2025	84.068	Bremsbelagfühler ern; Bremse Sonstiges; Bremsklötze vorne; Bremsscheiben + Klötze v; Bremsscheiben vorne
15.01.2025	77.800	Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst
27.12.2024	77.123	HU + AU
19.10.2023	55.750	Bremsbelagfühler ern; Bremsflüssigkeit; Bremsflüssigkeit ern; Bremsklötze hinten; Motoröl b. Wartung; Ölwechsel; Systemtest/Eigendiagnose
28.07.2023	50.471	Bremsklötze vorne
02.02.2023	35.928	Ölfilter ern; Regelwartungsdienst
12.12.2022	31.211	Motoröl b. Wartung; Ölwechsel