



Expertise

Protocol number: 46264228
Order No. / Reference: 26600923
Inspection date: 1 Jul 2026

Manufacturer: Ford

Model: Focus 1.0 EcoBoost Start-Stopp-System COOL&CONNECT

VIN: WF0NXXGCHNMM35731



Vehicle details	
Manufacturer / Type / Model / Equipment	
Ford Focus 1.0 EcoBoost Start-Stopp-System COOL&CONNECT	
Vehicle Identification number	WF0NXXGCHNMM35731
Mileage (Read)	82,821 km
First registration	27 Apr 2021
Number of holders	1
Next periodical technical inspection	04/2028
(Report on hand)	
Power / Engine displacement	74 kw / 999 ccm
Fuel type / Cylinder	Petrol / 3
Gearbox / Number of gears	Manual / 6
Type of drive	Front drive
Type of vehicle	Saloon car
Colour / colour code	Frozen White
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black
Re-import	no
Vehicle with smoke odor	no
readiness to drive	Roadworthy



Vehicle details			
Maintenance booklet / proof	digital proof / complete	Next maintenance in	14 %
Last service on / at	11/2024 at 57,132 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	FZ487026
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
readiness to drive	Roadworthy		
Manufacturer key number/ type code number	8566 / BOZ 00270		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	1,855 kg	Empty weight	

Tyres				
Mounted tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 92V	Summer tyres on Light alloy	Goodyear	4mm / 4mm
2)	205/60 R16 92V	Summer tyres on Light alloy	Goodyear	4mm / 4mm
Additional tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 92H	Winter tyres on Light alloy	Semperit	5mm / 5mm
2)	205/60 R16 92H	Winter tyres on Light alloy	Semperit	7mm / 7mm
Replacement				
Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 04/2025		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Airbag: Passenger airbag deactivation
- Exterior mirrors in body color, driver and passenger side, electrically adjustable and heated
- Chrome trim (on side windows)
- Fabric headliner
- Tachometer
- Driver information system
- Lane keeping assist including lane keeping assist
- Electric parking brake with auto-hold function
- Ford ECO-Coach (signals environmentally friendly driving style)
- Luggage compartment lighting
- Speed limiter
- Cruise control
- Transmission: 6-speed manual transmission
- Illuminated glove compartment
- Back window, heater
- rear window wiper
- Interior lighting with LED technology
- Intelligent security system
- air conditioning, manual
- LED daytime running lights
- Steering wheel: 3-spoke design
- Make-up mirrors in driver and passenger sun visors
- MyKey key system (individually programmable second key)
- Fog light
- Emergency brake light
- Otto particulate filter
- Front and rear parking pilot system
- Pollen filter and dust filter
- Upholstery: Cloth
- Post-Collision Assist (In the event of a severe collision, which would also deploy the airbag and in which the driver might be incapacitated, this system initiates the braking process. This reduces the risk of colliding with further obstacles and road users after the initial collision. The driver can intervene and operate the accelerator or brake pedal manually throughout the entire process.)
- Tire Pressure Monitoring System (TPMS)
- Headlight assistant with day/night sensor
- Seats: Passenger seat, 2-way adjustable
- Seats: Map grid on the driver's and front passenger's seat backrests
- Start-stop system
- Child safety lock on the rear doors, manual
- Warning system for unfastened seat belts for the 1st and 2nd rows of seats
- Central/Double Locking
- Anti-lock braking system (ABS) with electronic brake force distribution (EBD)
- Tires: 6.5 J x 16 alloy wheels (4) with 205/60 R 16 tires (in 5x2 spoke design)
- Roof spoiler painted in car color
- Electronic Safety and Stability Program (ESP)
- Driving mode switch, selective
- Electric windows front and rear
- Ford Easy Fuel
- FordPass Connect including eCall, live traffic information (only with navigation) and Wi-Fi hotspot (information about the current status or location of the vehicle as well as control of selected vehicle functions via smartphone with the FordPass app - eCall emergency call system to send an emergency call in the event of an accident or when manually activated - Real-time traffic information (only in conjunction with navigation system) - Wi-Fi hotspot (up to 4G/LTE7, for up to 10 mobile devices))
- Instrument lighting, adjustable
- Isofix bracket
- Headrests: 2 front and 3 rear, height adjustable
- Leather gear knob
- Adjustable steering column
- Center console "Premium" front
- Navigation: Ford Navigation, Ford SYNC 3 with AppLink, 8" touchscreen (20.3 cm) with DAB/DAB+ (Ford SYNC 3 communication and entertainment system with voice control, radio, 2 USB ports, 6 speakers and steering wheel remote control, Bluetooth hands-free calling and audio streaming, SMS reading and sending option, voice control for audio and telephone, support for Android Auto and Apple CarPlay, dynamic navigation with TMCpro, road map for Europe, voice control, destination input and search, advanced voice output, detailed visualization, Michelin travel guide for Europe)
- Pre-Collision Assist (Forward Alert system with pedestrian and bicycle detection)
- Tire repair kit
- Rear view camera
- Electromechanical power steering
- Seats: Driver's seat height adjustable
- Seats: Rear seat backrest
- Seats: Front sports seats with enhanced lateral support
- Carpet floor mats in the front
- Black trim around the side windows
- Electronic immobilizer
- Heat-insulating glazing, tinted



Extra equipment

- 1 set of alloy winter wheels
- All-weather front floor mats, black, in a tub shape
- Paint finish: Frost White
- Seat covers front and rear
- All-weather rear floor mats, black
- Car fire extinguisher 2 kg, testable
- Package: Winter (heated windscreen - heated steering wheel - individually and variably heated front seats)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was roadworthy at the time of inspection.

Value reducing factors

No.	Component group	Description
1	Equipment	Tirefit filler - Expired - Replace
2	Sill - left side	Sill - Scratch(es) - Smart repair
3	Mudguard - left side	Mudguard - left side - Paint defect - Smart repair
4	Body	Body (Zusatzkosten können entstehen) - Glued / labelled - De-glue / neutralise
5	Vehicle glazing	Windscreen with lane departure assistant - Unprofessionally repaired - Replace

Wear and tear

No.	Component group	Description
1	Door - front left side	Door - dent(s) - No deduction
2	Documents	Owner's manual - Missing - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

ALPHABET



Figure 1: Diagonal front (left)

ALPHABET



Figure 2: Diagonal front (right)

ALPHABET



Figure 3: Diagonal rear (left)

ALPHABET



Figure 4: Diagonal rear (right)

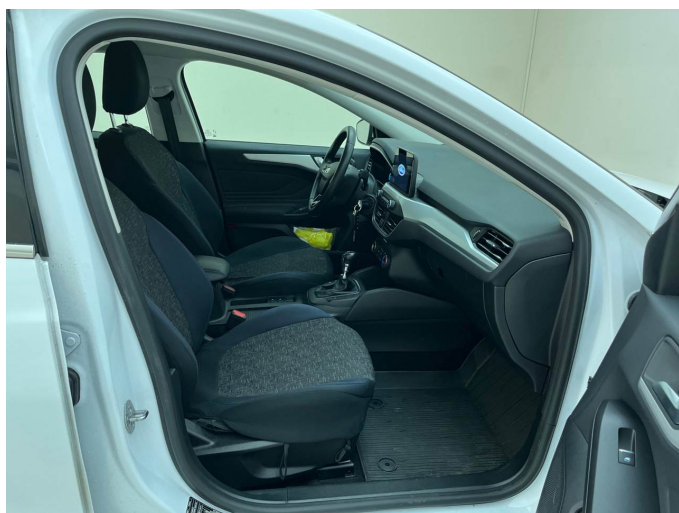


Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents

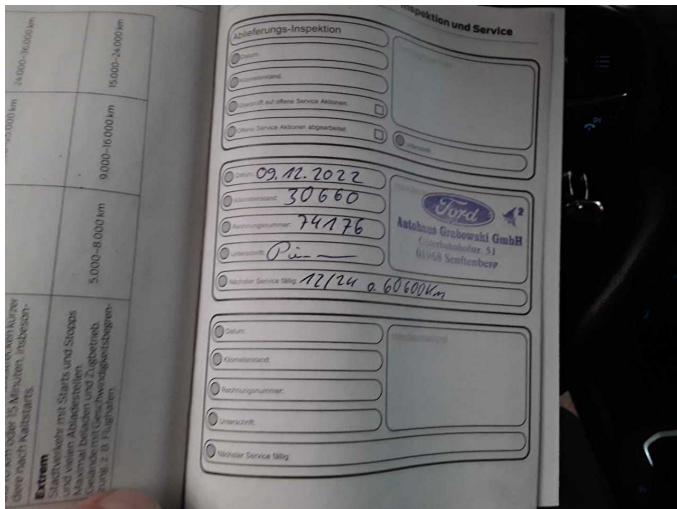


Figure 15: Documents



Figure 16: Additional tyres



Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.




Figure 26: Misc.



Damage 1: Equipment: Tirefit filler - Expired - Replace



Damage 2: Sill - left side: Sill - Scratch(es) - Smart repair

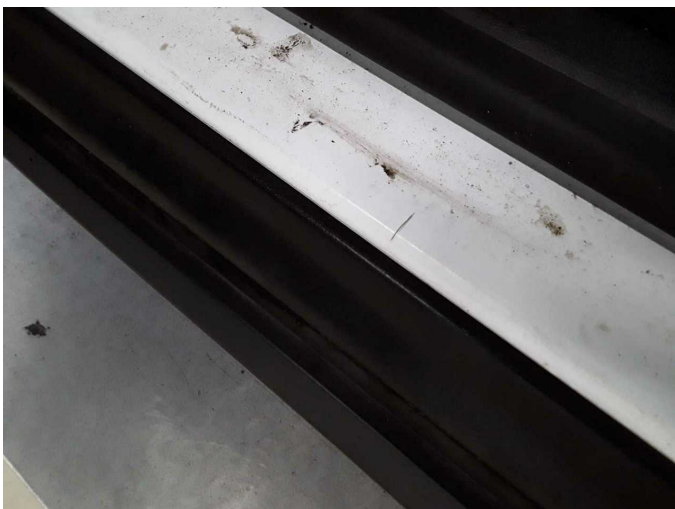

Damage 2: Sill - left side: Sill - Scratch(es) - Smart repair



Damage 3: Mudguard - left side: Mudguard - left side - Paint defect - Smart repair



Damage 3: Mudguard - left side: Mudguard - left side - Paint defect - Smart repair




Damage 4: Body: Body (Zusatzkosten können entstehen) - Glued / labelled - De-glue / neutralise



Damage 4: Body: Body (Zusatzkosten können entstehen) - Glued / labelled - De-glue / neutralise



Damage 5: Vehicle glazing: Windscreen with lane departure assistant - Unprofessionally repaired - Replace

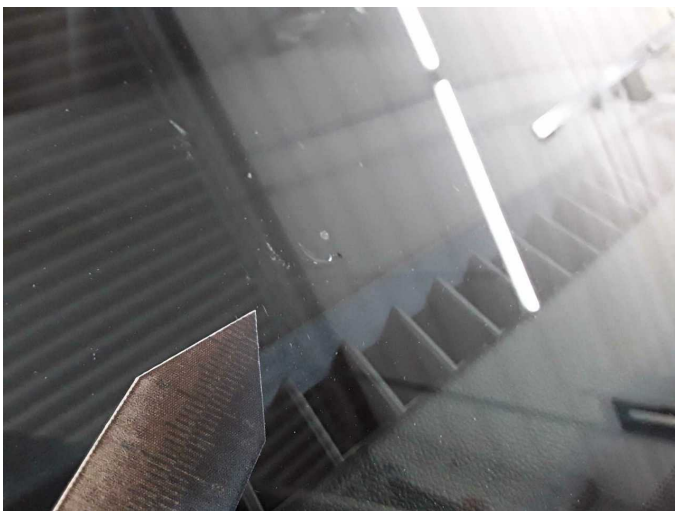

Damage 5: Vehicle glazing: Windscreen with lane departure assistant - Unprofessionally repaired - Replace



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WF0NXXGCHNMM35731

Hersteller / Modell: FORD FORD Focus 1.0 EcoBoost Start-Stopp-System
COOL&CONNECT

Datum	KM-Stand	Beschreibung
24.04.2026	82.129	AU
28.11.2024	57.132	Bremsflüssigkeit ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges; Zündkerzen ern
16.04.2024	49.296	AU; Bremsklötze hinten; Bremsscheiben + Klötze h; Bremsscheiben hinten; Systemtest/Eigendiagnose
09.12.2022	30.660	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges