



Expertise

Protocol number: 46553016
Order No. / Reference: 26663252
Inspection date: 15 Jul 2026

Manufacturer: Opel

Model: Mokka-e Ultimate

VIN: VXXKUKZKXZNW051544



Vehicle details

Manufacturer / Type / Model / Equipment

Opel Mokka-e Ultimate

Vehicle Identification number VXXKUKZKXZNW051544

Mileage (Read) 42,125 km

First registration 15 Dec 2022

Number of holders 1

Power / Engine displacement 57 kw /

Fuel type / Cylinder Electric / 0

Gearbox / Number of gears Direct drive / 1

Type of drive Front drive

Type of vehicle SUV

Colour / colour code Quarz Silber

Doors / Seats 5 / 5

Upholstery type Leather

Colour of upholstery Black



Vehicle details			
Maintenance booklet / proof	Available / complete	Next maintenance in	19,300 km
Last service on / at	12/2025 at 36,506 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GJ696649
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	1889 / ADD 00016		
Emission standard	2017/1151;WLTP;reine Elektrofz	fine dust sticker	
Permitted total weight	2,015 kg	Empty weight	

Tyres				
Mounted tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/55 R18 99V	All-season tyres on Light alloy	Sonstige	7mm / 7mm
2)	215/55 R18 99V	All-season tyres on Light alloy	Falken	6mm / 6mm
Replacement				
Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 12/2027		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- 2 ignition keys, with remote control
- Storage compartments (storage compartment in the center console, front and rear - storage compartment in the front doors, suitable for 1.5-liter beverage bottles - storage compartment in the rear doors, suitable for 0.5-liter beverage bottles - cup holder in the center console - glove compartment)
- Driver and passenger side airbags
- Airbag: Head airbags, front and rear outer
- Active pedestrian warning tone (AVAS) (ambient noise up to a driving speed of 30 km/h)
- Electrically adjustable, heated and folding exterior mirrors
- Exterior mirrors in black
- Hill Start Assist
- Braking system: Regenerative
- Headliner, Black
- Decorative strips, silver
- Electronic brake force distribution (EBD)
- Chassis: Driving modes (with 3 adjustable driving modes: ECO, Normal and Sport)
- Pedestrian protection
- Transmission: Automatic electric drive with fixed gear ratio
- Rear shelf
- IntelliLux LED Matrix Light (Adaptive LED matrix headlights with individual light distribution and the following functions: - City light - Highway light - Country road light - Static cornering light - Turning light - Parking light - High beam assistant: traffic-dependent dimming taking into account preceding and oncoming road users - Automatic headlight range control)
- Charging connection options (alternating current (AC), plug type 2, and direct current (DC), plug type CCS (Combined Charging System))
- Steering wheel: Heated leather steering wheel
- Steering column, height and tilt adjustable
- Illuminated makeup mirror in sun visor, for driver and front passenger
- myOpel App (with Mokka-e specific functions: battery charge level indicator and range monitoring, remote control of climate control and charging settings - energy consumption display, energy consumption statistics, energy recovery information, remote control of climate control - intelligent charging: charging process display with the option of immediate or time-programmable charging)
- Park & Go (Park Pilot, front and rear parking aid with audiovisual warning - 180-degree panoramic reversing camera - blind spot warning and side protection - electrically folding exterior mirrors - ambient lighting)
- Wheels: Light alloy (4) 5 spoke 7J x 18 in BiColor Black (with tires 215/55 R18)
- Wheels: Tire repair kit (with tire sealant and 12-volt compressor (without jack))
- Storage: Pockets on the back of the front seats (driver and passenger)
- Active Drive Assist Plus (Automatic Speed Assist with Stop & Go function - Front Collision Warning with automatic emergency braking as well as pedestrian and cyclist detection - Active Lane Keeping Assist)
- Adaptive brake light
- Airbag: Front and side airbags
- Actively controlled air intakes (Active Aero Shutter)
- Aluminum sports pedals
- Anti-lock braking system (ABS) with cornering brake control and brake assist
- Battery charging kit: Mode 2 charging cable (1.8 kW) for household socket and battery charging status indicator
- Roof design line in chrome
- Roof spoiler, black
- Third brake light
- Electronic Stability Program Plus (ESP Plus)
- Electric windows front and rear (with one-touch function and anti-pinch protection)
- Cruise control with intelligent speed limiter (The intelligent speed limiter, in conjunction with traffic sign recognition, allows for rapid speed adjustment)
- Child safety lock in the rear doors, manual
- Automatic climate control (with activated carbon filter, manual recirculation, automatic air distribution - rear footwell heating)
- Headrests (2)
- Rear headrests (3), height adjustable
- Paint finish: Roof and A-pillar in Diamond Black
- LED fog lights
- LED daytime running lights (LED ambient lighting in door storage compartments, front - LED turn signals, front and rear - LED taillights)
- Reading lights, front
- Center armrest, front (incl. 2 USB charging ports)
- Multi-collision brake (In the event of a collision or unavoidable accident, the system is activated and brakes the vehicle to a standstill to avoid further collisions with other road users or obstacles.)
- Fatigue detection
- Onboard charger (vehicle-integrated charging unit), 3-phase (11 kW)
- OpelConnect with telematics services (Telematics services: - Emergency call/breakdown call - Vehicle status and information - Route and journey information)
- Upholstery: Alcantara/Premium leather look



- Keyless locking and starting system "Keyless Open & Start" (keyless unlocking for driver and passenger doors as well as the luggage compartment - engine start button)
- Side impact protection
- Speed-sensitive power steering
- Seat belts (three-point seat belts in all seats - belt force limiter and belt tensioner, front and rear outer seats - warning tone and light for unfastened seat belts, front and rear seats)
- Seats: Driver's seat manually adjustable in 6 ways (length, height and backrest angle)
- Seats: Comfort seats, front
- Seats: Heated seats, multi-stage, driver and front passenger
- Solar Protect heat-insulating glazing (heavily tinted, in the rear)
- 12-volt power outlet (in the center console, front)
- Traction control with engine and brake intervention TC Plus
- Traffic sign recognition (recognition of speed limits and their cancellation, as well as display of the recognized sign in the driver information display (depending on visibility and weather conditions))
- Radio: Multimedia Navi Pro (Mokka-e) (with 10" color touchscreen display and fully digital 12" driver information display - Navigation with integrated memory - Road map of Europe (including Russia and Turkey) - 3D map display - Dynamic route guidance via map and/or arrow display - Display of points of interest - Trip planning - GPS module - Display of charging stations. OpelConnect, including LIVE navigation services: - Map updates (via USB) - Voice control for audio, telephone and navigation - Radio, Bluetooth, DAB+, USB, hands-free calling)
- Visibility equipment (front rain sensor - automatic dimming headlights with tunnel detection - interior rearview mirror, automatically dimming)
- Seats: Front passenger seat 6-way manually adjustable (length, height and backrest angle - pockets on the front seat back)
- Seats: Rear seat backrest foldable in a 60:40 ratio
- Seats: Pre-installation for ISOFIX child seat mounting system, rear outer
- Start/Stop System (Reinforced starter motor - High-performance battery - Switch to deactivate the start/stop function)
- Underride protection look, front and rear, in silver
- heat pump
- Central locking with remote control

Extra equipment

- All-weather tires
- Rubber floor mats
- Mode 3 charging cable (11 kW, 3-phase) for public charging, 6 meters long
- Headliner, Grey
- Paint finish: Metallic special color
- Opel Flex-Care Premium

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Bonnet	Bonnet - dent(s) - Smooth repair work
2	Door - front right side	Door - dent(s) - Smooth repair work
3	Wheel / tyres	Tyre - right - Porous / cracked - Replace
4	Roof	Roof - Damage by hail - Repair



Wear and tear

No.	Component group	Description
1	Rear bumper	Rear bumper - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

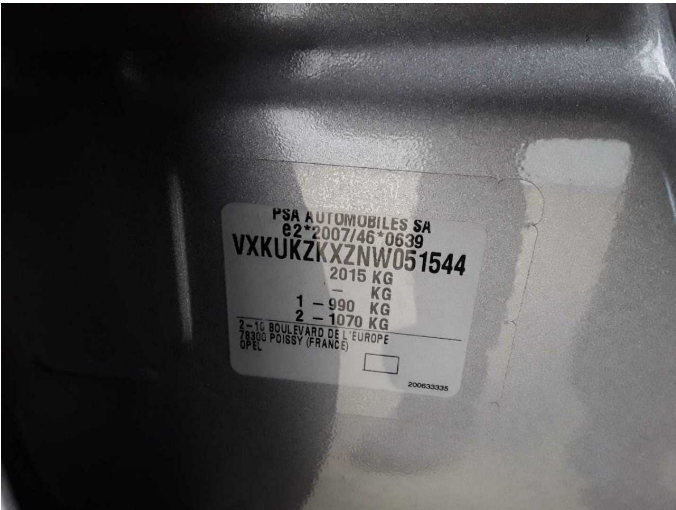


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents



Figure 15: Documents

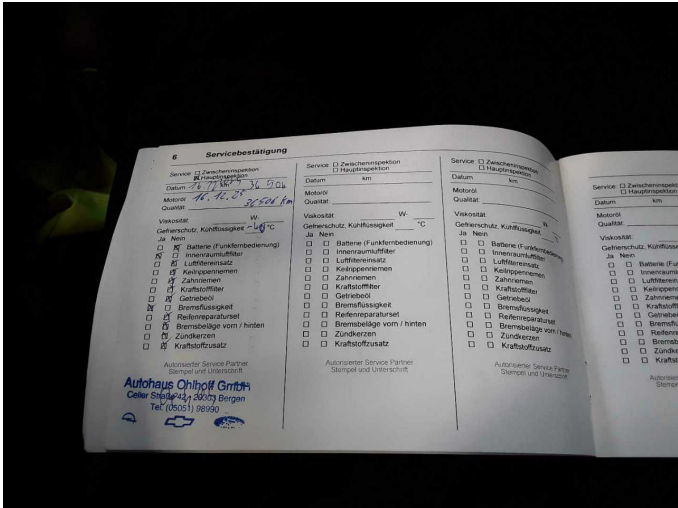


Figure 16: Documents

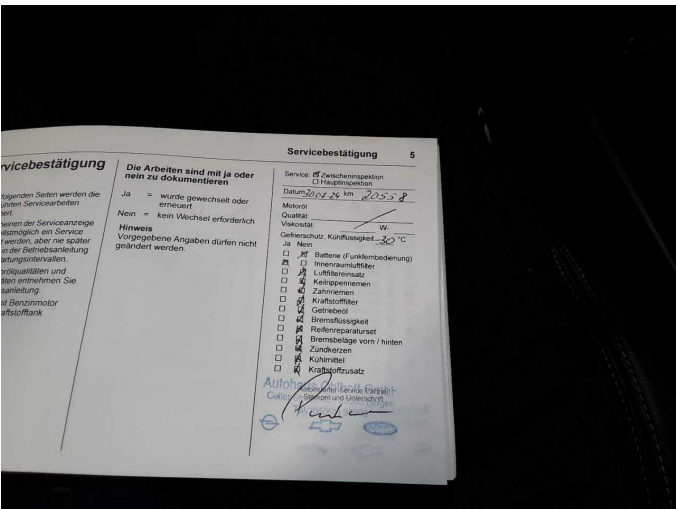


Figure 17: Documents

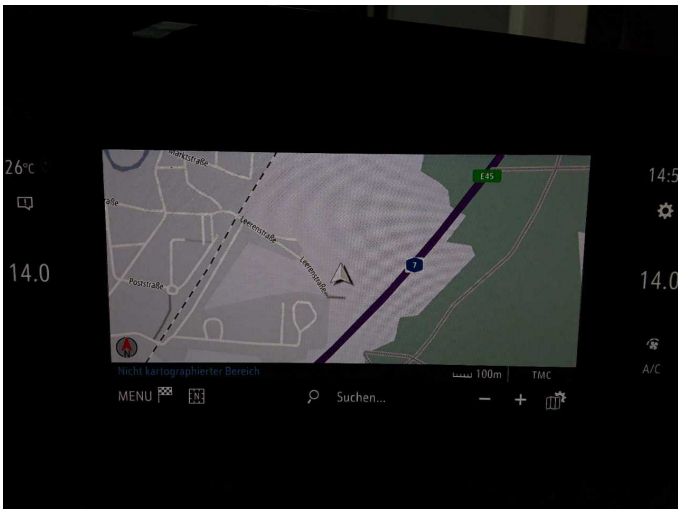


Figure 18: Navigation



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.

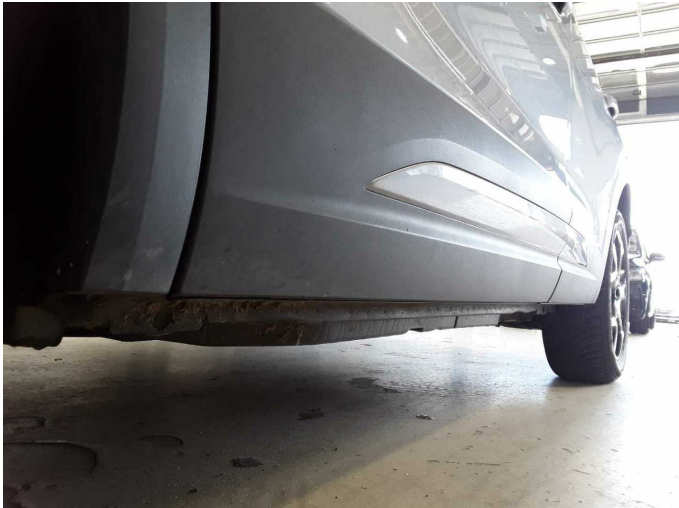


Figure 22: Misc.



Figure 23: Misc.

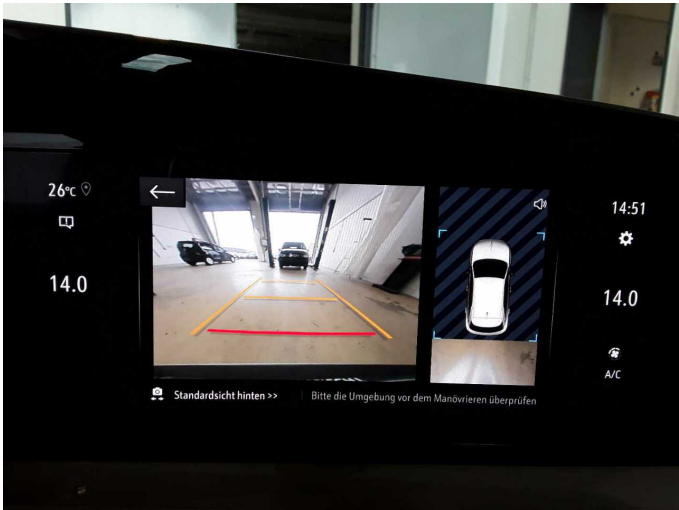



Figure 24: Misc.




Figure 25: Misc.



Figure 26: Misc.

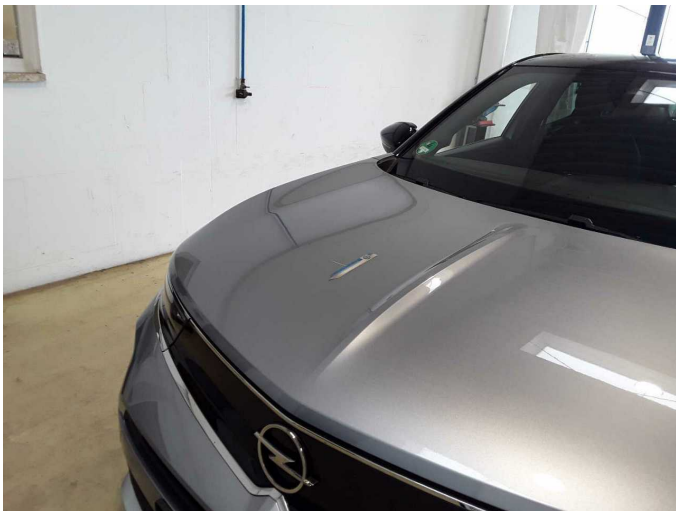

Damage 1: Bonnet: Bonnet - dent(s) - Smooth repair work

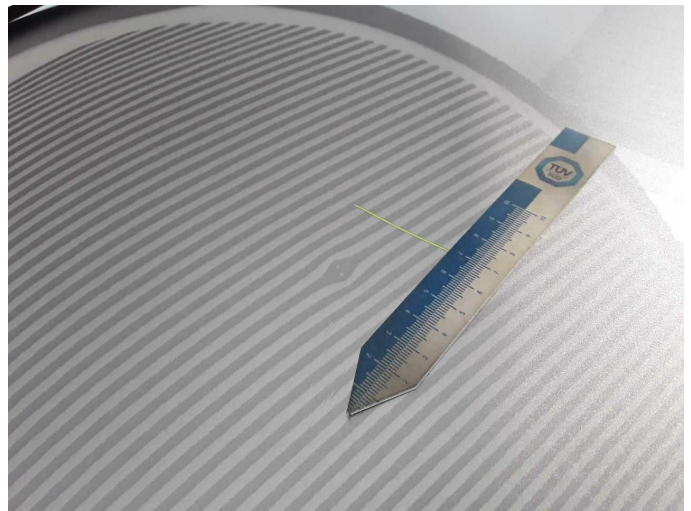


Damage 1: Bonnet: Bonnet - dent(s) - Smooth repair work



Damage 2: Door - front right side: Door - dent(s) - Smooth repair work




Damage 2: Door - front right side: Door - dent(s) - Smooth repair work

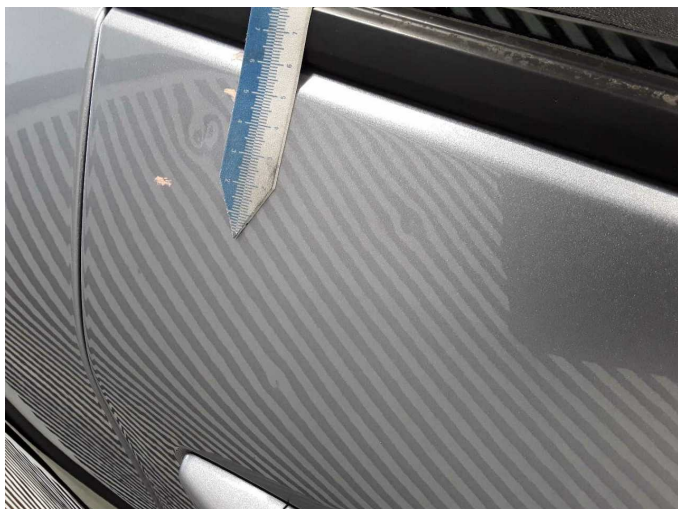

Damage 2: Door - front right side: Door - dent(s) - Smooth repair work



Damage 3: Wheel / tyres: Tyre - right - Porous / cracked - Replace

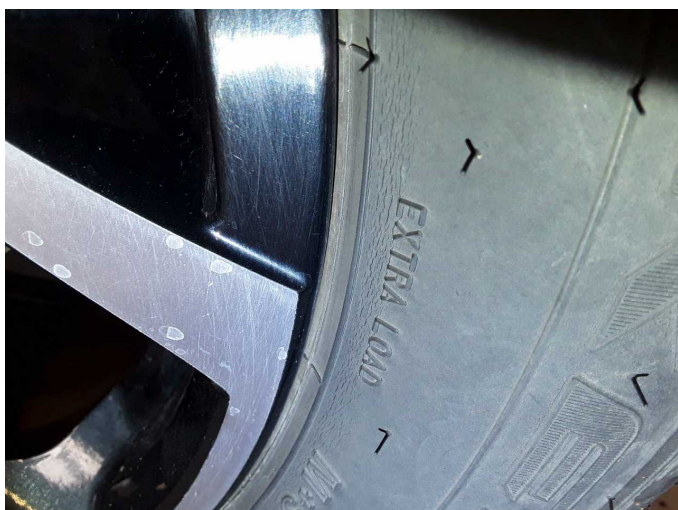

Damage 3: Wheel / tyres: Tyre - right - Porous / cracked - Replace



Damage 3: Wheel / tyres: Tyre - right - Porous / cracked - Replace




Damage 3: Wheel / tyres: Tyre - right - Porous / cracked - Replace



Damage 4: Roof: Roof - Damage by hail - Repair



Damage 4: Roof: Roof - Damage by hail - Repair

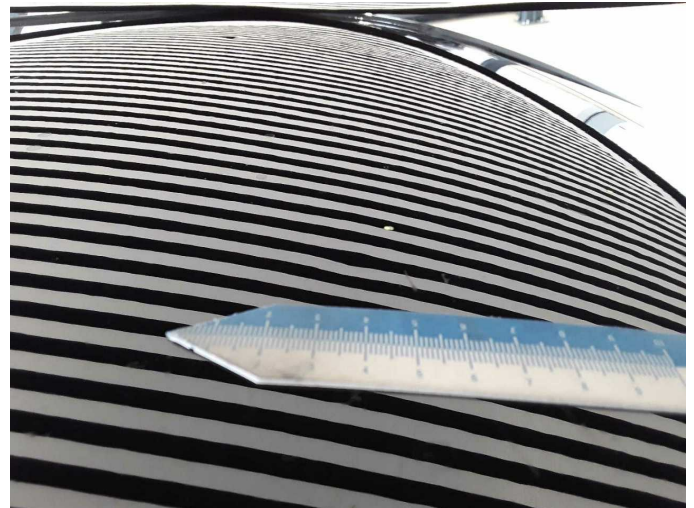

Damage 4: Roof: Roof - Damage by hail - Repair



Damage 4: Roof: Roof - Damage by hail - Repair