



Expertise

Protocol number: 46907286
Order No. / Reference: 26837458
Inspection date: 4 Aug 2026

Manufacturer: Renault

Model: Megane EV40 130hp boost charge Equilibre

VIN: VF1RCB00871321023



Vehicle details	
Manufacturer / Type / Model / Equipment	
Renault Megane EV40 130hp boost charge Equilibre	
Vehicle Identification number	VF1RCB00871321023
Mileage (Read)	3,819 km
First registration	19 Jul 2023
Number of holders	1
Fuel type	Electric
Power	55 kW
Gearbox / Number of gears	Direct drive / 1
Type of drive	Front drive
Type of vehicle	Car hatchback
Colour / colour code	Arktis-Weiß
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Light grey-Anthracite



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	
Last service on / at	05/2026 at 3,323 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GV524443
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	3333 / BPN 00022		
Emission standard	2017/1151	fine dust sticker	
Permitted total weight	2,045 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	195/60 R18 96H	All-season tyres on Light alloy	Goodyear	6mm / 6mm
2)	195/60 R18 96H	All-season tyres on Light alloy	Goodyear	7mm / 7mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 02/2029		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- | | |
|--|--|
| <ul style="list-style-type: none"> • Airbag: Airbag for driver and front passenger (passenger airbag can be deactivated) • Anti-lock braking system (with electronic brake force distribution (EBD)) • Exterior mirrors painted in car color • 12-inch digital speedometer display • Rear parking sensors • Electric window regulators front and rear (with momentary switch and pinch protection) • Heated rear window • Interior mirror with manual dimming function • Keycard Handsfree • 2-zone automatic climate control • Paint finish: Solid • LED light signature • LED daytime running lights • Steering wheel: Leather steering wheel • Steering wheel: Paddle shifters on the steering wheel for recuperation • Center console with storage compartment and center armrest • Emergency braking assistant with pedestrian, cyclist and intersection detection • Radio: OpenR link infotainment system with 9-inch touchscreen (Arkamys Classic sound system - 4 speakers - wireless Android Auto & Apple CarPlay - DAB+) • Wheels: Tire repair kit • Seat belts (3-point seat belts on all rear seats - seat belt warning for front and rear seats) • Seats: Driver's seat height-adjustable with electric lumbar support • Bumper in body color F1 Blade • Traffic sign recognition • Central locking with remote control | <ul style="list-style-type: none"> • Airbag: Front side airbags (front and rear windowbags and front center airbag) • Dashboard in grey - textile • Exterior mirrors (2) electrically adjustable and heated • Connected Services • eCall emergency call system • Electronic Stability Program (ESP) (with hill start assist) • Sound simulator • Transmission: Automatic reduction gearbox • Interior harmony Equilibre in grey fabric • ISOFIX i-Size child seat attachment • Climate: Heat pump • Headrests (5) • Charging cable Type 2/Type 2 (Mode 3) 5m length - 2.3 to 22kW AC • Steering wheel: Heated steering wheel • Steering wheel: Steering wheel adjustable for reach and height • light sensor • Fatigue detection • rear fog lights • Emergency Lane Keeping Assist • Upholstery: Cloth • Radio accessories: 2 USB ports in the front row • Tires: Direct tire pressure monitoring system • Wheels: 18" Oston alloy wheels (tires 195/60 R18) • Rear view camera • Safety distance warning system • Seats: Driver and passenger seats are heated • Seats: Rear bench seat folds down asymmetrically (1/3 to 2/3 foldable) • Adaptive cruise control (with speed limiter) • Full LED headlights LED PURE VISION |
|--|--|

Extra equipment

- | | |
|---|--|
| <ul style="list-style-type: none"> • Charging cable Schuko/Type 2 (Mode 2) with a length of 5.6 m ((for connection to a standard 230-volt household socket)) | <ul style="list-style-type: none"> • Wheels: All-season tires |
|---|--|

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.



Value reducing factors

No.	Component group	Description
1	Side panel - rear right side	Sill - Scratch(es) - Smart repair

Wear and tear

No.	Component group	Description
1	Rear bumper	Rear bumper - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

Das Fahrzeug weist eine erhöhte Lackdicke auf



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front

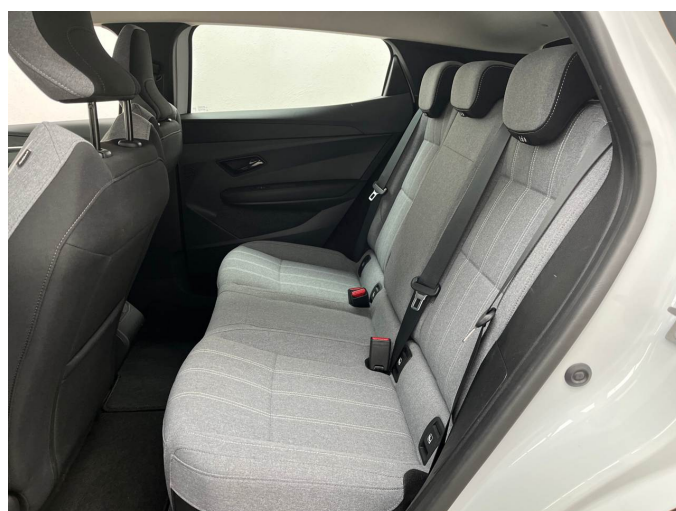


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

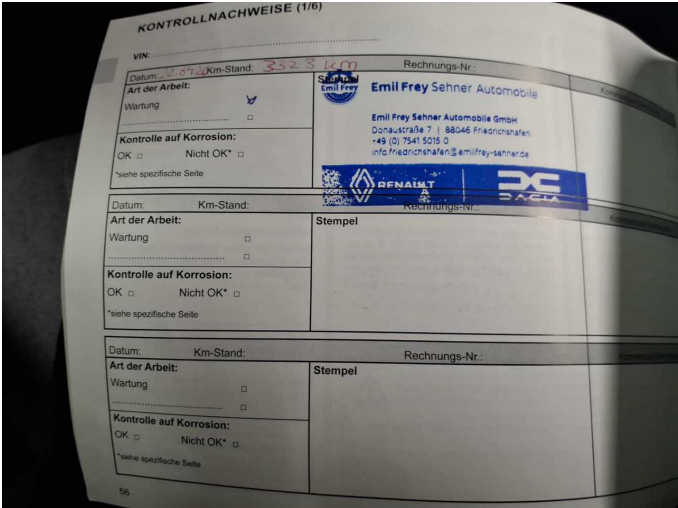


Figure 14: Documents



Figure 15: Misc.



Figure 16: Misc.



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.

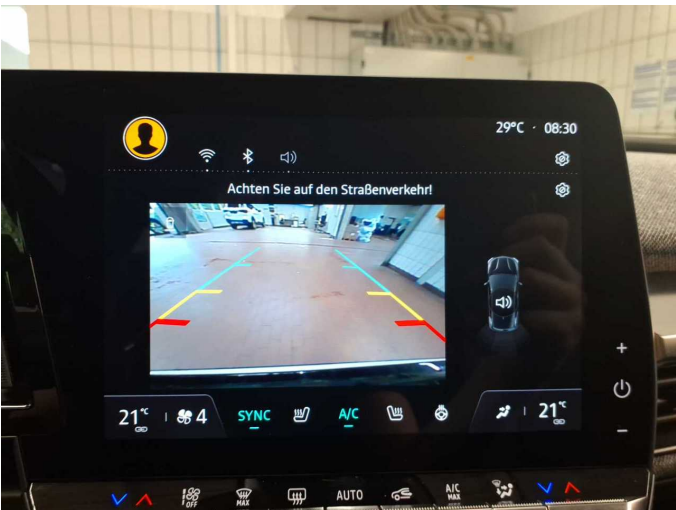


Figure 23: Misc.

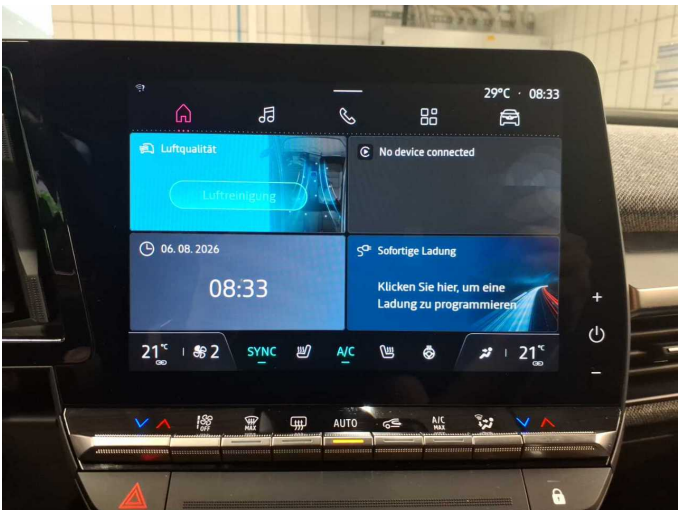


Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.

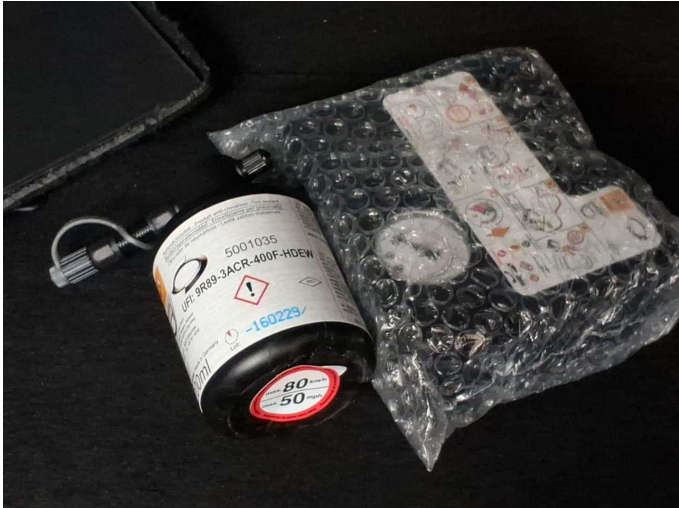


Figure 28: Misc.

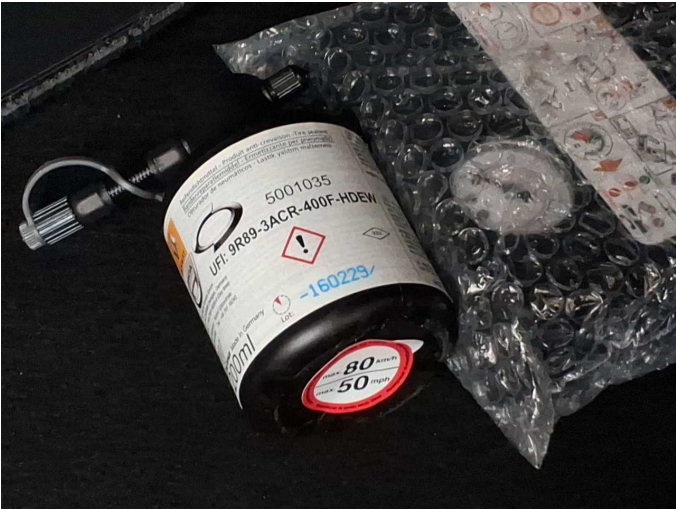



Figure 29: Misc.



Damage 1: Side panel - rear right side: Sill - Scratch(es) - Smart repair



Damage 1: Side panel - rear right side: Sill - Scratch(es) - Smart repair

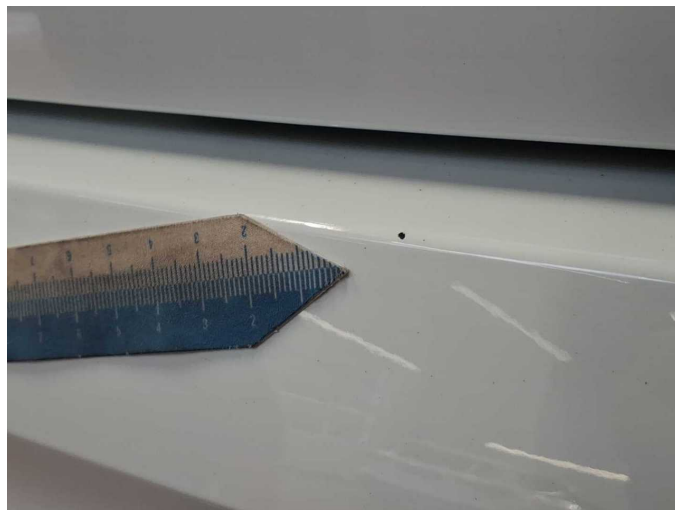

Wear and tear 1: Rear bumper: Rear bumper - Scratch(es) - No deduction



Wear and tear 1: Rear bumper: Rear bumper - Scratch(es) - No deduction



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: VF1RCB00871321023

Hersteller / Modell: RENAULT RENAULT Megane EV40 130hp boost charge Equilibre

Datum	KM-Stand	Beschreibung
26.05.2026	3.323	Regelwartungsdienst
28.11.2024	2.023	Regelwartungsdienst