



Expertise

Protocol number: 46416515
Order No. / Reference: 26628534
Inspection date: 9 Jul 2026

Manufacturer: Audi

Model: Q5 40 TDI quattro S tronic advanced

VIN: WAUZZZFY8N2120412



Vehicle details	
Manufacturer / Type / Model / Equipment	
Audi Q5 40 TDI quattro S tronic advanced	
Vehicle Identification number	WAUZZZFY8N2120412
Mileage (Read)	167,969 km
First registration	27 Jul 2022
Number of holders	2
Next periodical technical inspection	08/2027
(Report not on hand)	
Power / Engine displacement	150 kw / 1,968 ccm
Fuel type / Cylinder	Hybrid Diesel / E / 4
Gearbox / Number of gears	Automatic / 7
Type of drive	All-wheel drive
Type of vehicle	SUV
Colour / colour code	Brillantschwarz (Y9B)
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black
Re-import	no
readiness to drive	Roadworthy



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	0 Tag(e)
Last service on / at	08/2025 at 142,939 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GJ201550
Previous damage / Accident	Detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not possible to drive	Engine function test	Performed
readiness to drive	Roadworthy		
Manufacturer key number/ type code number	0588 / BQW 00481		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,510 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/65 R17 104H	Winter tyres on Light alloy	Continental	5mm / 5mm
2)	235/65 R17 104H	Winter tyres on Light alloy	Continental	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/60 R18 107V	Summer tyres on Light alloy	Continental	5mm / 5mm
2)	235/60 R18 107V	Summer tyres on Light alloy	Continental	5mm / 5mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
N	195/75 R18	Summer tyres on Steel		3 mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- AdBlue tank (12 liters)
- Airbag: Front side airbags and head airbag system
- "quattro" all-wheel drive with ultra technology
- Traction control (ASR)
- Audi drive select
- Audi pre sense city
- Exterior mirror housings in body color
- third brake light
- Roof edge spoiler
- Decorative inlays Micrometallic silver
- Tachometer
- Door sill trims with aluminum inlay at the front
- Electronic Differential Lock (EDS)
- Driver Information System
- Electric windows front and rear
- front and rear floor mats
- Cruise control system including speed limiter
- Heated rear window
- Interior lighting
- Manual child lock
- Automatic air conditioning
- boot floor mat
- Front headrests
- Stainless steel loading sill protector
- LED headlights
- Light/rain sensor
- Mild hybrid
- Model designation according to new performance labeling
- Wheel: On-board tools (excluding jack)
- Wheel: Tire pressure monitoring system
- Radio: MMI Radio plus
- Electromechanical power steering
- Fabric seat covers (synonym)
- Seats: Split-folding rear seat backrest
- Front sun visor
- Phone: Bluetooth interface
- First aid kit with warning triangle
- Glazing: Clear glass
- Glazing: Side and rear panes are made of heat-insulating glass.
- Central locking with remote control
- Airbag for driver and front passenger
- Accent areas matte black
- Anti-lock braking system (ABS)
- Audi connect emergency call & service with Audi connect Remote & Control
- Electrically adjustable and heated exterior mirrors
- Hill descent control
- Fabric headliner
- Black roof rails with roof rack recognition
- Diesel particulate filter (DPF)
- Rear parking sensors
- Electromechanical parking brake
- Electronic Stability Control (ESC)
- Chassis: Standard chassis
- Remote key (without Safe-Lock)
- Luggage compartment lid, electrically opening and closing
- Transmission: S tronic 7-speed
- rear window wiper
- Interior mirror dimming
- ISOFIX child seat attachment and Top Tether for the outer rear seats
- Rear headrests (3)
- Paint finish: Solid
- LED taillights
- Steering wheel: Leather steering wheel in 3-spoke design with multifunction
- front center armrest
- Non-smoking version
- Wheel: Alloy wheels, 18" 5-twin-spoke dynamic (8.0 J x 18, tires 235/60 R 18)
- Radio accessories: Data module Europe
- Seat belts
- Seats: Standard front seats
- Seats: Front seats manually adjustable
- Start-stop system
- Separation net
- Glazing: Windscreen in heat-insulating and acoustic glazing
- Electronic immobilizer
- thermal insulation glazing
- black decorative trim



Extra equipment

- Towbar (ball head mechanically swiveling with electric release - ball rod and head made of forged steel - operation via push button in the luggage compartment - trailer stabilization via the electronic stability control (ESC) The integrated swiveling system socket allows continuous operation of electrical devices in the trailer or caravan while driving and can be swivelled invisibly behind the bumper apron when not in use)
- Storage and luggage compartment package (flexible transport of items and comfort while traveling; consisting of: - storage net on the back of the front seatbacks - cup holder in the rear center armrest - storage compartment on the driver's side - lockable glove compartment in the luggage compartment: - luggage compartment net - net in the recess on the left - tension strap on the trunk side (not available for SQ5 Sportback))
- Function package tire package (on-board tools and jack in the luggage compartment - spare folding wheel, maximum permissible speed 80 km/h; with compressor)
- Radio accessories: Audi sound system (10 speakers including center speaker and subwoofer - 6-channel amplifier - total output of 180 watts)
- Seats: Rear bench seat plus (including longitudinal adjustment and backrest tilt - fold-out center armrest with 2 cup holders - rear seat backrest split 40:20:40 or fully foldable - including load-through facility - remote backrest release in the luggage compartment for the two outer backrest sections (no separate remote release for the smaller center section) - rear L-shaped headrests, manually adjustable)
- Phone: Audi Phone Box
- Glazing: Sun protection glazing, tinted (rear window, rear door and side windows tinted)
- Electrically adjustable, heated and folding exterior mirrors, automatically dimming on both sides
- Deletion of model designation and performance/technology lettering
- High beam assist
- Comfort center armrest at the front (adjustable in tilt and longitudinally sliding or completely foldable)
- Steering wheel: Leather steering wheel in 3-spoke design with multifunction plus (with 14 multifunction buttons for convenient operation of the available infotainment features such as audio skip, telephony, NAV button or the freely programmable button - adjustable in height and distance - with full-size airbag - shift paddles for manual changing of the driving modes)
- Business package (Audi phone box - MMI Navigation plus (incl. driver information system with color display) - Audi virtual cockpit - Heated front seats - Automatically dimming interior mirror - Electrically adjustable, heated and folding exterior mirrors, automatically dimming on both sides incl. curb view function for the passenger mirror - High beam assist - Manual sunshade for rear door windows)
- Seats: Lumbar support for the front seats, electric (4-way) (horizontally and vertically adjustable)
- Front seat heating
- Lane Departure Warning (within system limits, helps prevent unintentional lane departures. If the system is activated and ready, and the driver has not used the turn signal, the Lane Departure Warning helps prevent crossing detected lane markings by making corrective steering interventions. Additional steering wheel vibration can be set at the driver's request. Operating range from approximately 60 to a maximum of 250 km/h)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	It was not possible to drive the vehicle at the time of the inspection.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was roadworthy at the time of inspection.



Value reducing factors

No.	Component group	Description
1	Boot lid / rear door	Boot lid - Glued / labelled - De-glue / neutralise
2	Misc.	Inspection / maintenance - Due - Perform
3	Side panel - rear right side	Side panel - Dent / paintcoat damage - Repair and paint
4	Rear bumper	Rear bumper (Incl. Blende grau) - Scratched - Repair and paint
5	Door - front left side	Door - Dent / paintcoat damage - Repair and paint

Wear and tear

No.	Component group	Description
1	Seat - front	Seat base trim - left side - Scratch(es) - No deduction
2	Trim / covers	Boot lining - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Front, Provided by user / customer, from 26 Jun 2024	2.543,55 €

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.



Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

- Für den montierten Radsatz wurde kein Nachweis erbracht.
- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents



Figure 15: Documents



Figure 16: Additional tyres

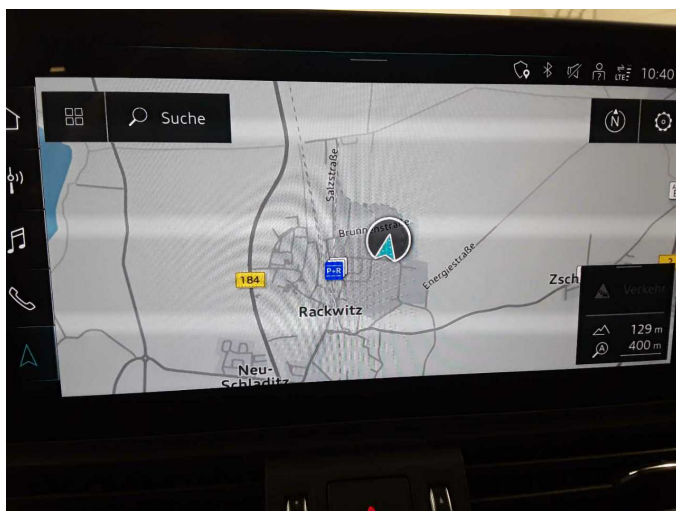


Figure 17: Navigation



Figure 18: Misc.

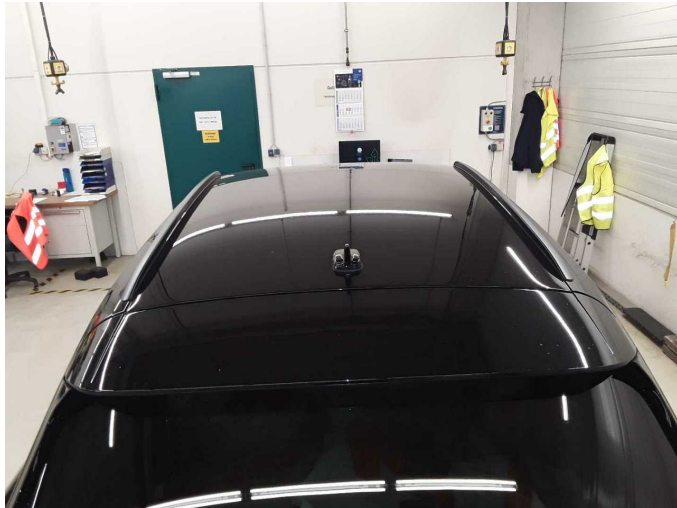


Figure 19: Misc.



Figure 20: Misc.

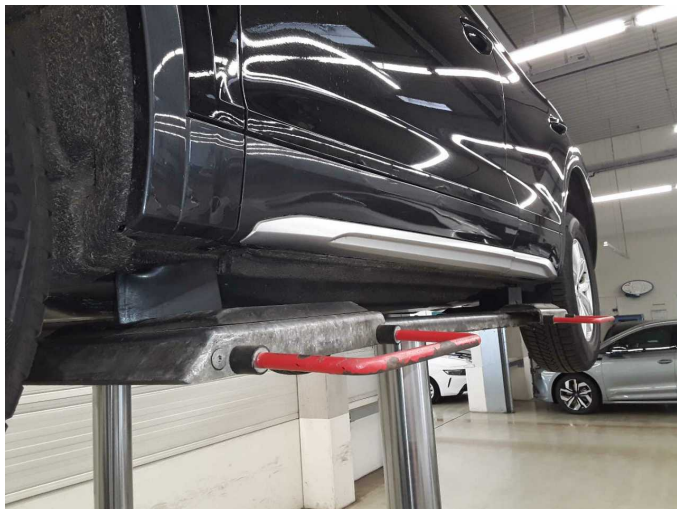


Figure 21: Misc.



Figure 22: Misc.

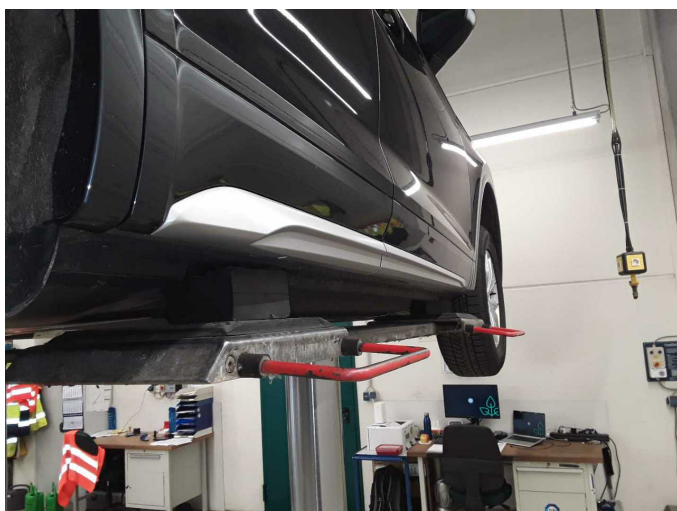


Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Damage 1: Boot lid / rear door: Boot lid - Glued / labelled - De-glue / neutralise



Damage 2: Misc.: Inspection / maintenance - Due - Perform



Damage 2: Misc.: Inspection / maintenance - Due - Perform



Damage 3: Side panel - rear right side: Side panel - Dent / paintcoat damage - Repair and paint



Damage 3: Side panel - rear right side: Side panel - Dent / paintcoat damage - Repair and paint



Damage 3: Side panel - rear right side: Side panel - Dent / paintcoat damage - Repair and paint




Damage 3: Side panel - rear right side: Side panel - Dent / paintcoat damage - Repair and paint



Damage 3: Side panel - rear right side: Side panel - Dent / paintcoat damage - Repair and paint



Damage 4: Rear bumper: Rear bumper (Incl. Blende grau) - Scratched - Repair and paint

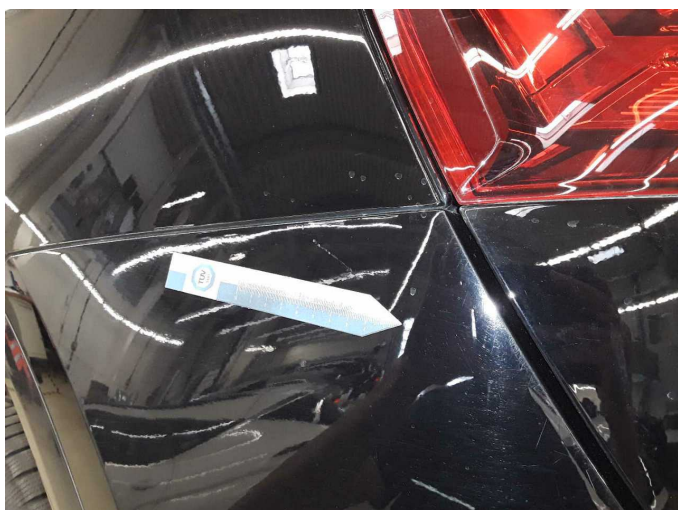


Damage 4: Rear bumper: Rear bumper (Incl. Blende grau) - Scratched - Repair and paint



Damage 4: Rear bumper: Rear bumper (Incl. Blende grau) - Scratched - Repair and paint



Damage 4: Rear bumper: Rear bumper (Incl. Blende grau) - Scratched - Repair and paint

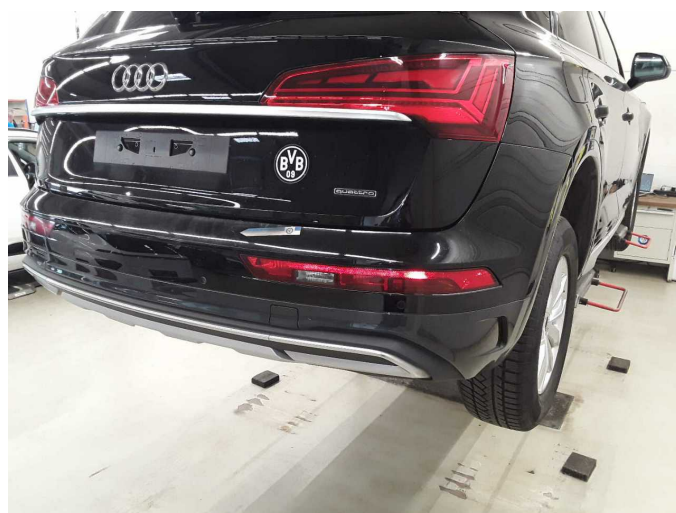

Damage 4: Rear bumper: Rear bumper (Incl. Blende grau) - Scratched - Repair and paint



Damage 4: Rear bumper: Rear bumper (Incl. Blende grau) - Scratched - Repair and paint




Damage 4: Rear bumper: Rear bumper (Incl. Blende grau) - Scratched - Repair and paint



Damage 5: Door - front left side: Door - Dent / paintcoat damage - Repair and paint



Damage 5: Door - front left side: Door - Dent / paintcoat damage - Repair and paint

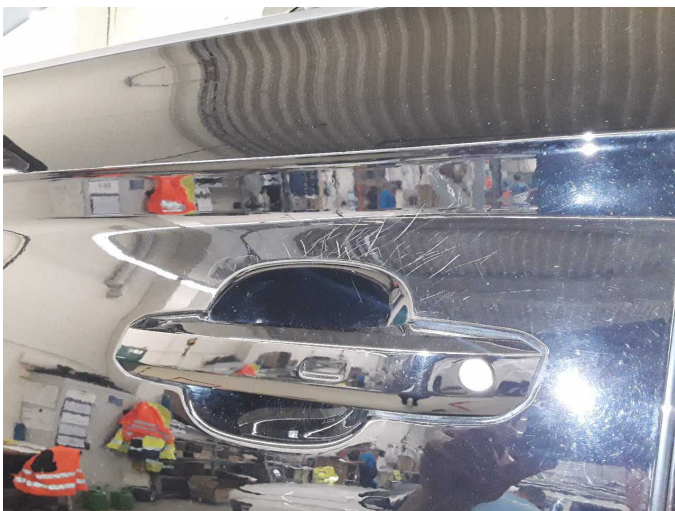

Damage 5: Door - front left side: Door - Dent / paintcoat damage - Repair and paint



Damage 5: Door - front left side: Door - Dent / paintcoat damage - Repair and paint




Damage 5: Door - front left side: Door - Dent / paintcoat damage - Repair and paint



Damage 5: Door - front left side: Door - Dent / paintcoat damage - Repair and paint




Damage 5: Door - front left side: Door - Dent / paintcoat damage - Repair and paint

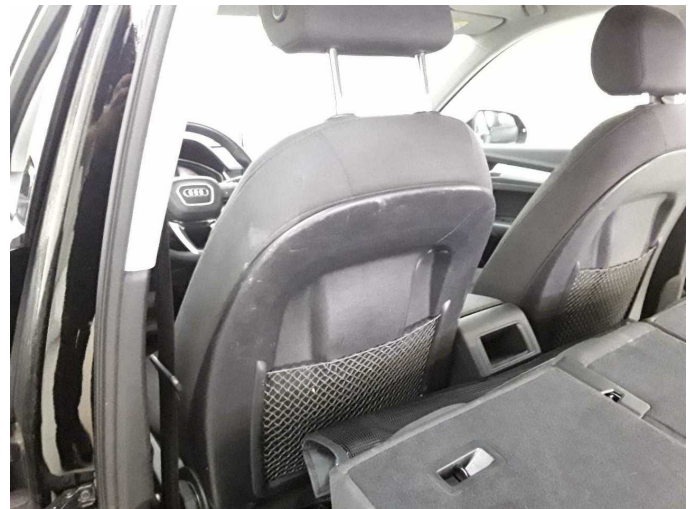

Wear and tear 1: Seat - front: Seat base trim - left side - Scratch(es) - No deduction



Wear and tear 1: Seat - front: Seat base trim - left side - Scratch(es) - No deduction

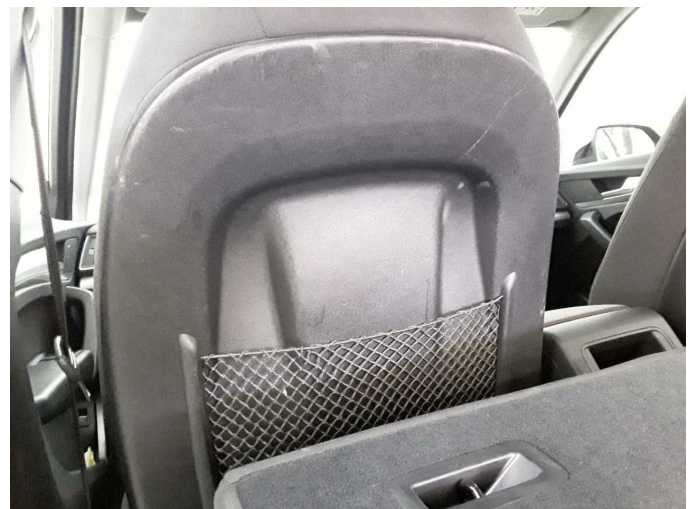

Wear and tear 1: Seat - front: Seat base trim - left side - Scratch(es) - No deduction



Wear and tear 2: Trim / covers: Boot lining - Scratch(es) - No deduction



Wear and tear 2: Trim / covers: Boot lining - Scratch(es) - No deduction



Wear and tear 2: Trim / covers: Boot lining - Scratch(es) - No deduction



Wear and tear 2: Trim / covers: Boot lining - Scratch(es) - No deduction



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WAUZZZFY8N2120412
Hersteller / Modell: AUDI AUDI Q5 40 TDI quattro S tronic advanced

Datum	KM-Stand	Beschreibung
23.12.2025	152.537	Bremsbelagfühler ern; Bremsentest; Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben hinten; Bremsscheiben vorne
07.10.2025	147.228	Systemtest/Eigendiagnose
04.08.2025	142.939	AU; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
29.07.2024	115.226	Bremsbelagfühler ern; Bremse Sonstiges; Bremsflüssigkeit; Bremsflüssigkeit ern; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben hinten; Bremsscheiben vorne; Getriebeöl ern/prüfen; Kraftstofffilter ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Reparatur Sonstiges; Wartung Sonstiges
24.01.2024	86.734	Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
20.07.2023	56.399	Bremsbelagfühler ern; Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben + Klötze h; Bremsscheiben + Klötze v; Bremsscheiben hinten; Bremsscheiben vorne; Getriebeöl ern/prüfen; Kraftstofffilter ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Reparatur Sonstiges; Wartung Sonstiges
31.01.2023	26.478	Motoröl b. Wartung; Regelwartungsdienst