



Expertise

Protocol number: 46631610
Order No. / Reference: 26536854
Inspection date: 22 Jul 2026

Manufacturer: Lexus
VIN: JTJCKBFZ702030333

Model: NX 450h+ E-FOUR Luxury-Paket



Vehicle details	
Manufacturer / Type / Model / Equipment	
Lexus NX 450h+ E-FOUR Luxury-Paket	
Vehicle Identification number	JTJCKBFZ702030333
Mileage (Read)	32,655 km
First registration	7 Nov 2023
Number of holders	1
Fuel type	Hybr.B/E ext.auf
Engine displacement / Cylinder	2,487 ccm / 4
Power	136 kW
Gearbox / Number of gears	Automatic / 1
Type of drive	All-wheel drive
Type of vehicle	SUV
Colour / colour code	Norigrün Metallic
Doors / Seats	5 / 5
Upholstery type	Leather
Colour of upholstery	Brown



Vehicle details

Maintenance booklet / proof	Non-existent	Next maintenance in	-434 km
Key is / should be	1 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GY791134
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	7104 / AAK 00005		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,540 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/60 R18 103H	Winter tyres on Light alloy	Pirelli	5mm / 5mm
2)	235/60 R18 103H	Winter tyres on Light alloy	Pirelli	7mm / 7mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/50 R20 100V	Summer tyres on Light alloy	Bridgestone	6mm / 6mm
2)	235/50 R20 100V	Summer tyres on Light alloy	Bridgestone	6mm / 6mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- 360° camera
- Airbag: Front airbags for driver and front passenger
- Airbag: Front and rear "Curtain-Shield" head airbags
- Airbags: Center airbag between driver and front passenger
- E-FOUR all-wheel drive, electronically controlled
- Traction control TRC
- Electrically adjustable and heated exterior mirrors
- Exterior mirrors with automatic curb view function
- Electronic Hill Start Assist Control (HAC)
- Turn signals integrated into the exterior mirrors
- Brake light, adaptive with emergency braking detection
- Aluminum roof rails
- Diabolo radiator grille
- Tachometer
- Entry lighting
- Chassis: EV mode (Electric Vehicle mode)
- Electrically operated window regulator with anti-pinch protection
- Glove compartment with LED lighting and lock
- Back window, heater
- Digital interior mirror
- Child seat attachment: ISOFIX, i-Size
- Rear headrests are height and tilt adjustable.
- Inductive charging station for charging smartphones
- 20" Luxury alloy wheels
- Steering wheel: 3-spoke leather steering wheel
- Automatic-dynamic headlight range control
- Lexus Link Pro Connected Services
- Lexus Safety System+ with Adaptive Cruise Control (ACC)
- Lexus Team-Mate Advanced Park
- Armrest - centre, rear
- 14-inch multifunction display
- 7-inch multi-information display
- LED fog lights
- Package: Interior (450h+) (Lexus Climate Concierge (automatic climate control, seat heating/ventilation and steering wheel heating, if equipped) - lumbar support for driver's seat - leather seat covers - seat ventilation for driver and front passenger - seat heating on outer rear seats - multi-color ambient lighting - 8-way power front seat adjustment with memory function for driver)
- Radio: Digital Audio Broadcast (DAB)
- Radio accessories: Lexus Link Pro multimedia system
- Rector
- Rear seat foldable in a 60:40 ratio
- Headlights washer / wiper system
- Seat belts: 3-point seat belts
- Seats: Heated rear outer seats
- Seats: Heated front seats
- 12V power outlet in the rear
- Blind Spot Monitoring (BSM) with Safe Exit Assist
- Electromechanical door opening
- Cornering light
- Airbag: Driver's knee airbag
- Airbag: Side airbags for driver and front passenger
- Acoustic Vehicle Alerting System (AVAS)
- Anti-lock braking system (ABS)
- Evasive steering assist
- Exterior mirrors painted in car color
- Exterior mirrors with blind spot warning
- LED turn signals, dynamic
- third brake light
- Roof antenna in sharkfin design
- Roof spoiler in car color
- Theft protection via Ultra-Wideband (UWB)
- eCall, automatic emergency call system
- Stainless steel front door sill plates with Lexus lettering
- Chassis: Driving mode selector (ECO, NORMAL, SPORT)
- High beam assist, adaptive
- Transmission: E-CVT, automatic, continuously variable
- Tailgate, electrically opening
- rear window wiper
- Child safety locks in the rear doors
- automatic climate control
- Front headrests, height and tilt adjustable
- LED taillights and daytime running lights
- Heated steering wheel, 2-stage
- Electrically adjustable steering column (height and reach).
- Lexus Intelligent Park Assist (IPA) with emergency braking function
- Lexus Smart Key
- light sensor
- Front center console with integrated storage compartment
- Multi-information display with on-board computer
- Navigation system cloud Lexus Smart Connect
- Rear fog light, LED
- Package: Technology Package
- Electromechanical parking brake
- Particulate filter: Gasoline particulate filter (GPF)
- Upholstery: Leather
- Upholstery: Leather with perforated leather seat surface
- Privacy glass
- Rear cross-traffic alert
- Radio accessories: Bluetooth interface
- Radio accessories: USB interfaces
- Tire pressure monitoring
- Headlights: Triple LED headlights
- electromechanical power steering
- Seats: Driver's seat and steering wheel move back for easy entry and exit.
- Stability program VSC (Vehicle Stability Control)
- LED daytime running lights
- Tahara door panel



- Lashing eyes (6) for securing luggage
- AC charging port with Type 2/Mennekes connector, 6.6 kW
- Immobiliser
- Leather gear selector
- Tinted heat-insulating glazing

- LED traffic warning lights in the doors
- AC charging cable for household socket
- AC charging cable Type 2/Mennekes
- Windscreen and front side windows made of acoustic glass
- Accessory socket (12 V) in the luggage compartment

Extra equipment

- Roof: Glass sliding/tilting roof
- Lexus ProTect paint sealant
- Paint finish: Mica/metallic paint
- Transparent protective films

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Instrument panel	Indicator light (Reifendruckkontrollsystem) - on - Perform diagnosis
2	Front bumper	Bumper with Parktronic - Scratched - Smart repair
3	Seat - rear	Back seat - Deformed - Smart repair
4	Door - rear right side	Door seal - Broken / torn - Replace
5	Misc.	Inspection / maintenance - Due - Perform

Missing parts

Description

Equipment - Vehicle key

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres

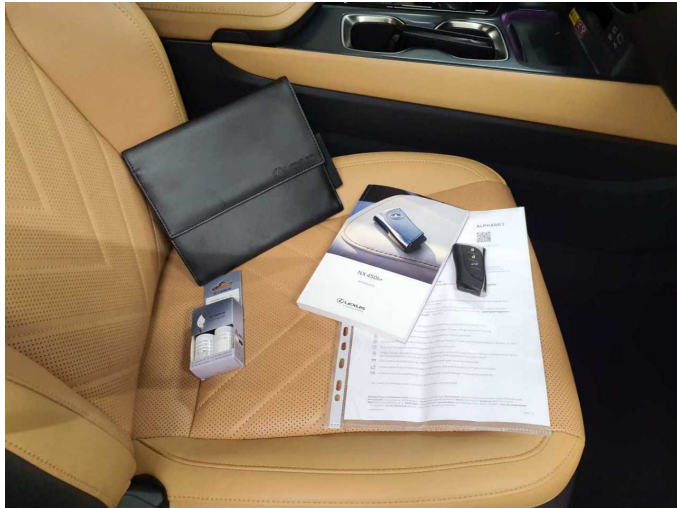


Figure 13: Documents



Figure 14: Documents



Figure 15: Additional tyres



Figure 16: Navigation



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.

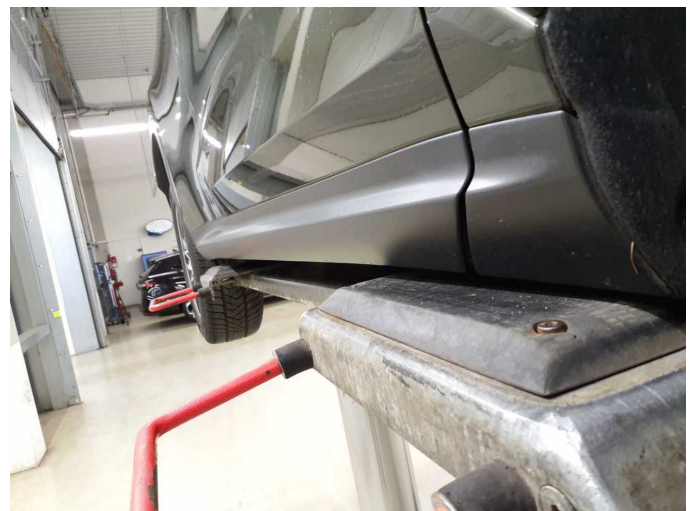


Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Damage 1: Instrument panel: Indicator light (Reifendruckkontrollsystem) - on - Perform diagnosis




Damage 2: Front bumper: Bumper with Parktronic - Scratched - Smart repair




Damage 2: Front bumper: Bumper with Parktronic - Scratched - Smart repair




Damage 2: Front bumper: Bumper with Parktronic - Scratched - Smart repair

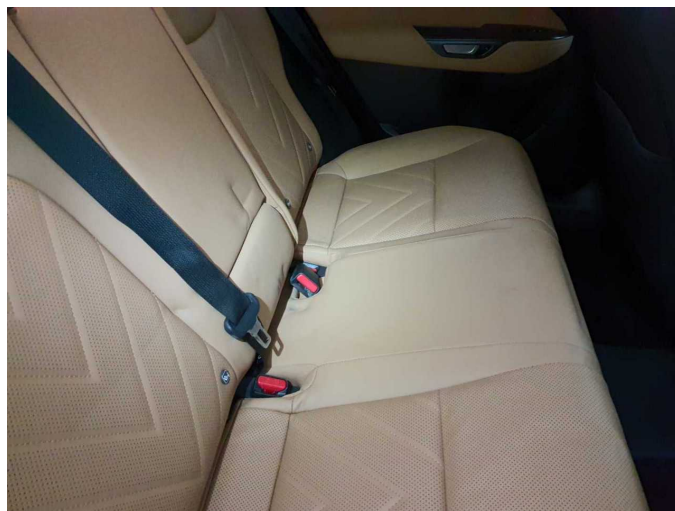


Damage 3: Seat - rear: Back seat - Deformed - Smart repair

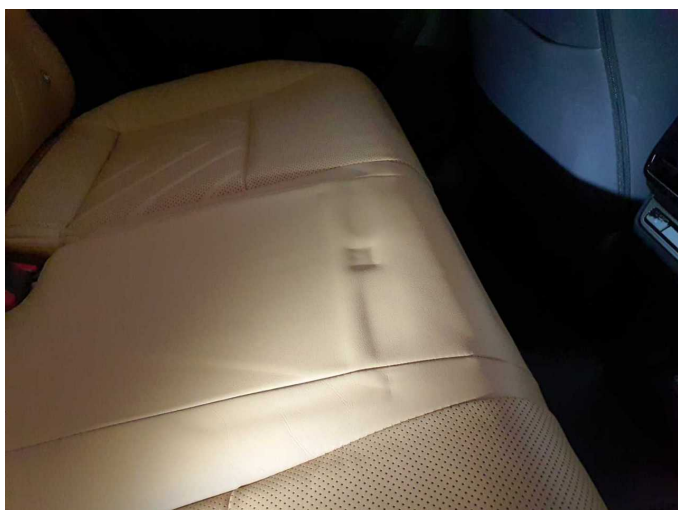


Damage 3: Seat - rear: Back seat - Deformed - Smart repair

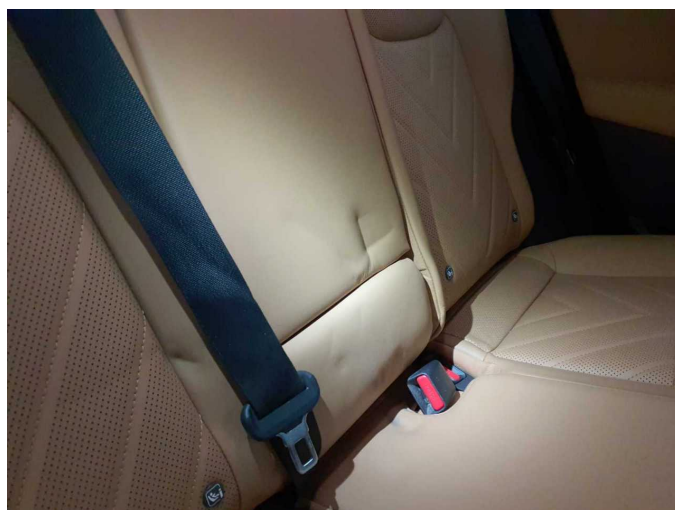


Damage 3: Seat - rear: Back seat - Deformed - Smart repair

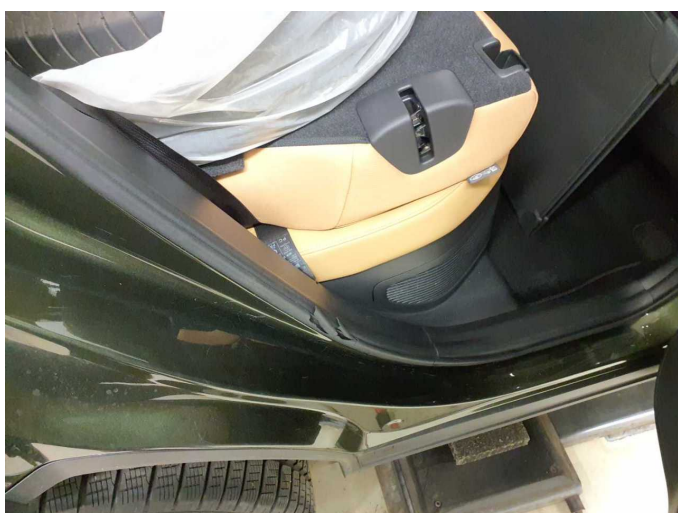

Damage 4: Door - rear right side: Door seal - Broken / torn - Replace

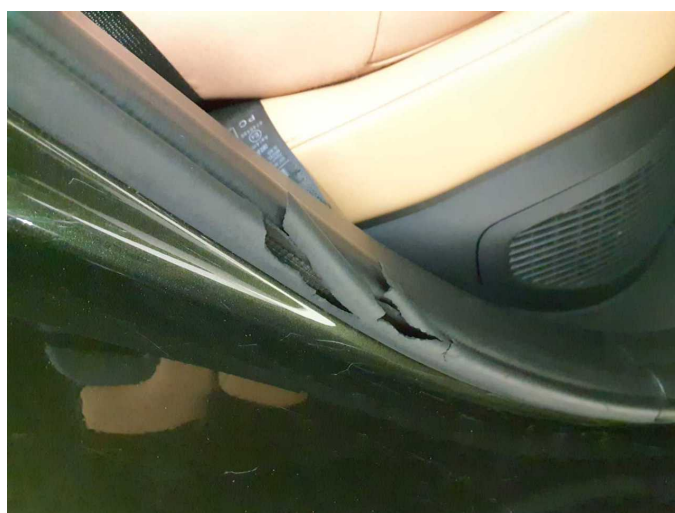

Damage 4: Door - rear right side: Door seal - Broken / torn - Replace

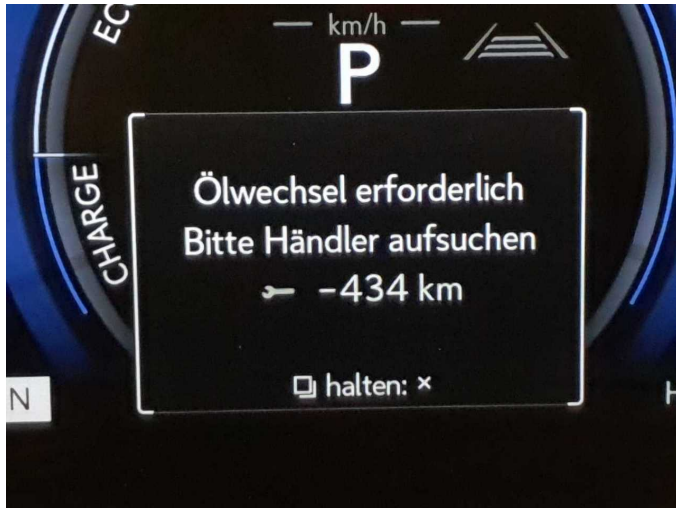

Damage 5: Misc.: Inspection / maintenance - Due - Perform