



Expertise

Protocol number: 46900875
Order No. / Reference: 26768106
Inspection date: 5 Aug 2026

Manufacturer: Volkswagen

Model: Tiguan Allspace 2.0 TDI SCR 4Motion DSG R-Line

VIN: WVGZZZ5NZNM093485



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volkswagen Tiguan Allspace 2.0 TDI SCR 4Motion DSG R-Line	
Vehicle Identification number	WVGZZZ5NZNM093485
Mileage (Read)	186,186 km
First registration	1 Jul 2022
Number of holders	1
Next periodical technical inspection	07/2027
(Report not on hand)	
Fuel type	Diesel
Engine displacement / Cylinder	1,968 ccm / 4
Power	147 kW
Gearbox / Number of gears	Automatic / 7
Type of drive	All-wheel drive
Type of vehicle	SUV
Colour / colour code	Pyritsilber Metallic
Doors / Seats	5 / 7
Upholstery type	Cloth
Colour of upholstery	Grey-Black
Re-import	no
readiness to drive	Roadworthy



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	23,000 km
Last service on / at	05/2026 at 179,146 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GJ130443
Previous damage / Accident	Detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
readiness to drive	Roadworthy		
Manufacturer key number/ type code number	0603 / CLE 02415		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,480 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	255/40 R20 101Y	Summer tyres on Light alloy	Continental	5mm / 5mm
2)	255/40 R20 101Y	Summer tyres on Light alloy	Continental	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/55 R18 100H	Winter tyres on Light alloy	Continental	5mm / 5mm
2)	235/55 R18 100H	Winter tyres on Light alloy	Continental	6mm / 6mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 07/2028		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Storage compartments in the overhead console
- Airbag, head airbag system including front side airbags
- Airbag: Side airbags for the outer seats of the 2nd row.
- App-Connect including App-Connect Wireless for Apple CarPlay and Android Auto
- Exterior mirror housings painted silver
- third brake light
- Chrome trim on the side windows
- Silver anodized roof rails
- Diesel particulate filter
- Parking assistance
- Front door sill trims in aluminum, with "R-Line" logo
- Electronic Stability Program with counter-steering support
- Automatic headlight control, with daytime running lights
- Driving profile selection
- Windscreen made of laminated safety glass, heat and sound insulating
- Luggage compartment floor height adjustable in 2 stages
- Tailgate with electric opening and closing, adjustable opening angle
- Rear spoiler in R-style
- ISOFIX mounting points, also for i-Size child car seats
- Air conditioning system "Air Care Climatronic"
- Front headrests
- LED headlights with bad weather light and cornering light
- Reading lights: 2 front and 2 rear
- Light in the front footwell
- front center armrest
- Non-smoking version
- Emergency call service
- Stainless steel pedals
- Proactive occupant protection system in conjunction with "Front Assist"
- Rain sensor
- Wheels: Tire Mobility Set omitted
- Drawers under the front seats
- Seat belts: Three-point automatic seat belts at the front with height adjustment and belt tensioner
- Seats: Lumbar support in the front
- Seats: Heated front seats
- Start-stop system with brake energy recuperation
- Power outlet: 2 USB-C ports on the front
- Telephone interface
- First aid kit, warning triangle and high-visibility vest
- Prepared for later activation: Navigation function "Discover Media" incl. "Streaming & Internet"
- Airbag for driver and front passenger including knee airbag on the driver's side
- Permanent 4MOTION all-wheel drive
- Adaptive Cruise Control (ACC) "stop & go" with speed limiter
- Hill descent control
- Chrome applications on mirror adjustment switches, window regulator switches, door pull handles
- Decorative inlays "Carbon Grey"
- Display: Digital Cockpit Pro, multicolor, various selectable info profiles
- Electronic parking brake including auto-hold function
- Driving assistant "Travel Assist" and lane keeping assistant "Lane Assist"
- Electric windows front and rear
- Pedestrian detection
- Luggage compartment lighting
- Transmission: 7-speed DSG
- Rear window heated
- Rear window wiper with intermittent function
- Interior mirror automatically dimming
- LED license plate lighting
- Rear headrests (3)
- LED matrix headlights - IQ.LIGHT
- Steering wheel: Multifunction sports steering wheel in leather, heated, with paddle shifters
- Illuminated makeup mirrors in the sun visors
- Fatigue detection
- Emergency braking assistant "Front Assist"
- Package: Winter
- Upholstery: Fabric inner side panels in "ArtVelours"
- Radio
- Radio accessories: Digital radio reception DAB+
- Tire pressure monitoring system
- Gearshift knob in leather
- electromechanical power steering
- Seats: Front passenger seat backrest folds down completely
- Seats: Top comfort seats in the front
- Seats: Front seats with height adjustment
- 12-volt socket
- Bumpers in body color, in "R-Line" styling
- Textile floor mats front and rear
- Prepared for "We Connect" and "We Connect Plus"
- Electronic immobilizer
- Central locking without safe locking, with remote control and 2 remote keys



Extra equipment

- Foldable towbar (electric release)
- Anti-theft alarm system with safe locking (anti-theft alarm system with interior monitoring, backup horn and tow-away protection, central locking with safe locking, remote control and 2 remote folding keys)
- Package: "Easy Open & Close" with safe locking mechanism ("Easy Open & Close" - tailgate with sensor-controlled opening and closing, with remote unlocking - keyless locking and starting system "Keyless Access" with safe locking mechanism)
- Package: Driver assistance package "Plus" (Driving assistant "Travel Assist", lane keeping assistant "Lane Assist" and "Emergency Assist" - parking steering assistant "Park Assist" incl. parking aid - proactive occupant protection system in conjunction with "Front Assist" - lane change assistant "Side Assist" and parking assistant - traffic sign recognition)
- Package: Winter additionally with heated outer rear seats (Air Care Climatronic air conditioning with active combination filter, rear controls and 3-zone temperature control - windshield washer nozzles automatically heated at the front - front seats and outer rear seats heated)
- Seats: 2 individual seats in the 3rd row (2 seats in the 3rd row, including rear bench seat and backrest asymmetrically split and foldable, with center armrest - luggage compartment floor with storage compartment)
- Electrically adjustable, folding and heated exterior mirrors (with passenger-side mirror lowering function)
- Paint finish: Metallic
- Navigation system "Discover Pro" incl. "Streaming & Internet" (8 speakers - App-Connect incl. App-Connect Wireless for Apple CarPlay and Android Auto - Digital radio reception DAB+ - Navigation system "Discover Pro" incl. "Streaming & Internet" - Radio - Voice control - Traffic sign recognition)
- Package: Business Premium (DSG) (2 USB-C ports in the front, 1 USB-C charging port on the rear center console - Head-up display - Leather multifunction steering wheel, heated, with shift paddles - Automatically heated windshield washer nozzles in the front - Voice control - "Comfort" telephone interface with inductive charging function - Heated front seats)
- Package: Top Package (Adaptive chassis control DCC incl. driving profile selection - Panoramic tilt/slide sunroof with panoramic roof at the rear - Darkened rear side windows and rear window)
- Park Assist system including parking aid
- Wheels: Alloy (4) "Misano" 8.5 J x 20, Volkswagen R (AirStop tires 255/40 R 20 - Wheel locks with enhanced theft protection)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was roadworthy at the time of inspection.

Value reducing factors

No.	Component group	Description
1	Door - front right side	Door edge - Scratched - Smart repair
2	Door - front right side	Brightware - lower - Scratch(es) - Paint
3	Rear bumper	Rear bumper - Scratched - Paint
4	Front bumper	Front bumper - Dent / paintcoat damage - Repair and paint
5	Wheel / tyres	Alloy rim - front right side (Materialabtrag) - Scratched - Replace
6	Wheel / tyres	Alloy rim - front left side (Materialabtrag) - Scratched - Replace



Wear and tear

No.	Component group	Description
1	Door - front left side	Door edge - Scratched - No deduction
2	Door - rear left side	Door - Scratch(es) - No deduction
3	Bonnet	Bonnet - Stone chips - No deduction
4	Door - rear right side	Door edge - Scratched - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Side right, Provided by user / customer, from 1 Dec 2025	2.638,41 €
2	Rear, Provided by user / customer	

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.



Comments

- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front

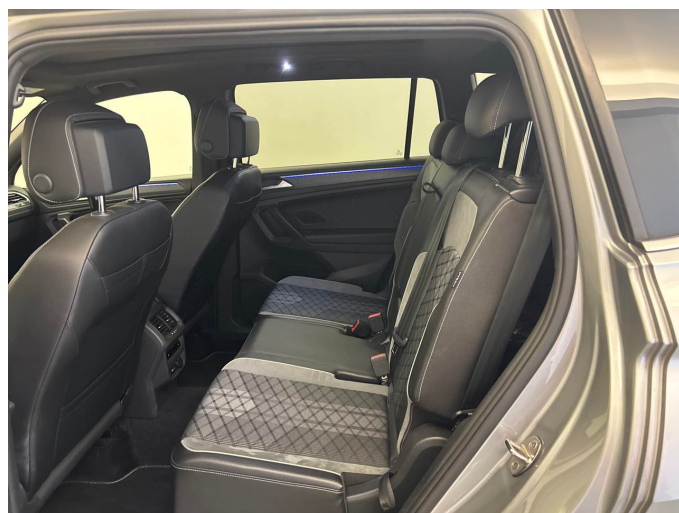


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

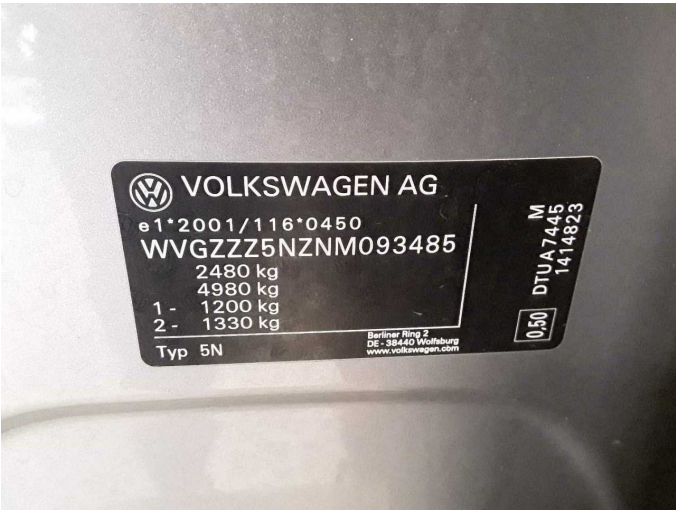


Figure 11: VIN



Figure 12: Mounted tyres

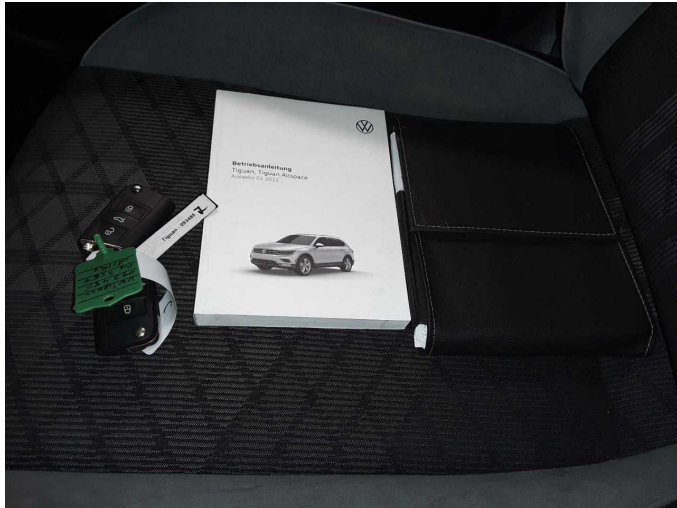


Figure 13: Documents

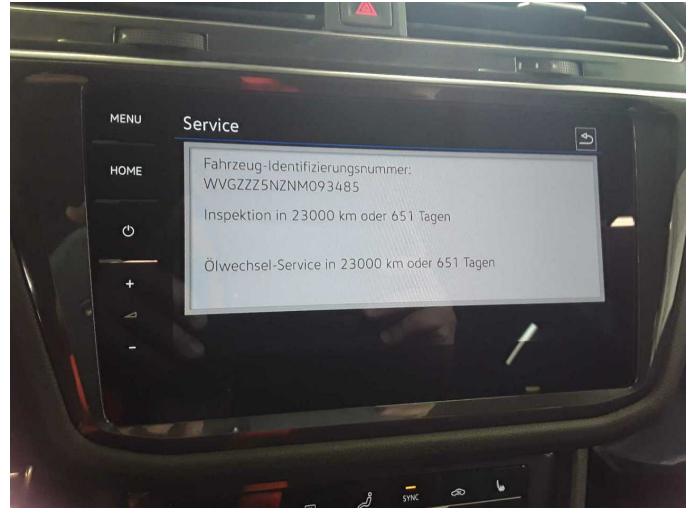


Figure 14: Documents



Figure 15: Documents



Figure 16: Additional tyres



Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.

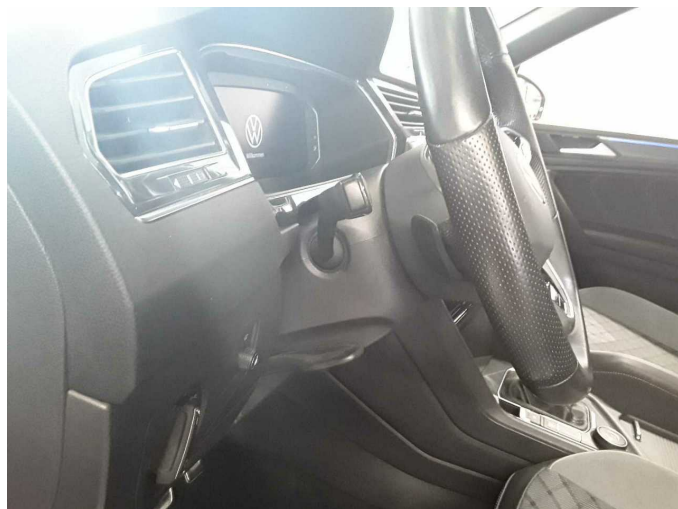


Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.

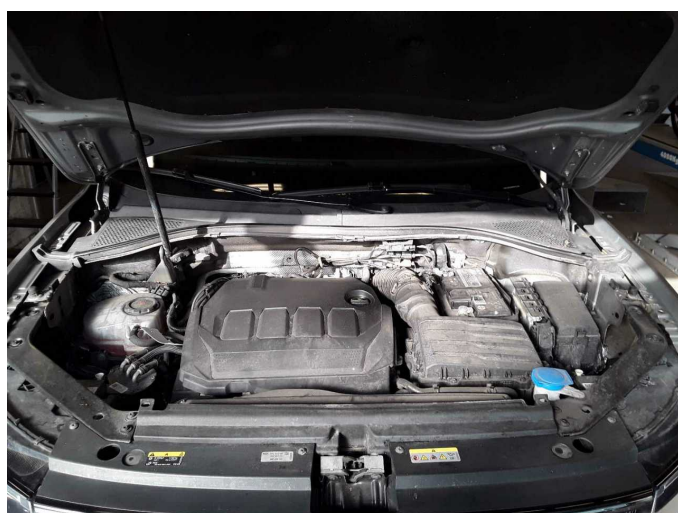


Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.



Figure 34: Misc.



Figure 35: Misc.



Damage 1: Door - front right side: Door edge - Scratched - Smart repair



Damage 1: Door - front right side: Door edge - Scratched - Smart repair



Damage 2: Door - front right side: Brightware - lower - Scratch(es) - Paint



Damage 2: Door - front right side: Brightware - lower - Scratch(es) - Paint



Damage 2: Door - front right side: Brightware - lower - Scratch(es) - Paint



Damage 2: Door - front right side: Brightware - lower - Scratch(es) - Paint



Damage 2: Door - front right side: Brightware - lower - Scratch(es) - Paint



Damage 3: Rear bumper: Rear bumper - Scratched - Paint



Damage 3: Rear bumper: Rear bumper - Scratched - Paint




Damage 3: Rear bumper: Rear bumper - Scratched - Paint



Damage 3: Rear bumper: Rear bumper - Scratched - Paint



Damage 3: Rear bumper: Rear bumper - Scratched - Paint

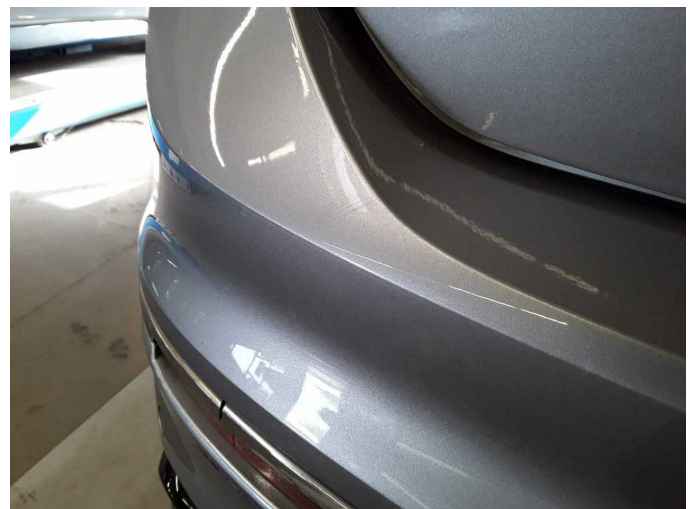

Damage 3: Rear bumper: Rear bumper - Scratched - Paint



Damage 3: Rear bumper: Rear bumper - Scratched - Paint



Damage 3: Rear bumper: Rear bumper - Scratched - Paint



Damage 3: Rear bumper: Rear bumper - Scratched - Paint



Damage 4: Front bumper: Front bumper - Dent / paintcoat damage - Repair and paint



Damage 4: Front bumper: Front bumper - Dent / paintcoat damage - Repair and paint



Damage 4: Front bumper: Front bumper - Dent / paintcoat damage - Repair and paint



Damage 4: Front bumper: Front bumper - Dent / paintcoat damage - Repair and paint



Damage 4: Front bumper: Front bumper - Dent / paintcoat damage - Repair and paint



Damage 4: Front bumper: Front bumper - Dent / paintcoat damage - Repair and paint




Damage 5: Wheel / tyres: Alloy rim - front right side (Materialabtrag) - Scratched - Replace



Damage 5: Wheel / tyres: Alloy rim - front right side (Materialabtrag) - Scratched - Replace



Damage 5: Wheel / tyres: Alloy rim - front right side (Materialabtrag) - Scratched - Replace

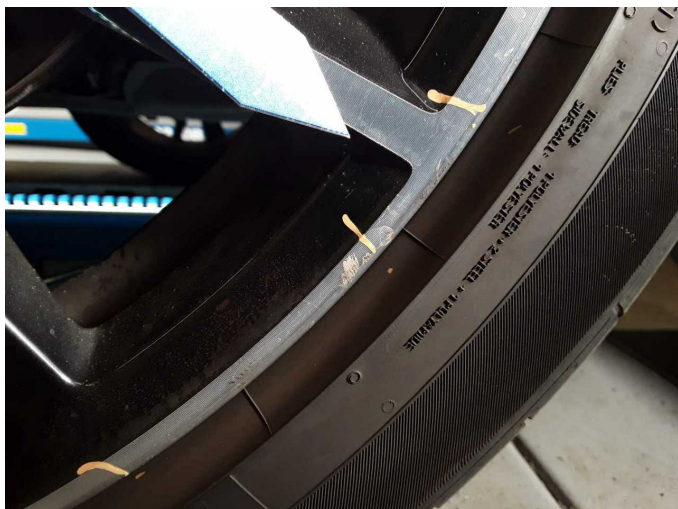

Damage 5: Wheel / tyres: Alloy rim - front right side (Materialabtrag) - Scratched - Replace



Damage 6: Wheel / tyres: Alloy rim - front left side (Materialabtrag) - Scratched - Replace




Damage 6: Wheel / tyres: Alloy rim - front left side (Materialabtrag) - Scratched - Replace



Damage 6: Wheel / tyres: Alloy rim - front left side (Materialabtrag) - Scratched - Replace



Wear and tear 1: Door - front left side: Door edge - Scratched - No deduction

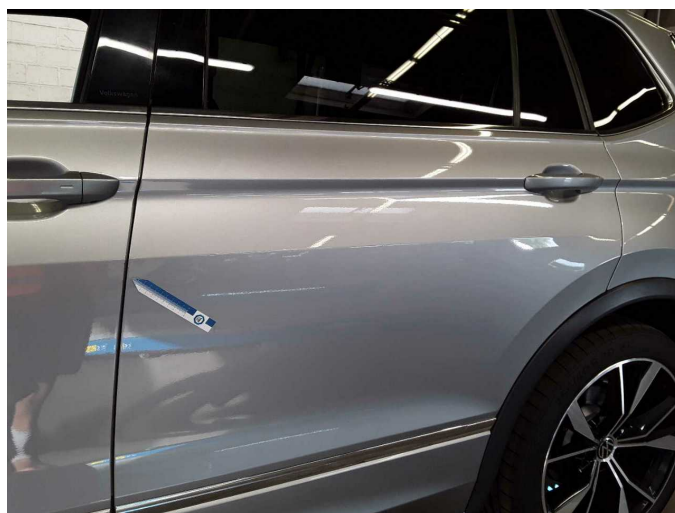

Wear and tear 2: Door - rear left side: Door - Scratch(es) - No deduction



Wear and tear 3: Bonnet: Bonnet - Stone chips - No deduction



Wear and tear 4: Door - rear right side: Door edge - Scratched - No deduction



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WVGZZZ5NZNM093485

Hersteller / Modell: VOLKSWAGEN VOLKSWAGEN Tiguan Allspace 2.0 TDI SCR
4Motion DSG R-Line

Datum	KM-Stand	Beschreibung
19.05.2026	179.146	Bremse Sonstiges; Bremsflüssigkeit; Bremsflüssigkeit ern; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben hinten; Bremsscheiben vorne; Kraftstofffilter ern; Motoröl b. Wartung; Ölfilter ern; Ölwechsel - Hinterachse; Regelwartungsdienst; Reparatur Sonstiges; Wartung Sonstiges
24.10.2025	150.388	Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
25.07.2025	138.425	HU + AU
17.01.2025	119.633	Bremsscheiben + Klötze v; Getriebeöl ern/prüfen; Motoröl b. Wartung; Regelwartungsdienst
28.05.2024	88.818	Bremse Sonstiges; Bremsflüssigkeit; Bremsflüssigkeit ern; Bremsklötze hinten; Bremsscheiben + Klötze h; Bremsscheiben hinten; Getriebeöl ern/prüfen; Kraftstofffilter ern; Motoröl b. Wartung; Ölfilter ern; Ölwechsel - Hinterachse; Regelwartungsdienst; Systemtest/Eigendiagnose; Wartung Sonstiges
01.12.2023	59.525	Bremse Sonstiges; Bremsklötze vorne; Bremsscheiben vorne; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
10.03.2023	29.769	Motoröl b. Wartung; Regelwartungsdienst