


Vehicle details

VIN	YSM4ZPAA3 TF430456	Registration date	10/10/2025	Exterior Color	Snow Matte
Brand	Polestar	Licence Plate	N/A	Odometer	7 183 km
Model	Polestar 4 PA / 200 kW (272 PS)	Condition of the car	Mit Schaden		
Pre-damage	Yes	Pre-damage amount excl. VAT	2138.49 €	Pre-damage Comments	2138,49€ rear body_damage ,

Inspection Details

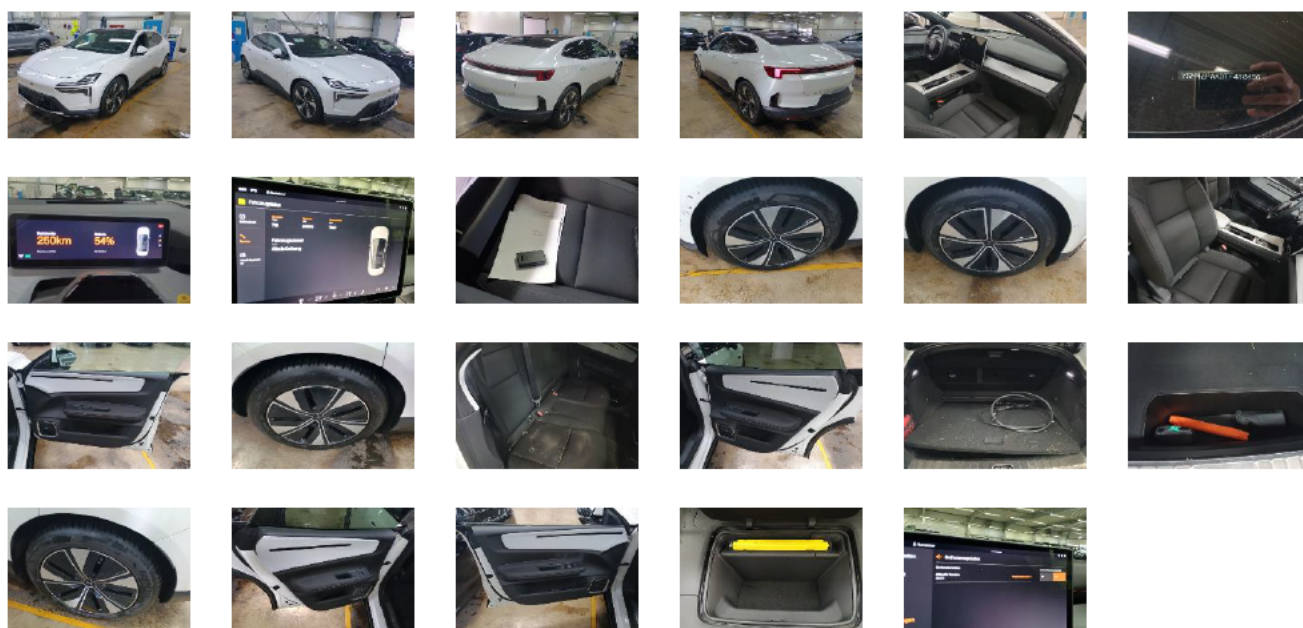


Removable element

Emergency compressor kit	✓
Refill emergency kit	✓
Toolkit	✓
Triangle	✓
Rear parcel shelf	✓
Floor mat BR	✓
Floor mat BL	✓
Floor mat FR	✓
Floor mat FL	✓

Technical Document

User manual	✓
Warranty booklet	✓
Log books	✓
First aid kit	✓
Inspektion	✓
Ladekabel Starkstrom-Steckdose	✓

Tyres

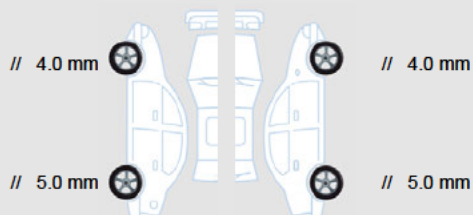

Exterior

1		Part	Bumper	Repair Time	1.30	Part Cost	-
		Position	Front	Repair Cost	117.00€	Net Cost	285.75€
		Damages	Scratched	Paint Time	1.50		
		Comments	-	Paint cost	168.75€		
				Flat Rate	-		
2		Part	Headlight	Repair Time	0.40	Part Cost	1,501.64€
		Position	Front left	Repair Cost	36.00€	Net Cost	1,537.64€
		Damages	Replace	Paint Time	-		
		Comments	-	Paint cost	-		
				Flat Rate	-		
3		Part	Bumper moulding	Repair Time	0.20	Part Cost	80.98€
		Position	Front	Repair Cost	18.00€	Net Cost	98.98€
		Damages	Replace	Paint Time	-		
		Comments	-	Paint cost	-		
				Flat Rate	-		
4		Part	Unpainted bumper	Repair Time	0.30	Part Cost	84.34€
		Position	Front	Repair Cost	27.00€	Net Cost	111.34€
		Damages	Replace	Paint Time	-		
		Comments	-	Paint cost	-		
				Flat Rate	-		
5		Part	Tailgate / Boot door	Repair Time	0.60	Part Cost	-
		Position	-	Repair Cost	54.00€	Net Cost	54.00€
		Damages	Dented - Smart repair	Paint Time	-		
		Comments	-	Paint cost	-		
				Flat Rate	54.00€		
6		Part	Door	Repair Time	0.60	Part Cost	-
		Position	Front right	Repair Cost	54.00€	Net Cost	54.00€
		Damages	Dented - Smart repair	Paint Time	-		
		Comments	-	Paint cost	-		
				Flat Rate	54.00€		

Estimated repair cost
Total **2,141.71€**