



Expertise

Protocol number: 46344082
Order No. / Reference: 26588104
Inspection date: 1 Jul 2026

Manufacturer: Mercedes-Benz

Model: GLC 220 d 4Matic 9G-TRONIC Exclusive

VIN: W1N2539151V331321



Vehicle details	
Manufacturer / Type / Model / Equipment	
Mercedes-Benz GLC 220 d 4Matic 9G-TRONIC Exclusive	
Vehicle Identification number	W1N2539151V331321
Mileage (Read)	175,334 km
First registration	27 Oct 2021
Number of holders	1
Next periodical technical inspection	10/2026
(Report not on hand)	
Power / Engine displacement	143 kw / 1,950 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 9
Type of drive	All-wheel drive
Type of vehicle	SUV
Colour / colour code	Schwarz
Doors / Seats	5 / 5
Upholstery type	Leather
Colour of upholstery	Black
Re-import	no
readiness to drive	Roadworthy



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	82 Tag(e)
Last service on / at	09/2025 at 153,774 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GF723016
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
readiness to drive	Roadworthy		
Manufacturer key number/ type code number	2222 / AKG 00229		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,500 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/65 R17 108V	Summer tyres on Light alloy	Continental	5mm / 5mm
2)	235/65 R17 108V	Summer tyres on Light alloy	Continental	6mm / 6mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- Airbag for driver and front passenger
- Airbag: Sidebag for driver and front passenger (combined thorax/pelvisbag)
- 4MATIC all-wheel drive
- Anti-lock braking system (ABS)
- ATTENTION ASSIST (can detect typical signs of fatigue through driver behavior and warn the driver of increasing fatigue or inattentiveness)
- Automatic passenger airbag deactivation
- On-board computer
- Roof rails in polished aluminum
- Diesel particulate filter
- Third brake light in LED technology
- EASY-Pack cargo cover (removable)
- Driving light assistant
- Electric window regulator, 4-way (with comfort operation and anti-pinch protection)
- Velour floor mats in interior color
- Heated rear window (with timer)
- Interior headliner fabric crystal grey (Only in combination with upholstery in black (001, 101, 221, 301, 651))
- KEYLESS-GO start function
- Remote trunk lid release
- Instrument cluster with 2 tubular round instruments, 13.97 cm (5.5") multifunction display
- Communication module (LTE) for using Mercedes me connect services (The communication module (LTE) offers you a clear increase in comfort and safety. It constantly connects the vehicle to the internet – so that you can use helpful services such as the Live Traffic Information from Mercedes me connect. Two mobile antennas and an LTE-enabled SIM card ensure a fast connection.)
- Steering wheel: Multifunction sports steering wheel in 3-spoke design in black leather (with black decorative stitching and two-piece front trim in silver chrome)
- Mercedes-Benz emergency call system
- Package: Storage (map pockets on the back of the front seats - net on the load floor - folding box under the load floor - 12V socket in the load compartment on the left - cargo bars - two USB-C ports in the rear)
- Package: Interior lighting (More light, more atmosphere, better orientation: The interior lighting package provides more comprehensive direct and indirect lighting. The additional light elements create a pleasant atmosphere and make operation easier.)
- Tire pressure monitoring system (TPMS)
- Remote Services Plus (The Remote Services Plus package transforms mobility into a new experience, offering greater comfort and safety. Status queries provide information about the remaining range. You can remotely control certain functions and locate your vehicle. Services such as maintenance management coordinate service appointments, saving you valuable time.)
- Airbag: Kneebag for driver
- Airbag: Windowbags
- Active Brake Assist (can help avoid rear-end collisions with vehicles ahead, whether moving or stationary, as well as collisions with moving pedestrians and cyclists. In addition to distance and collision warnings, it primarily offers brake boosting – up to and including autonomous emergency braking.)
- Heated exterior mirrors on the left and right, electrically adjustable from the inside (with aspherically curved mirror glass and integrated turn signal light)
- Tachometer
- DYNAMIC SELECT
- Electronic Stability Program (ESP)
- Chassis: AGILITY CONTROL chassis (with selective damping system)
- electric parking brake
- Transmission: 9G-TRONIC
- rear window wiper
- Instrument panel and door sills in ARTICO man-made leather
- Climate: THERMATIC automatic climate control with 2 climate zones (The THERMATIC automatic climate control with 2 climate zones offers individual climate comfort in the front seats: driver and front passenger can set the temperature separately for their side. Thanks to the automatic climate control and the sensitive sensor system, this is kept constant without any manual adjustments.)
- Headrests adjustable in 5 ways (4-way for driver and front passenger, and 2-way in the rear)
- Paint finish: Solid
- LED High Performance headlights (with integrated daytime running lights, LED taillights)
- Steering column mechanically adjustable in height and length
- Navigation accessories: Extended MBUX functions (personalization (profiles) and prediction functions - LINGUATRONIC with natural language understanding - activation via "Hey Mercedes" - Wi-Fi hotspot - internet radio)
- Radio: MBUX multimedia system
- Radio accessories: Digital radio
- Radio accessories: Touchpad (integrated into the center console, including a hand rest - single and multi-finger gestures, swiping movements and zoom gestures by spreading and pinching the fingers - recognizes handwritten characters: letters, special characters and numbers - clear haptic feedback)
- Wheels: 43.2 cm (17") alloy wheels, 4-piece set in 10-spoke design (vanadium silver painted with 235/65 R17 tires, 7.5 J x17 ET36)
- Windscreen wipers with rain sensor
- Power steering
- Seats: i-Size child restraint system on the outer rear seats
- Seats: Front seats electrically adjustable (with electric adjustment for seat height and backrest angle, as well as mechanical adjustment for longitudinal adjustment and headrests)



- Seats: Folding rear seat backrests (40/20/40 split including Easy Pack Quickfold and center armrest with double cupholder and storage compartment)
- Cruise control (Drive relaxed and fuel-efficiently, especially on longer journeys. Simply select your desired speed and your vehicle will regulate it. In addition to the cruising speed, the speed limiter helps you maintain a maximum speed. This increases road safety and protects you from expensive speeding tickets.)

- High-visibility vest for drivers
- Immobiliser
- Central locking (with interior switch, automatic locking (can be deactivated) and crash sensor with emergency opening)

Extra equipment

- Decorative elements: open-pored brown walnut wood
- EASY-Pack tailgate with electric operation for opening and closing
- Lower price component
- Partition net for luggage compartment separation (and occupant protection)
- Upholstery: ARTICO man-made leather
- Package: Business (Advanced Parking Package: Active Parking Assist PARKTRONIC with reversing camera; Advanced Infotainment Package: Media display with touch operation, smartphone integration - Apple CarPlay and Android Auto, connectivity package navigation, traffic sign assist; Comfort Package: Heated seats for driver and front passenger, seat comfort package - electric and manual adjustment options for the front seats; larger fuel tank capacity)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was roadworthy at the time of inspection.

Value reducing factors

No.	Component group	Description
1	Mudguard - right side	Mudguard - right side - Scratch(es) - Smart repair
2	Side panel - rear left side	Sill - Scratch(es) - Smart repair
3	Door - rear left side	Door edge - Scratch(es) - Smart repair
4	Door - front right side	Door - Scratch(es) - Smart repair
5	Rear bumper	Rear bumper - Scratch(es) - Smart repair
6	Door - front left side	Door - Scratch(es) - Paint
7	Bonnet	Bonnet - Stone chips - Paint
8	Front bumper	Spoiler - Broken / torn - Replace

Wear and tear

No.	Component group	Description
1	Vehicle glazing	Windscreen - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

Documents - Owner's manual



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

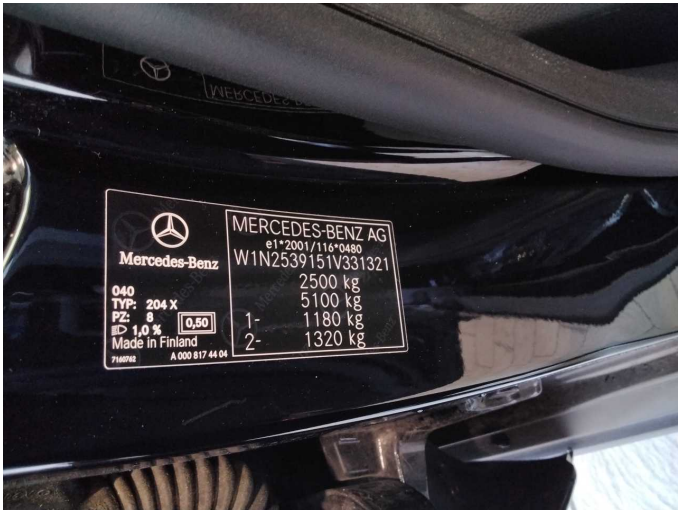


Figure 11: VIN



Figure 12: Mounted tyres

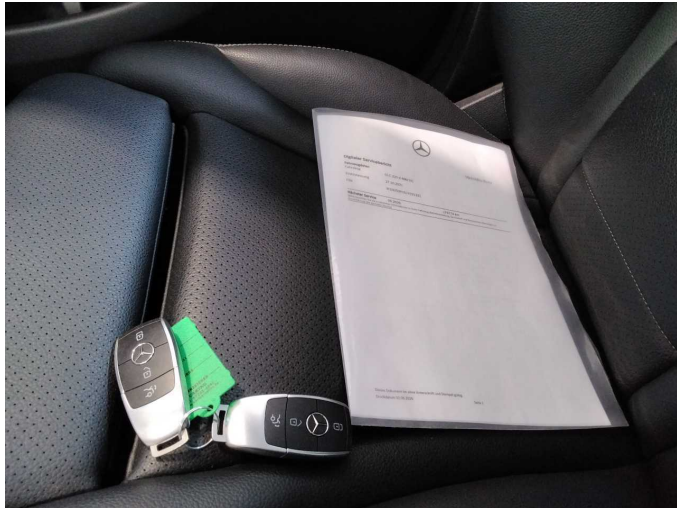


Figure 13: Documents

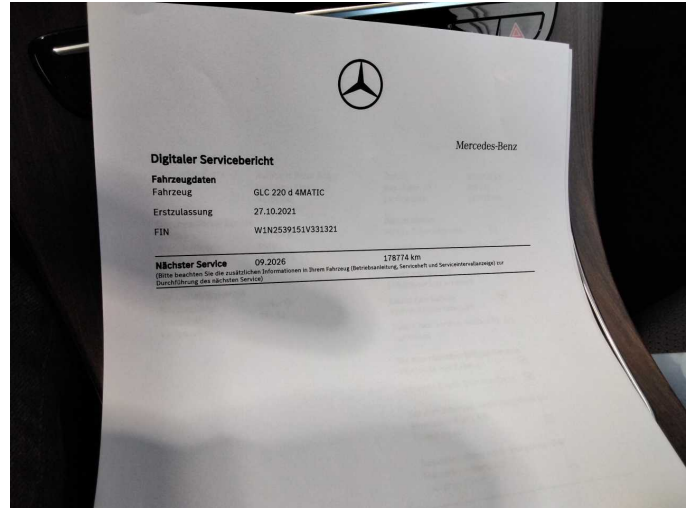


Figure 14: Documents

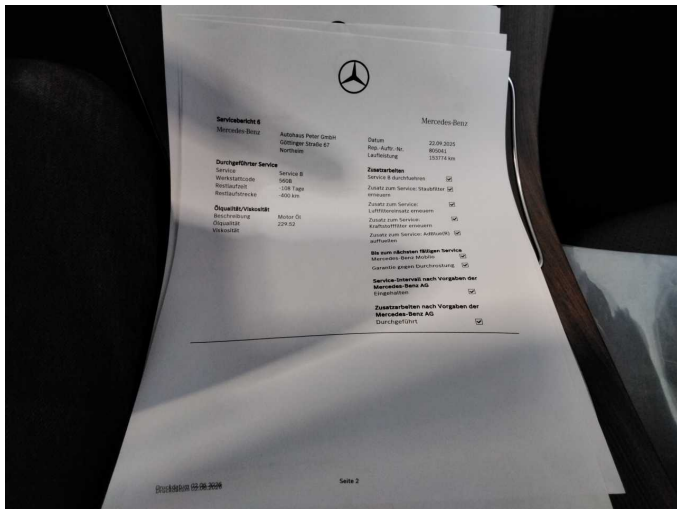


Figure 15: Documents

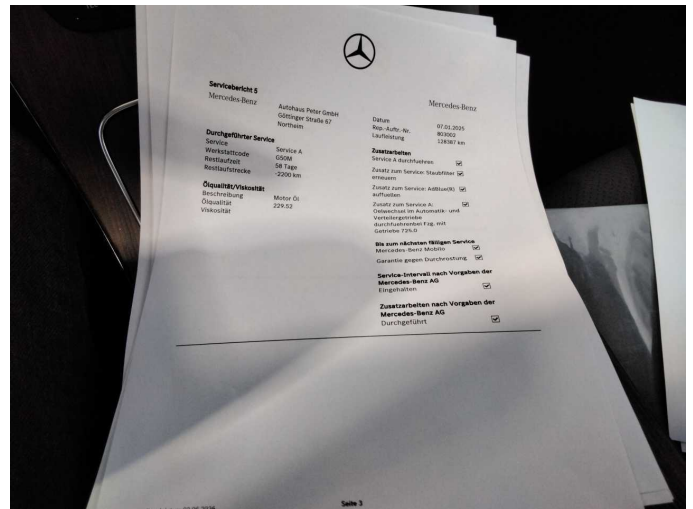


Figure 16: Documents

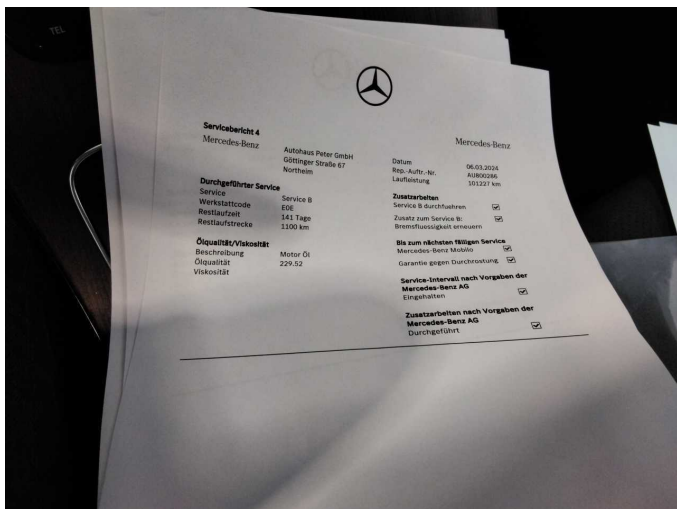


Figure 17: Documents

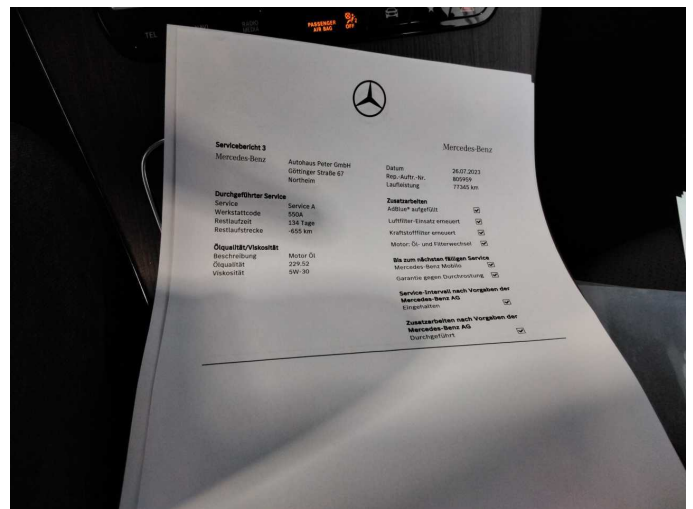


Figure 18: Documents

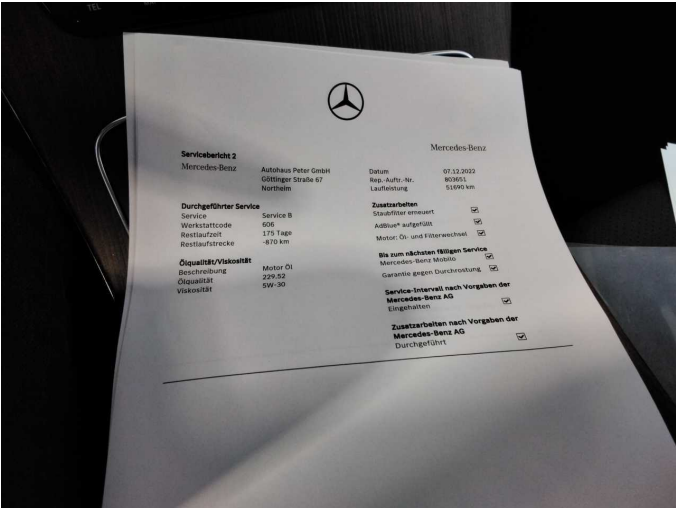


Figure 19: Documents

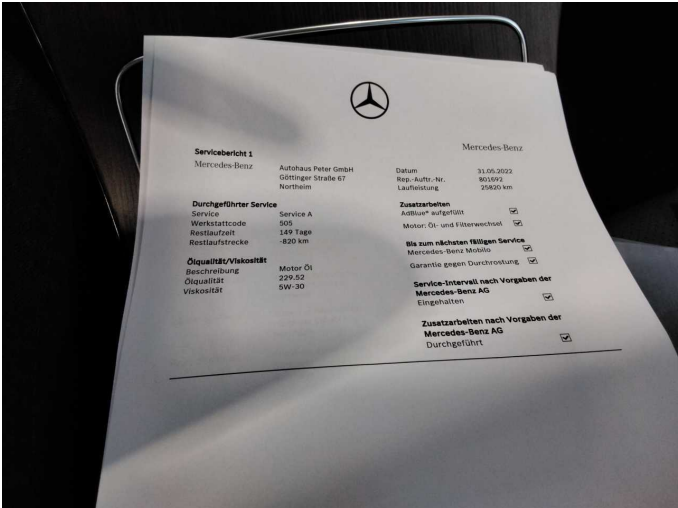


Figure 20: Documents

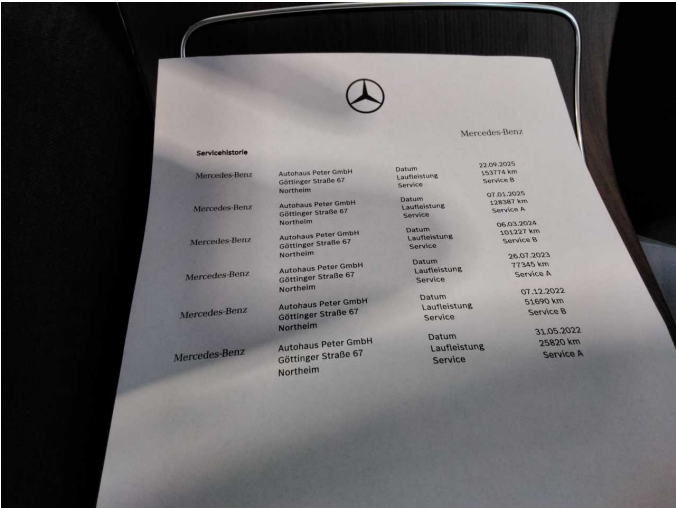


Figure 21: Documents



Figure 22: Navigation



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.

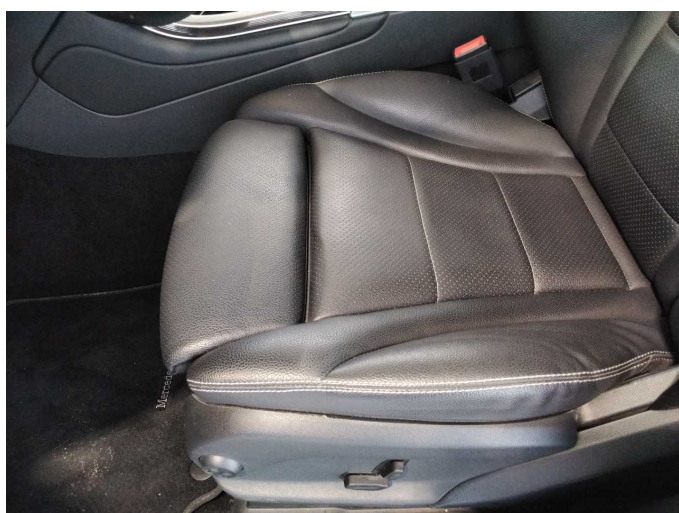


Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.




Figure 33: Misc.



Figure 34: Misc.



Damage 1: Mudguard - right side: Mudguard - right side - Scratch(es) - Smart repair

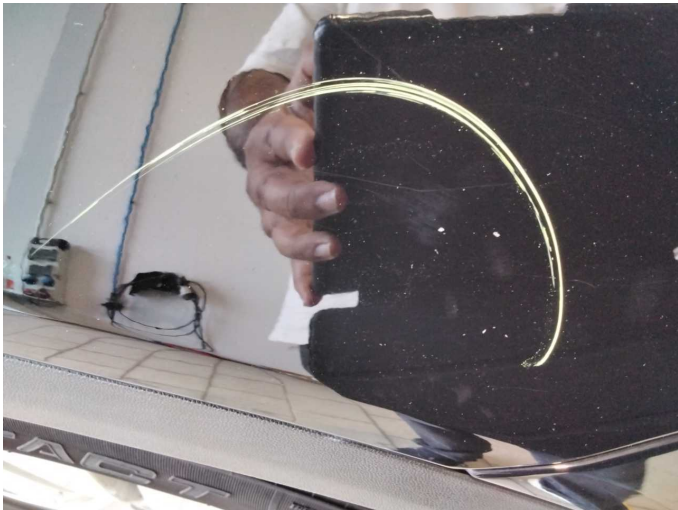

Damage 1: Mudguard - right side: Mudguard - right side - Scratch(es) - Smart repair



Damage 2: Side panel - rear left side: Sill - Scratch(es) - Smart repair



Damage 2: Side panel - rear left side: Sill - Scratch(es) - Smart repair




Damage 3: Door - rear left side: Door edge - Scratch(es) - Smart repair




Damage 3: Door - rear left side: Door edge - Scratch(es) - Smart repair



Damage 4: Door - front right side: Door - Scratch(es) - Smart repair

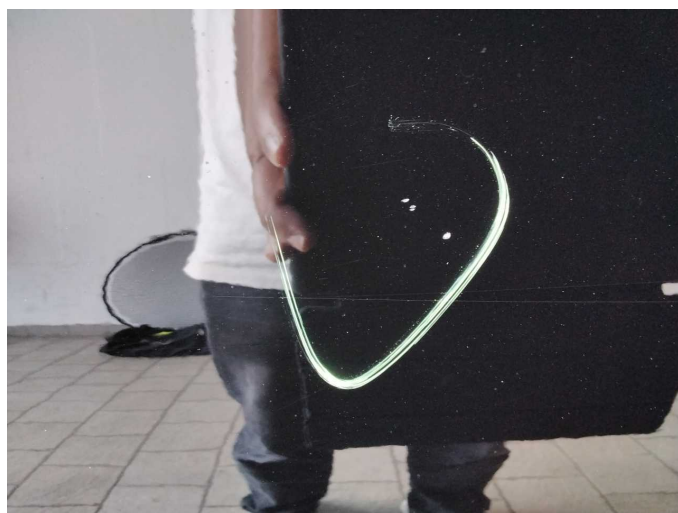

Damage 4: Door - front right side: Door - Scratch(es) - Smart repair

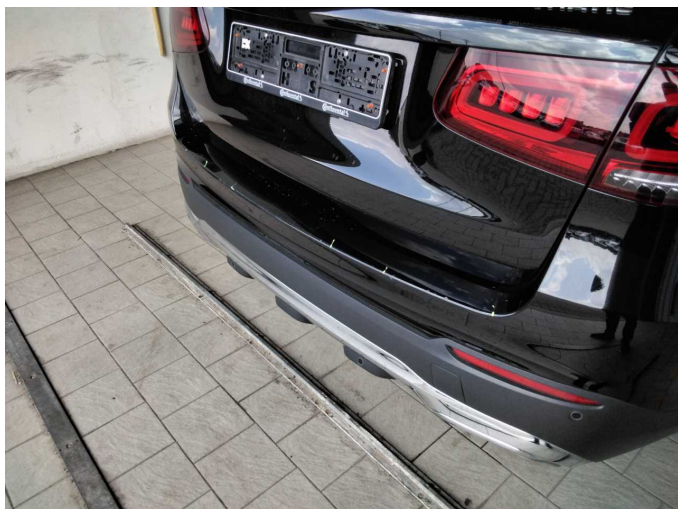

Damage 5: Rear bumper: Rear bumper - Scratch(es) - Smart repair



Damage 5: Rear bumper: Rear bumper - Scratch(es) - Smart repair



Damage 5: Rear bumper: Rear bumper - Scratch(es) - Smart repair



Damage 5: Rear bumper: Rear bumper - Scratch(es) - Smart repair



Damage 5: Rear bumper: Rear bumper - Scratch(es) - Smart repair



Damage 6: Door - front left side: Door - Scratch(es) - Paint




Damage 6: Door - front left side: Door - Scratch(es) - Paint




Damage 6: Door - front left side: Door - Scratch(es) - Paint




Damage 6: Door - front left side: Door - Scratch(es) - Paint

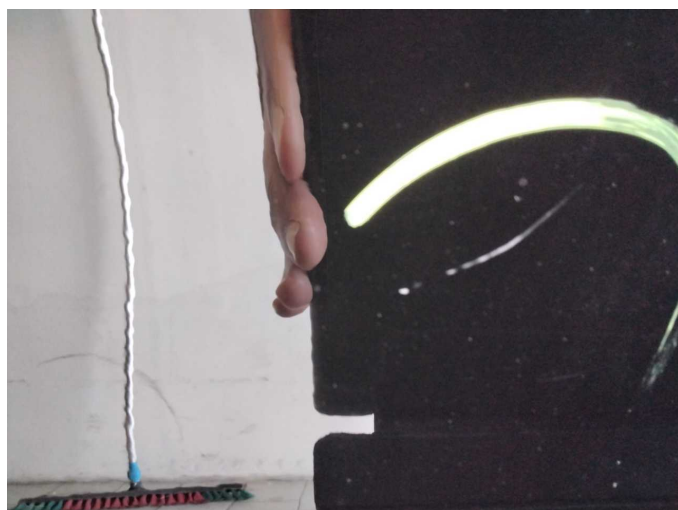

Damage 6: Door - front left side: Door - Scratch(es) - Paint

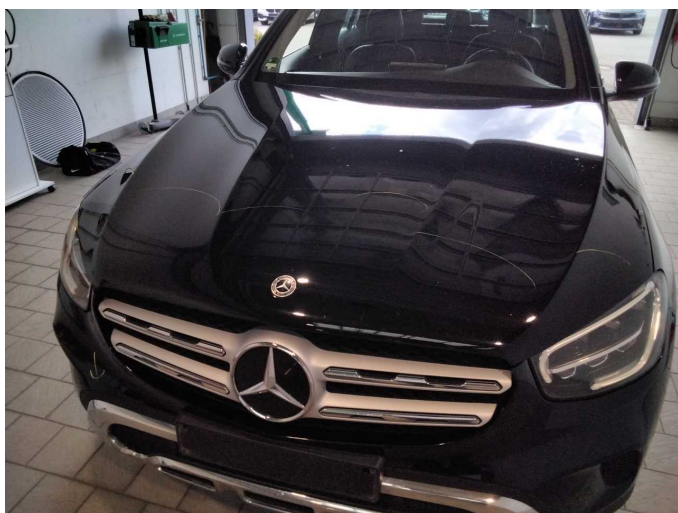


Damage 7: Bonnet: Bonnet - Stone chips - Paint

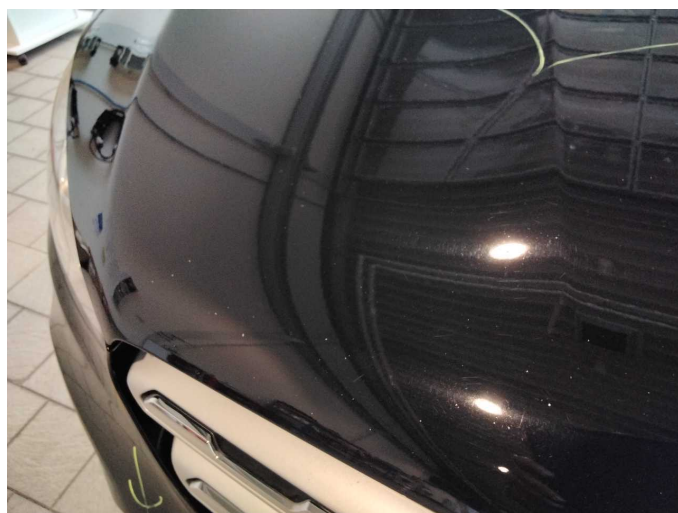


Damage 7: Bonnet: Bonnet - Stone chips - Paint




Damage 7: Bonnet: Bonnet - Stone chips - Paint

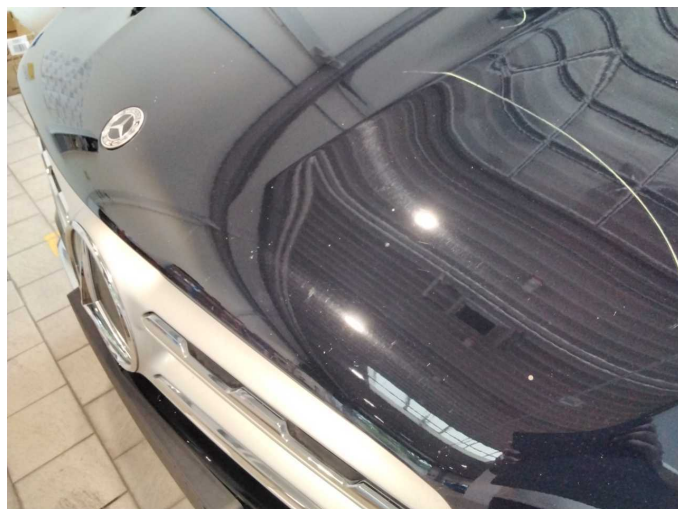


Damage 7: Bonnet: Bonnet - Stone chips - Paint

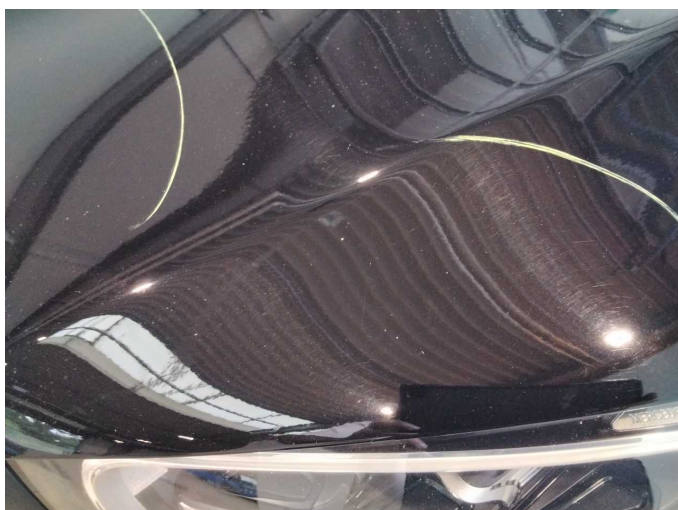

Damage 7: Bonnet: Bonnet - Stone chips - Paint

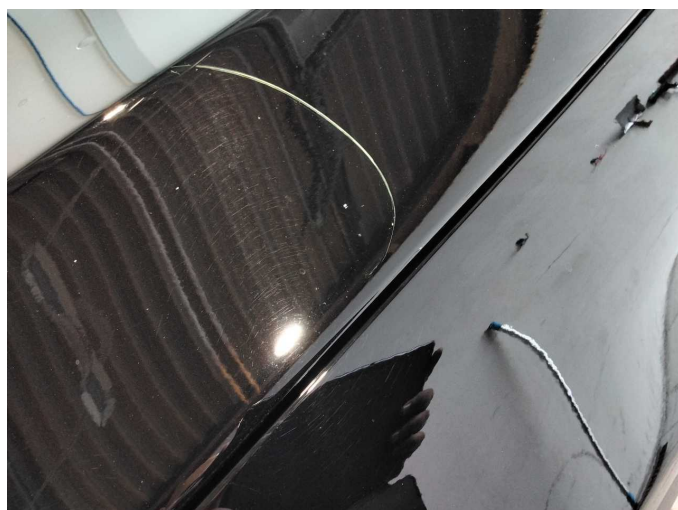

Damage 7: Bonnet: Bonnet - Stone chips - Paint

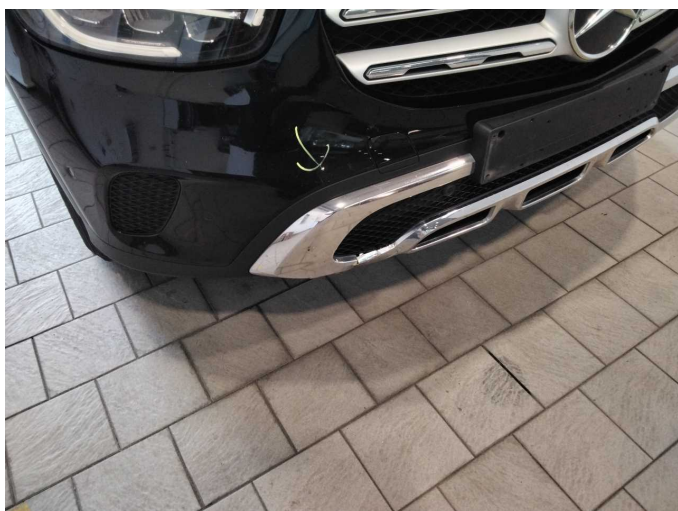

Damage 8: Front bumper: Spoiler - Broken / torn - Replace



Damage 8: Front bumper: Spoiler - Broken / torn - Replace