

INFORME DE INSPECCIÓN

VEHÍCULO

4809NGW / WBA31EG0105470924 / 5470924

Datos vehículo:

Marca:	BMW	Combustible:	DIESEL
Modelo:	X1 SDRIVE20D U11	Transmisión:	NO DETERMINADO
Versión:	X1 sDrive20d U11	Color:	NO DETERMINADA
Tapicería:	NO DETERMINADA	Kilómetros:	30.062

Controles específicos:

Llaves principales:	1	Llaves secundarias:	0
Llaves especiales:	0	Tipo transmisión:	Automática
Revisión:	Sin libro		

 DOCUMENTACION ORIGINAL

 CARPETA MANUALES

 MANUAL PROPIETARIO

 TUERCA ANTIRROBO

Información neumáticos

4809NGW Neumático	Marca	Medidas	Índice carga	Índice velocidad	Runflat
DD	PIRELLI	245/45/19	102	Y	-
DI	PIRELLI	245/45/19	102	Y	-
RP					-
TD	PIRELLI	245/45/19	102	Y	-
TI	PIRELLI	245/45/19	102	Y	-

Datos Inspección:

Tipo Inspección:	COMERCIAL	Ubicación Inspección:	BAL CIEMPOZUELOS
Fecha Inspección:	22/05/2026	RaC:	SIXT RENT A CAR
Comentarios:	servicio de aceite vence en 60km		

Daños no valorables:

4809NGW COMPONENTE	ACCIÓN		COMENTARIO						
4809NGW COMPONENTE	TIPO DAÑO	ACCIÓN	CARROC.	MONTAJE	PINTURA	MAT. PINTURA	RECAMBIO	%DTO	IMPORTE
1. Jgo pegado sensor lluvia	-	REEMPLAZAR				0,00	29,44	10,00	26,49 €
2. Luna parabrisas	-	REEMPLAZAR	2.25 h.			0,00	561,23	40,00	423,36 €
3. Jgo pegado lunas - PEGADO FRIO 300ML - Nueva	-	REEMPLAZAR				0,00	61,68	10,00	55,51 €
4. Moldura sup luna parabrisas	-	REEMPLAZAR				0,00	25,95	10,00	23,35 €
5. Emblema tr	-	REEMPLAZAR	0.08 h.			0,00	46,81	10,00	45,20 €
6. Anagrama tr modelo	-	REEMPLAZAR	0.17 h.			0,00	42,14	10,00	44,47 €
7. Neumático dl iz - HANKOOK S1 EVO3 - Nueva	-	REEMPLAZAR	0.44 h.			0,00	169,70	10,00	169,67 €
8. Neumático dl dr - HANKOOK S1 EVO3 - Nueva	-	REEMPLAZAR	0.44 h.			0,00	168,00	10,00	168,14 €
9. Neumático tr iz - HANKOOK S1 EVO3 - Nueva	-	REEMPLAZAR	0.44 h.			0,00	169,70	10,00	169,67 €
10. Neumático tr dr - HANKOOK S1 EVO3 - Nueva	-	REEMPLAZAR	0.44 h.			0,00	169,70	10,00	169,67 €
11. Paragolpes dl	Pintar Reparado Combinada no	DESMONTAR Y MONTAR		1.25 h.	1.25 h.	5,29	0,00		101,54 €
12. Paragolpes tr (zona inf)	Pintar Reparado Pieza desmontada	DESMONTAR Y MONTAR		1.00 h.	0.92 h.	3,90	0,00		77,82 €
13. Carcasa retrovisor dr	Pintar Sustitución Combinada no	DESMONTAR Y MONTAR		0.08 h.	0.25 h.	1,06	0,00		13,76 €
14. Aleta dl iz	Pintar Reparado Pieza montada	REPARAR	0.20 h.		1.00 h.	4,24	0,00		50,44 €
15. Puerta dl dr	Pintar Reparado Pieza montada	REPARAR	0.20 h.		2.67 h.	11,31	0,00		121,80 €
16. Puerta tr dr	Pintar Reparado Pieza montada	REPARAR	0.20 h.		2.25 h.	9,53	0,00		103,85 €
17. Portón tr	Pintar Reparado Pieza montada	REPARAR	0.20 h.		2.92 h.	12,37	0,00		132,49 €
18. Manilla exterior puerta dl dr	-	DESMONTAR Y MONTAR		0.09 h.		0,00	0,00		3,46 €
19. Manilla exterior puerta dl iz	-	DESMONTAR Y MONTAR		0.09 h.		0,00	0,00		3,46 €
20. Cejilla ext puerta dl dr	-	DESMONTAR Y MONTAR		0.67 h.		0,00	0,00		25,79 €
21. Cejilla ext puerta dl iz	-	DESMONTAR Y MONTAR		0.67 h.		0,00	0,00		25,79 €
22. Manilla exterior puerta tr dr	-	DESMONTAR Y MONTAR		0.08 h.		0,00	0,00		3,08 €
23. Cejilla ext puerta tr dr	-	DESMONTAR Y MONTAR		0.08 h.		0,00	0,00		3,08 €
24. Paragolpes tr (zona sup)	Pintar Reparado Combinada no	-			1.33 h.	5,63	0,00		56,83 €
25. Puerta dl iz	Pintar Reparado Pieza montada	-			2.67 h.	11,31	0,00		114,10 €
26. Capó dl	Pintar Reparado Pieza montada	-			5.42 h.	22,95	0,00		231,62 €

4809NGW COMPONENTE	TIPO DAÑO	ACCIÓN	CARROC.	MONTAJE	PINTURA	MAT. PINTURA	RECAMBIO	%DTO	IMPORTE
27. Llanta rueda dl iz	-	PINTURA LLANTA PULIDA				0,00	0,00		150,00 €
28. Llanta rueda tr iz	-	PINTURA LLANTA PULIDA				0,00	0,00		150,00 €
29. Faro dr	-	PULIDO POLICARBONATO				0,00	0,00		50,00 €
30. Aleta dl dr	-	SR Pintura				0,00	0,00		40,00 €
31. Faro iz	-	PULIDO POLICARBONATO				0,00	0,00		50,00 €
32. Llanta rueda dl dr	-	PINTURA LLANTA PULIDA				0,00	0,00		150,00 €
33. Llanta rueda tr dr	-	PINTURA LLANTA PULIDA				0,00	0,00		150,00 €
34. Puerta tr iz	-	SR Pintura				0,00	0,00		40,00 €
TOTAL INSPECCIÓN								(IVA no incluido)	3144,44 €

* Faltantes en color naranja

(IVA no incluido)

4809NGW RESUMEN PERITACIÓN	TIEMPO	EUROS
Total Mano de Obra Carrocero	9,07 h.	349,16 €
Total material pintura	-	87,59 €
Total Mano de Obra Pintura	20,68 h.	796,15 €
Total Recambios	-	1131,55 €
Descuento recambios aplicado	-	312,80 €
Total Faltantes	-	0,00 €
Total Smart Repair	-	780,00 €















45 km 9:23

Values since Individual

0.9 l/h



Total 30063 km 11731.6 km



Power % 100

P

Door open.

+18.0 °C

WARM-UP



Instrument cluster display showing speedometer (0 km/h), tachometer, and navigation information. Text includes "Vehicle status indicators" and "BMW".

RADIO ALL STATIONS FAVORITES
Loop40
Loop40
Loop40 Classic
Loop40 Dance
Loop40 Urban
103.1 MHz
Loop40 Live
LOWL
LOWL

Center console gear shifter and handbrake area with digital display and buttons.

RADIO

ALL STATIONS FAVORITES

- Los40
- Los40
- Los40 Classic
- Los40 Dance
- Los40 Urban

LOW FADER

LOW FADER AUTO OFF

B. RINDE DE LA C
Los40 Urban

Los40 UR

934

MAX
RPM
100

Vol. | EQ

AUTO H







BMW

Ⓢ WBA31EG0105470924 Ⓢ









MEDIA

TEL

NAV

The navigation screen displays a map with a blue overlay titled "My destinations". The overlay contains a 2x3 grid of icons: a gas pump, a magnifying glass with a 'P', a parking 'P' sign, a coffee cup, a fork and knife, and a hamburger. Below the grid is a search bar with the text "Search" and a magnifying glass icon. The background map shows a road network with labels like "Calle Alamo" and "Carretera Buzanca". The top status bar includes a notification bell, a location pin, "LOS40 UR", a speaker icon, a user profile icon, and the time "9:25".

- **LOW** +
AUTO OFF

- **LOW** +
AUTO OFF

MAX





S2WR2
3054

OFF ON ZERO

4.02

Indivim



TREADWEAR 280

TRACTION

5.92

OFF ON

ZERO

inch/mm



3525

TEMPERATURE A

P72A

OFF ON ZERO

5.35

Inch/mm



OFF ON ZERO

4.21

Inch/mm

























TRACTION AA - TEMPERATURE

W3

W2396L

(3625)

PZ4

003844
2012



Manheim
COX AUTOMOTIVE



Manheim
COX AUTOMOTIVE

TRACTION AA - TEMPERATURE

W3525 3525





 **Manheim**
COX AUTOMOTIVE





Manheim
COX & CO. AUTOMOTIVE





Manheim
COX AUTOMOTIVE










 **Manheim**
COL. AUTOMOTIVE

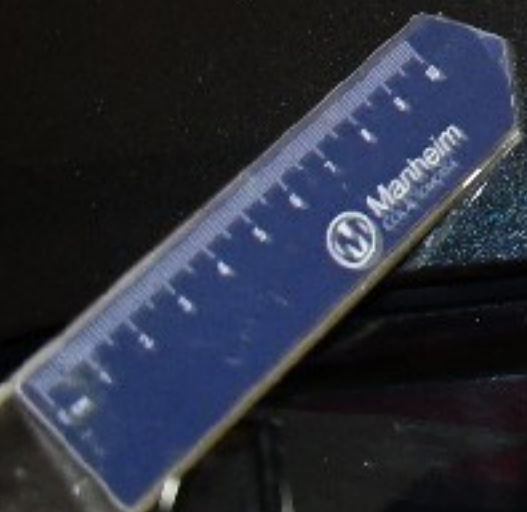



DML - ABSOLUTE

5

ASO 40

L3R

OUT

5W

E

CE

RoHS

Manheim
CDR - AUTOMOTIVE



 **Manheim**
CORPORATION





Manheim
COX AUTOMOTIVE

10
9
8
7
6
5



Manheim
COX AUTO CENTERS

C



Manheim
COX AUTOMOTIVE



PIRELLI

TRACTION AS TEMPERATURE

3625

270

PIRELLI



Manheim
CAR MEASUREMENTS



 **Manheim**
COR. AUTOMOTIVE

10 9 8 7 6 5 4 3 2 1 0

TREADWEAR 30





Manheim
CORPORATION



4809 NGW

GOONPLAC.COM

Manheim
CAR & TRUCK





 **Manheim**
COX AUTOMOTIVE