



Expertise

Protocol number: 46429164
Order No. / Reference: 26584500
Inspection date: 6 Jul 2026

Manufacturer: Volvo

Model: V60 T6 AWD Recharge Geartronic RDesign

VIN: YV1ZWBFVDM1444088



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volvo V60 T6 AWD Recharge Geartronic RDesign	
Vehicle Identification number	YV1ZWBFVDM1444088
Mileage (Read)	67,010 km
First registration	29 Apr 2021
Number of holders	1
Next periodical technical inspection	04/2028
(Report on hand)	
Power / Engine displacement	186 kw / 1,969 ccm
Fuel type / Cylinder	Hybr.B/E ext.aufl / 4
Gearbox / Number of gears	Automatic / 8
Type of drive	All-wheel drive
Type of vehicle	Station wagon
Colour / colour code	Bursting Blue-Metallic
Doors / Seats	5 / 5
Upholstery type	Leather
Colour of upholstery	Anthracite



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	266 Tag(e)
Last service on / at	04/2026 at 63,945 km		
Key is / should be	3 / 3	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GA552076
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	9101 / BOH 00014		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,550 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/45 R18 98W	Summer tyres on Light alloy	Michelin	5mm / 5mm
2)	235/45 R18 98W	Summer tyres on Light alloy	Michelin	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/45 R18 98V	Winter tyres on Light alloy	Goodyear	7mm / 7mm
2)	235/45 R18 98V	Winter tyres on Light alloy	Goodyear	7mm / 7mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 03/2025		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- ABS - Anti-lock Braking System
- Driver and passenger side airbags with two-stage deployment system
- Exhaust system with two chrome-plated tailpipes
- Electrically adjustable and heated exterior mirrors
- Outdoor temperature display
- fog sensor
- On-board computer with vehicle control functions
- City Safety
- Colored glazing
- Anthracite headliner
- Roof rails in high-gloss black (integrated)
- Drive Mode
- Driver Alert
- Rear parking assist
- Electronic differential lock Corner Traction Control (CTC)
- ESC - Vehicle Dynamics Control
- Window surround in high-gloss black
- Sport front and rear apron
- Luggage compartment partition net
- Transmission: 8-speed Geartronic
- Heated rear window
- IDIS (Intelligent Driver Information System)
- Interior lighting
- ISOFIX anchors for the outer rear seats
- Child safety lock (manual, rear doors)
- Headrests (5)
- Charging box under the cargo floor
- Stainless steel loading sill protector in the luggage compartment
- LED headlights "Thor's Hammer"
- Steering wheel: Multifunction buttons on the steering wheel in high-gloss black
- Rear center armrest (foldable) with cup holders
- Sensus navigation system
- Emergency brake lights
- Electric parking brake
- Pedals: Sport pedals
- Radio: Sensus Connect infotainment system with high-performance sound
- Radio accessories: Subwoofer
- Rain sensor
- Run-off Road Protection
- Wheels: Tire pressure monitoring system (passive)
- Wheel accessories: Tire sealant
- Speed-sensitive power steering
- Seat belts
- Safety steering column (adaptive)
- Seats: Driver and front passenger seats are height-adjustable (electrically)
- Front passenger airbag can be deactivated
- All-wheel drive (AWD) with Instant Traction
- Ambient lighting
- Electrically folding exterior mirrors
- Sport exterior mirrors in high-gloss black
- Hill Start Assist (HSA)
- LED turn signals integrated into the exterior mirrors
- third brake light
- CleanZone air quality system
- Connected Safety
- Roof edge spoiler
- Digital instrumentation with a 12.3" full-graphic display (31.2 cm diagonal, high resolution)
- Insoles: Metal Mesh
- Aluminum door sill plates with Recharge lettering at the front
- Electric windows front and rear
- Automatic emergency braking
- Sport front grille
- Cruise control system with variable speed limiter
- Automatic tailgate (electric)
- rear window wiper
- Interior and exterior mirrors with automatic dimming function
- Keyless Drive (electronic access system)
- Automatic air conditioning
- Rear headrests foldable, electrically
- Charging cable Schuko/Type 2 (Mode 2), 7 m length, single-phase, 10 A
- Cargo area roller blind
- Steering wheel adjustable for height and reach
- Steering wheel: Sport leather steering wheel
- Illuminated makeup mirror for driver and front passenger
- Front center armrest with integrated storage compartment and cup holders
- Package: Winter Package
- Particulate filter: Gasoline particulate filter
- Upholstery: Leather/Mash-Textile sports seats
- Radio accessories: Apple CarPlay and Android Auto
- Radio accessories: Digital radio reception (DAB+)
- Radio accessories: Two USB-C ports on the back of the center console
- Wheels: 18" 5-twin-spoke alloy wheels, sport design, diamond cut/graphite look
- Gearshift lever: Leather Sport gearshift lever
- Safety braking system with disc brakes all around (internally ventilated)
- Seats: Adjustable leg rest for driver and passenger seats
- Seats: Driver's seat electrically adjustable
- Seats: Lumbar support (4-way electrically adjustable) for driver and front passenger seats
- Start/Stop technology



- Seats: Rear seats in a 40/60 split or fully foldable with pass-through function
- Power socket
- Textile floor mats for sports
- Lashing eyes in the luggage compartment (foldable)
- Preparation for Trailer Stability Assist (TSA)
- WHIPS whiplash protection system

- Fuel filler neck with misfuelling protection
- First aid kit and warning triangle
- Volvo On Call with WiFi hotspot
- Immobiliser
- Central locking system with two remote controls and integrated emergency keys

Extra equipment

- Towbar (semi-electric)
- Chassis: Adaptive chassis with Four-C technology (Continuously Controlled Chassis Concept) with adjustable modes Comfort, Eco, Dynamic)
- Package: IntelliSafe Package Pro (Pilot Assist: Adaptive cruise control with distance warning and lane keeping assist up to speeds of 130 km/h - IntelliSafe Surround with: Blind Spot Information System (BLIS) - Blind Spot Assist and Lane Change Warning including steering intervention Cross Traffic Alert (CTA) - Cross traffic warning with braking intervention - Warning including braking to a standstill Rear impact mitigation - Preventive protection in case of impending rear collisions)
- Package: Xenium Package Pro (Panoramic glass sunroof with tilt function and integrated, continuously adjustable sunshade (electric) - Head-up display: graphic projection of driving information onto the windshield - Parking camera with 360° surround view - Front and rear parking sensors - Sensus Connect infotainment system with HIGH PERFORMANCE SOUND PRO by Harman/Kardon - Enhanced air quality system with fine dust filtration according to PM2.5 air quality standard)
- Side and rear windows tinted (from the B-pillar back)
- Seats: Massage function for driver and front passenger seats
- Storage bag for the charging cable
- Child safety lock for the rear doors, electric
- Paint finish: Bursting Blue Metallic
- Charging cable Type 2/Type 2 (Mode 3) 7 m length 1-phase, 16A (for connection to a charging station with Type 2 connector)
- Package: Light Package (Headlight cleaning system - Full LED headlights "Thor's Hammer" Active High Beam with extended high beam, dynamic cornering lights, intelligent high beam assistant with adaptive headlight range control and integrated LED daytime running lights)
- Package: Seat Comfort Package (Electrically adjustable passenger seat - memory function for passenger seat)
- Park Assist Pilot incl. front/rear parking aid (Parking assistant for parallel and perpendicular parking spaces (left and right) as well as exiting parallel parking spaces. Steering is controlled by the assistant, acceleration and braking are controlled by the driver. The parking space must be at least 1.2 times the length of the vehicle.)
- Upholstery: Nappa leather comfort seats (front seats perforated) (with active ventilation and electrically adjustable side bolsters for driver and front passenger seats including storage compartment in the rear center armrest)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Equipment	Tirefit filler - Expired - Replace
2	Body	Body - Glued / labelled - De-glue / neutralise
3	Wheel / tyres	Alloy rim - rear left side - Scratch(es) - Loss in value



Wear and tear

No.	Component group	Description
1	Front bumper	Front bumper - Stone chips - No deduction
2	Vehicle glazing	Windscreen - Stone chips - No deduction
3	Interior	Interior - Scratch(es) - No deduction
4	Rear bumper	Rear bumper - Scratch(es) - No deduction
5	Bonnet	Bonnet - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

- Die Unterbodenbesichtigung war nur ebenerdig und eingeschränkt möglich.
- Mehrkosten möglich .
- Der beiliegende Winterradsatz ist nicht Bestandteil der Ausstattung.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front

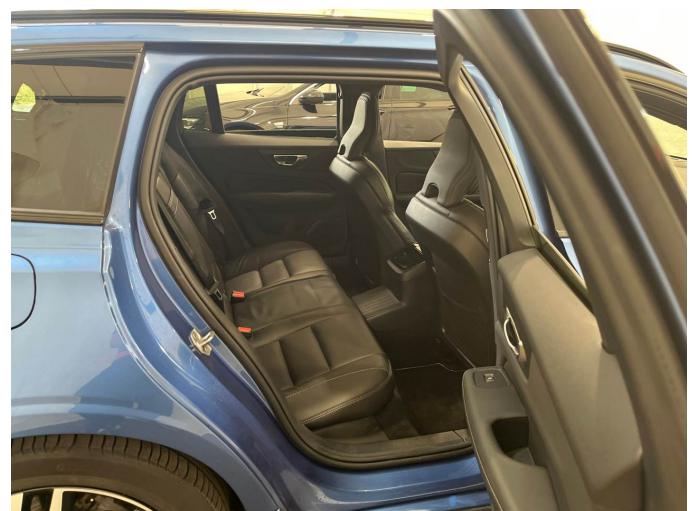


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

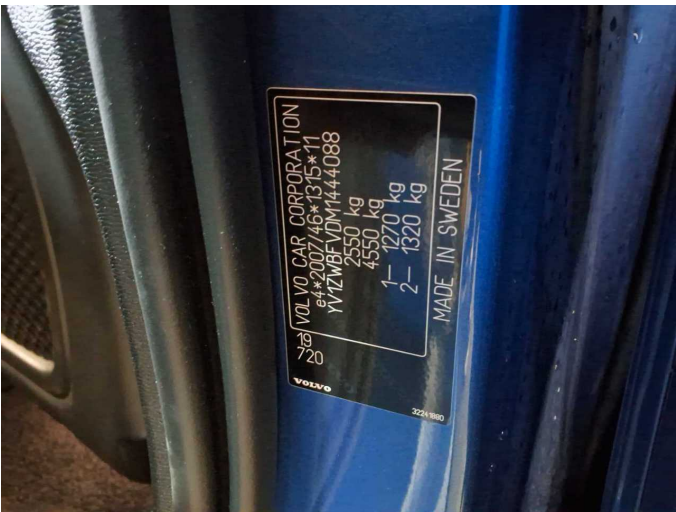


Figure 11: VIN



Figure 12: Mounted tyres

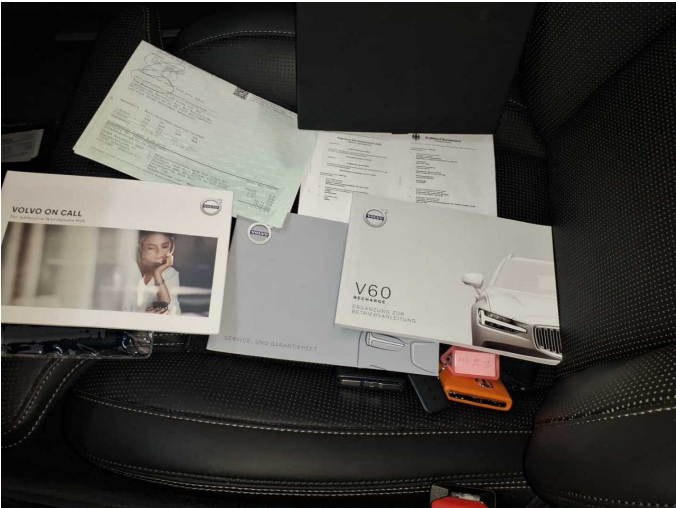


Figure 13: Documents

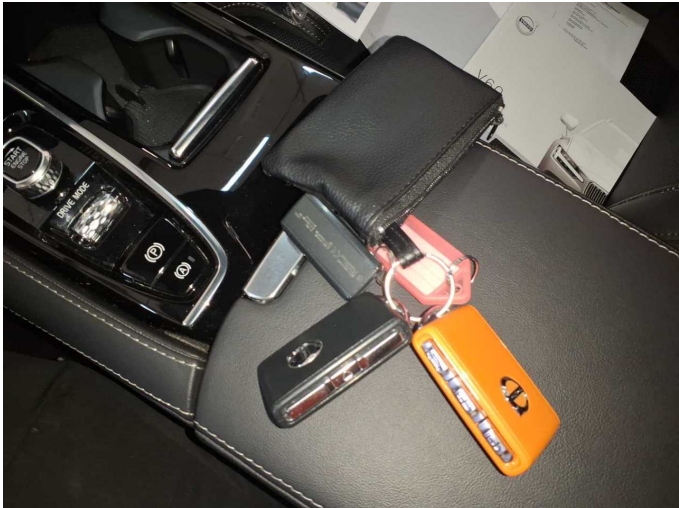


Figure 14: Documents

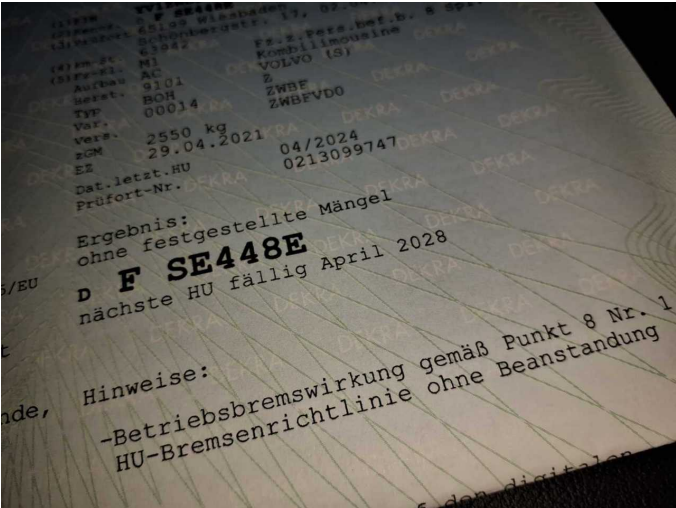


Figure 15: Documents

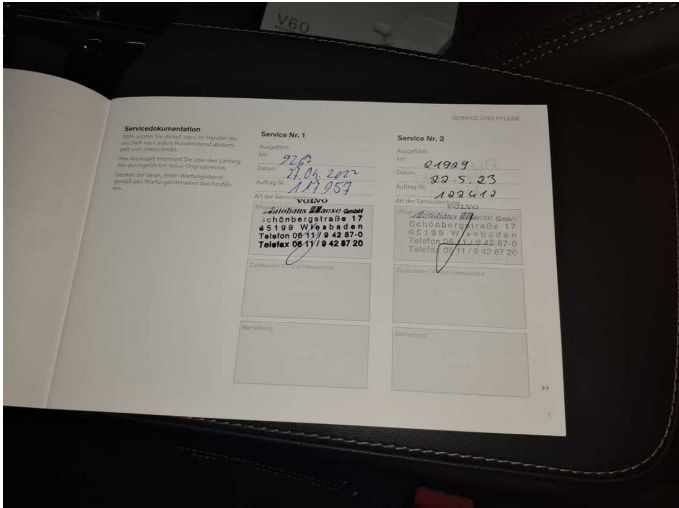


Figure 16: Documents

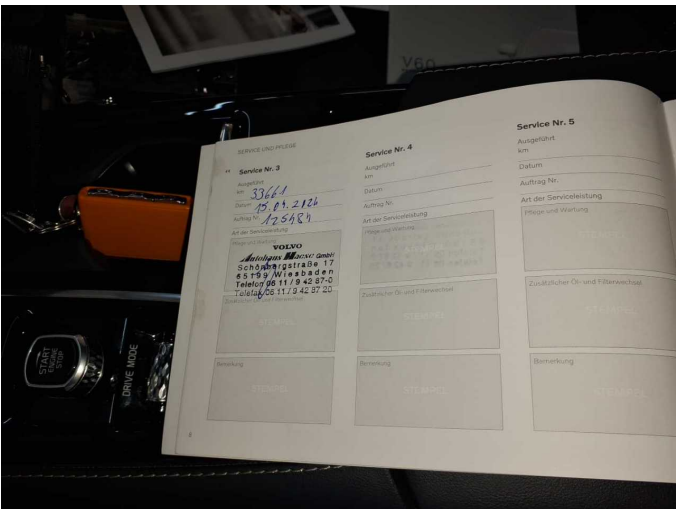


Figure 17: Documents



Figure 18: Documents



Figure 19: Additional tyres

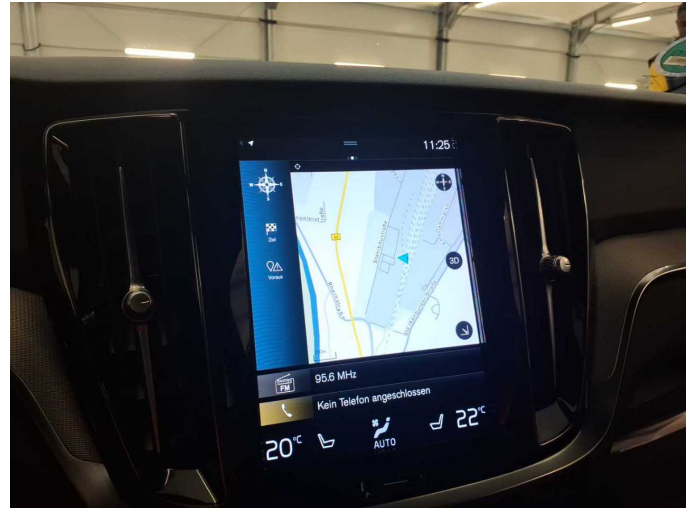


Figure 20: Navigation

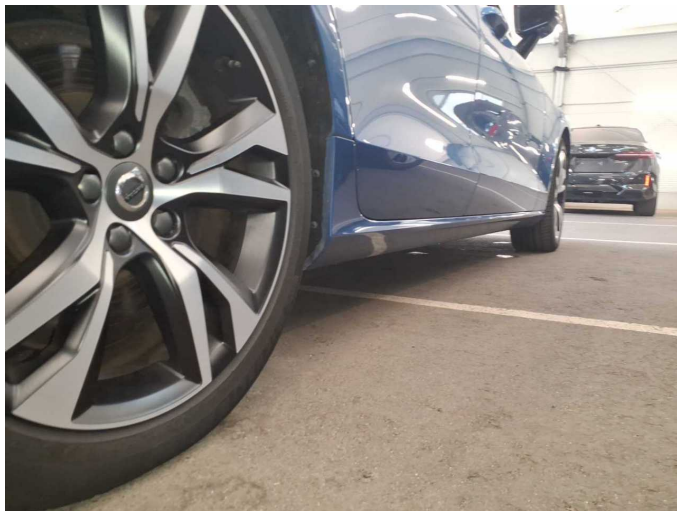


Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.

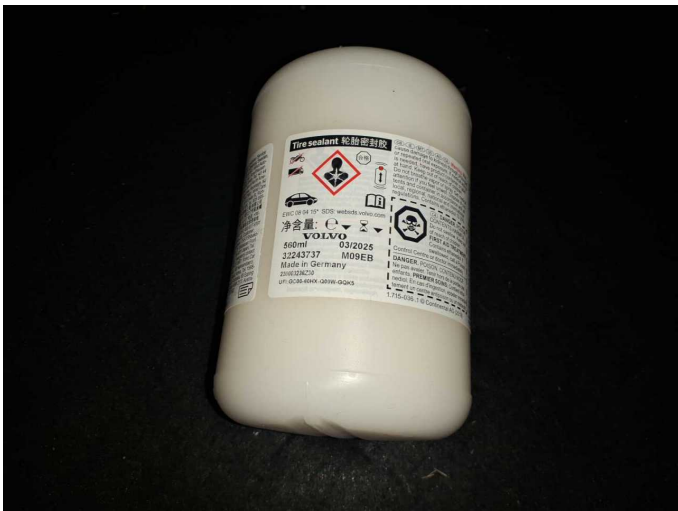


Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.

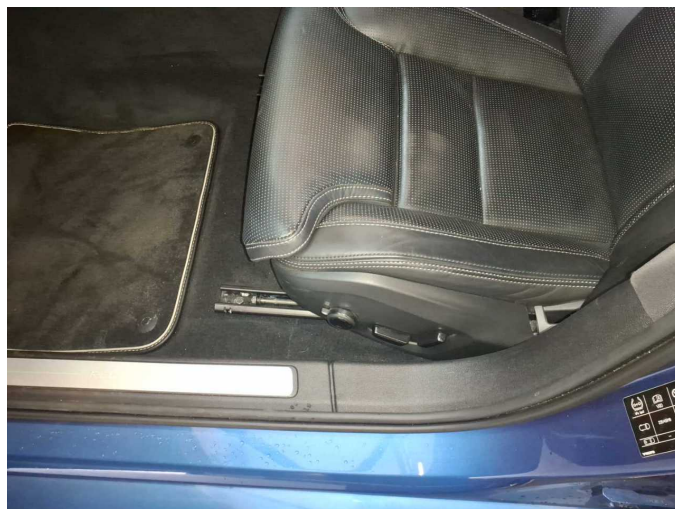


Figure 32: Misc.



Figure 33: Misc.



Figure 34: Misc.

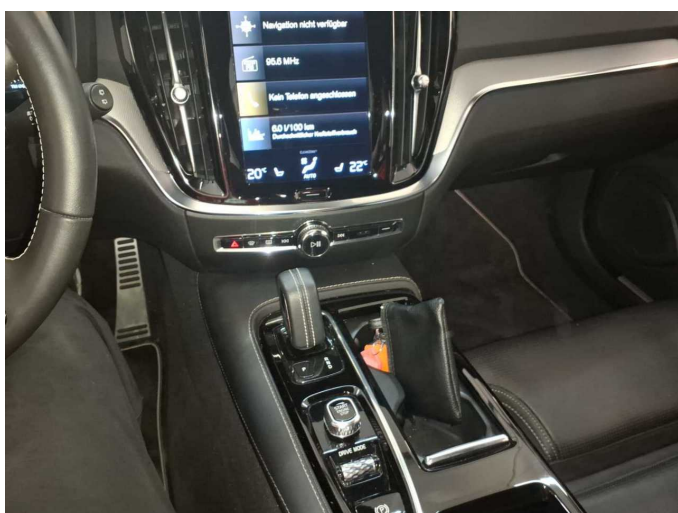


Figure 35: Misc.



Figure 36: Misc.



Figure 37: Misc.



Figure 38: Misc.



Figure 39: Misc.

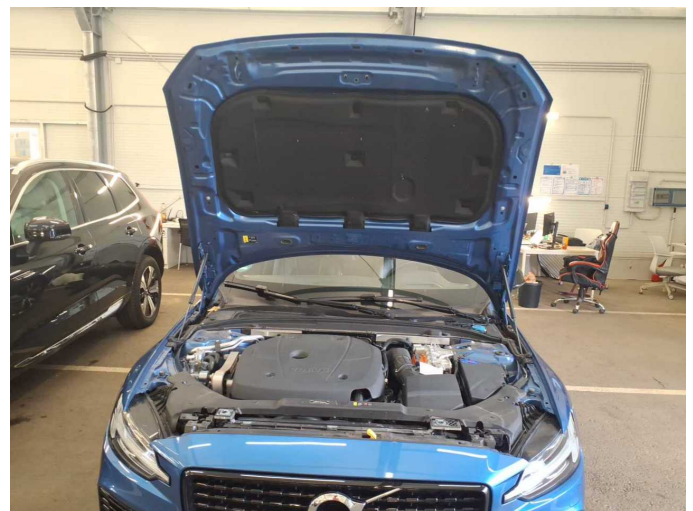


Figure 40: Misc.



Figure 41: Misc.


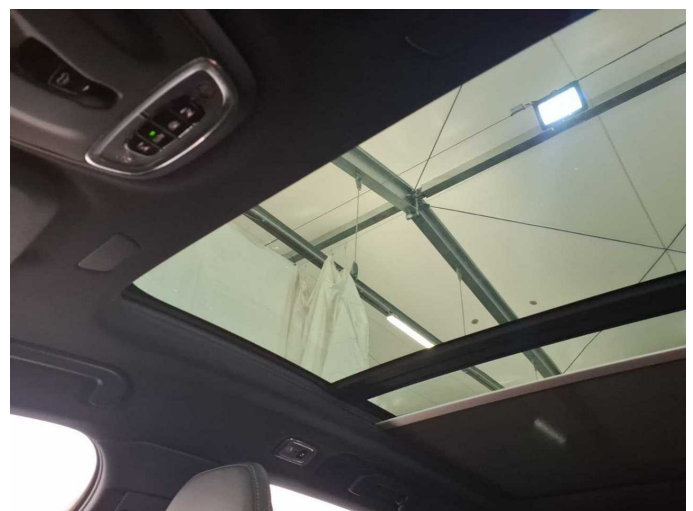



Figure 42: Misc.




Damage 1: Equipment: Tirefit filler - Expired - Replace

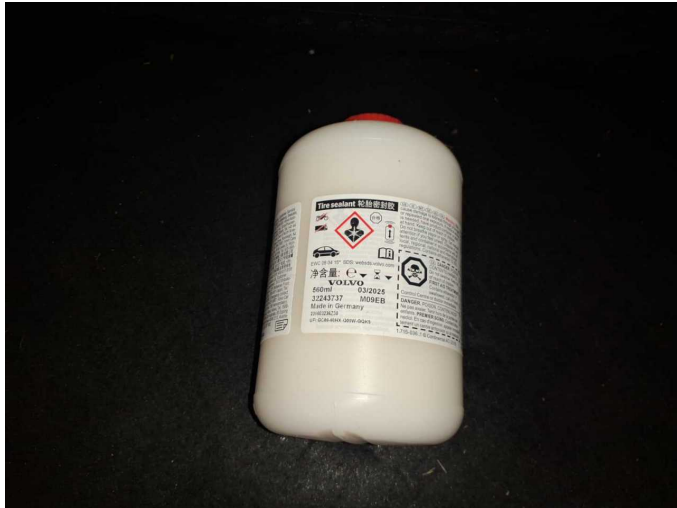

Damage 2: Body: Body - Glued / labelled - De-glue / neutralise

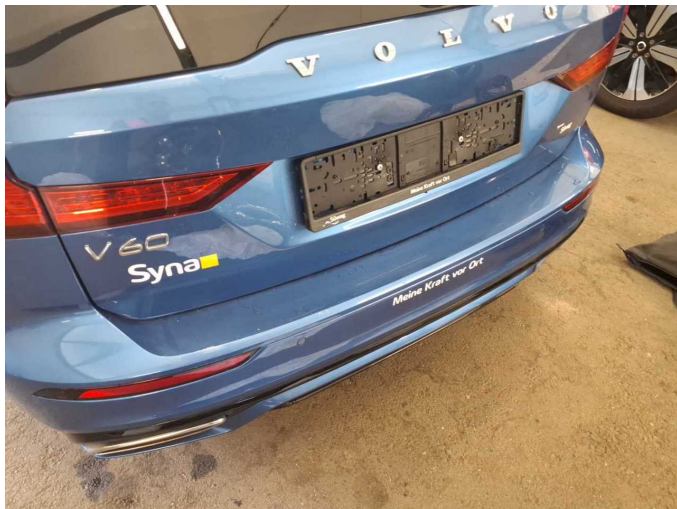

Damage 2: Body: Body - Glued / labelled - De-glue / neutralise

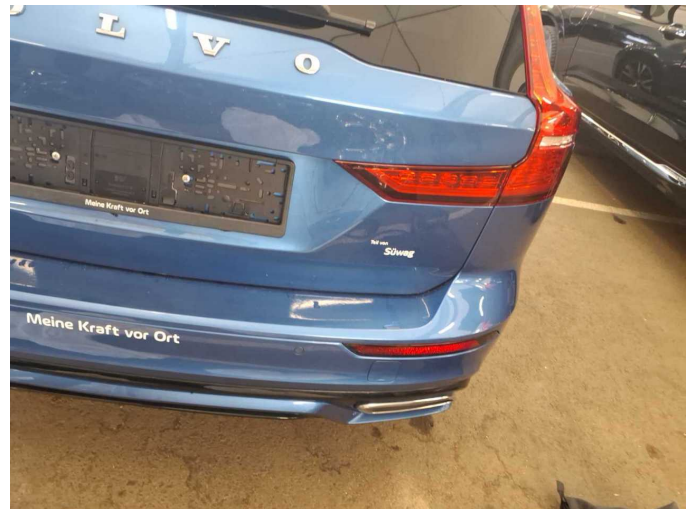

Damage 2: Body: Body - Glued / labelled - De-glue / neutralise



Damage 3: Wheel / tyres: Alloy rim - rear left side - Scratch(es) - Loss in value



Damage 3: Wheel / tyres: Alloy rim - rear left side - Scratch(es) - Loss in value



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: YV1ZWBFVDM1444088

Hersteller / Modell: VOLVO VOLVO V60 T6 AWD Recharge Geartronic RDesign

Datum	KM-Stand	Beschreibung
02.04.2026	63.945	AU; Bremsflüssigkeit; Bremsflüssigkeit ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
02.04.2025	48.701	Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Reparatur Sonstiges; Wartung Sonstiges; Zündkerzen ern
13.11.2024	43.588	Wartung Sonstiges
16.04.2024	33.661	AU; Batterie ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Systemtest/Eigendiagnose; Wartung Sonstiges
22.05.2023	21.929	Bremsflüssigkeit; Bremsflüssigkeit ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
27.04.2022	9.267	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Reparatur Sonstiges