



Expertise

Protocol number: 46674161
Order No. / Reference: 26543035
Inspection date: 23 Jul 2026

Manufacturer: Audi

Model: Q5 50 TFSIe quattro S tronic

VIN: WAUZZZFY5M2122830



Vehicle details	
Manufacturer / Type / Model / Equipment	
Audi Q5 50 TFSIe quattro S tronic	
Vehicle Identification number	WAUZZZFY5M2122830
Mileage (Read)	110,650 km
First registration	15 Oct 2021
Number of holders	1
Fuel type	Hybr.B/E ext.aufl
Engine displacement / Cylinder	1,984 ccm / 4
Power	195 kW
Gearbox / Number of gears	Automatic / 7
Type of drive	All-wheel drive
Type of vehicle	SUV
Colour / colour code	Brillantschwarz
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black-Anthracite



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	6,600 km
Last service on / at	11/2025 at 96,950 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GB515657
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	0588 / BYI 00009		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,660 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/60 R18 103V	Summer tyres on Light alloy	Continental	6mm / 6mm
2)	235/60 R18 103V	Summer tyres on Light alloy	Continental	7mm / 7mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/65 R17 104H	Winter tyres on Light alloy	Goodyear	5mm / 5mm
2)	235/65 R17 104H	Winter tyres on Light alloy	Goodyear	7mm / 7mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Airbag for driver and front passenger
- Acoustic vehicle warning system
- "quattro" all-wheel drive with ultra technology
- Traction control (ASR)
- Audi drive select
- Audi pre sense city
- Exterior mirror housings in body color
- Fabric headliner
- Black roof rails with roof rack recognition
- Tachometer
- Rear parking sensors
- Electromechanical parking brake
- Electronic Stability Control (ESC)
- Chassis: Standard chassis
- Remote key (without Safe-Lock)
- Luggage compartment lid, electrically opening and closing
- Transmission: S tronic 7-speed
- Heated rear window
- rear window wiper
- PHEV hybrid drive system
- Interior lighting
- Interior mirror dimming
- Manual child lock
- ISOFIX child seat attachment and Top Tether for the outer rear seats
- Front headrests
- Mode 3 charging cable (charging cable for charging at public AC charging stations (Type 2). The cable connects the charging station to the vehicle's AC charging port and enables a charging capacity of up to 22 kW (requires additional optional equipment). A current of up to 32 A can be transmitted per phase.)
- front center armrest
- Non-smoking version
- Wheel: On-board tools (excluding jack)
- Wheel: Tire repair kit
- Electromechanical power steering
- Fabric seat covers (synonym)
- Seats: Rear bench seat plus
- Sun visor on driver and passenger side
- Start-stop system
- Separation net
- Glazing: Windscreen in heat-insulating and acoustic glazing
- thermal insulation glazing
- Airbag: Front side airbags and head airbag system
- Accent areas matte black
- Anti-lock braking system (ABS)
- Audi connect emergency call & service with Audi connect Remote & Control
- Electrically adjustable and heated exterior mirrors
- Hill descent control
- Roof edge spoiler
- Decorative inlays Micrometallic silver
- e-tron compact charging system
- Door sill trims with aluminum inlay at the front
- Electronic Differential Lock (EDS)
- Driver information system with color display
- Electric windows front and rear
- front and rear floor mats
- Cruise control system including speed limiter
- Household plug type E/F (mains connection cable (length 1.6 m, current 10 A) with angled household plug type E/F for the e-tron compact charging system)
- Industrial plug CEE 16A / 400V / long+straight (for the e-tron charging system mains connection cable (length 1.6 m) with industrial plug CEE 16 A, three-phase, red, straight version, for the e-tron charging system compact)
- 3-zone automatic climate control
- Rear headrests (3)
- Paint finish: Solid
- Plastic loading sill protector
- LED taillights
- LED headlights
- Steering wheel: Leather steering wheel in 3-spoke design with multifunction
- Light/rain sensor
- Model designation according to new performance labeling
- Otto particulate filter
- Wheel: Tire pressure monitoring system
- Radio accessories: Data module Europe
- Seat belts
- Seats: Standard front seats
- Seats: Front seats manually adjustable
- Stationary air conditioning
- Phone: Bluetooth interface
- First aid kit with warning triangle
- Glazing: Clear glass
- Electronic immobilizer
- black decorative trim

Extra equipment

- Assistance package City with Assistance package Parking (City: - Parking aid plus - Reversing camera - Lane change warning - Audi pre sense basic - Audi pre sense rear - Exit warning and rear cross traffic assist Parking: - Parking assistant - Surround view cameras - Reversing camera view - Panoramic view front and rear - Virtual top view)
- Business package (Audi phone box - MMI Navigation plus (incl. driver information system with color display) - Audi virtual cockpit - Heated front seats - Automatically dimming interior mirror - Electrically adjustable, heated and folding exterior mirrors, automatically dimming on both sides incl. curb view function for the passenger mirror - High beam assist - Manual sunshade for rear door windows)
- Camera-based traffic sign recognition (Supports the driver by displaying traffic signs detected within the system's limits, such as speed limits, no-overtaking zones, and temporary speed restrictions, which are within the detection range of the front camera. The traffic sign recognition is displayed automatically in the digital instrument cluster or in the optional Audi virtual cockpit.)
- Front seat heating (for driver and front passenger side, individually adjustable in 3 stages via direct selection button on the climate control unit)
- Glazing: Windscreen in climate comfort/acoustic glazing, wirelessly heated (facilitates rapid defrosting and ensures fog-free operation through surface heating of the windscreen without obstructing heating wires. With heated wiper blade rest. Controlled via the automatic climate control system. Additionally, the reflective coating on the windscreen reduces interior heating in strong sunlight, thus lowering the energy consumption of the air conditioning system).
- Radio accessories: USB charging ports for rear passengers (two USB-A charging ports for rear passengers in the rear center console)
- Seats: Lumbar support for the front seats, electric (4-way) (horizontally and vertically adjustable)
- Storage and luggage compartment package (flexible transport of items and comfort while traveling; consisting of: - storage net on the back of the front seatbacks - cup holder in the rear center armrest - storage compartment on the driver's side - lockable glove compartment in the luggage compartment: - luggage compartment net - net in the recess on the left - tension strap on the trunk side (not available for SQ5 Sportback))
- Towbar (ball head mechanically swiveling with electric release - ball rod and head made of forged steel - operation via push button in the luggage compartment - trailer stabilization via the electronic stability control (ESC) The integrated swiveling system socket allows continuous operation of electrical devices in the trailer or caravan while driving and can be swivelled invisibly behind the bumper apron when not in use)
- Ambient Lighting Package Plus (in addition to the standard interior lighting (LED): - Approach lighting in the exterior door handles - Entry lights on the underside of the front and rear doors (white) - Footwell lighting front and rear (white) - Interior door handles front and rear (white) - Ambient lighting in the front and rear doors, multi-colored - Illuminated storage compartment below the instrument panel - Ambient lighting on the front center console, multi-colored - Illuminated decorative inserts in the instrument panel and doors, multi-colored)
- Audi virtual cockpit (12.3-inch display with HD resolution - displays: speed, engine speed, map, Audi connect services, radio and media information and much more - specific displays for plug-in hybrid models - operation via the multifunction steering wheel - configuration of on-board computer values - display of the navigation map as a 3D terrain model - permanent display of navigation information - break recommendation)
- Deletion of model designation and performance/technology lettering
- High-beam assist (within the system's limitations, it automatically detects oncoming headlights, taillights of other road users, and light sources in built-up areas. Depending on the traffic situation, the high beams are automatically switched on or off. The system thus improves the driver's visibility and increases comfort.)
- Radio accessories: Bang & Olufsen Premium Sound System with 3D sound (19 speakers (including center speaker/subwoofer and additional 3D sound tweeters and midrange drivers) - 16-channel amplifier with 755 watts - illuminated front speaker grilles - speed-dependent volume adjustment - spatial sound reproduction thanks to the new 3D sound feature. This is created by additional speakers in the A-pillar, by the midrange drivers and by Fraunhofer Symphoria technology.)
- Seats: Electrically adjustable front seats with memory function for the driver's seat and exterior mirrors (4-way lumbar support for the front seats - electrically adjustable, heated and folding exterior mirrors, automatically dimming on both sides, with memory function - electrically adjustable front seats with memory function for the driver's seat)
- Steering wheel: Leather steering wheel in 3-spoke design with multifunction plus (with 14 multifunction buttons for convenient operation of the available infotainment features such as audio skip, telephony, NAV button or the freely programmable button - adjustable in height and distance - with full-size airbag - shift paddles for manual changing of the driving modes)
- Wheel: Alloy wheels, 18" 5-twin-spoke dynamic (8.0 J x 18, tires 235/60 R 18)



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Door - front left side	Door edge - Scratch(es) - Smart repair
2	Side panel - rear left side	Wheel well extension - Scratch(es) - Loss in value
3	Door - front right side	Door - Scratch(es) - Smart repair
4	Rear bumper	Rear bumper - Scratch(es) - Paint
5	Bonnet	Bonnet - Stone chips - Paint

Wear and tear

No.	Component group	Description
1	Boot lid / rear door	Boot lid - Scratch(es) - No deduction
2	Front bumper	Front bumper - Stone chips - No deduction
3	Vehicle glazing	Windscreen - Stone chips - No deduction
4	Side panel - rear right side	Side panel - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

Equipment - Tirefit filler

Interior - Separation net

Equipment - charging cable (2.er satz)

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

- Die Unterbodenbesichtigung war nur ebenerdig & eingeschränkt möglich. Mehrkosten sind möglich.
- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

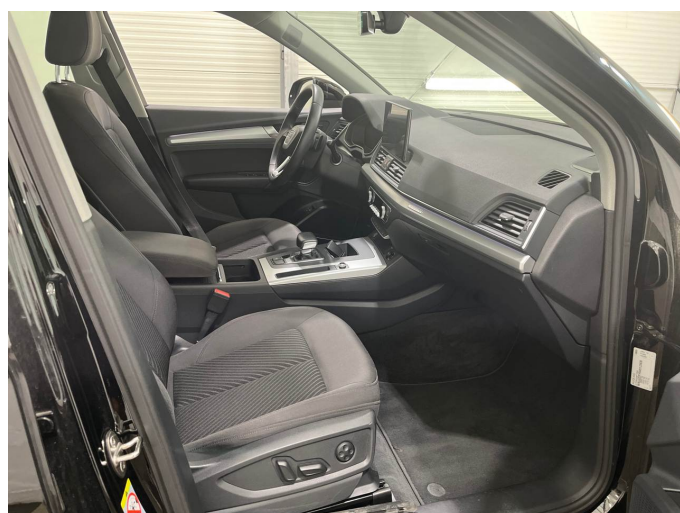


Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view

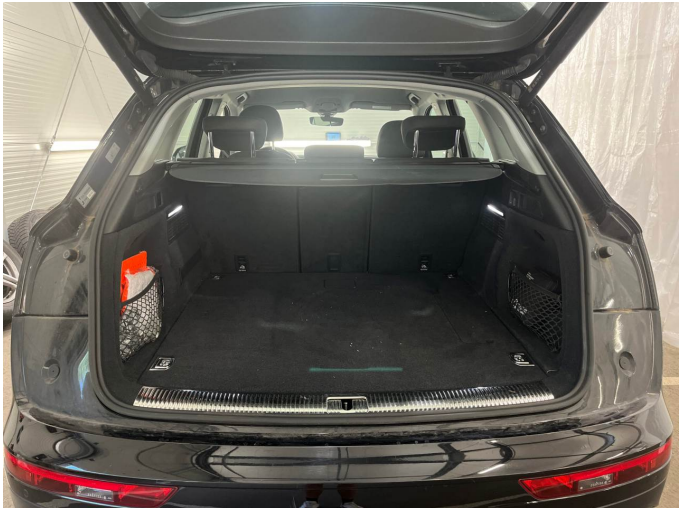


Figure 10: Cargo area

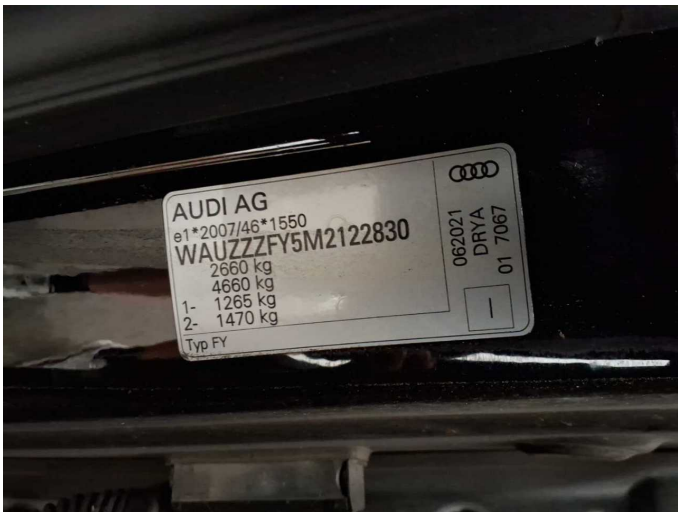


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

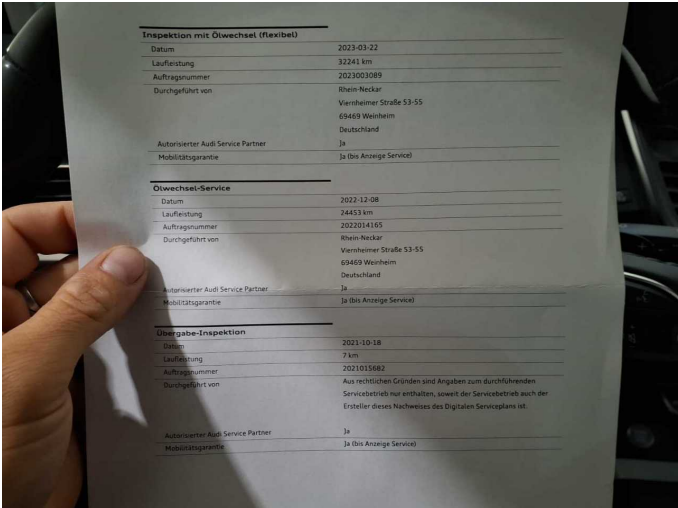


Figure 14: Documents

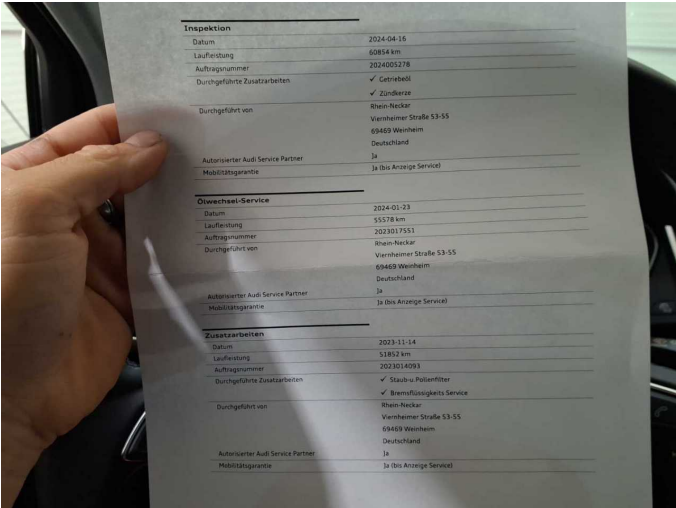


Figure 15: Documents

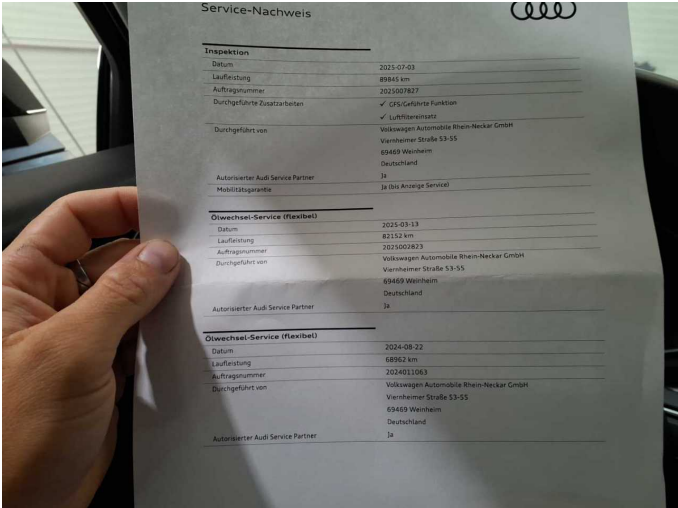


Figure 16: Documents

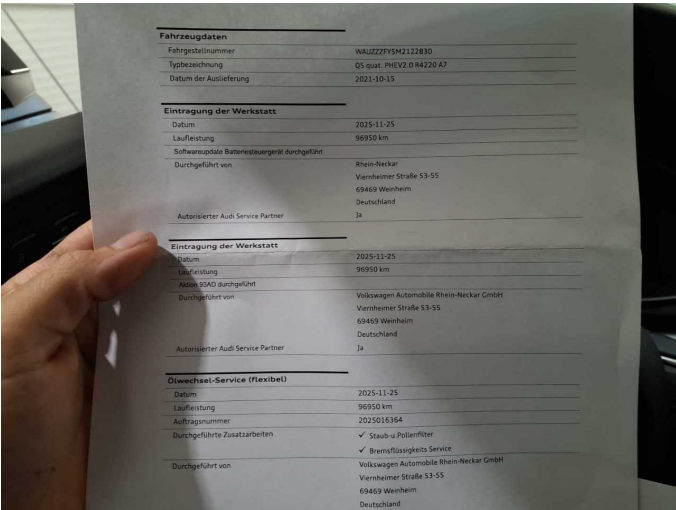


Figure 17: Documents

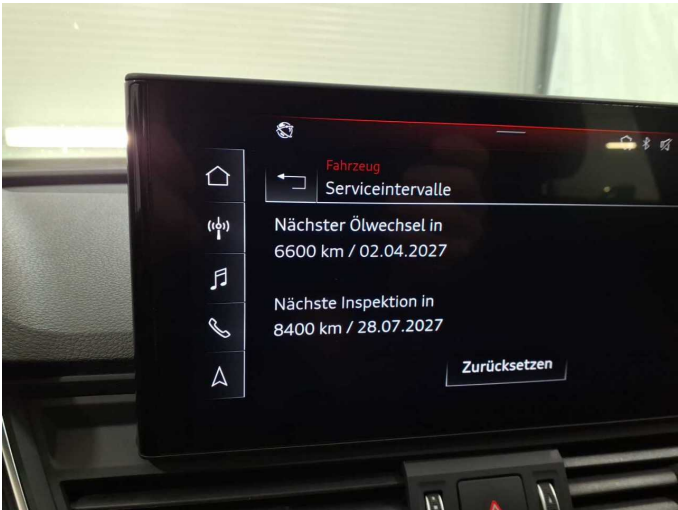


Figure 18: Documents



Figure 19: Additional tyres



Figure 20: Navigation



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.




Figure 31: Misc.



Damage 1: Door - front left side: Door edge - Scratch(es) - Smart repair



Damage 1: Door - front left side: Door edge - Scratch(es) - Smart repair

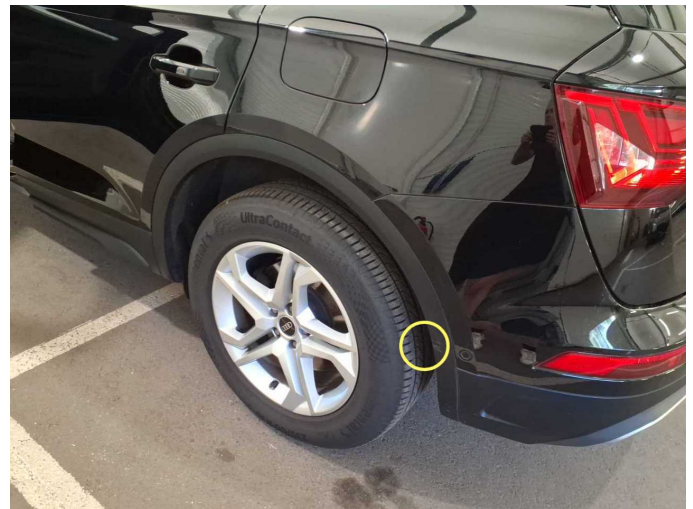

Damage 2: Side panel - rear left side: Wheel well extension - Scratch(es)
- Loss in value



Damage 2: Side panel - rear left side: Wheel well extension - Scratch(es)
- Loss in value



Damage 3: Door - front right side: Door - Scratch(es) - Smart repair



Damage 3: Door - front right side: Door - Scratch(es) - Smart repair



Damage 4: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 4: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 4: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 4: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 5: Bonnet: Bonnet - Stone chips - Paint



Damage 5: Bonnet: Bonnet - Stone chips - Paint



Damage 5: Bonnet: Bonnet - Stone chips - Paint



Damage 5: Bonnet: Bonnet - Stone chips - Paint



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WAUZZZF5M2122830
Hersteller / Modell: AUDI AUDI Q5 50 TFSle quattro S tronic

Datum	KM-Stand	Beschreibung
27.03.2026	104.707	Reparatur Sonstiges; Systemtest/Eigendiagnose
25.11.2025	96.950	Bremsflüssigkeit; Bremsflüssigkeit ern; Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
03.07.2025	89.842	Luftfiltereinsatz ern; Regelwartungsdienst
13.03.2025	82.152	Bremsbelagfühler ern; Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben hinten; Bremsscheiben vorne; Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
22.08.2024	68.965	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
16.04.2024	60.854	Getriebeöl ern/prüfen; Regelwartungsdienst; Zündkerzen ern
23.01.2024	55.578	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
14.11.2023	51.852	Bremsflüssigkeit; Bremsflüssigkeit ern; Systemtest/Eigendiagnose
23.03.2023	32.247	Regelwartungsdienst
09.12.2022	24.456	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges