



PEUGEOT 208: GC-809-XS

Vinnumber:	VR3UBYHTKM5867457	Versionname:	PEUGEOT 208 BLUEHDI 100 S&S Allure Business VP
First Registrationdate:	10/11/2021	Fiscalpower:	[5P] bvm 6-100CH-5cv (bi-corps)
Expertise Mileage:	134252	Power Kw:	75
Bodytype:	Berline	Body colour:	Blue
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Interior colour:	Dark Grey
Fueltype:	Diesel	Type of rims (mounted):	Aluminium
Engine functioning:	Yes	Dashboard color:	Black
Battery functioning:	Yes		
Vehicle running:	Yes		
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Type of rims (mounted):	Aluminium		
Category:	Passenger Car		

Options

Number of keys total	1	Radio	
Number keys remote	1	Central consol F	
GPS big screen color		Luggage cover	
GPS storage		Headlights Xenon/LED/Laser	
GPS storage	HD	Rear parking sensors	
Windows electric F		Rear view camera	
Windows electric R		Seat cover lining	Lining Semi-leather
Cruise Control			
Steering wheel multifunctional			
Steering wheel leather			
Type of climate control	Autom climate control		

Tyres

	195/55/16/91 H			
Summer tyres:	Fr.L.	Other: 20%	Fr.R.	Other: 20%
	Re.L.	Michelin: 40%	Re.R.	Michelin: 55%
Tyre profile depth FL				7.0
Tyre profile depth FR				6.8
Tyre profile depth RL				5.5
Tyre profile depth RR				4.7
Tyre size FL				195/55 R 16 91 H
Tyre size FR				195/55 R 16 91 H
Tyre size RL				195/55 R 16 87 H
Tyre size RR				195/55 R 16 87 H
Tyre type FL				All seasons
Tyre type FR				All Seasons
Tyre type RL				All seasons
Tyre type RR				All Seasons
Tyre make FL				263
Tyre make FR				263
Tyre make RL				261
Tyre make RR				261

Assistance equipment

Seat cover FR, Stain, Cleaning



Seat cover FL, Tear, Replace



Remote ignition key (no insert), Missing, Repair/replace (lump sum)



Roof liner, Stain, Cleaning




Alloy rim FL bitone/polychrome, Scratch(es), Repair/replace (lump sum)



Alloy rim RR bitone/polychrome, Scratch(es), Repair/replace (lump sum)



Tyre RR, Tear, Replace

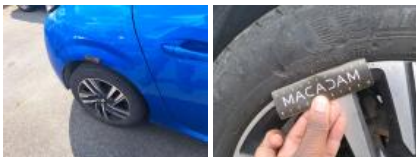

Alloy rim FR bitone/polychrome, Scratch(es), Repair/replace (lump sum)



Outside rear-view mirror housing L, Scratch(es), Acceptable



Windscreen, Stone chip(s), Windscreen repair



Historique Maintenance

Immatriculation: GC-809-XS Date de 1ère immatriculation: 10/11/2021

Modèle: Peugeot 208 BLUEHDI 100 S&S Allure Business VP [5P] bvm 6-100CH-5cv (bi-corps)

Date	Kilométrage	Fournisseur	Descriptif
09/01/2026	133.187	TRUJAS PARIS EST	COURROIE ACCESSOIRES RPLT
	0		REVISION
	0		FILTRE A AIR RPLT
	0		FILTRE CLIM RPLT
	0		REVISION
	0		INJECTEUR ADBLUE RPLT
	0		RECYCLAGE
	0		BALAI ESSUIE GLACE AR
	0		BALAI ESSUIE GLACE AV
	0		DIVERS CLIM
05/11/2025	124.859	TRUJAS PARIS EST	RECYCLAGE
	0		DISQUES PLAQUETTES AV RPLT
30/10/2025	124.148	DEKRA AUTOMOTIVE S.A	CONTROLE TECHNIQUE
23/06/2025	108.325	TRUJAS PARIS EST	RECYCLAGE
	0		DIVERS CLIM
	0		DIVERS ELEC
	0		REVISION
	0		FILTRE CLIM RPLT
13/09/2024	83.808	BERNIER JUVISY	DISQUES PLAQUETTES AV RPLT
	0		REVISION
	0		FILTRE CLIM RPLT
	0		FILTRE A AIR RPLT
	0		REVISION
	0		BALAI ESSUIE GLACE AV
	0		BALAI ESSUIE GLACE AR
	0		RECYCLAGE
21/06/2024	72.800	EUROMASTER FRANCE	REMPLACEMENT PNEUS ETE
29/09/2023	53.290	MIDI AUTO 27	BALAI ESSUIE GLACE AR
	0		BALAI ESSUIE GLACE AV
	0		ADBLUE
	0		REVISION
	0		FILTRE A AIR RPLT

Historique Maintenance

Immatriculation: **GC-809-XS**

Date de 1ère immatriculation: **10/11/2021**

Modèle: **Peugeot 208 BLUEHDI 100 S&S Allure Business VP [5P] bvm 6-100CH-5cv (bi-corps)**

Date	Kilométrage	Fournisseur	Descriptif
	0		LIQUIDE DE FREIN
	0		REVISION
	0		FILTRE CLIM RPLT
15/03/2023	37.180	FRANCE PARE BRISE SAS	PARE BRISE RPLT
28/11/2022	26.237	VAUBAN AUTOMOBILE - HERBLAY	RECYCLAGE
	0		BALAIS ESSUIE GLACE AV
	0		BALAI ESSUIE GLACE AR
	0		REVISION ET CLIM
	0		REVISION ET CLIM