



Expertise

Protocol number: 46831785
Order No. / Reference: 26830934
Inspection date: 16 Jul 2026

Manufacturer: Opel

Model: Zafira Life 2.0 D L Aut. Edition

VIN: VXEEVHZ7MZ123242



Vehicle details

Manufacturer / Type / Model / Equipment

Opel Zafira Life 2.0 D L Aut. Edition

Vehicle Identification number VXEEVHZ7MZ123242

Mileage (Read) 55,730 km

First registration 23 Feb 2022

Number of holders 1

Next periodical technical inspection 02/2027
(Report on hand)

Fuel type Diesel

Engine displacement / Cylinder 1,997 ccm / 4

Power 130 kW

Gearbox / Number of gears Automatic / 8

Type of drive Front drive

Type of vehicle Van

Colour / colour code TYPE HABILLAGE
EXTERIEUR
METALLISEE VERNIS

Doors / Seats 5 / 8

Upholstery type Cloth

Colour of upholstery Black



Vehicle details

Maintenance booklet / proof	Available / complete	Next maintenance in	80 km
Last service on / at	02/2025 at 35,821 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GJ633284
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	3003 / BBA 00318		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	3,100 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/55 R17 101V	Summer tyres on Light alloy	Michelin	4mm / 4mm
2)	225/55 R17 101V	Summer tyres on Light alloy	Michelin	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/55 R17 101V	Winter tyres on Steel rim with wheel cover	Falken	5mm / 5mm
2)	225/55 R17 101V	Winter tyres on Steel rim with wheel cover	Falken	7mm / 7mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 12/2025		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Low beam automatically
- Airbag for driver and front passenger side (passenger airbag can be deactivated)
- Airbag: Head airbags, driver and front passenger
- Airbag: Curtain airbags, in the 2nd and 3rd rows of seats
- Anti-lock braking system (ABS) (with cornering brake control (CBC) and brake assist)
- Automatic activation of the hazard warning lights (and unlocking of the doors after deployment of the airbag or seatbelt pretensioner)
- On-board computer
- Diesel particulate filter
- Electronic Stability Program (ESP Plus)
- Electric front windows (with one-touch function)
- Luggage compartment cover
- Manual handbrake
- Child safety lock, mechanical
- Air conditioning: Auxiliary air conditioning, rear
- LED daytime running lights
- Headlight range adjustment, manual
- Fog light
- Package: Driver Assistance Package 1 (High Beam Assist - Driver Alert System - Solar Reflect Windscreen - Lane Keeping Assist - Traffic Sign Recognition with Intelligent Speed Control)
- Rear parking assist (acoustic warning signal when reversing into a parking space)
- Radio: Multimedia radio with 7" touchscreen color display (automatic music recognition (title, album, artist, cover) for audio devices with USB connection, Bluetooth audio streaming, digital radio reception (DAB), hands-free calling via Bluetooth interface, display of phonebook and call lists, pictures/movies/videos: display of pictures via USB interface, smartphone integration via Apple CarPlay, Android Auto via touchscreen or voice control, e.g., navigation, music, telephone, reading aloud and dictating text messages, 1 USB port, 8 speakers)
- Power steering
- Safety steering column, height and length adjustable
- Seats: 8 seats in fabric, Harlequin Black (Comfort driver's seat: 6-way adjustable, armrest and lumbar support - Comfort passenger seat: 4-way adjustable, armrest and foldable - 2nd row bench seat, foldable in a 1/3 to 2/3 ratio and ISOFIX preparation - 3rd row bench seat, foldable in a 1/3 to 2/3 ratio and ISOFIX preparation - Rail system for the 2nd and 3rd rows - Height-adjustable headrests)
- Traction Control (TC) Plus (traction control with engine and brake intervention)
- Immobiliser
- Ignition keys (2), both foldable (3-button remote ignition key)
- Storage compartments (storage compartment in the center console, front - storage shelf above the windshield, closed - storage compartment in the front doors, suitable for 1.5-liter beverage bottles - glove compartment, closed, cooled and illuminated - glove compartment, bottom, closed - storage compartment on dashboard, passenger side, closed)
- Exterior mirrors, electrically adjustable, heated and folding
- Exterior mirror housings in black
- Hill Start Assist
- Third brake light
- Tachometer
- Window: Window, driver's side in the 2nd row of seats, fixed
- Transmission: 8-speed automatic transmission
- Glazed tailgate, with rear window wiper and heater
- Air conditioning (front, with particle and odor filter - manual recirculation)
- Steering wheel: Comfort steering wheel (flattened at the bottom)
- Rear fog lights with reversing lights
- Package: Driver Assistance Package 2 (Semi-adaptive cruise control and speed limiter - Forward collision warning - Instrument cluster, 3, 5" color driver information display - Emergency brake assist - Solar reflective windscreen)
- Radio: Digital radio reception DAB+ (Digital Audio Broadcasting)
- Rain sensor
- Tire repair kit (including tire sealant and 12-volt compressor (without jack))
- Tire pressure warning
- Wheels: Alloy wheels in BiColor, 7J x 17 (tires 225/55 R17 101)
- Sliding door trim with cover, in vehicle color
- Side impact protection
- Side protection strips in vehicle color
- Seat belts: Three-point seat belts in all seats (belt force limiter, front - double belt tensioners, front - warning tone and light for unfastened seat belts, front)
- Heated seats for driver and front passenger
- Solar Protect heat-insulating glazing (in the rear, heavily tinted)
- Sun visors for driver and passenger side (including make-up mirrors)
- 12V socket
- Door: Sliding door, driver and passenger side
- Exterior door handles, in car color
- Central locking with remote control



Extra equipment

- Head-Up Display (projects, on request, speed, settings of the intelligent cruise control and limiter, traffic signs with speed limits and their cancellation, front collision warnings and navigation information into the driver's direct field of vision.)
- Navigation system: Multimedia Navi Pro with 7" color touchscreen, voice control for audio, telephone, and navigation (automatic music recognition for audio devices with USB connection, Bluetooth audio streaming, hands-free calling via Bluetooth interface, display of phonebook and call lists, image display via USB interface, navigation system with integrated memory, European road map, 3D map display, dynamic route guidance, TMC messages, smartphone integration via Apple CarPlay and Android Auto, 1 USB interface, 8 speakers, head-up display)
- Interior mirror, automatically dimming
- Interior mirror, additional, for interior monitoring
- Automatic climate control: Dual-zone automatic climate control
- Paint finish: Metallic
- Sunshades in the 2nd row of seats
- Complete winter wheel sets on steel rims with hubcaps

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Equipment	Tirefit filler - Expired - Replace
2	Misc.	Misc. (Reifendruckkontrolle) - on - Perform diagnosis
3	Braking system	Parking brake / hand brake (Feststellbremse) - Functional / admissibility - Perform diagnosis
4	Electronic systems	Electronic systems - Functional / admissibility - Perform diagnosis

Wear and tear

No.	Component group	Description
1	Roof	Roof - dent(s) - No deduction
2	Mudguard - right side	Mudguard - right side - Scratch(es) - No deduction
3	Bonnet	Bonnet - Stone chips - No deduction
4	Front bumper	Front bumper - Stone chips - No deduction
5	Door - front right side	Door - Scratch(es) - No deduction
6	Door - rear left side	Door - Scratch(es) - No deduction
7	Sill - left side	Sill - Scratch(es) - No deduction
8	Vehicle glazing	Windscreen - Stone chips - No deduction
9	Side panel - rear right side	Side panel - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

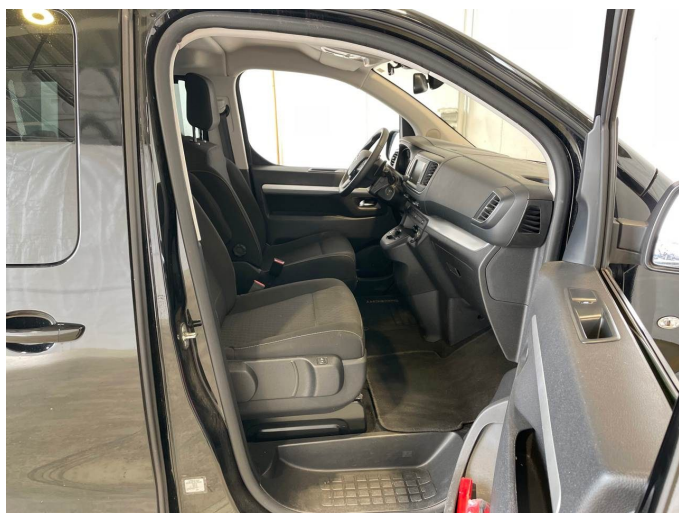


Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

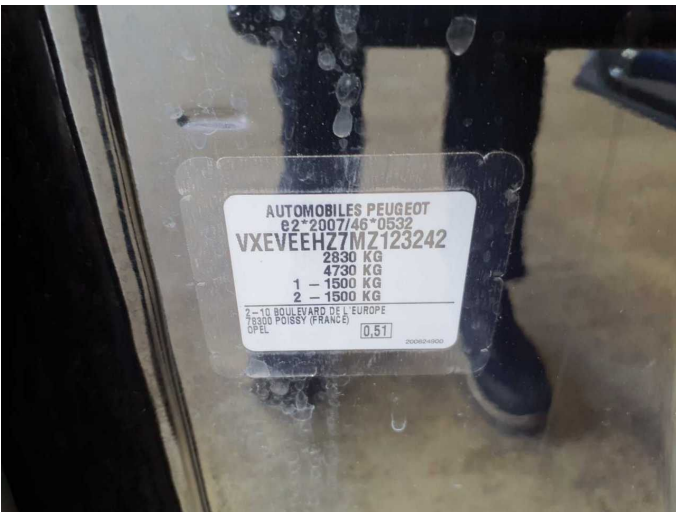


Figure 11: VIN



Figure 12: Mounted tyres

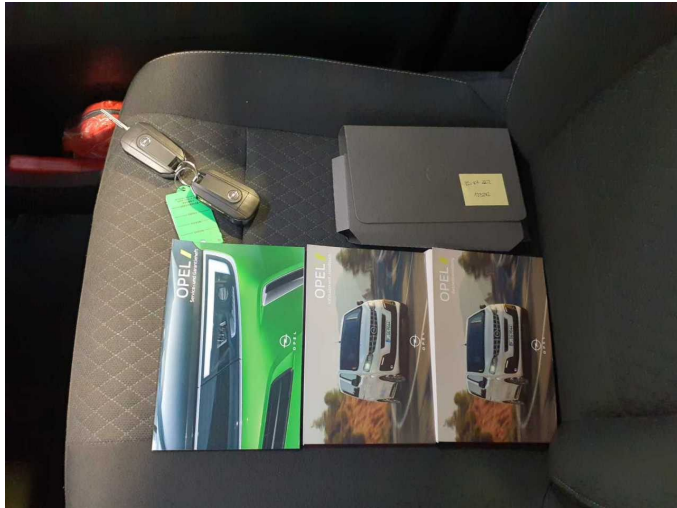


Figure 13: Documents



Figure 14: Additional tyres



Figure 15: Additional tyres

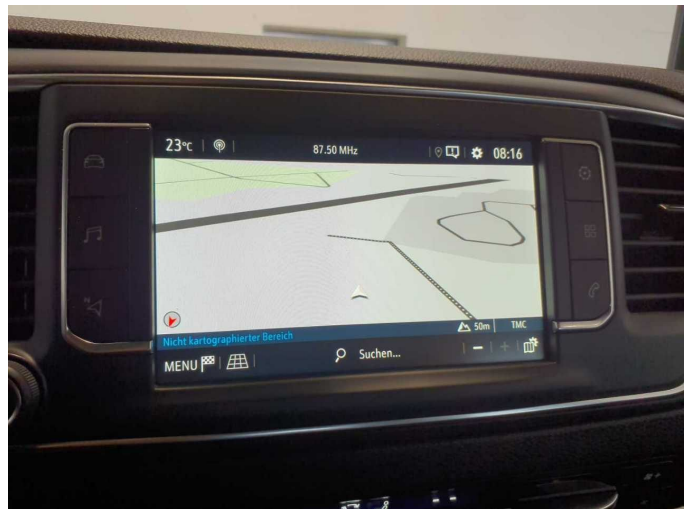


Figure 16: Navigation

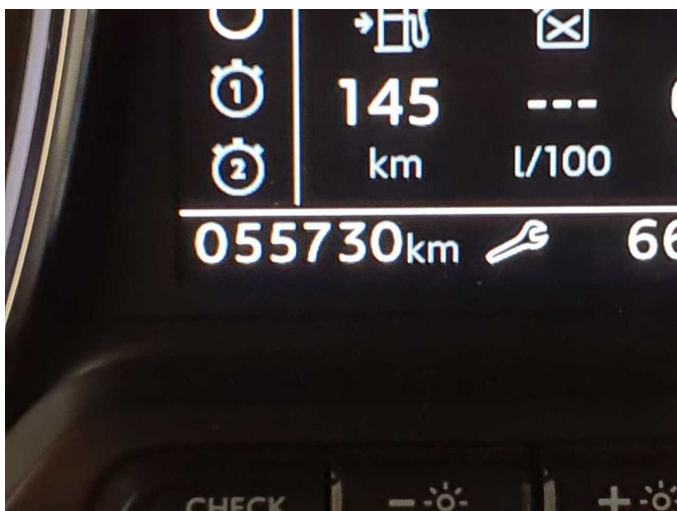


Figure 17: Misc.



Figure 18: Misc.

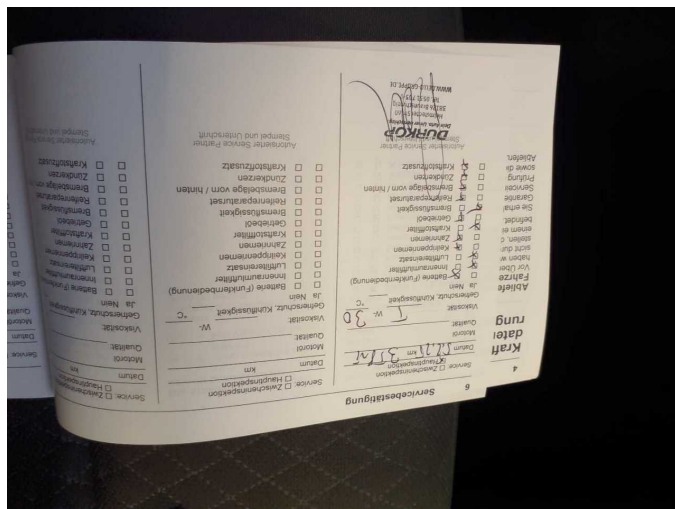


Figure 20: Misc.

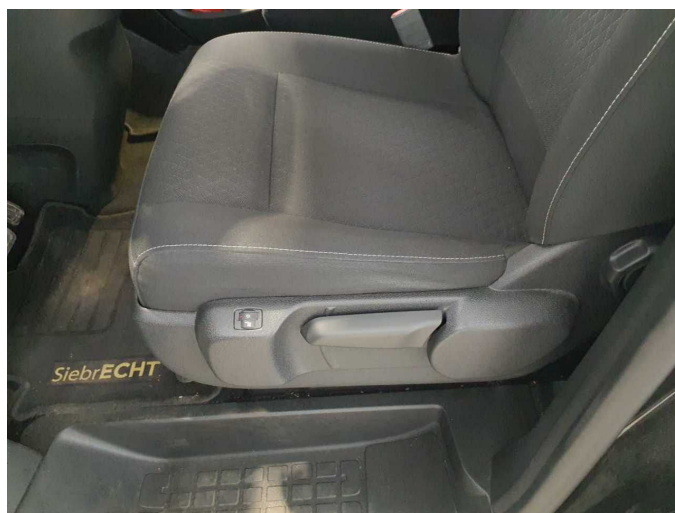


Figure 22: Misc.



Figure 24: Misc.



Figure 25: Misc.

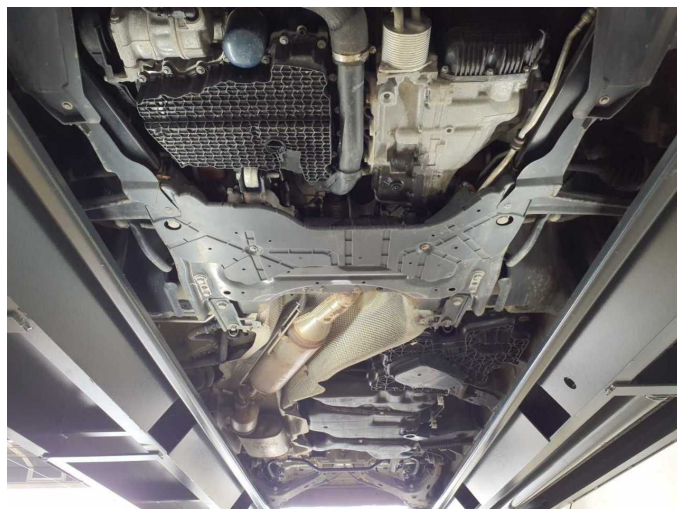


Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.




Damage 1: Equipment: Tirefit filler - Expired - Replace



Damage 2: Misc.: Misc. (Reifendruckkontrolle) - on - Perform diagnosis



Damage 3: Braking system: Parking brake / hand brake (Feststellbremse) - Functional / admissibility - Perform diagnosis

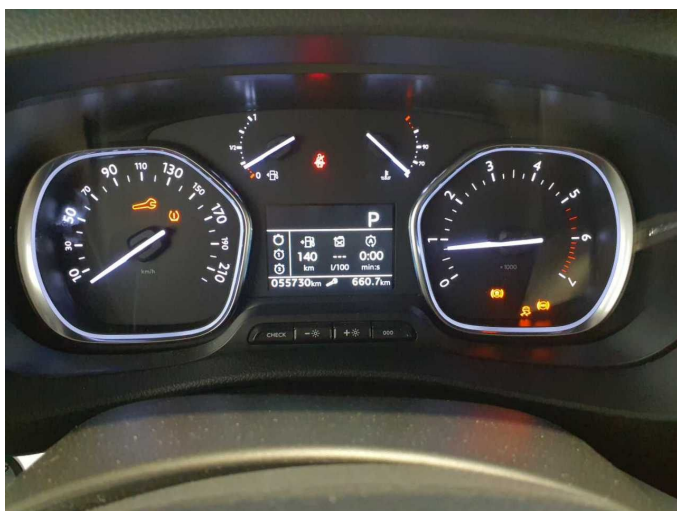

Damage 4: Electronic systems: Electronic systems - Functional / admissibility - Perform diagnosis



Damage 4: Electronic systems: Electronic systems - Functional / admissibility - Perform diagnosis



Damage 4: Electronic systems: Electronic systems - Functional / admissibility - Perform diagnosis




Damage 4: Electronic systems: Electronic systems - Functional / admissibility - Perform diagnosis




Damage 4: Electronic systems: Electronic systems - Functional / admissibility - Perform diagnosis



Damage 4: Electronic systems: Electronic systems - Functional / admissibility - Perform diagnosis

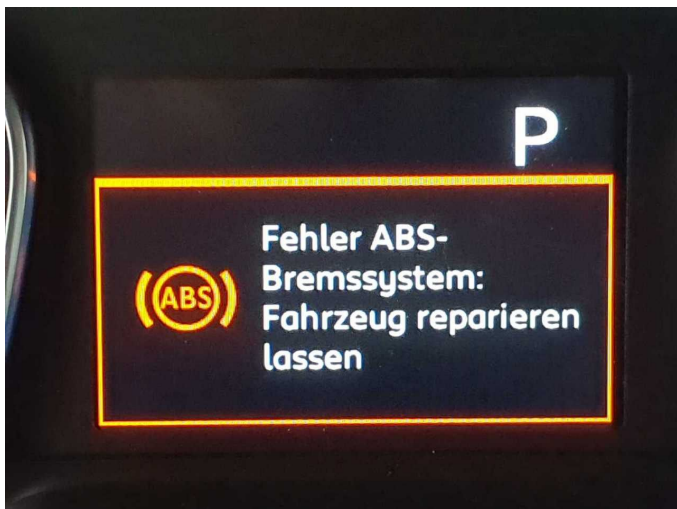

Damage 4: Electronic systems: Electronic systems - Functional / admissibility - Perform diagnosis

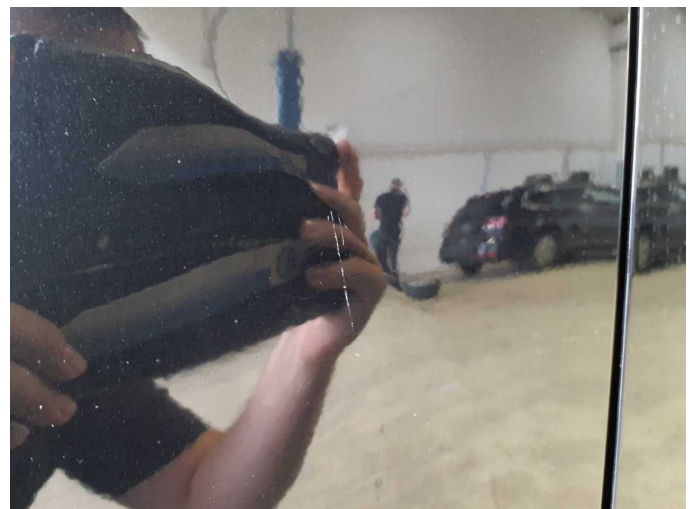

Wear and tear 9: Side panel - rear right side: Side panel - Scratch(es) - No deduction



Wear and tear 9: Side panel - rear right side: Side panel - Scratch(es) -
No deduction