DEKRA

DEKRA Automotive Solutions

Appraisal Report

Vehicle details

VIN	ZACNJECA0 RPT03062	Registration date	14/02/2025	Exterior Color	Unknown
Brand	JEEP	Licence Plate	EU-FA 9719	Odometer	24 182 km
Model	COMPASS 1.5l GSE T4 48V e -Hybrid Altitud				

Inspection Details

Arrival Date	17/08/2026	Inspection ID	7119967	Inspection date	19/08/2026
Assign Date	17/08/2026	Fleet owner	Leasys FINN	Inspection loc.	Leasys AKB Zörbig



Generic equipment

Removable element

Spare wheel kit	✓
Toolkit	✓
Rear parcel shelf	✓
Floor mat B	✓
Floor mat F	✓


Technical Document

User manual	✓
Warranty booklet	✓
Log books	✓
Spare key	✓
Key	✓
Remote key	✓
Service	✗

Tyres

Goodyear 215/60/17 V All seasons 5.0 mm

Goodyear 215/60/17 V All seasons 5.0 mm

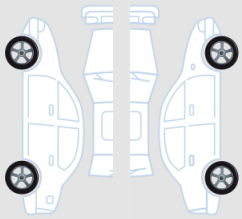



Goodyear 215/60/17 V All seasons 6.0 mm

Goodyear 215/60/17 V All seasons 6.0 mm

Exception / Damage

1



Part	Door	Repair Time	1.50	Part Cost	-
Position	Back left	Repair Cost	105.00€	Gross Cost	240.00€
Damages	Scratched	Paint Time	1.50	Depreciation %	10.00%
Severity	-	Paint cost	135.00€	Depreciation	- 24.00
Repair mode	Repair	Flat Rate	-	**Net Cost**	**216.00€**

DEKRA

DEKRA Automotive Solutions

Appraisal Report

2



Part	Side panel	Repair Time	2.40	Part Cost	-
Position	Back left	Repair Cost	168.00€	Gross Cost	294.00€
Damages	Dented	Paint Time	1.40	Depreciation %	10.00%
Severity	-	Paint cost	126.00€	Depreciation	- 29.40
Repair mode	Repair	Flat Rate	-	**Net Cost**	**264.60€**

3

Part	Bumper	Repair Time	-	Part Cost	-
Position	Front	Repair Cost	-	Gross Cost	-
Damages	Stone impact	Paint Time	-	Depreciation %	10.00%
Severity	-	Paint cost	-	Depreciation	-
Repair mode	For info	Flat Rate	-	**Net Cost**	**-**

4

Part	Bonnet	Repair Time	-	Part Cost	-
Position	-	Repair Cost	-	Gross Cost	-
Damages	Stone impact	Paint Time	-	Depreciation %	10.00%
Severity	-	Paint cost	-	Depreciation	-
Repair mode	For info	Flat Rate	-	**Net Cost**	**-**

5

Part	Windscreen	Repair Time	-	Part Cost	-
Position	-	Repair Cost	-	Gross Cost	-
Damages	Stone impact	Paint Time	-	Depreciation %	-
Severity	-	Paint cost	-	Depreciation	-
Repair mode	For info	Flat Rate	-	**Net Cost**	**-**

6

Part	Bumper	Repair Time	-	Part Cost	-
Position	Back	Repair Cost	-	Gross Cost	-
Damages	Scratched	Paint Time	-	Depreciation %	10.00%
Severity	-	Paint cost	-	Depreciation	-
Repair mode	For info	Flat Rate	-	**Net Cost**	**-**

7

Part	Caisse de chargement complète	Repair Time	-	Part Cost	-
		Repair Cost	-	Gross Cost	-
Position	-	Paint Time	-	Depreciation %	10.00%
Damages	Scratched	Paint cost	-	Depreciation	-
Severity	-	Flat Rate	-	**Net Cost**	**-**
Repair mode	For info				

8

Part	Paint preparation	Repair Time	-	Part Cost	-
Position	-	Repair Cost	-	Gross Cost	153.00€
Damages	-	Paint Time	1.70	Depreciation %	10.00%
Severity	-	Paint cost	153.00€	Depreciation	- 15.30
Repair mode	Paintworks	Flat Rate	-	**Net Cost**	**137.70€**

Summary Inspection

Gross Price	687.00€	Depreciation	-68.70€	Net Price	618.30€

Labor cost summary

	Hourly Rate	Time	Gross Price	Depreciation %	Depreciation	Net Price
Bodywork	70.00€	3.90	273.00€	10.00 %	-27.30€	245.70€
Paintwork	90.00€	2.90	261.00€	10.00 %	-26.10€	234.90€
Paint preparation	90.00€	1.70	153.00€	10.00 %	-15.30€	137.70€

Miscellaneous

	Gross Price	Depreciation %	Depreciation	Net Price
Small parts / disposal charge	0.00€	-	-	0.00€
Part Cost	0.00€	-	-	0.00€
Flat Rate	0.00€	-	-	0.00€