



Expertise

Protocol number: 45675261
Order No. / Reference: 26412551
Inspection date: 29 May 2026

Manufacturer: Opel
VIN: VXKUHZKXZN4406884

Model: Corsa-e Elegance



Vehicle details	
Manufacturer / Type / Model / Equipment	
Opel Corsa-e Elegance	
Vehicle Identification number	VXKUHZKXZN4406884
Mileage (Read)	16,332 km
First registration	20 Dec 2022
Number of holders	1
Next periodical technical inspection	12/2025
(Report not on hand)	
Power / Engine displacement	57 kw / 0 ccm
Fuel type / Cylinder	Electric / 0
Gearbox / Number of gears	Direct drive / 1
Type of drive	Front drive
Type of vehicle	Saloon car
Colour / colour code	Jade Weiß
Doors / Seats	5 / 5
Upholstery type	Cloth / leather combination
Colour of upholstery	Black-Blue
Re-import	no
readiness to drive	Roadworthy



Vehicle details			
Maintenance booklet / proof	Available / complete	Next maintenance in	10 Monat(e)
Last service on / at	02/2025 at 11,444 km		
Key is / should be	2 / 2	FZG documents	ZB#1+2 (B+S) was available (copy)
		Letter No.	GQ342120
Previous damage / Accident	Detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
readiness to drive	Roadworthy		
Manufacturer key number/ type code number	1889 / ABX 00028		
Emission standard	2017/1151;WLTP;reine Elektrofz	fine dust sticker	
Permitted total weight	1,920 kg	Empty weight	

Tyres				
Mounted tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	195/55 R16 91H	Summer tyres on Light alloy	Michelin	4mm / 4mm
2)	195/55 R16 91H	Summer tyres on Light alloy	Michelin	5mm / 5mm
Replacement				
Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 02/2028		
Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.				

Equipment

Standard equipment

- Electric parking brake
- Upholstery: Fabric/premium leatherette combination
- Tire pressure warning
- Keyless Start system
- Power steering
- Visibility equipment
- Seats: Rear seat backrest split 60:40, foldable
- 12V power outlet in the center console, front
- Ambient lighting
- Pre-installation for ISOFIX child seat mounting system
- Immobiliser
- Central locking with remote control
- Storage compartments
- Airbag: Front airbags, driver and front passenger
- Airbag: Side airbag for driver and front passenger side
- Anti-lock braking system (ABS)
- Hill Start Assist
- On-board computer
- Braking system: Regenerative
- Electronic brake force distribution (EBD)
- Driver information display 7", color
- Electric windows front and rear
- Pedestrian protection
- Intelligent speed control and limiter
- Back window, heater
- Child safety lock in the rear doors, manual
- Headrests (5)
- Steering wheel made of vegan synthetic leather, flattened at the bottom.
- Lithium-ion battery
- myOpel app, with Corsa-e specific functions
- Pollen filter
- Quickheat rapid heating system
- Wheels: 6.5 J x 16 alloy wheels in 5-spoke design, silver/black
- Seat belts: Three-point seat belts in all seats
- Seats: Comfort driver's seat
- Lane Keeping Assist
- Traction Control (TC) Plus
- Traffic sign recognition
- Pre-wiring for child seat mounting system "ISOFIX"
- Heat-insulating glazing, tinted
- Ignition key (2)
- Adaptive brake light
- Airbag: Front and rear head airbags
- Active Pedestrian Warning System (AVAS)
- Electrically adjustable and heated exterior mirrors for driver and passenger side
- third brake light
- Headliner, Grey
- Electronic Stability Program Plus (ESP Plus)
- Driving modes: 3 adjustable
- Front collision warning system with automatic emergency braking and pedestrian detection
- Transmission: Automatic electric drive with fixed gear ratio
- rear window wiper
- automatic climate control
- LED headlights
- Steering column, height and reach adjustable
- Headlight range adjustment, manual
- Center armrest with storage compartment in front
- Fatigue detection

Extra equipment

- Charging cable: Mode 3 charging cable, 3-phase (for public charging (11 kW))
- Navigation system: Multimedia navigation system with 7" color touchscreen display (Multimedia radio, automatic music recognition, Bluetooth hands-free system, Apple CarPlay, Android Auto, voice control, 1 USB port, DAB+, steering wheel remote control, navigation system, road map of Europe (including Russia and Turkey), 3D map display, dynamic route guidance, display of points of interest, tour planning, GPS module, charging station display, OpelConnect, including live navigation services, real-time traffic information, online POI search, map updates (via USB))
- Heated seats for driver and front passenger (multi-stage adjustable)
- Leather steering wheel, heated
- LED fog lights
- Onboard charger (vehicle-integrated charging unit, 3-phase (11 kW))
- Paint finish: Solid
- Reversing camera: 180-degree panoramic reversing camera including parking pilot, rear parking aid (display of the area behind the vehicle, including steering guidelines, when reverse gear is engaged in the color display of the infotainment system)



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 1 (registration document) and the vehicle registration certificate Part 2 (title) were available. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was roadworthy at the time of inspection.

Value reducing factors

No.	Component group	Description
1	Misc.	Main inspection - Due - Perform
2	Boot lid / rear door	Boot lid - Deformed - Repair and paint

Wear and tear

No.	Component group	Description
1	Front bumper	Front bumper - Stone chips - No deduction
2	Bonnet	Bonnet - Stone chips - No deduction
3	Vehicle glazing	Windscreen - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Rear, Provided by user / customer, from 17 Nov 2023	2.869,34 €

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

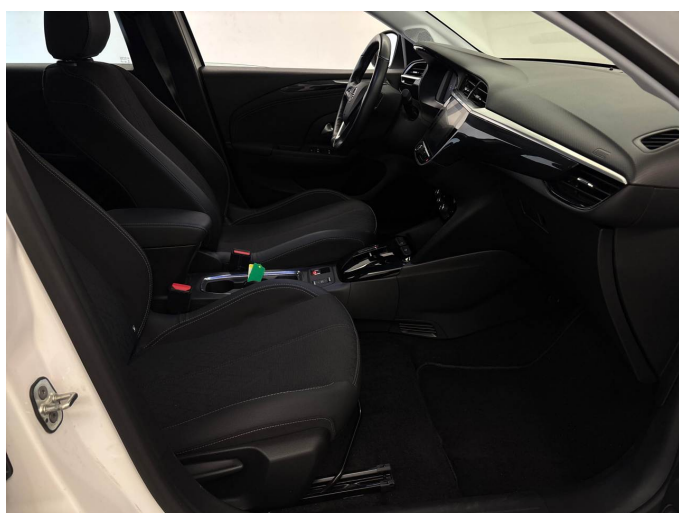


Figure 5: Interior - front

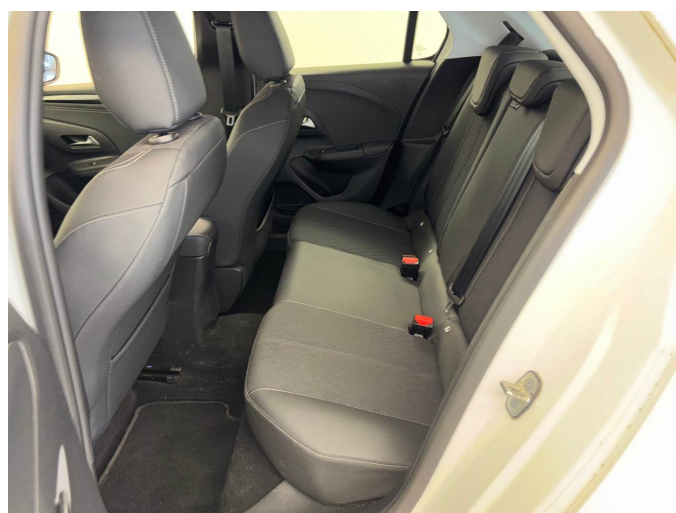


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view

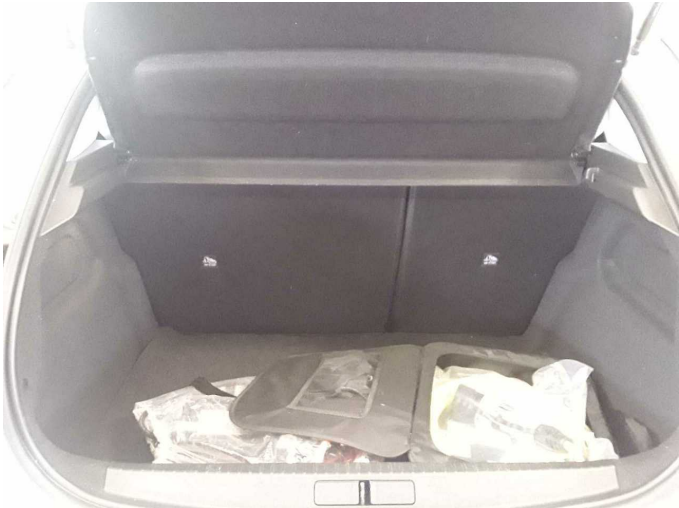


Figure 10: Cargo area

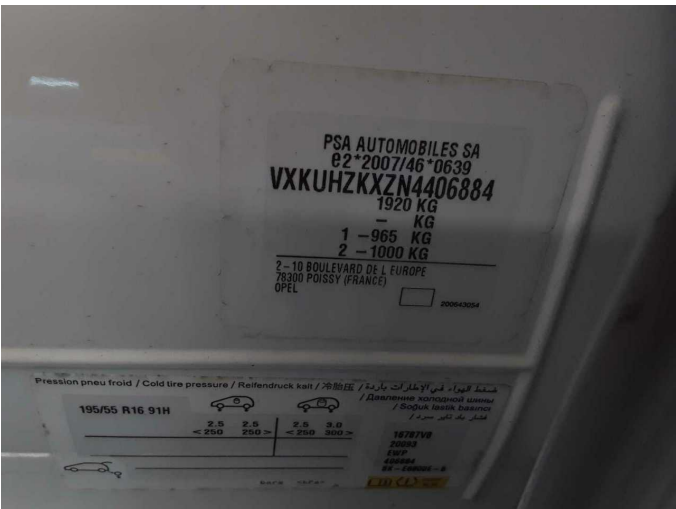


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

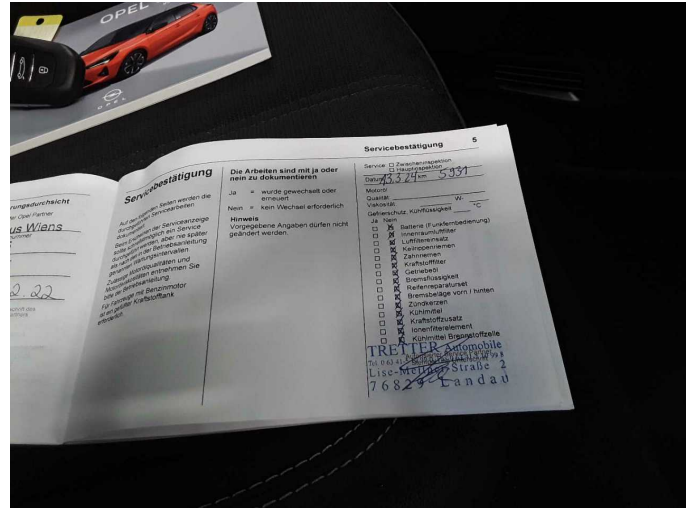


Figure 14: Documents

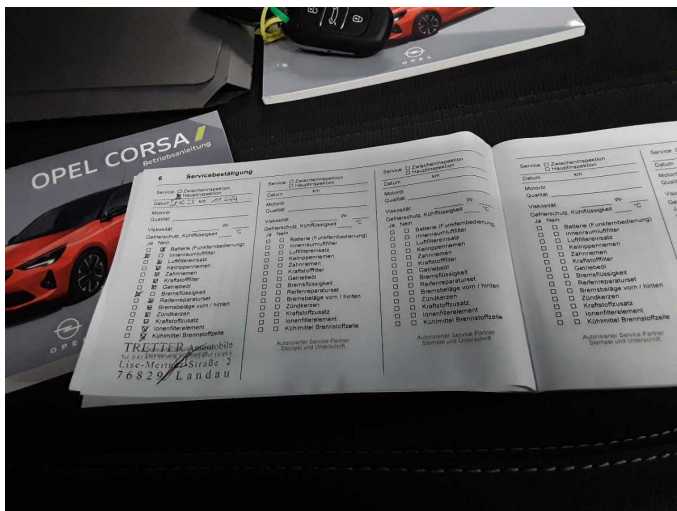


Figure 15: Documents



Figure 16: Navigation



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.

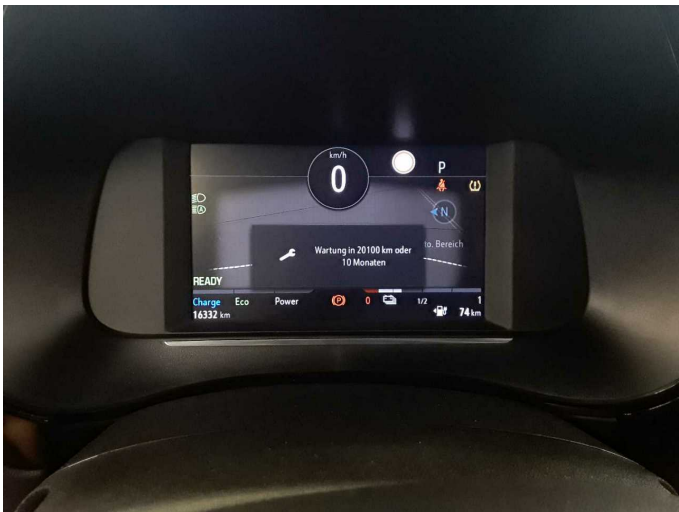


Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.


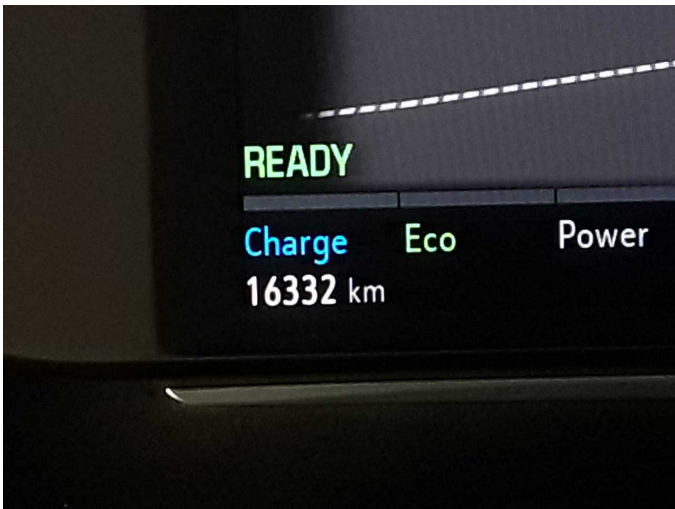


Figure 27: Misc.



Damage 2: Boot lid / rear door: Boot lid - Deformed - Repair and paint

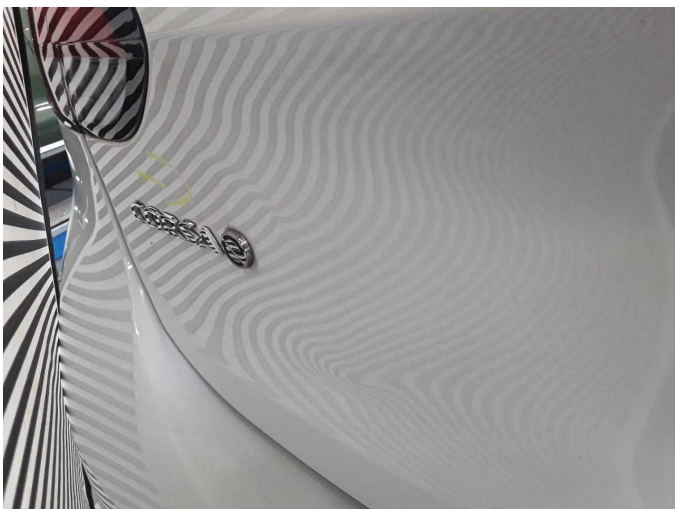

Damage 2: Boot lid / rear door: Boot lid - Deformed - Repair and paint



Damage 2: Boot lid / rear door: Boot lid - Deformed - Repair and paint



Damage 2: Boot lid / rear door: Boot lid - Deformed - Repair and paint



Damage 2: Boot lid / rear door: Boot lid - Deformed - Repair and paint



Wear and tear 1: Front bumper: Front bumper - Stone chips - No deduction



Wear and tear 2: Bonnet: Bonnet - Stone chips - No deduction



Wear and tear 3: Vehicle glazing: Windscreen - Stone chips - No deduction