



Expertise

Protocol number: 46058479
Order No. / Reference: 26512509
Inspection date: 18 Jun 2026

Manufacturer: Volkswagen

Model: T-Roc 1.5 TSI OPF Life

VIN: WVGZZA1ZNV152464



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volkswagen T-Roc 1.5 TSI OPF Life	
Vehicle Identification number	WVGZZA1ZNV152464
Mileage (Read)	71,608 km
First registration	24 Aug 2022
Number of holders	1
Power / Engine displacement	110 kw / 1,498 ccm
Fuel type / Cylinder	Petrol / 4
Gearbox / Number of gears	Manual / 6
Type of drive	Front drive
Type of vehicle	SUV
Colour / colour code	Deep Black Perleffekt (C9X)
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Anthracite-Black



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	18,300 km
Last service on / at	09/2025 at 59,761 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GJ164916
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	0603 / CED 00059		
Emission standard	EURO6;WLTP;DG;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	1,850 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 96H	Winter tyres on Light alloy	Firestone	6mm / 6mm
2)	205/60 R16 96H	Winter tyres on Light alloy	Pirelli	8mm / 8mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/60 R16 95V	Summer tyres on Light alloy	Continental	5mm / 5mm
2)	215/60 R16 95V	Summer tyres on Light alloy	Continental	6mm / 6mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 03/2026		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Airbag for driver and front passenger, with front passenger airbag deactivation
- App Connect (Volkswagen offers three interfaces for connecting smartphones with numerous possibilities: Apple CarPlay, Android Auto from Google and MirrorLink.)
- Vehicle tool kit
- black roof rails
- Digital cockpit, multi-colored, various selectable information profiles
- Electronic parking brake including auto-hold function
- Automatic headlight control with LED daytime running lights ("Leaving home" function and manual "Coming home" function)
- Pedestrian detection
- Luggage compartment floor height-adjustable and removable
- Rear window wiper with intermittent function
- ISOFIX mounting points (device for attaching 2 child seats to the rear seat)
- Front headrests (safety-optimized)
- Steering wheel: Multifunction steering wheel in leather
- front center armrest
- Non-smoking version (storage compartment and 12V socket at the front)
- Otto particulate filter
- Park Assist system including parking aid
- Radio "Composition" (2 speakers - Digital radio reception (DAB+) - 16.5 cm touchscreen - FM radio reception - Dual tuner with phase diversity for the best possible radio reception - Radio Data System (RDS) - MP3 playback - USB-C interface with Apple compatibility - Output power 4 x 20 watts)
- LED taillights, dark red
- Drawer under the right front seat
- Seat belts: Three-point automatic seat belts at the front with height adjustment and belt tensioner (3 three-point automatic seat belts at the rear including belt tensioner for the outer rear seats - warning tone and light for unfastened seat belts at the front and rear)
- Lane keeping assistant "Lane Assist"
- Bumpers in body color
- Textile floor mats front and rear
- Ambient lighting with logo projection
- First aid kit, warning triangle and high-visibility vest
- Prepared for "We Connect" and "We Connect Plus" (online information is transmitted directly to the car (e.g. navigation with point-of-interest search, online traffic information, parking information, etc.))
- Airbag: Head airbag system for front and rear passengers including front side airbags
- Electrically adjustable, folding, and heated exterior mirrors with memory function
- Hill start assist
- third brake light
- Decorative inlays "Pewter matt" (for instrument panel, center console and front door panels)
- Tachometer
- Electronic stability program with counter-steering support (including ABS, ASR, EDS, MSR and trailer stabilization)
- Electric windows front and rear
- Windscreen made of laminated safety glass, heat-insulating
- Transmission: 6-speed manual transmission
- Rear window heated
- Interior mirror automatically dimming
- Air conditioning with active combination filter
- Rear headrests (3)
- LED headlights
- Illuminated makeup mirrors in the sun visors
- Fatigue detection
- Emergency braking assistant "Front Assist"
- Emergency call service (no registration required, service is activated upon delivery)
- Upholstery: Cloth
- Rain sensor
- Tire pressure monitoring system
- Wheels: Light alloy (4) "Chester" 6.5 J x 16 (215/60 R16, optimized for rolling resistance)
- Wheels: Tire Mobility Set (12-volt compressor and tire sealant)
- Gearshift knob in leather
- Electromechanical power steering (speed-dependent control)
- Seats: Comfort seats in the front
- Seats: Rear seat backrest asymmetrically split and foldable with center armrest
- Seats: Front seats with height adjustment
- Start-stop system with brake energy recuperation
- Telephone interface (operation and display via multifunction display and touchscreen of the radio or radio navigation system as well as via multifunction steering wheel - hands-free system - Bluetooth audio)
- Electronic immobilizer
- Green thermal insulation glazing, sides and rear
- Central locking without safe locking, with remote control and 2 remote keys



Extra equipment

- Air conditioning system "Air Care Climatronic" (with active combination filter and 2-zone temperature control)
- Package: "IQ.Drive" assistance package including LED Plus headlights (manual transmission) (6 speakers - cornering and bad weather lights - App-Connect including App-Connect Wireless for Apple CarPlay and Android Auto - Adaptive Cruise Control (ACC) with speed limiter - "Travel Assist", "Lane Assist" - High beam assist - LED Plus headlights with LED daytime running lights - Dynamic headlight range adjustment - "Front Assist" emergency braking system - Proactive occupant protection system - Radio - "Side Assist" lane change assist - Prepared for later activation: navigation function)
- Paint finish: Pearl effect
- Navigation system "Discover Media" incl. "Streaming & Internet" (6 speakers - App-Connect Wireless for Apple CarPlay and Android Auto - 20.3 cm touchscreen - Dual tuner with phase diversity for best possible radio reception - Radio Data System (RDS) - MP3 playback - USB-C interface (Apple compatibility) - Output power 4 x 20 watts - Map with 2D display - Points of interest - Telephone interface - Traffic sign recognition)
- Package: Winter Package
- Rear View reversing camera

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Door - rear right side	Door handle - outside - Scratch(es) - Smart repair
2	Door - front right side	Door handle - outside - Scratch(es) - Smart repair
3	Equipment	Tirefit filler - Expired - Replace
4	Door - front right side	Brightware - lower - Scratch(es) - Loss in value
5	Door - front left side	Door edge - Scratch(es) - Smart repair
6	Tail light	Tail lamp - left side - Scratch(es) - Loss in value
7	Tail light	Tail lamp - right side - Scratch(es) - Loss in value
8	Door - rear left side	Door edge - Scratch(es) - Smart repair
9	Body	C-pillar - left side - Scratch(es) - Smart repair
10	Sill - left side	Sill - Scratch(es) - Smart repair
11	Sill - right side	Sill - Dent / paintcoat damage - Smart repair
12	Side panel - rear right side	Sill - Scratch(es) - Smart repair
13	Door - front right side	Door - Scratch(es) - Smart repair
14	Rear bumper	Spoiler - Scratch(es) - Replace
15	Rear bumper	Rear bumper - Scratch(es) - Paint
16	Vehicle glazing	Windscreen - Broken / torn - Replace



Wear and tear

No.	Component group	Description
1	Bonnet	Bonnet - Stone chips - No deduction
2	Front bumper	Front bumper - Stone chips - No deduction
3	Roof	Roof - dent(s) - No deduction
4	Front bumper	Spoiler (unterhalb) - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Side - left, Provided by user / customer, from 22 May 2023	7.217,09 €

Repainting

No.	Repainting
1	Door - rear left side, Professionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Door - rear left side	203 µm
-----------------------	--------

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.



Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Additional tyres



Figure 15: Additional tyres



Figure 16: Navigation

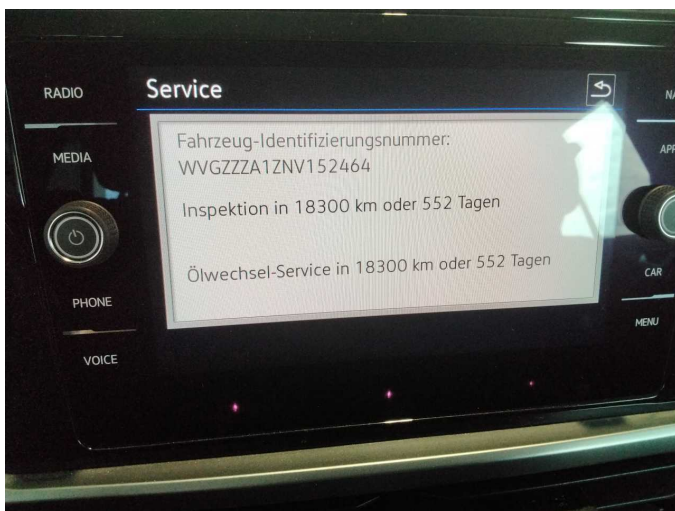


Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.

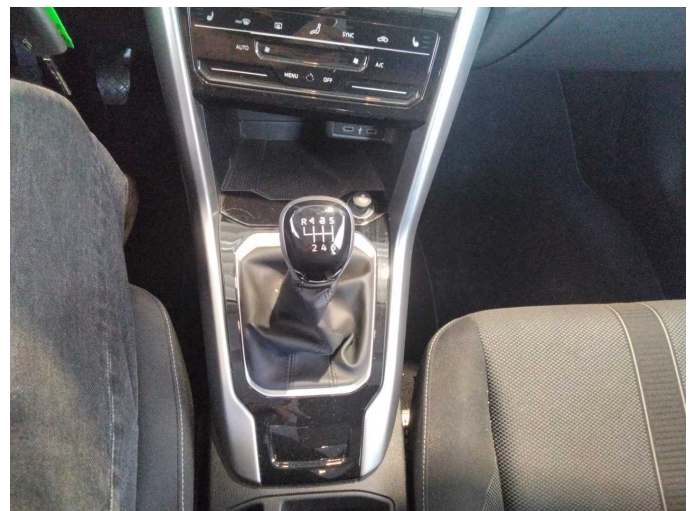


Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.

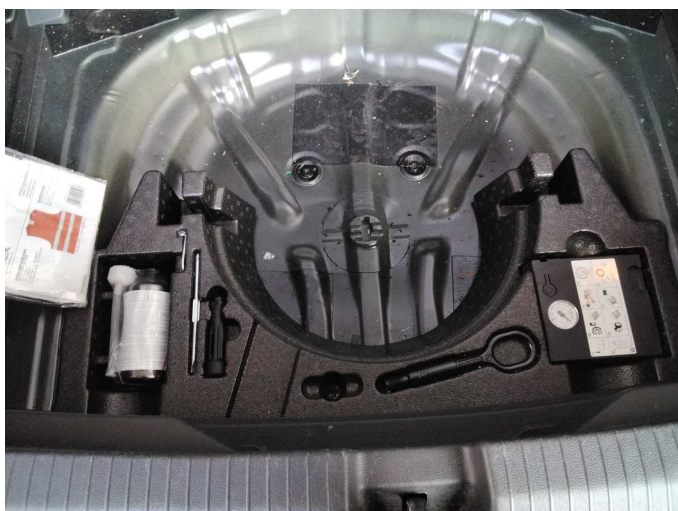


Figure 29: Misc.



Damage 1: Door - rear right side: Door handle - outside - Scratch(es) - Smart repair




Damage 1: Door - rear right side: Door handle - outside - Scratch(es) - Smart repair



Damage 2: Door - front right side: Door handle - outside - Scratch(es) - Smart repair



Damage 2: Door - front right side: Door handle - outside - Scratch(es) - Smart repair

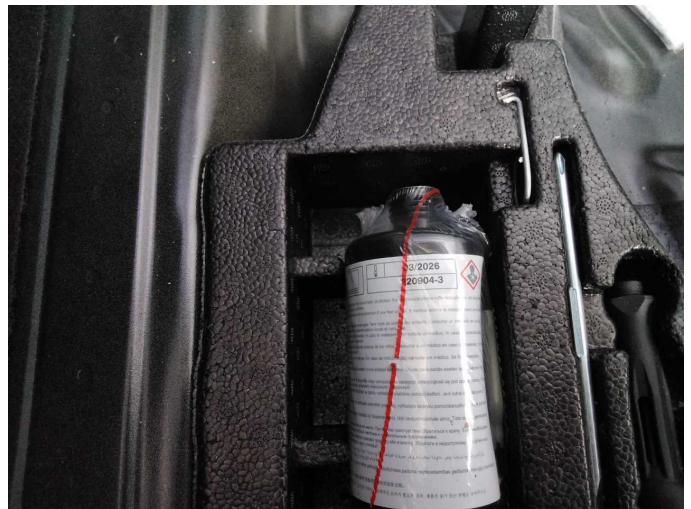

Damage 3: Equipment: Tirefit filler - Expired - Replace



Damage 4: Door - front right side: Brightware - lower - Scratch(es) - Loss in value



Damage 4: Door - front right side: Brightware - lower - Scratch(es) - Loss in value



Damage 5: Door - front left side: Door edge - Scratch(es) - Smart repair




Damage 5: Door - front left side: Door edge - Scratch(es) - Smart repair




Damage 6: Tail light: Tail lamp - left side - Scratch(es) - Loss in value



Damage 6: Tail light: Tail lamp - left side - Scratch(es) - Loss in value

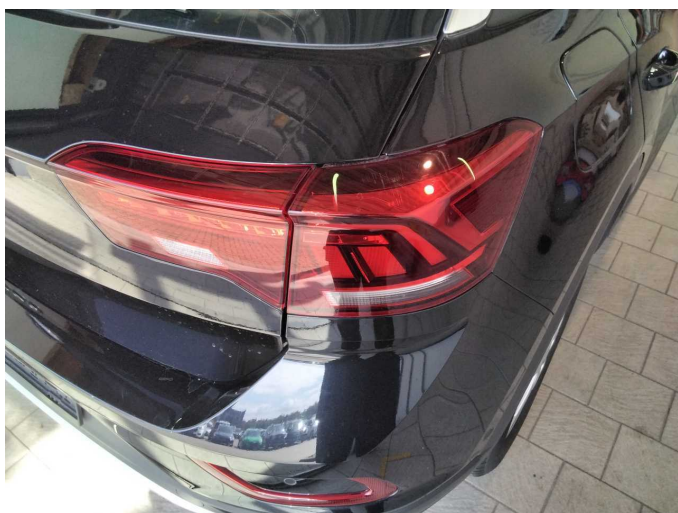

Damage 7: Tail light: Tail lamp - right side - Scratch(es) - Loss in value

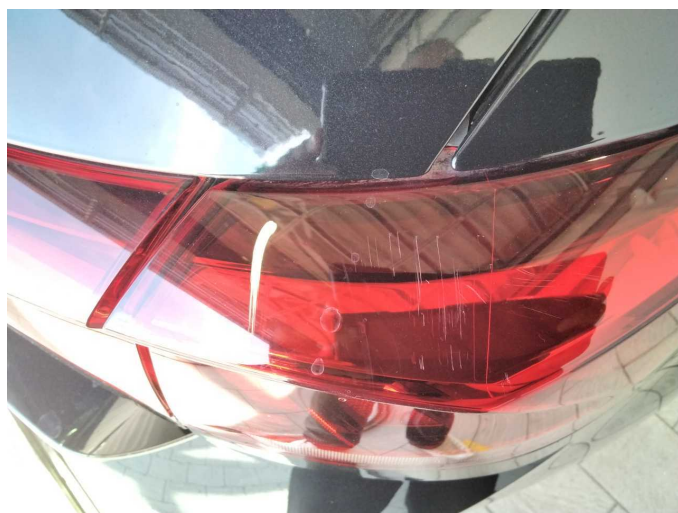


Damage 7: Tail light: Tail lamp - right side - Scratch(es) - Loss in value




Damage 8: Door - rear left side: Door edge - Scratch(es) - Smart repair




Damage 8: Door - rear left side: Door edge - Scratch(es) - Smart repair

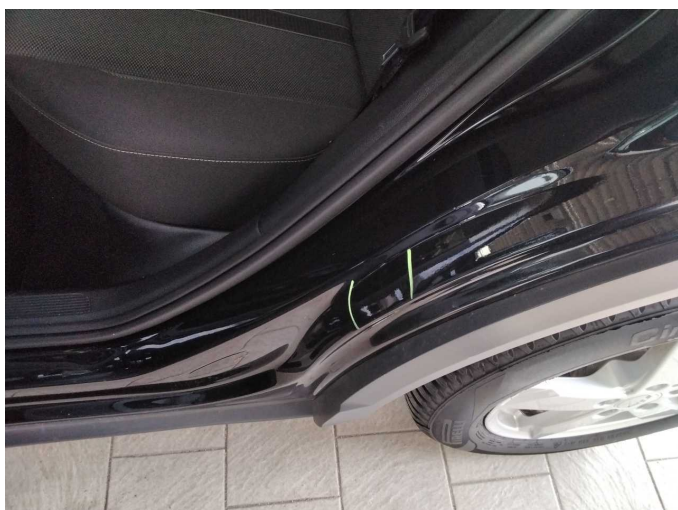

Damage 9: Body: C-pillar - left side - Scratch(es) - Smart repair

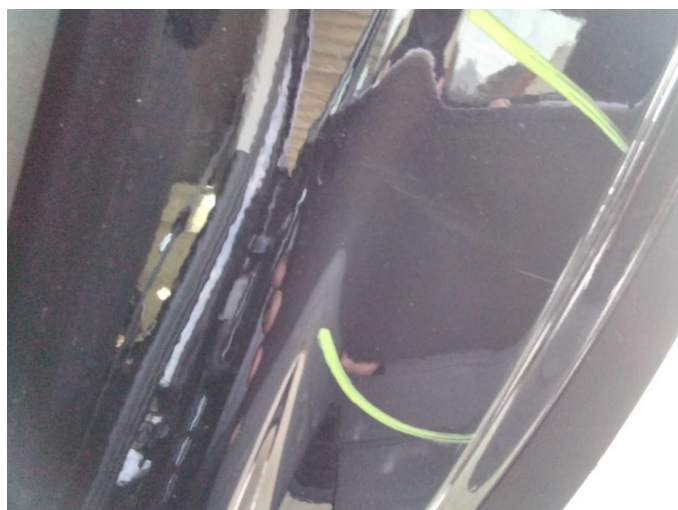

Damage 9: Body: C-pillar - left side - Scratch(es) - Smart repair

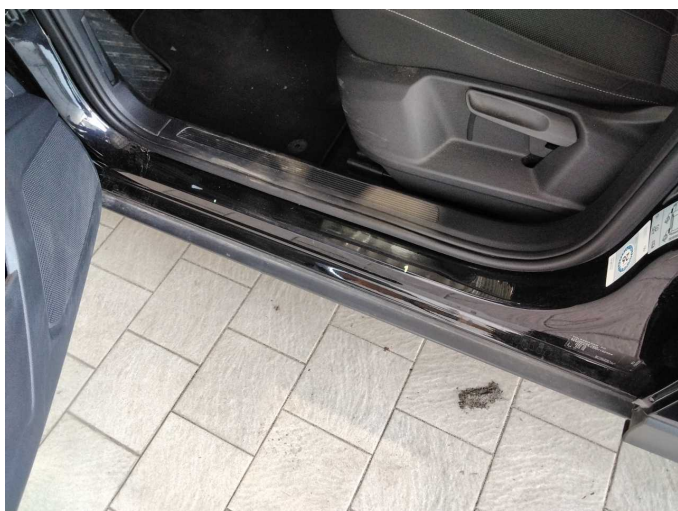


Damage 10: Sill - left side: Sill - Scratch(es) - Smart repair




Damage 10: Sill - left side: Sill - Scratch(es) - Smart repair




Damage 11: Sill - right side: Sill - Dent / paintcoat damage - Smart repair

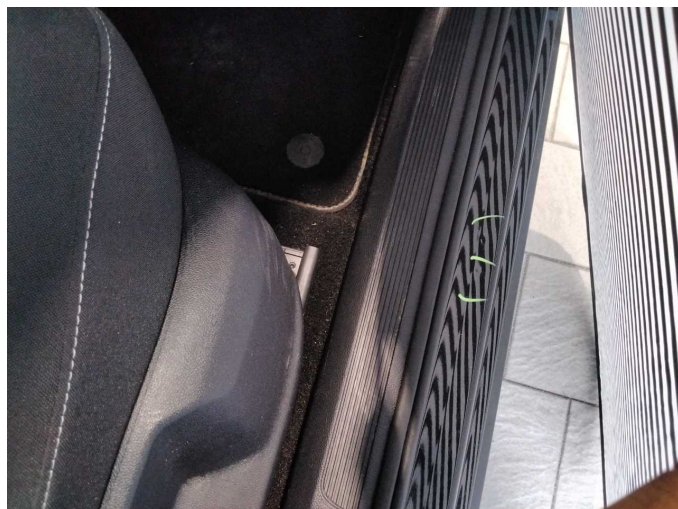


Damage 11: Sill - right side: Sill - Dent / paintcoat damage - Smart repair

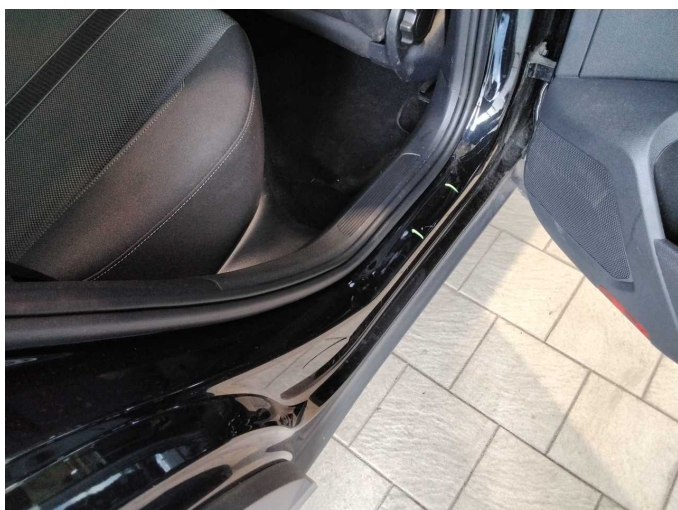


Damage 12: Side panel - rear right side: Sill - Scratch(es) - Smart repair

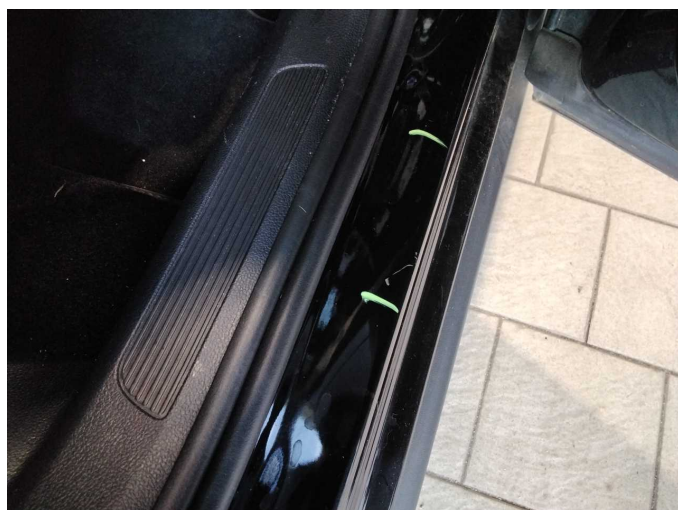

Damage 12: Side panel - rear right side: Sill - Scratch(es) - Smart repair

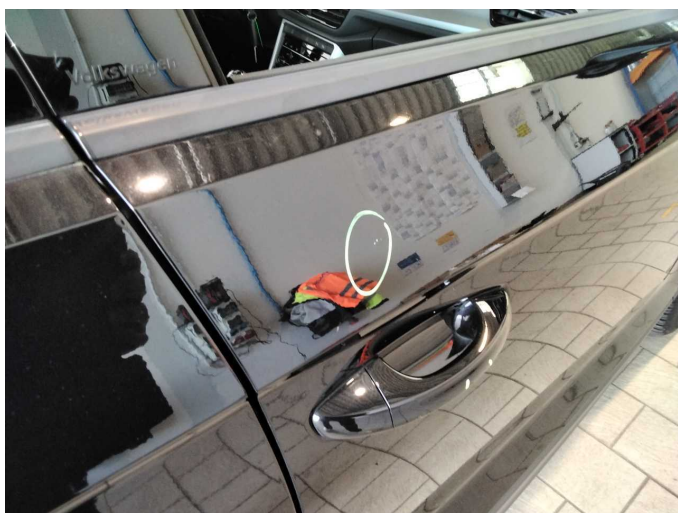

Damage 13: Door - front right side: Door - Scratch(es) - Smart repair

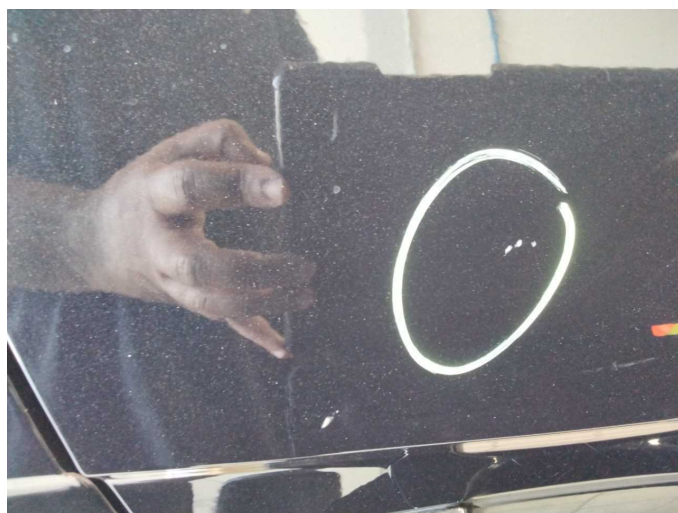

Damage 13: Door - front right side: Door - Scratch(es) - Smart repair



Damage 14: Rear bumper: Spoiler - Scratch(es) - Replace



Damage 14: Rear bumper: Spoiler - Scratch(es) - Replace




Damage 14: Rear bumper: Spoiler - Scratch(es) - Replace



Damage 14: Rear bumper: Spoiler - Scratch(es) - Replace



Damage 15: Rear bumper: Rear bumper - Scratch(es) - Paint

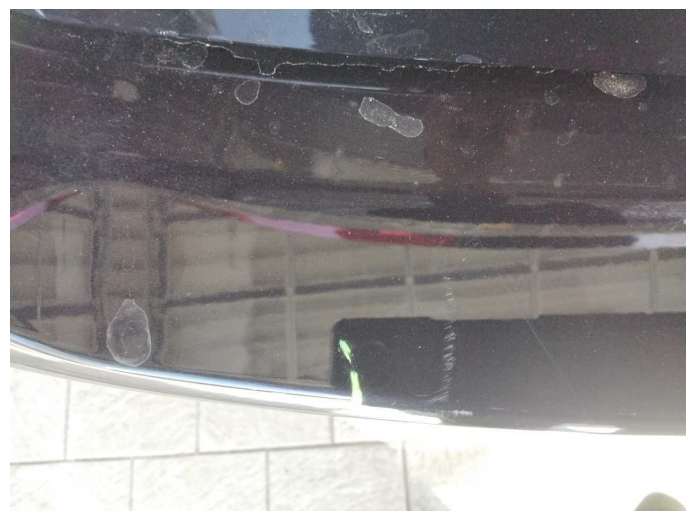

Damage 15: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 15: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 15: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 15: Rear bumper: Rear bumper - Scratch(es) - Paint




Damage 15: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 15: Rear bumper: Rear bumper - Scratch(es) - Paint




Damage 16: Vehicle glazing: Windscreen - Broken / torn - Replace

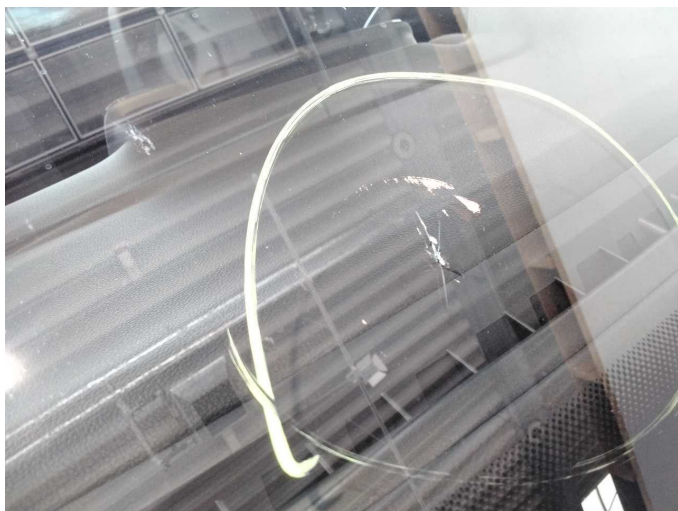

Damage 16: Vehicle glazing: Windscreen - Broken / torn - Replace



Wear and tear 1: Bonnet: Bonnet - Stone chips - No deduction

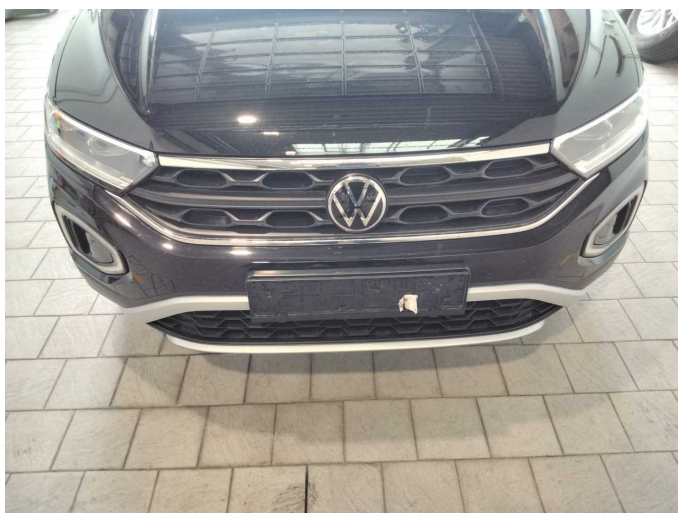

Wear and tear 2: Front bumper: Front bumper - Stone chips - No deduction



Wear and tear 3: Roof: Roof - dent(s) - No deduction



Wear and tear 3: Roof: Roof - dent(s) - No deduction



Wear and tear 4: Front bumper: Spoiler (unterhalb) - Scratch(es) - No deduction



Wear and tear 4: Front bumper: Spoiler (unterhalb) - Scratch(es) - No deduction



Repainting 1: Door - rear left side



Repainting 1: Door - rear left side