



Expertise

Protocol number: 46797341
Order No. / Reference: 26688259
Inspection date: 27 Jul 2026

Manufacturer: Volkswagen

Model: Tiguan 2.0 TDI SCR 4MOTION DSG R-Line

VIN: WVGZZZ5N1PW505926



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volkswagen Tiguan 2.0 TDI SCR 4MOTION DSG R-Line	
Vehicle Identification number	WVGZZZ5N1PW505926
Mileage (Read)	154,849 km
First registration	25 Nov 2022
Number of holders	1
Fuel type	Diesel
Engine displacement / Cylinder	1,968 ccm / 4
Power	147 kW
Gearbox / Number of gears	Automatic / 7
Type of drive	All-wheel drive
Type of vehicle	SUV
Colour / colour code	Reflexsilber-metallic (A7W)
Doors / Seats	5 / 5
Upholstery type	Alcantara / cloth
Colour of upholstery	Grey-Black
Vehicle with smoke odor	no
readiness to drive	Not roadworthy / moveable



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	0 km
Last service on / at	10/2025 at 121,189 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GM793569
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
readiness to drive	Not roadworthy / moveable		
Manufacturer key number/ type code number	0603 / CLE 03278		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,250 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	255/40 R20 101V	Summer tyres on Light alloy	Continental	6mm / 6mm
2)	255/40 R20 101V	Summer tyres on Light alloy	Continental	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/50 R19 103H	Winter tyres on Light alloy	Pirelli	5mm / 5mm
2)	235/50 R19 103H	Winter tyres on Light alloy	Pirelli	5mm / 5mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
N	145/85 R18 103M	Summer tyres on Steel	Sonstige	3 mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- Airbag for driver and front passenger including knee airbag on the driver's side (passenger airbag deactivation - knee airbag on the driver's side)
- 30-color ambient lighting
- Adaptive Cruise Control ACC (DSG) (Adaptive Cruise Control ACC "stop & go", with speed limiter - Emergency Brake Assist "Front Assist" (for ACC up to 210 km/h))
- Hill descent control
- Chrome applications on mirror adjustment switches, window regulator switches, door pull handles (interior door operation in matte chrome)
- Diesel particulate filter
- Tachometer
- Parking aid (warning signals for obstacles in the front and rear area)
- Driving assistant "Travel Assist" and lane keeping assistant "Lane Assist"
- Driving profile selection
- Electric windows front and rear
- Windscreen made of laminated safety glass, heat and sound insulating
- Rear window heated
- Rear spoiler in R-style
- ISOFIX mounting points, also for i-Size child seats (device for attaching 2 child seats to the rear seats)
- Instrument cluster with electronic speedometer (odometer, trip meter, tachometer)
- Rear headrests (3)
- LED reading lights, 2 in the front and 2 in the rear
- LED headlights with LED daytime running lights
- Light in the front footwell
- Front center armrest adjustable in height and length, with storage box and rear air vents
- Emergency call service (no registration required, service is activated upon delivery)
- Pedals and footrest in brushed stainless steel
- Upholstery: Cloth
- Radio accessories: 8 speakers
- Rain sensor
- Tire pressure monitoring system
- Wheels: AirStop tires 255/45 R 19, optimized for low rolling resistance
- Wheels: Alloy (4) "Valencia" 8.5 J x 19, Volkswagen R (tires 255/45 R 19)
- Gearshift knob in leather
- Drawers under the front seats
- Seat belts: Three-point automatic seat belts at the front with height adjustment and belt tensioner (3 three-point automatic seat belts at the rear including belt tensioner for the outer rear seats - warning tone and light for unfastened seat belts at the front and rear)
- Seats: Top comfort seats in the front
- Airbag: Head airbag system for front and rear passengers including front side airbags
- Permanent 4MOTION all-wheel drive
- App-Connect including App-Connect Wireless for Apple CarPlay and Android Auto
- Electrically adjustable and heated exterior mirrors (driver's side exterior mirror aspherical)
- third brake light
- black roof rails
- Decorative inlays "Carbon Grey" (for instrument panel and front door panels)
- Display: Digital Cockpit Pro, multicolor, various selectable info profiles
- Electronic parking brake including auto-hold function
- Electronic stability program with counter-steering support (including ABS, ASR, EDS, MSR and trailer stabilization)
- Automatic headlight control with LED daytime running lights ("Coming home" and "Leaving home" function)
- High beam control Light Assist
- Pedestrian detection
- Transmission: 7-speed DSG
- rear window wiper
- Interior mirror automatically dimming
- LED license plate lighting
- Air conditioning "Air Care Climatronic" (with active combination filter, rear controls and 3-zone temperature control)
- Front headrests (safety-optimized - adjustable lengthwise and height)
- Steering wheel: Multifunction sports steering wheel in leather, heated, with touch controls and paddle shifters
- Fatigue detection
- Non-smoking version (storage compartment and 12V socket at the front)
- Package: Winter (front windshield washer nozzles automatically heated - front seats heated)
- Radio "Ready 2 Discover" incl. "Streaming & Internet" (20.3 cm TFT touchscreen - FM radio reception - Prepared for later activation: "Discover Media" navigation function incl. "Streaming & Internet" - Dual tuner with phase diversity for best possible radio reception - Radio Data System (RDS) - Radio station logos - MP3 playback - USB-C interface with Apple compatibility - Output power 4 x 20 watts - 3-band tone control - Telephone interface - Gesture control - Digital radio reception DAB+)
- Electromechanical power steering (speed-dependent control)
- Seats: Front passenger seat backrest folds down completely
- Seats: Lumbar support in the front
- Seats: Rear bench seat asymmetrically split (longitudinally sliding and folding - with pass-through and center armrest)
- Start-stop system with brake energy recuperation
- Power outlet: 2 USB-C ports on the front



- Seats: Front seats with height adjustment
- 12-volt power outlet (on the rear center console and in the luggage compartment)
- Bumpers in body color, in "R-Line" styling
- Textile floor mats front and rear with decorative stitching in grey
- Electronic immobilizer
- Green thermal insulation glazing, sides and rear

Extra equipment

- Foldable towbar (electric release)
- Silver anodized roof rails
- Chassis: Adaptive chassis control DCC (including driving profile selection)
- Navigation system "Discover Media" incl. "Streaming & Internet" (20.3 cm TFT touchscreen - FM radio reception - Dual tuner with phase diversity for best possible radio reception - Radio Data System (RDS) - Radio station logos - MP3 playback - USB-C interface with Apple compatibility - 4 x 20 watt output power - Map with 2D display - 3-band sound control - Telephone interface - Traffic sign recognition - Points of interest - DAB+ digital radio reception)
- Package: Driver Assistance Package "Plus" PFC
- Park Assist system including parking aid
- Radio accessories: "Harman Kardon" sound system (8+1 speakers - 480 watts total power - digital 16-channel amplifier - subwoofer)
- Wheels: Alloy (4) "Suzuka" 8.5 J x 20, Volkswagen R (in Dark Graphite - AirStop tires 255/40 R 20 - Wheel locks with enhanced theft protection)
- Rear View reversing camera
- Windows: Rear side windows and rear window tinted

- Power outlet: 2 USB-C ports on the front (charging power up to 45 W)
- First aid kit, warning triangle and high-visibility vest
- Prepared for later activation: Navigation function "Discover Media" incl. "Streaming & Internet"
- Central locking without safe locking, with remote control and 2 remote keys

- Electrically adjustable, folding, and heated exterior mirrors, ambient lighting, passenger-side mirror lowering function
- Fire extinguisher
- Paint finish: Metallic
- Mesh partition
- Package: Business Premium (DSG) (App-Connect incl. App-Connect Wireless for Apple CarPlay and Android Auto - Leather multifunction steering wheel, heated, with shift paddles - Automatically heated front windscreen washer nozzles - Voice control - "Comfort" telephone interface with inductive charging function - Heated front seats)
- Package: Cargo package including space- and weight-saving spare wheel (230V socket in the luggage compartment - on-board tools and jack - luggage compartment lighting - luggage compartment floor height-adjustable in 2 stages - space- and weight-saving spare wheel)
- Tire pressure monitoring system for road tires and winter tires
- Wheels: Winter wheels (4) (additional), alloy "Auckland" 7 J x 19 painted in sterling silver (winter tires 235/50 R 19 H - on-board tools and jack)
- Power outlets: 2 USB-C ports at the front, (1 USB-C charging port at the rear of the center console, charging power up to 45 W)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was not capable of driving under its own power at the time of inspection, but can be moved on its own axle with the aid of assistance.



Value reducing factors

No.	Component group	Description
1	Trim / covers	Door trim - front left side - Scratched - Smart repair
2	Trim / covers	Door trim - front right side - Scratched - Smart repair
3	Boot lid / rear door	Boot lid - dent(s) - Smooth repair work
4	Side panel - rear left side	Side panel - dent(s) - Smooth repair work
5	Side panel - rear right side	Side panel - dent(s) - Smooth repair work
6	Door - rear right side	Door - dent(s) - Smooth repair work
7	Trim / covers	Door trim - rear left side - Damaged - Loss in value
8	Trim / covers	Door trim - rear right side - Damaged - Loss in value
9	Wheel / tyres	Tyre - front right side - Damaged - Replace
10	Interior	Rear shelf - Broken / torn - Replace
11	Wheel / tyres	Alloy rim - rear right side - Damaged - Loss in value
12	Wheel / tyres	Alloy rim - front right side - Scratch(es) - Replace
13	Wheel / tyres	Alloy rim - front right side - Damaged - Loss in value
14	Misc.	Inspection / maintenance - Due - Perform
15	Rear bumper	Rear bumper - Dent / paintcoat damage - Paint
16	Front bumper	Front bumper - Paint defect - Paint
17	Roof	Roof - Dent / paintcoat damage - Paint

Wear and tear

No.	Component group	Description
1	Wing mirror - left side	Cap - Stone chips - No deduction
2	Wing mirror - right side	Cap - Stone chips - No deduction
3	Side panel - rear left side	Sill - dent(s) - No deduction
4	Bonnet	Bonnet - Stone chips - No deduction
5	Door - rear left side	Door - Scratch(es) - No deduction
6	Door - front left side	Door - Scratch(es) - No deduction
7	Trim / covers	Door trim - rear right side - Scratched - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Rear, Provided by user / customer	917,37 €
2	Side right, Provided by user / customer	16.570,17 €

Paint coat thickness measurement

Roof rail - right side	183 µm	Mudguard - right side	166 µm
Side panel - rear right side	213 µm	Door - front right side	169 µm



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

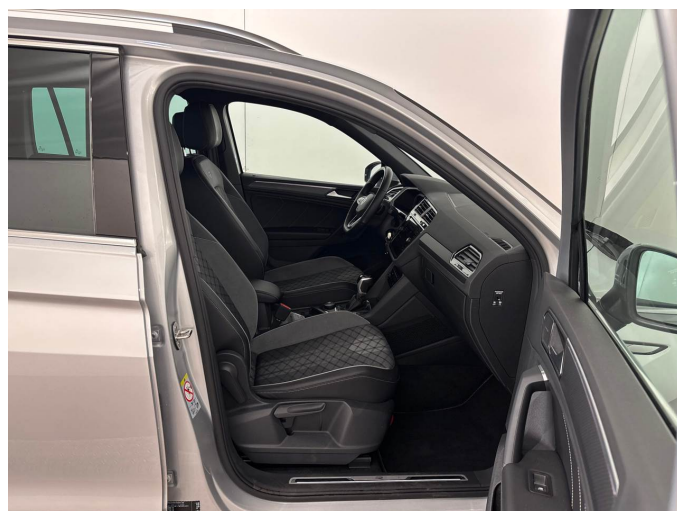


Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres

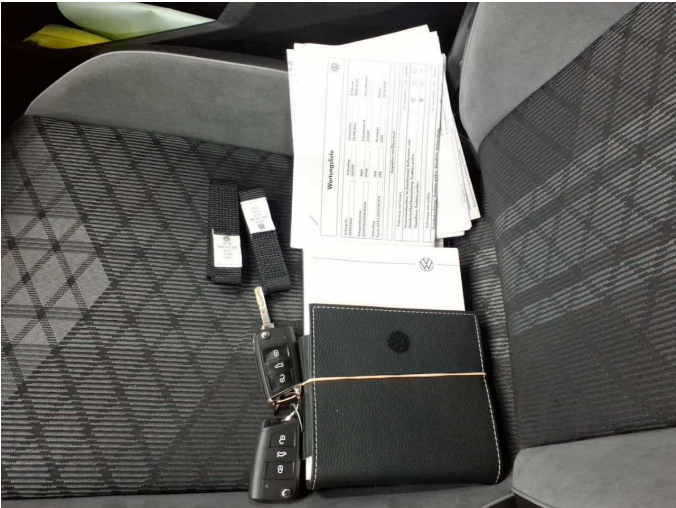


Figure 13: Documents



Figure 14: Additional tyres



Figure 15: Additional tyres



Figure 16: Additional tyres



Figure 17: Additional tyres



Figure 18: Additional tyres



Figure 19: Navigation



Figure 20: Misc.



Figure 21: Misc.

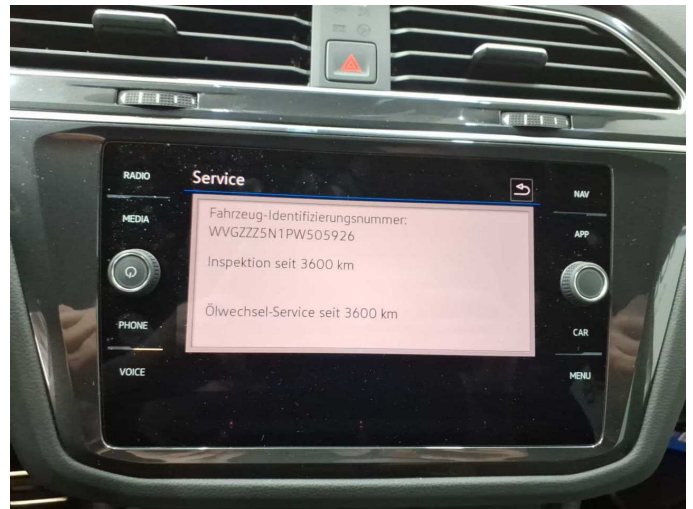


Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Damage 1: Trim / covers: Door trim - front left side - Scratched - Smart repair



Damage 1: Trim / covers: Door trim - front left side - Scratched - Smart repair



Damage 2: Trim / covers: Door trim - front right side - Scratched - Smart repair




Damage 2: Trim / covers: Door trim - front right side - Scratched - Smart repair



Damage 2: Trim / covers: Door trim - front right side - Scratched - Smart repair



Damage 3: Boot lid / rear door: Boot lid - dent(s) - Smooth repair work

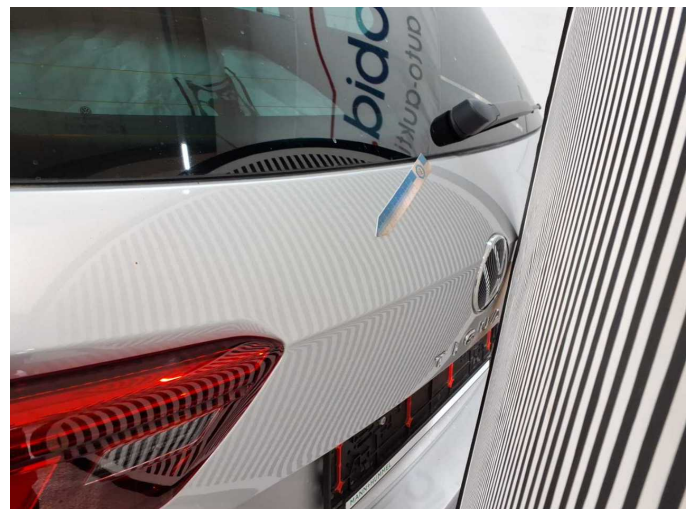

Damage 3: Boot lid / rear door: Boot lid - dent(s) - Smooth repair work



Damage 4: Side panel - rear left side: Side panel - dent(s) - Smooth repair work



Damage 4: Side panel - rear left side: Side panel - dent(s) - Smooth repair work




Damage 5: Side panel - rear right side: Side panel - dent(s) - Smooth repair work



Damage 5: Side panel - rear right side: Side panel - dent(s) - Smooth repair work



Damage 6: Door - rear right side: Door - dent(s) - Smooth repair work

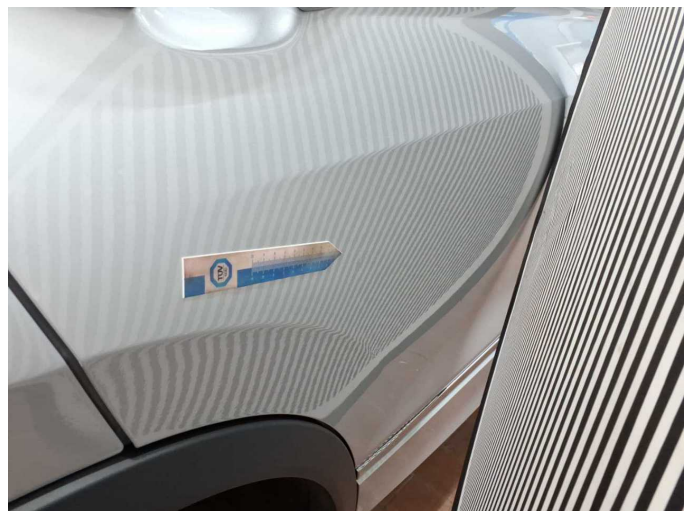

Damage 6: Door - rear right side: Door - dent(s) - Smooth repair work



Damage 7: Trim / covers: Door trim - rear left side - Damaged - Loss in value



Damage 7: Trim / covers: Door trim - rear left side - Damaged - Loss in value




Damage 7: Trim / covers: Door trim - rear left side - Damaged - Loss in value



Damage 8: Trim / covers: Door trim - rear right side - Damaged - Loss in value



Damage 8: Trim / covers: Door trim - rear right side - Damaged - Loss in value

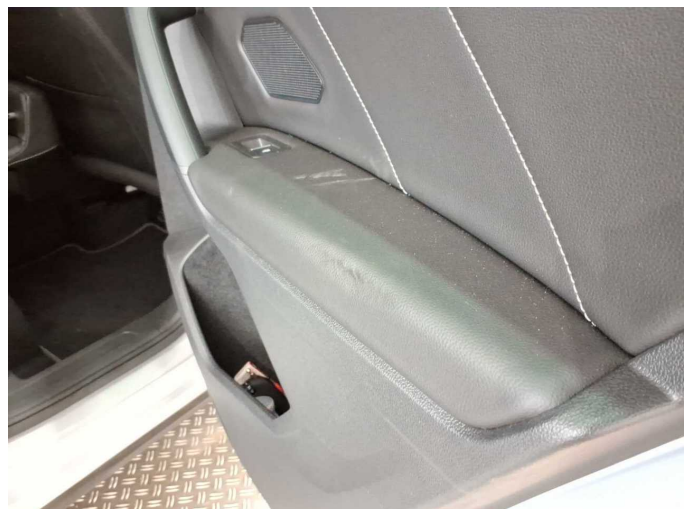

Damage 8: Trim / covers: Door trim - rear right side - Damaged - Loss in value



Damage 9: Wheel / tyres: Tyre - front right side - Damaged - Replace




Damage 9: Wheel / tyres: Tyre - front right side - Damaged - Replace



Damage 10: Interior: Rear shelf - Broken / torn - Replace



Damage 10: Interior: Rear shelf - Broken / torn - Replace

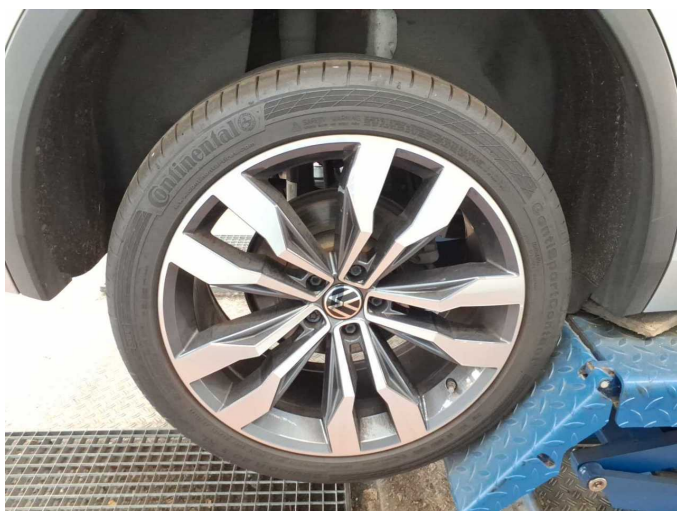

Damage 11: Wheel / tyres: Alloy rim - rear right side - Damaged - Loss in value



Damage 11: Wheel / tyres: Alloy rim - rear right side - Damaged - Loss in value



Damage 12: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Replace



Damage 12: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Replace



Damage 12: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Replace



Damage 12: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Replace



Damage 12: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Replace



Damage 13: Wheel / tyres: Alloy rim - front right side - Damaged - Loss in value



Damage 13: Wheel / tyres: Alloy rim - front right side - Damaged - Loss in value



Damage 13: Wheel / tyres: Alloy rim - front right side - Damaged - Loss in value




Damage 13: Wheel / tyres: Alloy rim - front right side - Damaged - Loss in value



Damage 14: Misc.: Inspection / maintenance - Due - Perform



Damage 15: Rear bumper: Rear bumper - Dent / paintcoat damage - Paint

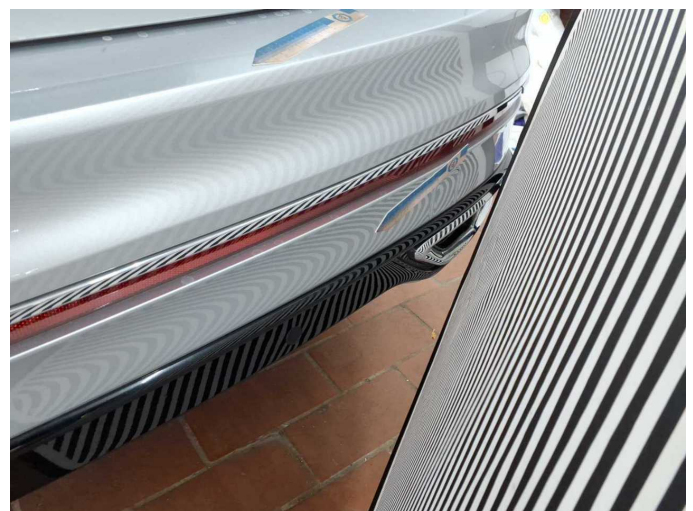

Damage 15: Rear bumper: Rear bumper - Dent / paintcoat damage - Paint



Damage 15: Rear bumper: Rear bumper - Dent / paintcoat damage - Paint



Damage 15: Rear bumper: Rear bumper - Dent / paintcoat damage - Paint




Damage 15: Rear bumper: Rear bumper - Dent / paintcoat damage - Paint



Damage 15: Rear bumper: Rear bumper - Dent / paintcoat damage - Paint



Damage 16: Front bumper: Front bumper - Paint defect - Paint

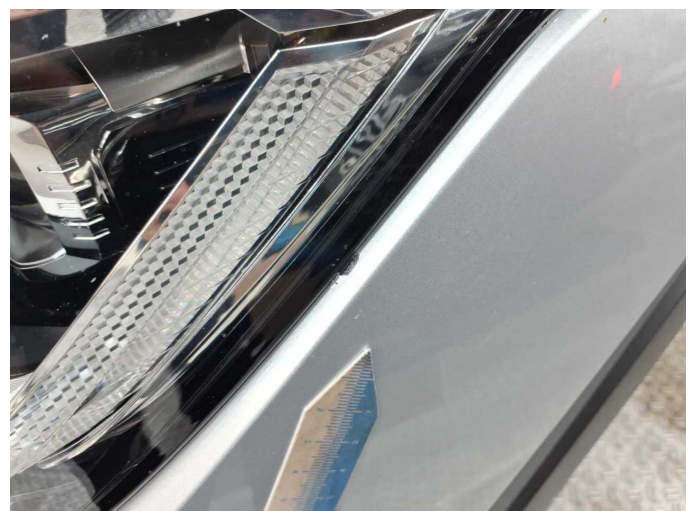

Damage 16: Front bumper: Front bumper - Paint defect - Paint



Damage 16: Front bumper: Front bumper - Paint defect - Paint



Damage 17: Roof: Roof - Dent / paintcoat damage - Paint



Damage 17: Roof: Roof - Dent / paintcoat damage - Paint



Damage 17: Roof: Roof - Dent / paintcoat damage - Paint



Damage 17: Roof: Roof - Dent / paintcoat damage - Paint




Wear and tear 3: Side panel - rear left side: Sill - dent(s) - No deduction



Wear and tear 4: Bonnet: Bonnet - Stone chips - No deduction




Wear and tear 4: Bonnet: Bonnet - Stone chips - No deduction

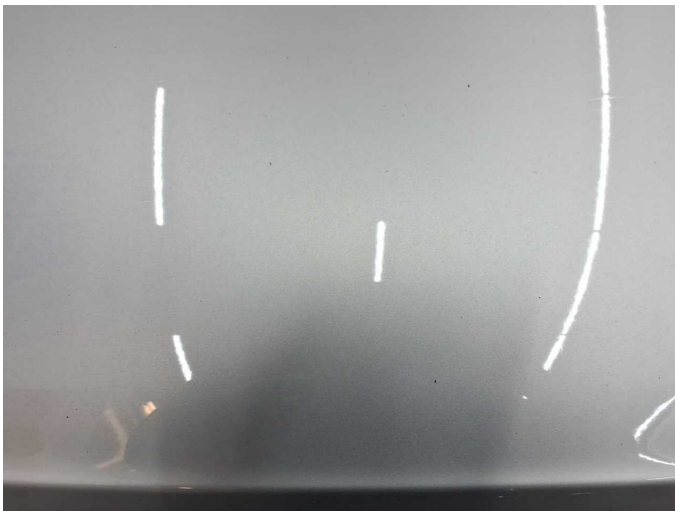


Wear and tear 4: Bonnet: Bonnet - Stone chips - No deduction



Wear and tear 4: Bonnet: Bonnet - Stone chips - No deduction

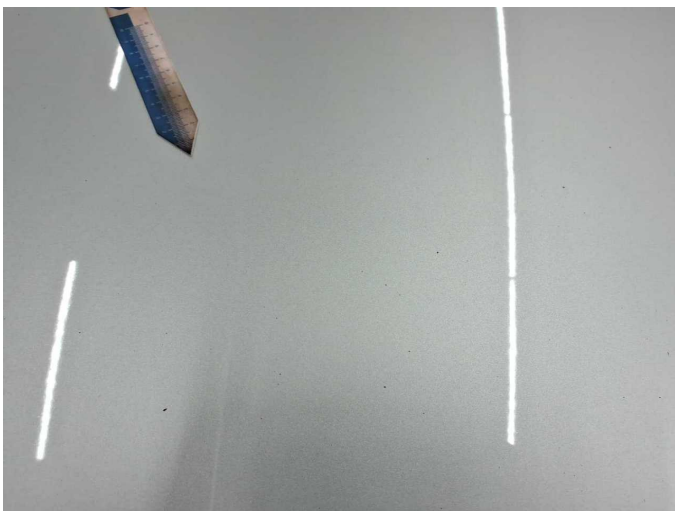

Wear and tear 4: Bonnet: Bonnet - Stone chips - No deduction

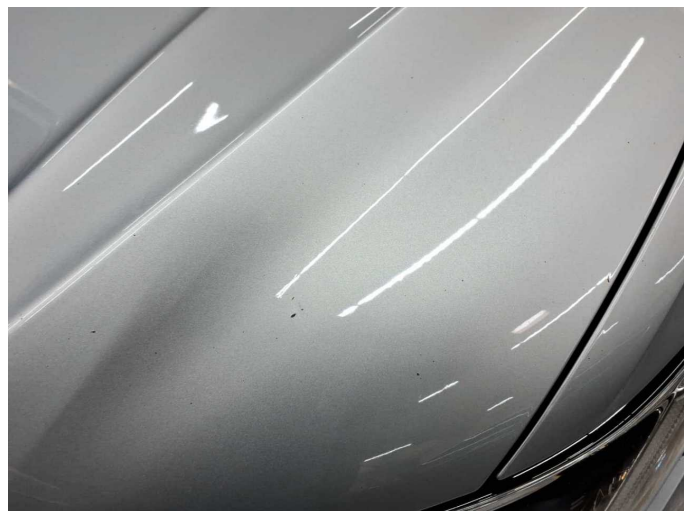

Wear and tear 4: Bonnet: Bonnet - Stone chips - No deduction




Wear and tear 5: Door - rear left side: Door - Scratch(es) - No deduction



Wear and tear 5: Door - rear left side: Door - Scratch(es) - No deduction



Wear and tear 6: Door - front left side: Door - Scratch(es) - No deduction

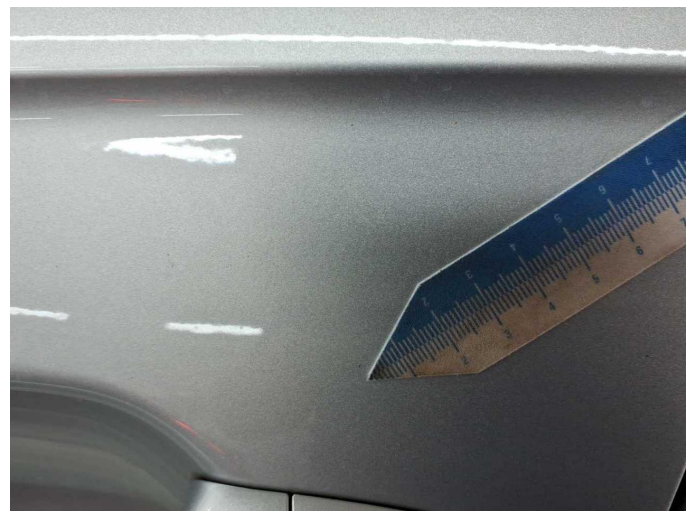

Wear and tear 6: Door - front left side: Door - Scratch(es) - No deduction



Wear and tear 7: Trim / covers: Door trim - rear right side - Scratched - No deduction




Wear and tear 7: Trim / covers: Door trim - rear right side - Scratched - No deduction



Previous damage 2: Side right



Previous damage 2: Side right

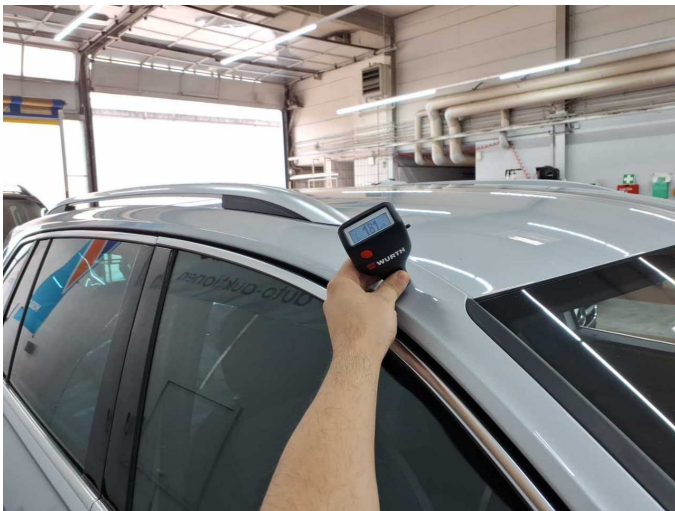


Previous damage 2: Side right



Previous damage 2: Side right



Previous damage 2: Side right

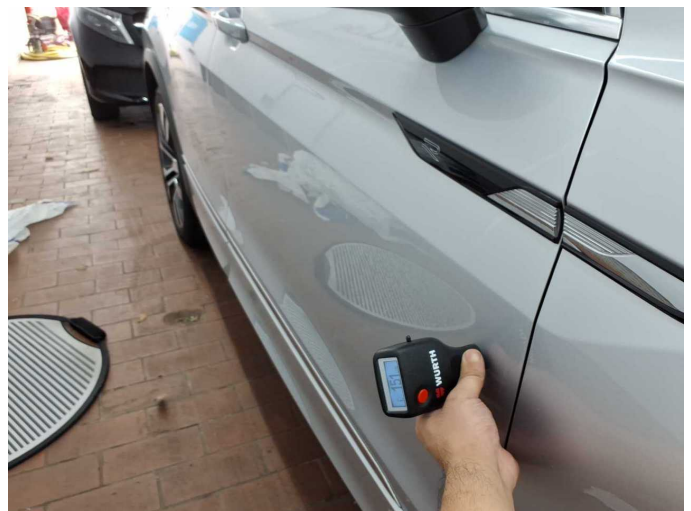


Previous damage 2: Side right



Previous damage 2: Side right



Previous damage 2: Side right

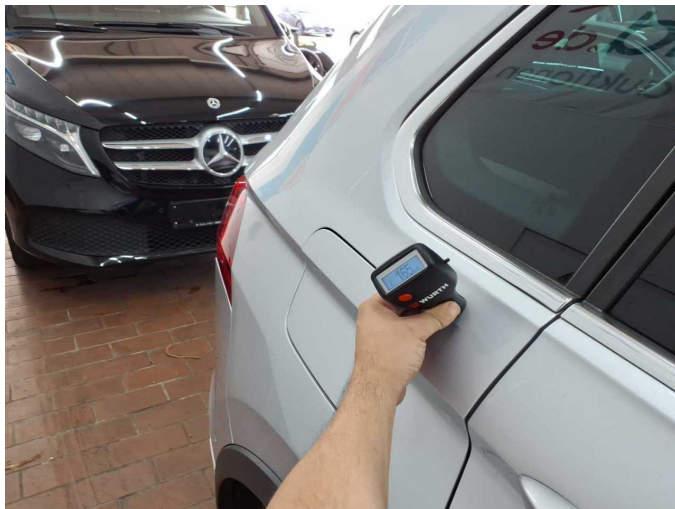

Previous damage 2: Side right



Previous damage 2: Side right



Roof rail - right side: 183 µm



Mudguard - right side: 166 µm



Side panel - rear right side: 213 µm



Door - front right side: 169 µm



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WVGZZZ5N1PW505926

Hersteller / Modell: VOLKSWAGEN VOLKSWAGEN Tiguan 2.0 TDI SCR 4MOTION
DSG R-Line

Datum	KM-Stand	Beschreibung
04.11.2025	121.189	Bremse Sonstiges; Bremsklötze vorne; Bremsscheiben + Klötze v; Bremsscheiben vorne; HU + AU
30.10.2025	121.189	Bremse Sonstiges; Bremsflüssigkeit; Bremsflüssigkeit ern; Bremsklötze hinten; Bremsscheiben + Klötze h; Bremsscheiben hinten; Getriebeöl ern/ prüfen; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Ölwechsel - Hinterachse; Regelwartungsdienst; Reparatur Sonstiges; Systemtest/Eigendiagnose; Wartung Sonstiges
14.08.2024	75.499	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
05.09.2023	34.537	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges