



Ford S-MAX:

Vinnumber:	WF0JXXWPCJMM03047	Versionname:	FORDS-MAX 2.0 TDCi 110kW S/S Connected 150PK 5d/p MAN6 (NABU)
First Registrationdate:	6/05/2021	Fiscalpower:	
Expertise Mileage:	103068	Power Kw:	110
Bodytype:		Body colour:	Grey
Gearbox:	MAN 6 VIT	Type of rims (mounted):	Aluminium
Transmission:		Parking lot:	3526
Fueltype:	Diesel		
Maintenance:	OK		
Type of rims (mounted):	Aluminium		
Certificate of Conformity:	Yes		
Category:	Passenger Car		
Registration Certificate Car (BE):	Yes		
Registration Certificate Home (BE):	No		

Options

Number of keys total:	2	Luggage cover:	
Cruise Control:		Front parking sensors:	
Steering wheel multifunctional:		Rear parking sensors:	
Seats F heated:		Type of Tow bar:	No Tow bar
Radio multimedia:			
Type of headlighting:	Headlighting Halogen		
Type of GPS:	GPS big screen color		
Type of Lining:	Lining fabrics		
Type of climate control:	Autom climate control		
Type of GPS storage:	HD		

Limited Technical Inspection

Tyres

	235/55/17/103 V			
Summer tyres:	Fr.L.	Vredestein: 6 mm	Fr.R.	Vredestein: 6 mm
	Re.L.	Michelin: 7 mm	Re.R.	Michelin: 7 mm
Tyre profile depth FL	6.0			
Tyre profile depth FR	6.0			
Tyre profile depth RL	7.0			
Tyre profile depth RR	7.0			
Tyre size FL	235/55 R 17 103 V			
Tyre size FR	235/55 R 17 103 V			
Tyre size RL	235/55 R 17 99 V			
Tyre size RR	235/55 R 17 99 V			
Tyre type FL	Summer			
Tyre type FR	Summer			
Tyre type RL	Summer			
Tyre type RR	Summer			
Tyre make FL	2480			
Tyre make FR	2480			
Tyre make RL	261			
Tyre make RR	261			

Assistance equipment

Repair kit:	Yes	Compressor:	Yes
Number of charging cables (normal):	0		
Number of charging cables (rapid charge):	0		

Total cost ex VAT:	809,12
Seat cover FL, Worn, Acceptable:	0,00



Backrest cover FL, Worn, Acceptable

0,00



Seat cover FR, Worn, Acceptable

0,00



Interior, Not original part, Check

0,00



Engine insulation, Tear, Replace

0,00



Bumper F, Dent(s) and scratch(es), Acceptable

0,00



Windscreen, Stone chip(s), Acceptable

0,00



Wing FL, Scratch(es), Acceptable

0,00



Door FL, Scratch(es), Acceptable

0,00



Door RL, Scratch(es), Acceptable	0,00
----------------------------------	------



Outer door handle RL, Scratch(es), Acceptable	0,00
---	------



Alloy rim RL, Scratch(es), Acceptable	0,00
---------------------------------------	------



Internal boot lining R, Scratch(es), Acceptable	0,00
---	------



Internal boot lining L, Scratch(es), Acceptable	0,00
---	------



Rear window, Scratch(es), Acceptable	0,00
--------------------------------------	------




Bumper R, Scratch(es), Acceptable	0,00
-----------------------------------	------



Door FR, Scratch(es), Acceptable	0,00
----------------------------------	------



Alloy rim FR, Scratch(es), Acceptable	0,00
---------------------------------------	------

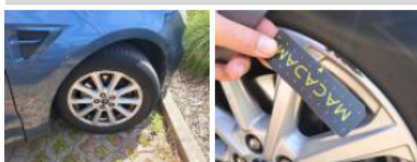

Roof, Chemical polution, Repair and paint (complete)	809,12
--	--------

