



OPEL ASTRA:

Vinnnumber:	W0VBD6ER4MG003154	Versionname:	1.2 Turbo 81kW S/S Edition
First Registratiedate:	18/01/2021	Fiscalpower:	
Expertise Mileage:	96055	Power Kw:	81
Bodytype:		Body colour:	Black
Gearbox:	Automatic	Type of rims (mounted):	Aluminium
Transmission:		Parking lot:	3208
Fueltype:	Petrol		
Type of rims (mounted):	Aluminium		
Certificate of Conformity:	Yes		
Category:	Passenger Car		
Registration Certificate Car (BE):	Yes		
Registration Certificate Home (BE):	No		

Options

Number of keys total:	2	Luggage cover:	
Cruise Control:		Rear parking sensors:	
Steering wheel multifunctional:		Type of Tow bar:	No Tow bar
Type of headlighting:	Headlighting LED		
Type of GPS:	GPS base		
Type of Lining:	Lining fabrics		
Type of climate control:	Manual climate control		

Limited Technical Inspection

Tyres

205/55/16/91 T				
Summer tyres:	Fr.L.	Continental: 3 mm	Fr.R.	Continental: 3 mm
	Re.L.	Continental: 3 mm	Re.R.	Continental: 3 mm
Tyre profile depth FL				3.0
Tyre profile depth FR				3.0
Tyre profile depth RL				3.0
Tyre profile depth RR				3.0
Tyre size FL				205/55 R 16 91 T
Tyre size FR				205/55 R 16 91 T
Tyre size RL				205/55 R 16 91 T
Tyre size RR				205/55 R 16 91 T
Tyre type FL				Summer
Tyre type FR				Summer
Tyre type RL				Summer
Tyre type RR				Summer
Tyre make FL				256
Tyre make FR				256
Tyre make RL				256
Tyre make RR				256

Assistance equipment

Repair kit:	Yes	Compressor:	Yes
Number of charging cables (normal):	0		
Number of charging cables (rapid charge):	0		


Total cost ex VAT:	655,91
Interior, Damaged, Acceptable:	0,00




Dashboard, Glue residues, Smart repair 116,69



Bumper F, Scratch(es), Acceptable 0,00

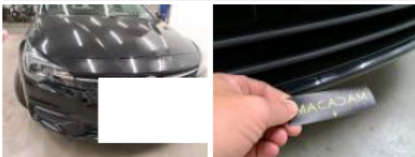

Bonnet, Chemical polution, Repair and paint (complete) 406,19

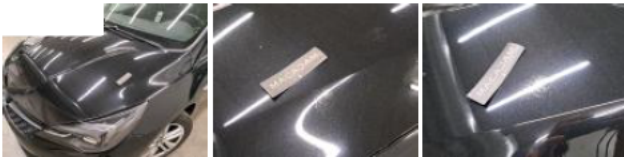

Alloy rim FL, Scratch(es), Acceptable 0,00



Wing FL, Dent(s), Acceptable 0,00



Wing RL, Dent(s) and scratch(es), Acceptable 0,00



Alloy rim RL, Scratch(es), Repair and paint (complete) 133,03



Door FL, Scratch(es), Acceptable

0,00



Bumper R, Scratch(es), Acceptable

0,00



Tailgate / Boot, Scratch(es), Acceptable

0,00



Bodywork, Not original part, Remove lettering

0,00



Roof, Chemical polution, Polish

0,00

