



Expertise

Protocol number: 46163697
Order No. / Reference: 26407639
Inspection date: 23 Jun 2026

Manufacturer: Mercedes-Benz
VIN: W1N1671541A770314

Model: GLE 350 e 4Matic 9G-TRONIC



Vehicle details	
Manufacturer / Type / Model / Equipment	
Mercedes-Benz GLE 350 e 4Matic 9G-TRONIC	
Vehicle Identification number	W1N1671541A770314
Mileage (Read)	65,227 km
First registration	15 Nov 2022
Number of holders	1
Next periodical technical inspection	10/2027
(Report on hand)	
Power / Engine displacement	155 kw / 1,991 ccm
Fuel type / Cylinder	Hybr.B/E ext.aufll / 4
Gearbox / Number of gears	Automatic / 9
Type of drive	All-wheel drive
Type of vehicle	SUV
Colour / colour code	CAVANSITBLAU - METALLICLACK
Doors / Seats	5 / 5
Upholstery type	Leather
Colour of upholstery	Beige



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	104 Tag(e)
Last service on / at	09/2025 at 55,106 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GM937577
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	2222 / AVV 00262		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	3,210 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	275/55 R19 111W	Summer tyres on Light alloy	Continental	6mm / 6mm
2)	275/55 R19 111W	Summer tyres on Light alloy	Continental	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	275/50 R20 113V	Winter tyres on Light alloy	Continental	3mm / 3mm
2)	275/50 R20 113V	Winter tyres on Light alloy	Continental	5mm / 5mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 06/2027		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Exhaust system with 2 chrome-plated tailpipe trims
- Adaptive Highbeam Assist
- Airbag: Driver and passenger side
- Airbag: Sidebag for driver and front passenger (combined thorax/pelvisbag)
- Active Lane Keeping Assist
- 4MATIC permanent all-wheel drive
- Anti-lock braking system
- Foldable armrest for driver and front passenger
- ATTENTION ASSIST
- Electrically adjustable and heated exterior mirrors
- Roof rails in aluminum look
- Tachometer
- EASY-Pack tailgate with electric operation for opening and closing
- Front door sills with "Mercedes-Benz" lettering illuminated in white
- Chassis with steel springs and lowered suspension
- electric parking brake
- Speed Limit Assistant
- Lockable, air-conditioned and illuminated glove compartment
- Interior headliner fabric crystal grey
- Mechanical child safety lock in the rear doors
- Communication module (LTE) for the use of Mercedes me connect services
- Charging cable for household socket, 5m, smooth
- Charging system: AC on-board charger 7.4 kW
- LED High Performance Headlights
- Steering column mechanically adjustable lengthwise and heightwise.
- Navigation accessories: Extended MBUX functions
- Navigation: Hard disk navigation
- Otto particulate filter
- Package: Parking package with reversing camera
- Package: Mirror Package
- PRE-SAFE system
- Radio accessories: Additional USB ports
- Remote Services Plus
- Windscreen wipers with rain sensor
- 3-point seat belts
- Seats: Comfort seats
- Seats: Rear seat backrests foldable
- Phone accessories: Smartphone integration
- High-visibility vest for drivers
- Widescreen Cockpit
- Central locking with interior switch
- ADAPTIVE BRAKE
- Adaptive brake light
- Airbag: Kneebag for driver
- Airbag: Windowbags
- Active Brake Assist
- Acoustic environmental protection
- Ambient lighting
- Traction control (ASR)
- Rear armrest
- Automatic passenger airbag deactivation
- Brake Assist BAS
- Downhill Speed Regulation (DSR)
- Third brake light
- EASY-Pack cargo cover (removable)
- ECO start/stop function
- Electronic Stability Program
- Electronic traction system for all-wheel drive (4ETS)
- Electric windows, front and rear
- Velour floor mats
- Transmission: 9G-TRONIC
- Rear window heated
- Rear window wiper with intermittent function
- KEYLESS-GO start function
- Climate: THERMATIC automatic climate control
- Headrests 5-way
- Radiator grille with 2 chrome-plated louvers in SUV design
- Charging cable for wallboxes and public charging stations, 5m, smooth
- Steering wheel: Multifunction sports steering wheel in Nappa leather
- Mercedes-Benz emergency call system
- Navigation accessories: Pre-installation for navigation services
- Package: Chrome
- Package: Public Charging
- Upholstery: ARTICO black leatherette
- Radio accessories: Digital radio (DAB)
- Tire pressure monitoring system (TPMS)
- Wheels: 48.3 cm (19") alloy wheels, 4-spoke design
- Power steering
- Seats: 4-way lumbar support for driver and front passenger
- Seats: Heated seats for driver and front passenger seats
- Seats: Front seats electrically adjustable
- Cruise control with variable speed limiter
- Immobiliser
- Heat-insulating glass, all around
- Decorative elements: Brushed aluminum with light longitudinal grain



Extra equipment

- 230V power outlet in the rear
- Charging cable for household socket, 8m, smooth (This charging cable, also called Mode 2 cable, allows you to charge the vehicle battery at the household socket with up to 1.8 kW (230 V, 1-phase, 8A) and fits sockets of type E/F CEE 7/7.)
- Charging system: DC on-board charger (DC charging)
- Heated windshield washer system (including washer fluid reservoir, washer nozzles and washer fluid hoses)
- Package: AIRMATIC package (air suspension system with adaptive damping system ADS+ - automatic level control, depending on - payload: load detection for a constant chassis level - driving speed: lowering for higher driving speeds - DYNAMIC SELECT driving program: lowering in the "Sport"/"Sport plus" program or raising in the "Offroad"/"Offroad plus" program - demand-based level control: - rear lowering for loading and unloading - individual selection of the chassis level)
- Paint finish: Metallic
- Roof rack (Expand your transport options. You can combine the base carrier with a variety of Mercedes-Benz roof accessories – such as roof boxes, bicycle carriers or ski racks. It is precisely matched to the body and offers the best possible safety and aerodynamics.)
- Seats: Heated rear seats
- Steering wheel: Steering wheel heating
- Sunroof: Panoramic sunroof (large glass module made of heat-insulating, tinted safety glass - mesh wind deflector in the front area - electric sunshade with one-touch operation - comprehensive protection concept: - anti-pinch protection - automatic rain closing - PRE-SAFE closing function (only in conjunction with PRE-SAFE system))
- Telephone: Multifunctional telephony (wireless connection of a compatible mobile phone to the external antenna - wireless charging for compatible mobile phones - Bluetooth and WLAN pairing wirelessly via NFC (Near Field Communication) technology)
- Tempered cupholders for driver and front passenger (Cool or warm drinks always within easy reach – this is the comfort drivers and front passengers enjoy with the tempered cupholders. Bottles, cans and cups up to 0.5 l are securely held in the center console. The temperature is maintained between 8° and 55° C, depending on preference.)
- TIREFIT with tire inflation compressor
- Airbag: Sidebags in the rear, left and right
- Charging cable for wallbox and public charging stations, 8m, smooth (This charging cable, also called Mode 3 cable, allows you to charge the vehicle battery at the wallbox or at public charging stations with up to 11 kW (Type 2, 3-phase, 16 A).)
- Climate: THERMOTRONIC automatic climate control (4-zone automatic climate control: enables individually adjustable climate control for the driver and front passenger sides as well as for the left and right sides in the rear - Sensors for detecting, e.g., interior/ exterior temperature, solar radiation, humidity and for checking air quality - Fine dust activated carbon filter for filtering dust, soot and pollen as well as for reducing pollutants and odors - Residual heat function for efficient use of engine waste heat (activated via residual heat button))
- Decorative elements: open-pored brown walnut wood
- Heat-insulating dark tinted glass
- Interior headliner fabric macchiato beige
- Package: Driving Assistance Package (Active Distance Assist DISTRONIC - Active Steering Assist - Active Brake Assist - Evasive Steering Assist - Active Lane Keeping Assist - Active Blind Spot Assist - PRE-SAFE PLUS)
- Package: Parking Package with 360° camera (12 sensors: four front, four rear, two on the sides in the front/rear bumper; detects parking spaces up to 35 km/h; steering control; in conjunction with automatic transmission, assists with acceleration, braking, and gear changes; 360° camera; visual/audible warning of detected obstacles in front of/ behind the vehicle up to approx. 10 km/h; Rear Cross Traffic Alert warns of detected cross traffic; Drive Away Assist (only in conjunction with automatic transmission); button on the center console or on the control panel for the assistance systems)
- Seats: Electrically adjustable rear seats (separate longitudinal adjustment for the two outer seats, backrest tilt adjustment, height adjustment of the outer headrests, load floor function: via longitudinal and backrest tilt adjustment, backrest split 40/20/40, 3-point safety belt with retractor tensioner and belt force limiter for the outer seats, 3-point seat belt system for the middle rear passenger seat, folding center armrest with two cupholders, optional child seat attachment: i-Size and Top Tether)
- Towbar with ESP trailer stabilization



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Boot lid / rear door	Boot lid - dent(s) - Smooth repair work
2	Door - rear left side	Door edge - Scratch(es) - Smart repair
3	Door - front left side	Door edge - Scratch(es) - Smart repair
4	Bonnet	Insulation lining - Damage caused by marten / rodent - Replace
5	Front bumper	Spoiler - Scratched - Replace
6	Rear bumper	Rear bumper - Scratched - Repair and paint
7	Front bumper	Front bumper - Dent / paintcoat damage - Repair and paint

Wear and tear

No.	Component group	Description
1	Side panel - rear right side	Side panel - Scratch(es) - No deduction
2	Door - rear right side	Door - Scratch(es) - No deduction
3	Side panel - rear left side	Side panel - Scratch(es) - No deduction
4	Bonnet	Bonnet - Stone chips - No deduction
5	Vehicle glazing	Windscreen - Stone chips - No deduction
6	Side panel - rear right side	Wheel well extension - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

Equipment - Roof rack system

Equipment - charging cable (2er satz)

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

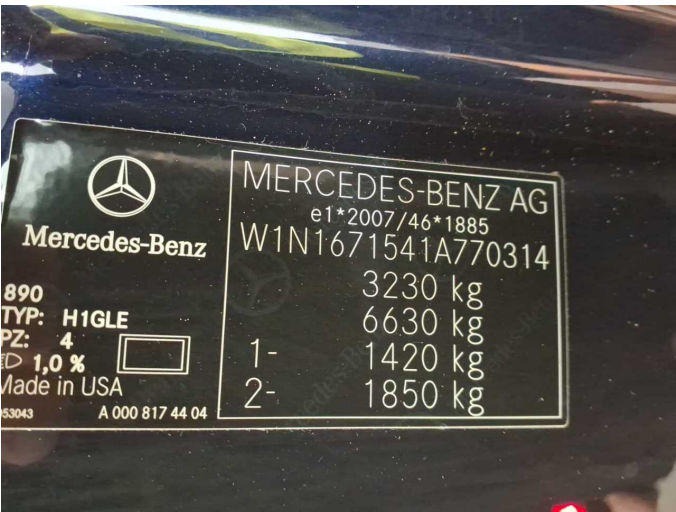


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

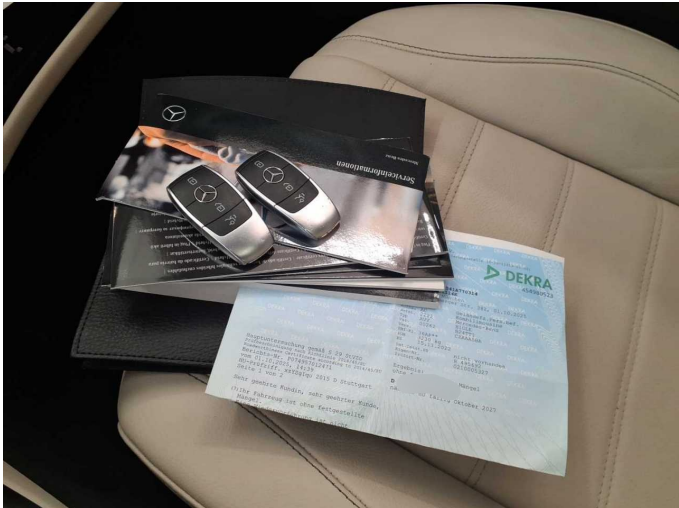


Figure 14: Documents



Figure 15: Additional tyres



Figure 16: Navigation



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.

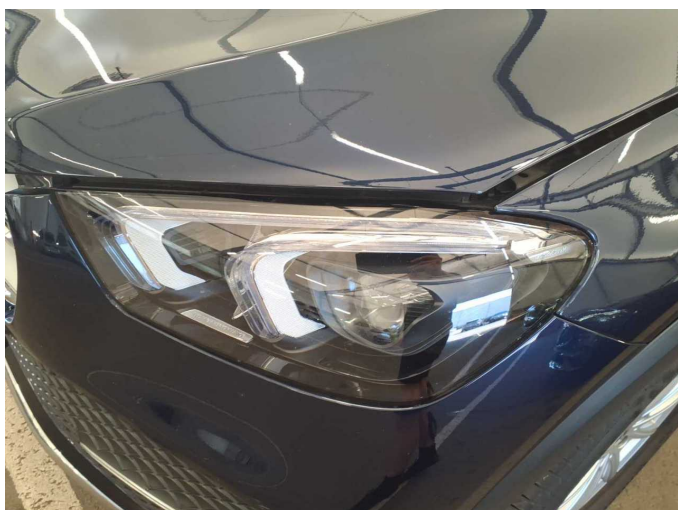


Figure 21: Misc.

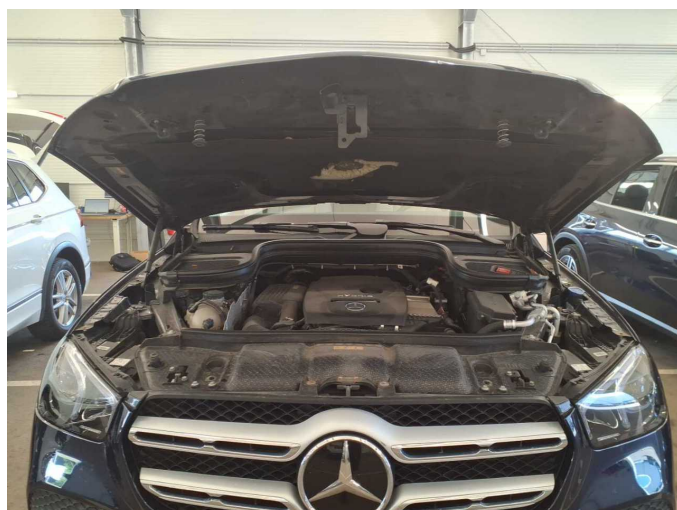


Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.




Figure 27: Misc.



Figure 28: Misc.




Damage 1: Boot lid / rear door: Boot lid - dent(s) - Smooth repair work

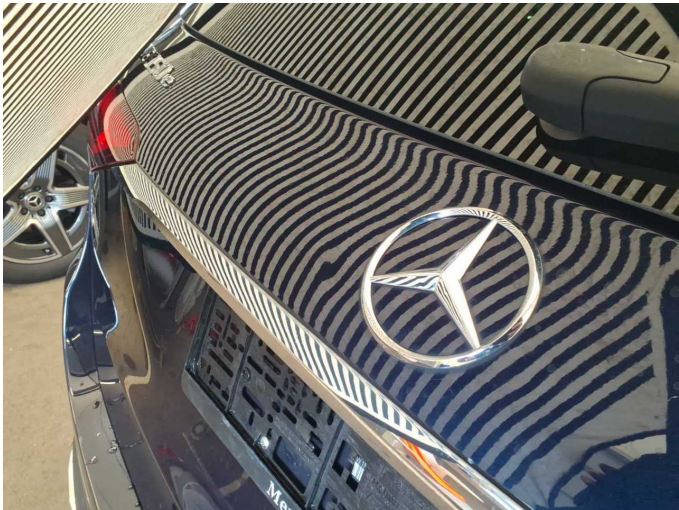


Damage 1: Boot lid / rear door: Boot lid - dent(s) - Smooth repair work



Damage 2: Door - rear left side: Door edge - Scratch(es) - Smart repair

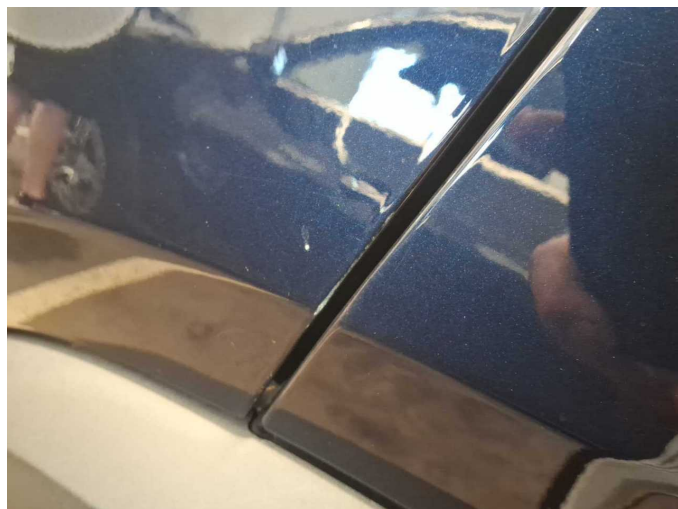


Damage 2: Door - rear left side: Door edge - Scratch(es) - Smart repair

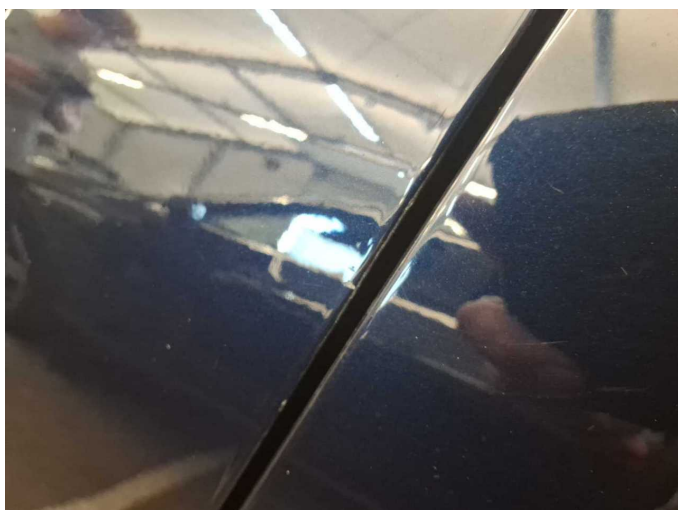


Damage 2: Door - rear left side: Door edge - Scratch(es) - Smart repair



Damage 3: Door - front left side: Door edge - Scratch(es) - Smart repair

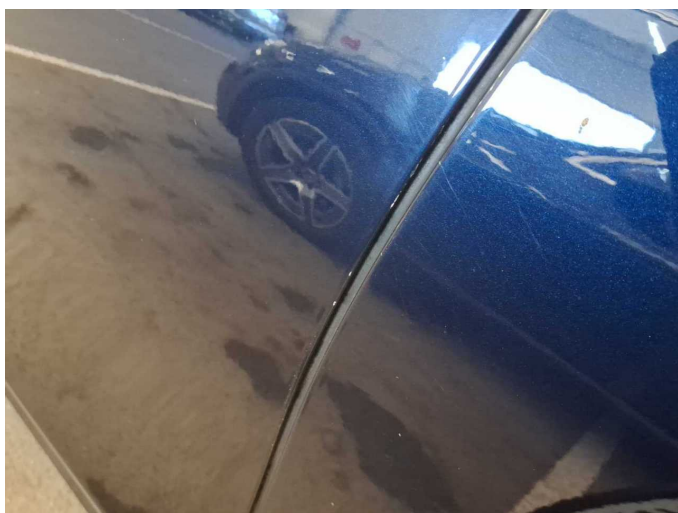

Damage 3: Door - front left side: Door edge - Scratch(es) - Smart repair

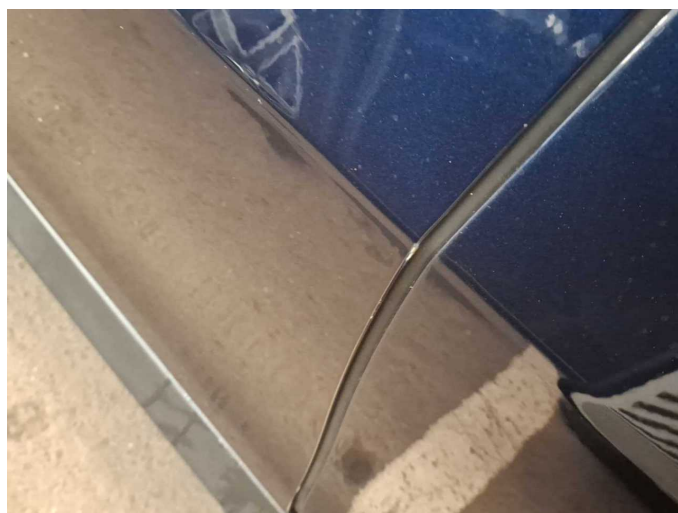


Damage 3: Door - front left side: Door edge - Scratch(es) - Smart repair




Damage 4: Bonnet: Insulation lining - Damage caused by marten / rodent - Replace




Damage 4: Bonnet: Insulation lining - Damage caused by marten / rodent - Replace

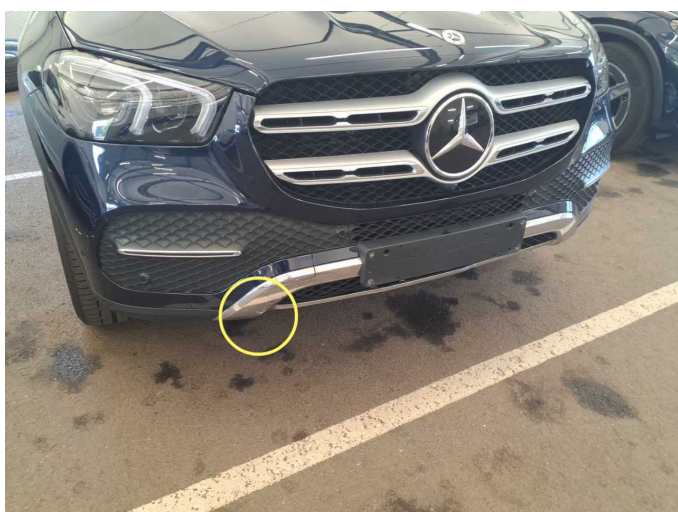


Damage 5: Front bumper: Spoiler - Scratched - Replace

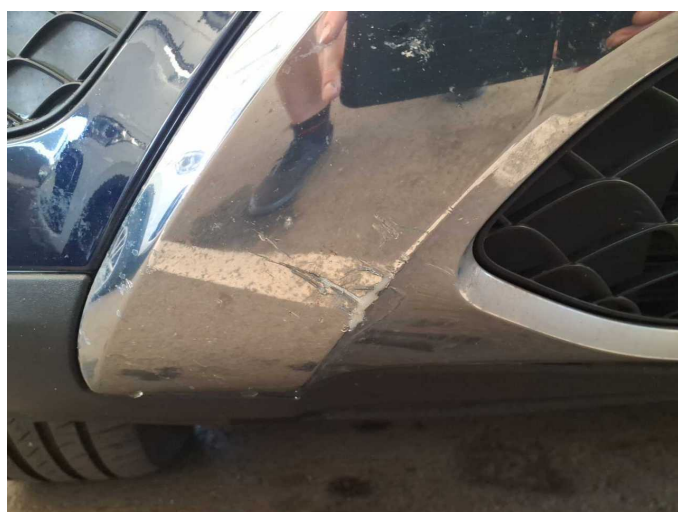


Damage 5: Front bumper: Spoiler - Scratched - Replace

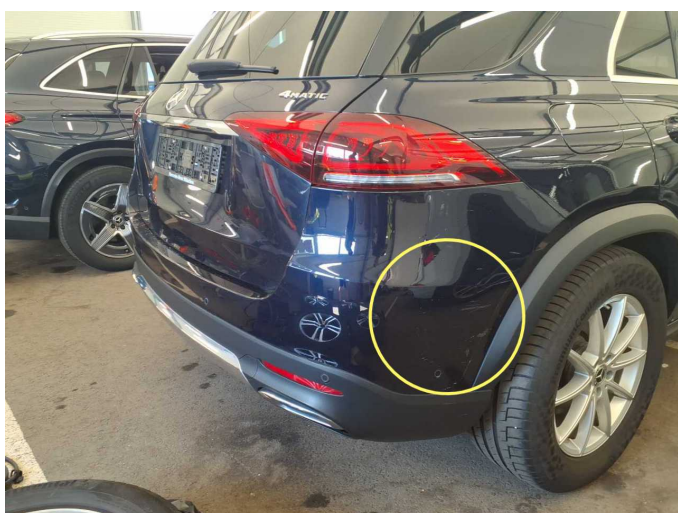


Damage 6: Rear bumper: Rear bumper - Scratched - Repair and paint

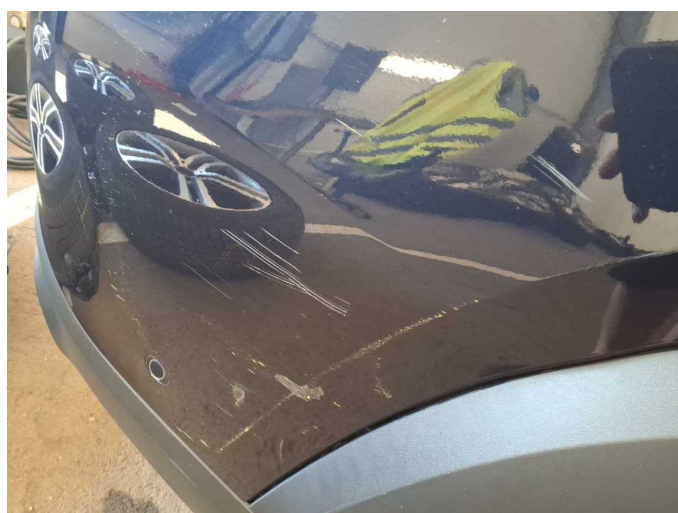


Damage 6: Rear bumper: Rear bumper - Scratched - Repair and paint

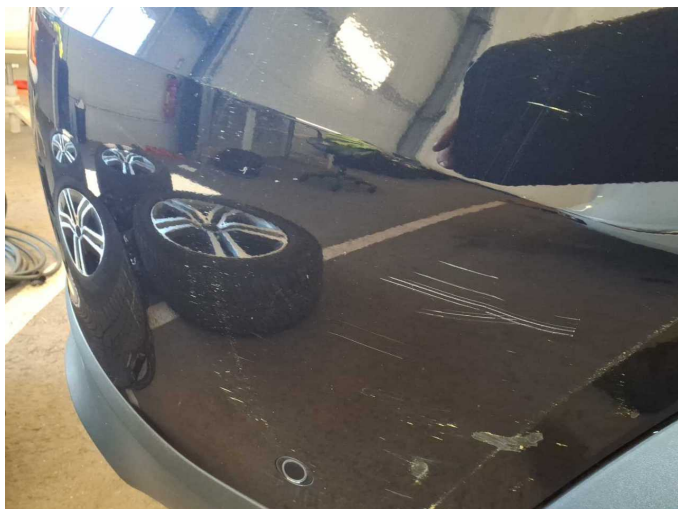


Damage 6: Rear bumper: Rear bumper - Scratched - Repair and paint

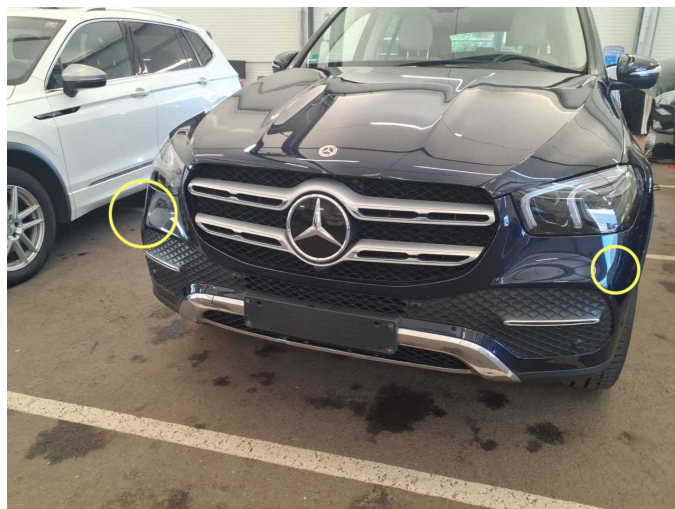

Damage 7: Front bumper: Front bumper - Dent / paintcoat damage - Repair and paint

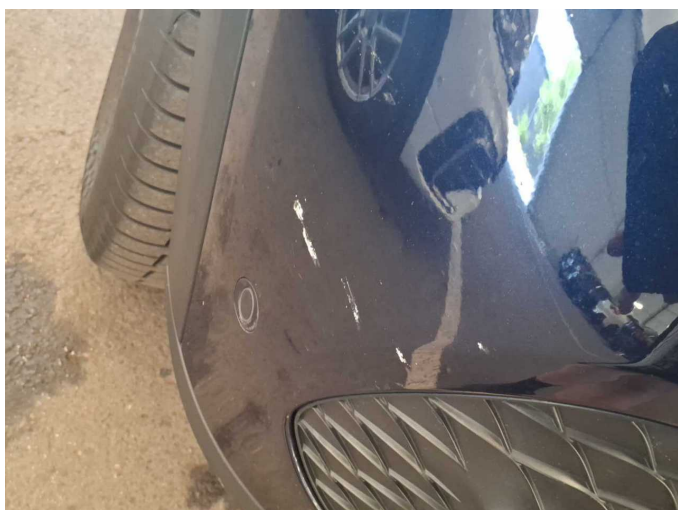

Damage 7: Front bumper: Front bumper - Dent / paintcoat damage - Repair and paint

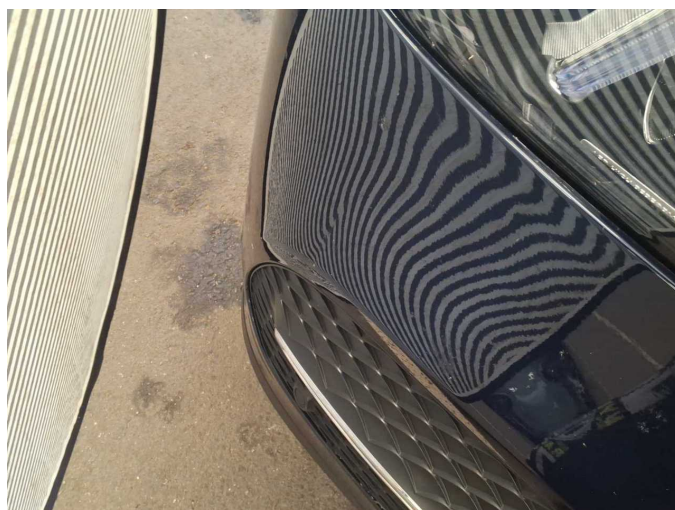

Damage 7: Front bumper: Front bumper - Dent / paintcoat damage - Repair and paint



Damage 7: Front bumper: Front bumper - Dent / paintcoat damage - Repair and paint



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W1N1671541A770314

Hersteller / Modell: MERCEDES-BENZ MERCEDES-BENZ GLE 350 e 4Matic 9G-TRONIC

Datum	KM-Stand	Beschreibung
01.10.2025	55.106	HU + AU
05.09.2025	55.106	Regelwartungsdienst
15.04.2024	28.457	Regelwartungsdienst