



Expertise

Protocol number: 46230075
Order No. / Reference: 26584151
Inspection date: 26 Jun 2026

Manufacturer: Volkswagen

Model: Golf Variant 2.0 TSI OPF DSG R-Line

VIN: WVGZZCD3PW507451



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volkswagen Golf Variant 2.0 TSI OPF DSG R-Line	
Vehicle Identification number	WVGZZCD3PW507451
Mileage (Read)	84,819 km
First registration	10 Nov 2022
Number of holders	1
Next periodical technical inspection	03/2028
(Report not on hand)	
Power / Engine displacement	140 kw / 1,984 ccm
Fuel type / Cylinder	Petrol / 4
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Deep Black Perleffekt
Doors / Seats	5 / 5
Upholstery type	Cloth / leather combination
Colour of upholstery	Grey-Black
Re-import	no
readiness to drive	Roadworthy



Vehicle details			
Maintenance booklet / proof	digital proof / complete	Next maintenance in	28,100 km
Last service on / at	03/2026 at 82,834 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GM779359
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
readiness to drive	Roadworthy		
Manufacturer key number/ type code number	0603 / COV 00267		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,020 kg	Empty weight	

Tyres				
Mounted tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/50 R17 93H	Winter tyres on Light alloy	Pirelli	5mm / 5mm
2)	205/50 R17 93H	Winter tyres on Light alloy	Bridgestone	5mm / 5mm
Additional tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/40 R18 92Y	Summer tyres on Light alloy	Bridgestone	5mm / 4mm
2)	225/40 R18 92Y	Summer tyres on Light alloy	Bridgestone	5mm / 6mm
Replacement				
Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 06/2026		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- Airbag for driver and front passenger (with passenger airbag deactivation)
- Ambient lighting 30-color (LED light in the front footwell, light color selectable)
- Electrically adjustable and heated exterior mirrors with memory function and passenger-side mirror lowering function.
- Car2X (Using the WLANp ITS G5 standard, all Car2X-enabled vehicles and traffic systems such as traffic lights can transmit data at high speed without using the mobile network. This works over a distance of around 800 meters - enough to warn of an invisible traffic jam.)
- Parking aid (acoustic warning signals for obstacles in the front and rear area)
- Electronic stability program and electromechanical brake booster (Anti-lock braking system with brake assist - Electronic brake force distribution - Traction control - Electronic differential lock - Engine drag torque control - Trailer stabilization)
- Chassis: Sport chassis
- Electric windows, front and rear
- Windscreen made of laminated safety glass, heat and sound insulating
- Luggage compartment cover
- Transmission: 7-speed DSG (7-speed dual-clutch transmission DSG)
- Rear spoiler in car color
- "Climatronic" air conditioning system (with active combination filter)
- Front headrests (safety-optimized)
- LED taillights
- Steering wheel: Multifunction sports steering wheel in leather, with touch controls and paddle shifters
- Non-smoking version (storage compartment and 12V socket at the front)
- Emergency braking assistant "Front Assist" with pedestrian and cyclist detection (detects critical distance situations to other vehicles and helps to shorten the stopping distance - warns the driver visually and audibly in dangerous situations as well as with a preventive braking jolt with pedestrian and cyclist detection - also reacts to pedestrians and cyclists)
- Brushed stainless steel pedals
- Progressive steering (the steering ratio is progressively increased with increasing steering angle - the steering behavior becomes noticeably more direct depending on the driving situation, the steering wheel movements are significantly reduced and thus steering comfort is increased)
- Tire pressure monitoring system (passive)
- Wheels: Tire Mobility Set (12-volt compressor and tire sealant)
- Keyless start system without safe locking
- Seat belts: Three-point automatic seat belts for the outer rear seats
- Seat covers in "R-Line" fabric (center panels of the front seats and outer rear seats in "R-Line" fabric, inner side panels in "ArtVelours")
- Lane keeping assistant "Lane Assist"
- Airbag, head airbag system for front and rear passengers (including front side airbags)
- App-Connect (selected apps for Android smartphones and Apple iPhones can be displayed and operated on the touchscreen of the radio or navigation system)
- Exterior mirror housings and door handles in body color
- Third brake light
- Black roof rails
- Decorative inlays "Carbon Grey" (for instrument panel and front door panels)
- Digital Cockpit Pro, multicolor (various info profiles selectable)
- Electronic differential lock XDS
- Electronic parking brake including auto-hold function
- Automatic headlight control, with LED daytime running lights (as well as welcome and farewell lights)
- Driving profile selection (possibility to set different vehicle settings: Comfort, Normal, Sport, Eco, Individual - adaptable vehicle systems include: engine, adaptive chassis control DCC, DSG, steering, start-stop system, cornering lights and "Dynamic Light Assist", automatic distance control ACC, air conditioning)
- Pedestrian protection measures expanded
- Speed limiter (in conjunction with online services)
- Rear window heated
- Rear window wiper with intermittent function
- ISOFIX mounting points (for child seats on the outer rear seats and on the front passenger seat, i-Size compatible)
- Rear headrests (3)
- LED reading lights at the front (2) and 2 at the rear
- LED headlights
- Dynamic headlight range control
- Fatigue detection (detects signs of possible driver fatigue based on characteristic steering behavior, time of day and driving duration and issues a visual and audible warning)
- Emergency call service (no registration required, service is activated upon delivery)
- Otto particulate filter
- Package: Seating comfort package (2 USB-C ports in the front, 2 USB-C charging ports on the rear center console; charging power up to 45 W - front center armrest adjustable in height and length - front seats with height adjustment)
- Radio "Composition" (touchscreen with 21 cm screen diagonal - 4+1 speakers - output power 4 x 20 watts - FM radio reception - dual tuner with phase diversity for the best possible radio reception - Radio Data System (RDS) - MP3 playback - USB-C interface with Apple compatibility - DAB+ digital radio reception - telephone interface (hands-free system, Bluetooth audio))
- Rear bench seat undivided, backrest asymmetrically split and foldable with center armrest
- Seat belts: Three-point automatic seat belt for the middle rear seat



- 12-volt power outlet in the luggage compartment
- Telephone interface with inductive charging function
- Ambient lighting with logo projection
- Green thermal insulation glazing, sides and rear

- Seat belts: Three-point automatic seat belts at the front with height adjustment and belt tensioner
- Seats: Lumbar support in the front
- Seats: Top sports seats in the front (height adjustable)
- Start-stop system (with brake energy recuperation)
- Bumpers in body color
- Textile floor mats front and rear
- Electronic immobilizer
- Central locking without safe locking, with remote control and 2 remote folding keys

Extra equipment

- Towbar, foldable with electric release
- Paint finish: Pearl effect
- LED Plus headlights (LED headlights for low and high beam - dynamic headlight range control - bad weather light and cornering light)
- Mesh partition
- Package: Design package "Black Style" (Exterior mirror housings in black - Roof rails in black - Illuminated strip between headlights and door handle recesses - With individual installation)
- Package: Winter "Premium" (DSG) (R-Line) (Air Care Climatronic air conditioning with active combination filter, rear controls and 3-zone temperature control - multifunction leather sports steering wheel, heated, with touch controls and shift paddles - automatically heated front windshield washer nozzles - auxiliary heating and ventilation with remote control and timer - heated front seats and outer rear seats)
- Wheels: Winter wheels (additional), alloy, "Nottingham" 6.5 J x 17 (4 alloy wheels 6.5 J x 17 - wheel wrench and jack - winter tires 205/50 R 17 H)
- Rear side windows and rear window tinted
- "Comfort" telephone interface with inductive charging function (hands-free system)
- Adaptive Cruise Control ACC "stop & go" (Adaptive Cruise Control ACC incl. speed limiter - Emergency braking assistant "Front Assist" with pedestrian and cyclist detection)
- Navigation system "Discover Media" incl. "Streaming & Internet" (6+1 speakers - App-Connect incl. App-Connect Wireless for Apple CarPlay and Android Auto - Multifunction camera - Navigation system "Discover Media" incl. "Streaming & Internet" - Radio - Traffic sign recognition)
- Package: Technology package (anti-theft alarm system with interior monitoring, backup horn and tow-away protection - "Park Assist" parking assistant including parking aid - "Keyless Access" keyless locking and starting system with safe locking - side airbags for the outer rear seats, including front side airbags and head airbag system)
- Smoker's version (ashtray in front - cigarette lighter in front)
- Wheels: Alloy wheels (4) "Bergamo" 7.5 J x 18 (in black, polished surface - with individual installation - wheel locks with enhanced theft protection - tires 225/40 R 18)
- Rear View reversing camera
- Voice control

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was roadworthy at the time of inspection.



Value reducing factors

No.	Component group	Description
1	Equipment	Tirefit filler - Expired - Replace
2	2nd wheel set	1 alloy rim - Scratch(es) - Loss in value
3	Door - rear right side	Door - Scratch(es) - Smart repair
4	Side panel - rear right side	Sill - Scratch(es) - Smart repair
5	Side panel - rear left side	Sill - Scratch(es) - Smart repair
6	Door - front left side	Door - Scratch(es) - Smart repair
7	Rear bumper	Rear bumper - Scratch(es) - Paint
8	Roof	Roof - Scratch(es) - Paint

Wear and tear

No.	Component group	Description
1	Trim / covers	Boot lid - interior trim - Scratch(es) - No deduction
2	Boot lid / rear door	Boot lid - Dent / paintcoat damage - No deduction
3	Vehicle glazing	Windscreen - Stone chips - No deduction
4	Bonnet	Bonnet - Stone chips - No deduction
5	Side panel - rear right side	Side panel - Dent / paintcoat damage - No deduction
6	Door - front left side	Door edge - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

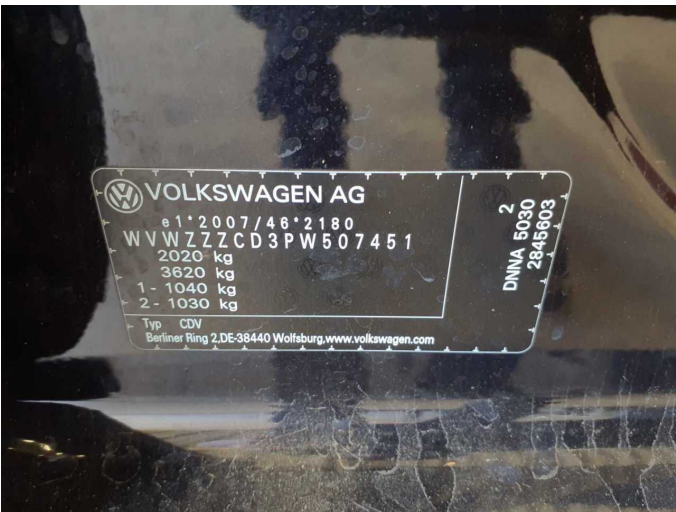


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Additional tyres

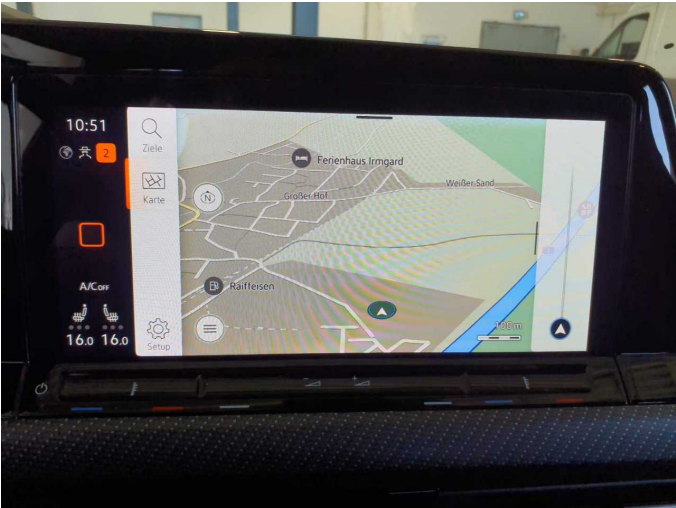


Figure 15: Navigation



Figure 16: Misc.

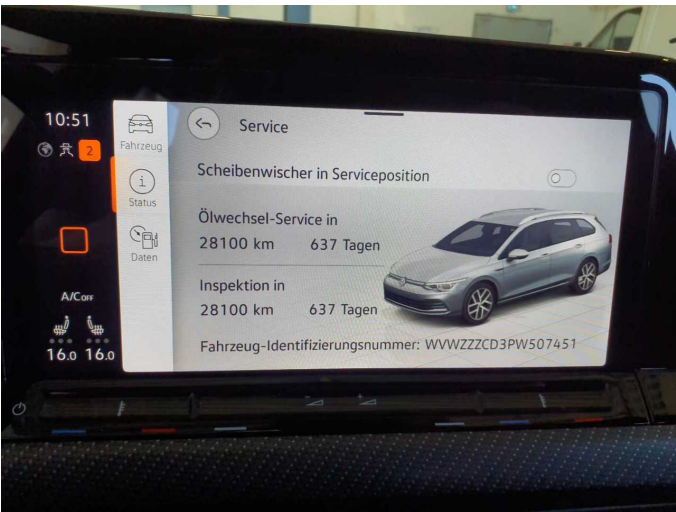


Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.

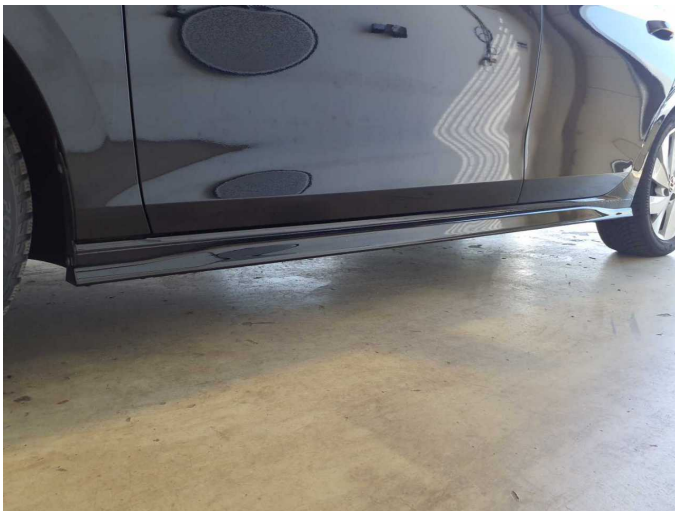


Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Damage 1: Equipment: Tirefit filler - Expired - Replace



Damage 2: 2nd wheel set: 1 alloy rim - Scratch(es) - Loss in value




Damage 2: 2nd wheel set: 1 alloy rim - Scratch(es) - Loss in value




Damage 2: 2nd wheel set: 1 alloy rim - Scratch(es) - Loss in value



Damage 3: Door - rear right side: Door - Scratch(es) - Smart repair

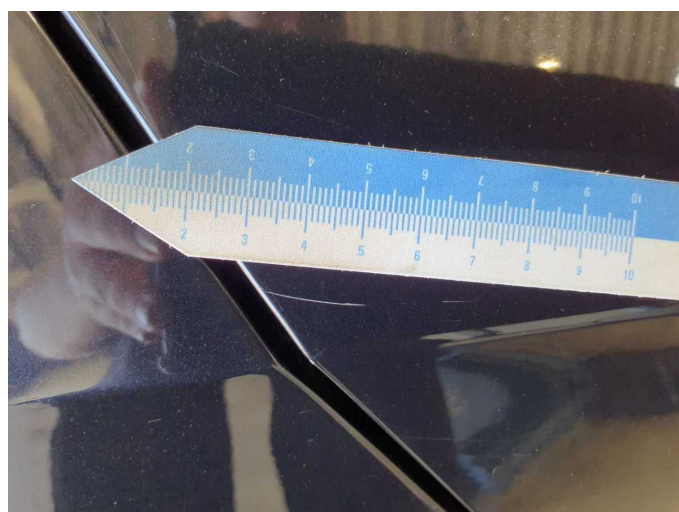


Damage 3: Door - rear right side: Door - Scratch(es) - Smart repair

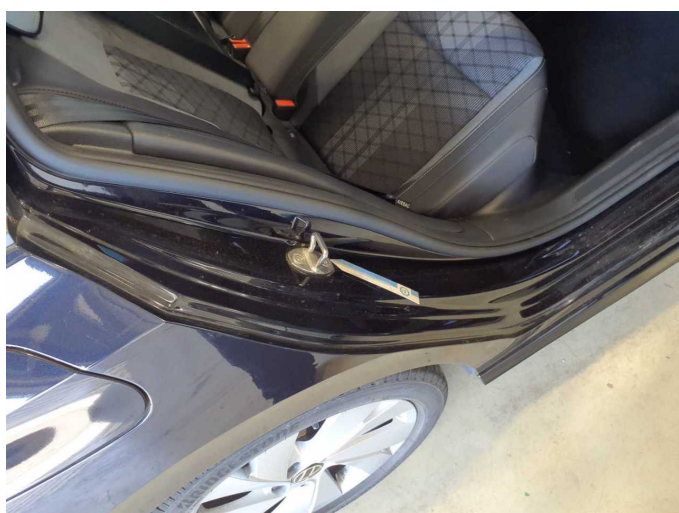

Damage 4: Side panel - rear right side: Sill - Scratch(es) - Smart repair



Damage 4: Side panel - rear right side: Sill - Scratch(es) - Smart repair

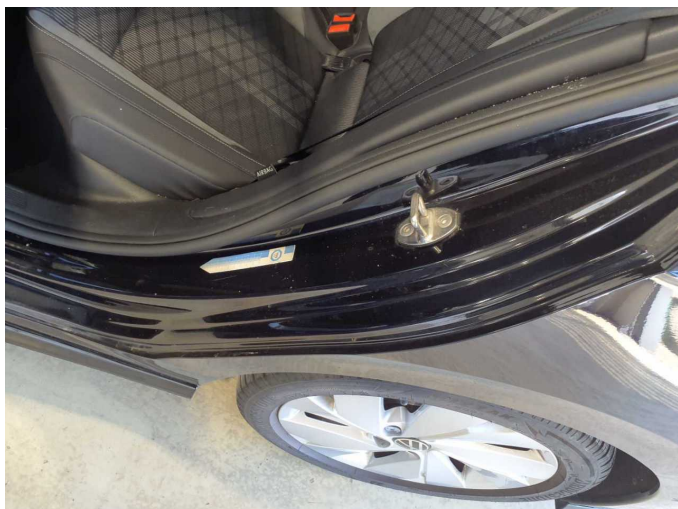

Damage 5: Side panel - rear left side: Sill - Scratch(es) - Smart repair




Damage 5: Side panel - rear left side: Sill - Scratch(es) - Smart repair



Damage 6: Door - front left side: Door - Scratch(es) - Smart repair



Damage 6: Door - front left side: Door - Scratch(es) - Smart repair

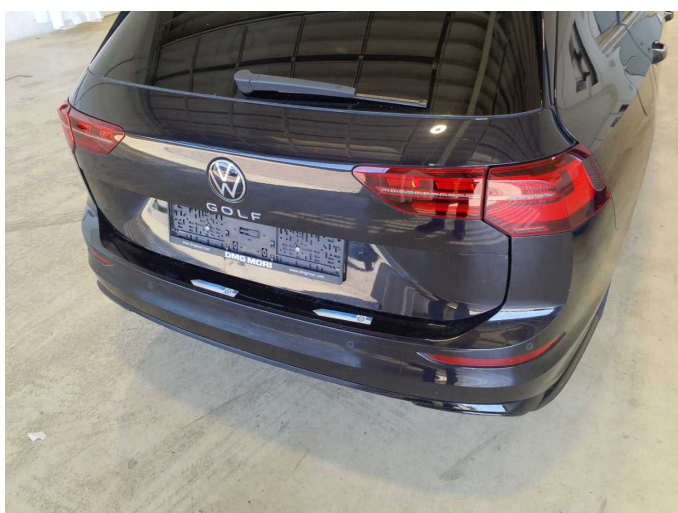

Damage 7: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 7: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 7: Rear bumper: Rear bumper - Scratch(es) - Paint




Damage 7: Rear bumper: Rear bumper - Scratch(es) - Paint




Damage 7: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 8: Roof: Roof - Scratch(es) - Paint

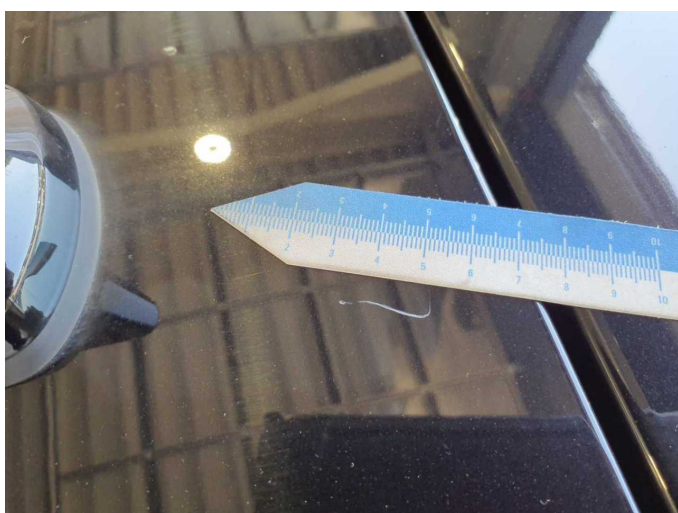

Damage 8: Roof: Roof - Scratch(es) - Paint

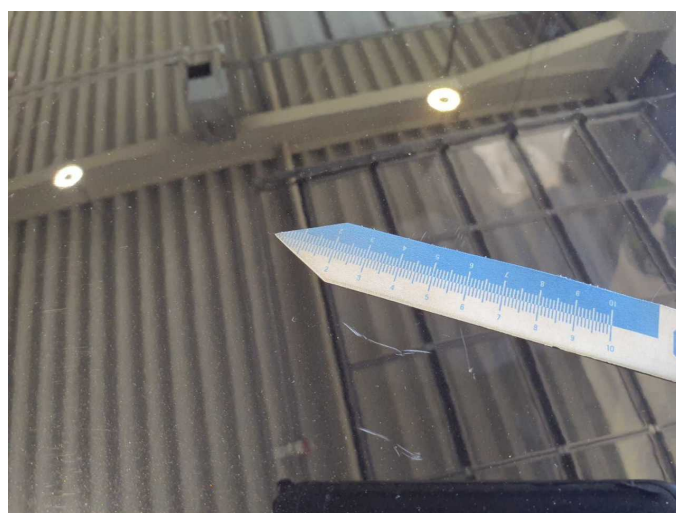

Damage 8: Roof: Roof - Scratch(es) - Paint