



Expertise

Protocol number: 46899689
Order No. / Reference: 26611649
Inspection date: 10 Jul 2026

Manufacturer: Peugeot

Model: 3008 BlueHDi 130 Stop & Start EAT8 Allure Pack

VIN: VF3MCYHZUMS075544



Vehicle details	
Manufacturer / Type / Model / Equipment	
Peugeot 3008 BlueHDi 130 Stop & Start EAT8 Allure Pack	
Vehicle Identification number	VF3MCYHZUMS075544
Mileage (Read)	168,661 km
First registration	23 Mar 2021
Number of holders	1
Next periodical technical inspection	01/2028
(Report not on hand)	
Fuel type	Diesel
Engine displacement / Cylinder	1,499 ccm / 4
Power	96 kW
Gearbox / Number of gears	Automatic / 8
Type of drive	Front drive
Type of vehicle	SUV
Colour / colour code	Platinum Grau Metallic
Doors / Seats	5 / 5
Upholstery type	Cloth / leather combination
Colour of upholstery	Black-Grey
Re-import	no
Vehicle with smoke odor	no
readiness to drive	Roadworthy



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	7 Monat(e)
Last service on / at	01/2026 at 156,913 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	FX935309
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
readiness to drive	Roadworthy		
Manufacturer key number/ type code number	3003 / AZI 00150		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,000 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/55 R18 102Y	Summer tyres on Light alloy	Pirelli	3mm / 3mm
2)	225/55 R18 102Y	Summer tyres on Light alloy	Pirelli	3mm / 3mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/65 R17 99H	Winter tyres on Light alloy	Pirelli	4mm / 4mm
2)	215/65 R17 99H	Winter tyres on Light alloy	Pirelli	4mm / 4mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 06/2025		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- ABS (Anti-lock Braking System)
- Airbags (6) (Driver and front passenger airbag - front passenger airbag deactivatable - front and rear side airbags - front and rear curtain airbags)
- Exterior mirror caps painted in car color
- Hill start assist
- On-board computer (outside temperature and maintenance display - average and current fuel consumption - remaining range - distance traveled - average speed)
- "Brumeo" fabric decorative inserts for door panels and dashboard
- Digital instrument cluster with high-resolution 12.3" screen, adjustable and customizable
- Front parking aid, acoustic and visual (including parking space assistant)
- Driving mode selector (Normal, ECO and Sport) ((Sport from GT level); (in conjunction with EAT8) or ECO button (in conjunction with manual transmission))
- Electric front windows (with comfort operation and anti-pinch protection)
- Follow-me-home function (automatic)
- Front bumper in chrome look
- Transmission: 8-speed automatic transmission EAT8
- Seat belts: 3-point seat belts (Front seats: - Height-adjustable three-point seat belts with belt locks - Pyrotechnic belt tensioners and electronically controlled belt force limiters - Warning light and warning signal when the seat belt is not fastened or is released for driver and front passenger Rear seats: - 3 three-point seat belts - 3 three-point Isofix child seat anchors in the 2nd row - Belt force limiters on the side seats - Warning light and warning signal when the seat belt is released)
- Automatic climate control (2-zone), with activated carbon filter (separately adjustable for driver and front passenger)
- LED ambient lighting in the front footwell
- LED ceiling light and LED reading lamps (LED ceiling light front and back - 2 LED reading lamps front and back)
- LED daytime running lights and LED turn signals at the front
- Makeup mirror (illuminated for driver and front passenger)
- Front center armrest, two-piece, with storage compartment, illuminated and climate-controlled
- Fog light
- Emergency brake assist with automatic activation of the hazard warning lights
- Particulate filter: FAP diesel particulate filter
- Peugeot Connect Box (with the free telematics services Peugeot Connect SOS and Peugeot Connect Assistance - GPS module - Integrated European SIM card - Speaker and microphone - Emergency battery)
- Radio accessories: Digital radio reception DAB+
- Active Safety Brake and Front Collision Warning
- Active Blind Spot Assist
- Electrically folding exterior mirrors (with approach lighting)
- Electrically adjustable and heated exterior mirrors with integrated LED turn signals
- Turn signals with lane change indicator function
- third brake light
- Chrome trim strips on the lower part of the doors
- Chrome trim strips above the side windows
- Aluminum roof rails
- Decorative trim on the dashboard and door panels in satin chrome
- EBV (Electronic Brakeforce Distribution)
- Rear parking aid, acoustic and visual
- ESP (Electronic Stability Program) with ASR (Anti-Slip Regulation)
- Misfueling protection
- Electric rear windows (with comfort operation and anti-pinch protection)
- High beam assist
- electric parking brake
- Front collision warning
- Cruise control system with speed limiter
- Cup holder in the center console
- Heated rear window
- rear window wiper
- Interior mirror automatically dimming
- ISOFIX child seat anchors (on the front passenger seat)
- ISOFIX child seat anchors (on the outer seats of the rear bench seat)
- Map pockets on the front seatbacks
- Keyless system (keyless access and start system)
- Manual child lock
- Front headrests (2) (Safety optimized)
- Rear headrests (3) (height adjustable and lowerable)
- Blue LED lighting on the door panel and the cup holder
- LED taillights with 3D effect
- LED headlights (Eco)
- Steering wheel: Multifunction leather steering wheel
- light sensor
- Rear center armrest with pass-through flap
- Fatigue warning
- Navigation system: 3D navigation system NAC (3D navigation including 3D display of buildings and monuments - voice recognition for navigation, telephone and media - real-time navigation by TomTom Services - operation via touchscreen with 10" HD color screen - map transfer to the digital instrument cluster)
- Upholstery: Fabric/faux leather (Colyn) in black with decorative stitching in mint
- Radio: RCC audio system (Bi-tuner - 6 speakers - MP3-compatible - Bluetooth hands-free system with audio streaming via Bluetooth - USB port - operation via steering wheel and touchscreen)
- Rain sensor



- Radio accessories: Mirror Screen (transmission of multimedia content and apps from a compatible smartphone to the vehicle's touchscreen, allowing direct control of compatible functions and apps - Android Auto and Mirror Link (for compatible smartphone models with Android operating system) - CarPlay (for compatible iPhone models from Apple))
- Reversing camera with 180° surround view
- paddle shifters on the steering wheel
- Keyless start system
- Electric power steering
- Seats: Passenger seat foldable
- Seats: Manual lumbar support for driver's seat (2-way)
- 12 Volt power outlet (3) (in the trunk, rows 1 and 2)
- Doors lock automatically when driving off
- Tie-down points in the trunk (4 pieces)
- Immobiliser

- Tire pressure monitoring system
- Wheels: 18" "Detroit" alloy wheels, two-tone with grey (with 225/55 R 18 tires)
- Wheels: Tire repair kit (compressor + tire sealant spray)
- Rear seat backrest split 40/60 and automatically foldable, control element in the boot
- Side and rear windows are more heavily tinted.
- Seats: Passenger seat height adjustable
- Seats: Driver's seat height adjustable
- Lane keeping assist with steering intervention
- Stop&Start system (automatic)
- Traffic sign recognition (with display of the speed recommendation in the instrument cluster)
- Central locking can be activated from inside using a remote control.

Extra equipment

- Detachable towbar (with removable ball head without tools)
- luggage compartment partition net
- tailgate sensor-controlled
- Paint finish: Special metallic paint
- Package: Grip Control (Adaptive traction system with 5 modes (Standard, Snow, Off-road, Sand, ESP off) - Hill Descent Control - 18" "Los Angeles" alloy wheels, two-tone - 225/55R18 M+S tires)

- Adaptive Cruise Control (ACC) with stop function (lane positioning assistant and Active Safety Brake Plus at night and for cyclists)
- Inductive charging station (dual USB port (Type A) in row 2)
- Package: Easy Package (Reversing camera with 360° surround view - Park Assist: Active parking system with automatic steering for parallel and perpendicular parking spaces)
- Seats: Heated front seats (adjustable in 3 stages)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was roadworthy at the time of inspection.

Value reducing factors

No.	Component group	Description
1	Equipment	Tirefit filler - Expired - Replace
2	Trim / covers	Boot lining - Scratch(es) - Loss in value
3	Sill - right side	Sill - dent(s) - Smooth repair work
4	Side panel - rear right side	Sill - dent(s) - Smooth repair work
5	Side panel - rear left side	Sill - dent(s) - Smooth repair work
6	Side panel - rear right side	Sill - Scratch(es) - Smart repair
7	Bonnet	Bonnet - dent(s) - Smooth repair work
8	Boot lid / rear door	Boot lid - Scratch(es) - Smart repair



Wear and tear

No.	Component group	Description
1	2nd wheel set	2nd wheel set (4mm) - Abrasion - No deduction
2	Body	Body - Scratch(es) - No deduction
3	Vehicle glazing	Windscreen - Stone chips - No deduction
4	Wheel / tyres	Alloy rim - front right side - Scratch(es) - No deduction
The vehicle shows signs of wear and tear commensurate with its age and use.		

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Front, Side - left, Provided by user / customer, from 26 Nov 2024	5.085,61 €
2	Front, Side - left, Provided by user / customer, from 30 Oct 2025	8.746,76 €

Repainting

No.	Repainting
1	Door - front left side, Professionally carried out

Paint coat thickness measurement

Door - front left side	161 µm
------------------------	--------

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

- Winterradsatz ist kein Bestandteil des Auslieferumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

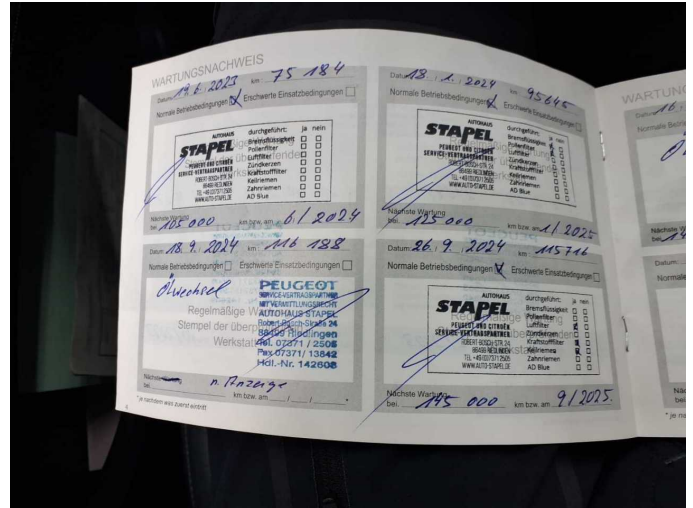


Figure 14: Documents

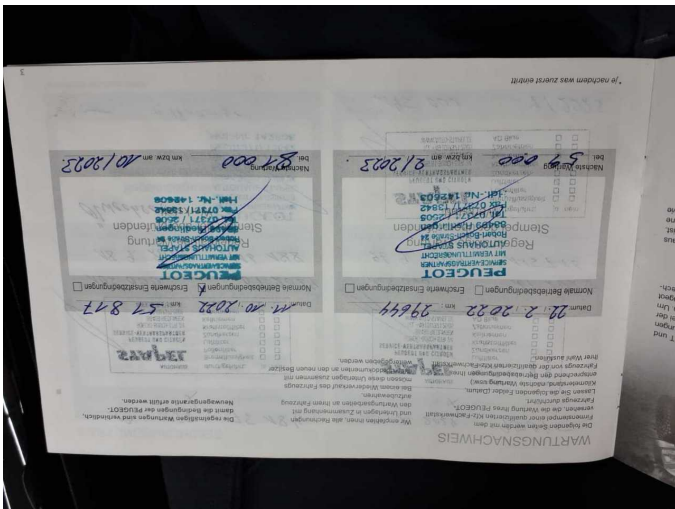


Figure 15: Documents



Figure 16: Documents

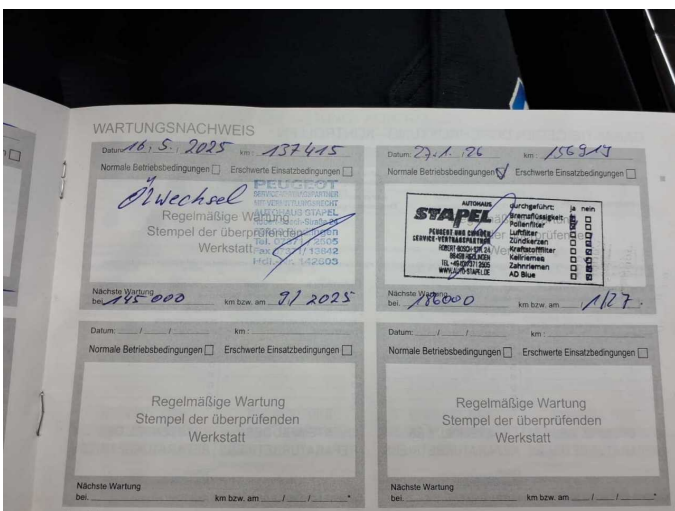


Figure 17: Documents



Figure 18: Additional tyres



Figure 19: Additional tyres



Figure 20: Navigation



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.

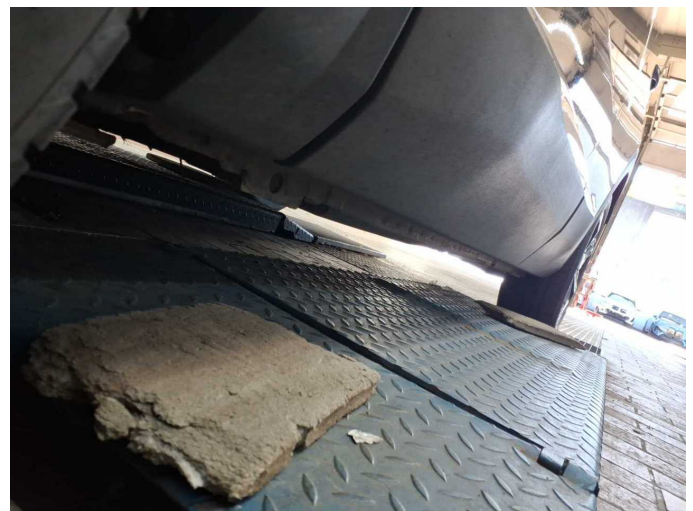


Figure 24: Misc.

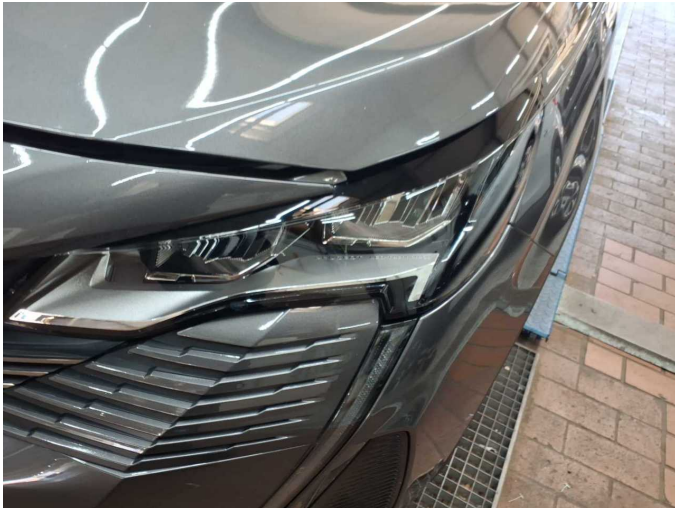


Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.




Damage 1: Equipment: Tirefit filler - Expired - Replace



Damage 2: Trim / covers: Boot lining - Scratch(es) - Loss in value



Damage 2: Trim / covers: Boot lining - Scratch(es) - Loss in value

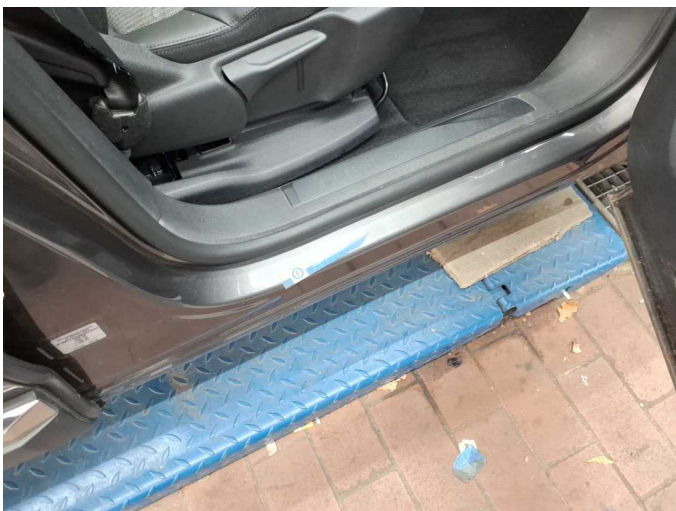

Damage 3: Sill - right side: Sill - dent(s) - Smooth repair work



Damage 3: Sill - right side: Sill - dent(s) - Smooth repair work



Damage 4: Side panel - rear right side: Sill - dent(s) - Smooth repair work




Damage 4: Side panel - rear right side: Sill - dent(s) - Smooth repair work




Damage 5: Side panel - rear left side: Sill - dent(s) - Smooth repair work



Damage 5: Side panel - rear left side: Sill - dent(s) - Smooth repair work

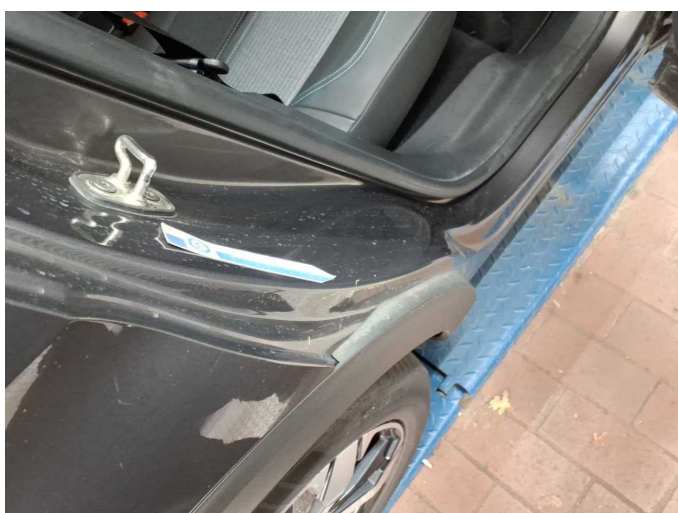

Damage 6: Side panel - rear right side: Sill - Scratch(es) - Smart repair

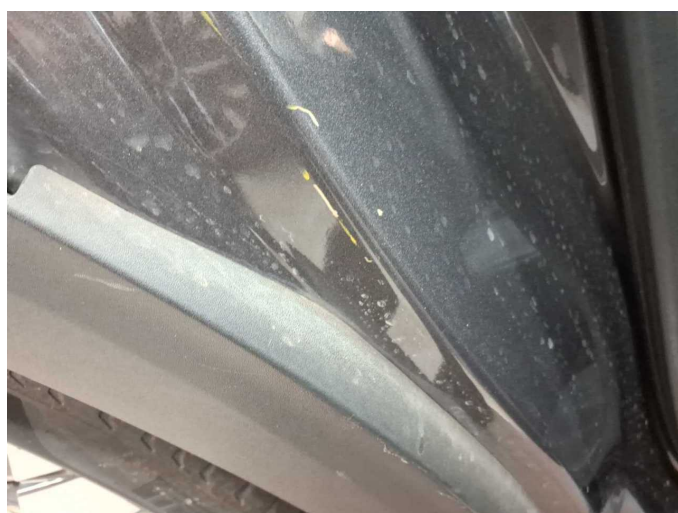

Damage 6: Side panel - rear right side: Sill - Scratch(es) - Smart repair



Damage 7: Bonnet: Bonnet - dent(s) - Smooth repair work



Damage 7: Bonnet: Bonnet - dent(s) - Smooth repair work



Damage 8: Boot lid / rear door: Boot lid - Scratch(es) - Smart repair



Damage 8: Boot lid / rear door: Boot lid - Scratch(es) - Smart repair



Wear and tear 1: 2nd wheel set: 2nd wheel set (4mm) - Abrasion - No deduction



Wear and tear 1: 2nd wheel set: 2nd wheel set (4mm) - Abrasion - No deduction



Wear and tear 1: 2nd wheel set: 2nd wheel set (4mm) - Abrasion - No deduction



Wear and tear 1: 2nd wheel set: 2nd wheel set (4mm) - Abrasion - No deduction



Wear and tear 1: 2nd wheel set: 2nd wheel set (4mm) - Abrasion - No deduction



Wear and tear 1: 2nd wheel set: 2nd wheel set (4mm) - Abrasion - No deduction



Wear and tear 1: 2nd wheel set: 2nd wheel set (4mm) - Abrasion - No deduction



Wear and tear 1: 2nd wheel set: 2nd wheel set (4mm) - Abrasion - No deduction



Previous damage 2: Front, Side - left




Previous damage 2: Front, Side - left



Previous damage 2: Front, Side - left



Previous damage 2: Front, Side - left

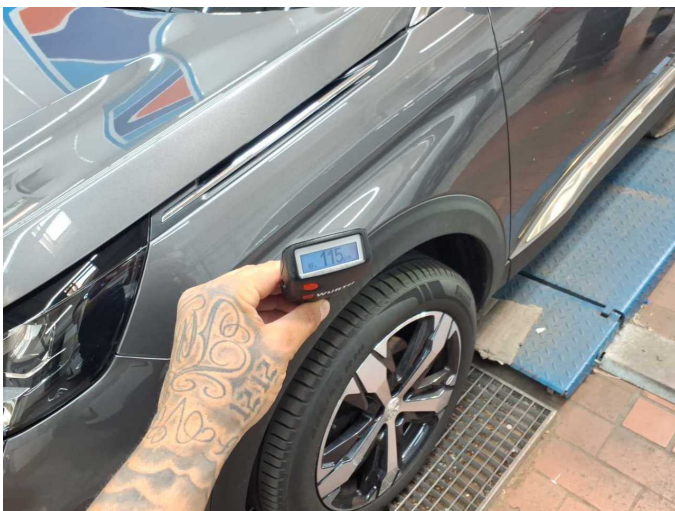

Previous damage 2: Front, Side - left



Previous damage 2: Front, Side - left



Previous damage 2: Front, Side - left



Previous damage 2: Front, Side - left



Previous damage 2: Front, Side - left



Previous damage 2: Front, Side - left



Previous damage 2: Front, Side - left



Previous damage 2: Front, Side - left



Repainting 1: Door - front left side



Repainting 1: Door - front left side



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: VF3MCYHZUMS075544

Hersteller / Modell: PEUGEOT PEUGEOT 3008 BlueHDi 130 Stop & Start EAT8 Allure Pack

Datum	KM-Stand	Beschreibung
27.01.2026	156.913	AU; Bremsflüssigkeit; Bremsflüssigkeit ern; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben + Klötze h; Bremsscheiben + Klötze v; Bremsscheiben hinten; Bremsscheiben vorne; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Reparatur Sonstiges; Wartung Sonstiges
17.06.2025	137.415	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Regelwartungsdienst; Wartung Sonstiges
26.09.2024	115.716	Keilrippenriemen; Kraftstofffilter ern; Luftfiltereinsatz ern; Ölwechsel; Reparatur Sonstiges; Wartung Sonstiges
12.03.2024	95.645	Bremsflüssigkeit ern; Bremsklötze hinten; Motoröl b. Wartung; Regelwartungsdienst
19.06.2023	75.184	Bremsscheiben + Klötze v; Motoröl b. Wartung; Regelwartungsdienst
12.10.2022	51.817	Bremsflüssigkeit ern; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Regelwartungsdienst
24.02.2022	29.644	Kleine Inspektion; Motoröl b. Wartung