



Expertise

Protocol number: 46755528
Order No. / Reference: 26844397
Inspection date: 28 Jul 2026

Manufacturer: Volkswagen

Model: Tiguan 2.0 TDI SCR DSG Life

VIN: WVGZZZCT5TW000063



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volkswagen Tiguan 2.0 TDI SCR DSG Life	
Vehicle Identification number	WVGZZZCT5TW000063
Mileage (Read)	40,206 km
First registration	25 Aug 2025
Number of holders	1
Fuel type	Diesel
Engine displacement / Cylinder	1,968 ccm / 4
Power	110 kW
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	SUV
Colour / colour code	Dolphin grey metallic (C7Q)
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black-Grey



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	8,700 km
Last service on / at	03/2026 at 31,238 km		
Key is / should be	2 / 2	FZG documents	Registration and title documents unavailable
		Letter No.	HQ009997
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	0603 / CSG 00115		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,240 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/65 R17 99V	Summer tyres on Light alloy	Hankook	5mm / 5mm
2)	215/65 R17 99V	Summer tyres on Light alloy	Hankook	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/65 R17 99H	Winter tyres on Steel	Continental	6mm / 6mm
2)	215/65 R17 99H	Winter tyres on Steel	Continental	6mm / 6mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
N	145/85 R18 103M	Summer tyres on Steel	Sonstige	3 mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- Turning brake function and evasive steering support
- Airbag for driver and front passenger, with front passenger airbag deactivation
- Ambient lighting, 10 colors (in the instrument panel)
- App-Connect Wireless for Apple CarPlay and Android Auto
- Electrically adjustable, folding, and heated exterior mirrors with memory function
- Vehicle tool kit
- Chrome trim on the side windows
- black roof rails
- Diesel particulate filter
- Tachometer
- Electronic parking brake including auto-hold function
- Driving experience switch including interior experience "Atmospheres"
- Driving profile selection
- Electric windows front and rear
- Windscreen made of laminated safety glass, heat-insulating
- Luggage compartment floor adjustable to 2 heights
- Transmission: 7-speed DSG
- rear window wiper
- Interior mirror automatically dimming
- Air conditioning "Air Care Climatronic" (with active combination filter, rear controls and 3-zone temperature control)
- Front headrests (safety-optimized)
- LED taillights
- Steering wheel: Multifunction steering wheel in leather, with paddle shifters
- front center armrest
- Non-smoking version (storage compartment and 12V socket at the front)
- Emergency call service, term 10 years
- Upholstery: Fabric "Life" (center panels of the front seats and the outer rear seats)
- Rain sensor
- Wheels: Light alloy (4) "Venezia" 7 J x 17 in black, polished surface (tires 215/65 R 17, optimized for low rolling resistance)
- Seat belts: Three-point automatic seat belt for the middle rear seat
- Seats: Front passenger seat backrest folds down completely
- Seats: Pneumatically adjustable lumbar support in the front
- Seats: Front seats with height adjustment
- Lane keeping assistant "Lane Assist"
- Start-stop system with brake energy recuperation
- Power outlet: 12V socket in the luggage compartment
- Bumpers in body color, air intake with chrome strip
- Telephone interface
- Illuminated door handle recesses
- First aid kit, warning triangle and high-visibility vest
- Prepared for "VW Connect" and "VW Connect Plus"
- Warning tone and light for unfastened seat belts front and rear
- Distraction and fatigue detection
- Airbag: Front and rear head and side airbags, center airbag
- Anti-lock braking system (ABS)
- Adaptive Cruise Control (ACC) "stop & go"
- Exterior mirror housings and door handles in body color
- Hill start assist
- third brake light
- Ceramique headliner
- Decor set "Life"
- Digital Cockpit Pro (multicoloured, various info profiles selectable)
- Electronic stability program and electromechanical brake booster
- Automatic headlight control with LED daytime running lights ("Coming home" and "Leaving home" function)
- High Beam Assist (Light Assist)
- Pedestrian protection measures expanded
- luggage compartment cover
- Speed limiter with predictive control
- Back window, heater
- Infotainment system with 32 cm (12.9 inch) display
- ISOFIX mounting points for child seats (mounting points for child seats on the outer rear seats and on the front passenger seat, i-Size compatible)
- Rear headrests (3)
- Intersection assistant
- LED headlights
- Headlight range control
- Illuminated makeup mirrors in the sun visors
- Centre console
- Emergency braking assistant "Front Assist" with pedestrian and cyclist detection
- Parking assistant "Park Assist Plus" incl. parking aid
- Radio accessories: 8 speakers
- Radio accessories: Digital radio reception DAB+
- Tire pressure monitoring system
- Rear View reversing camera
- Keyless Start system (without safe locking)
- Electromechanical power steering (speed-dependent control)
- Seat belts: Three-point automatic seat belts with belt tensioners for the outer rear seats
- Seats: Comfort seats in the front
- Seats: Rear bench seat (longitudinally adjustable, backrest asymmetrically split and foldable, tilt adjustable - with pass-through option)
- Lane change assistant "Side Assist", parking assistant and exit warning
- Power outlet: 2 USB-C ports on the front (charging power up to 45 W)
- Textile floor mats front and rear
- Ambient lighting with logo projection
- Traffic sign recognition



- Central locking including remote control

- Prepared for later activation: Navigation system
- Electronic immobilizer
- Green thermal insulation glazing, sides and rear

Extra equipment

- Head-up display
- Mesh partition
- Package: Design package (silver anodized roof rails - noise-reducing door windows; tinted rear side windows and rear window)
- Package: Infotainment package including "Discover Pro Max" navigation system (2 USB-C ports in the front, 2 USB-C charging ports in the rear of the center console; charging power up to 45 W - Head-up display - Infotainment system with 38.1 cm (15 inch) display and touchscreen - Navigation system - IDA voice assistant and electronic voice amplification - "Comfort" telephone interface with inductive charging function for 2 smartphones, charging power up to 15 W)
- Paint finish: Metallic
- Package: "IQ.Drive" assistance package (electrically adjustable, folding and heated exterior mirrors, auto-dimming on the driver's side, memory function - "Travel Assist", "Lane Assist" and "Emergency Assist" - proactive occupant protection system - "Area View" surround view including "Rear View" reversing camera)
- Package: Winter package including heated steering wheel (multifunction leather steering wheel, heated, with paddle shifters - heated front seats, seat cushion and backrest separately adjustable)
- Panoramic tilt/slide sunroof with panoramic roof at the rear
- Wheels: Spare wheel in a weight- and space-saving design (on-board tools and jack - spare wheel in a weight- and space-saving design)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 1 (registration document) and the vehicle registration certificate Part 2 (title) were not available.
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Side panel - rear right side	Side panel - dent(s) - Smooth repair work
2	Trim / covers	Boot lid - interior trim - Scratch(es) - Replace
3	Front structure	Emblem - Stone chips - Replace

Wear and tear

No.	Component group	Description
1	Bonnet	Bonnet - Stone chips - No deduction
2	Rear bumper	Rear bumper - Scratch(es) - No deduction
3	Door - rear left side	Door - Scratch(es) - No deduction
4	Vehicle glazing	Windscreen - Stone chips - No deduction
5	Body	A-pillar - right side - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

Der beiliegende Winterradsatz ist kein Bestandteil der Ausstattung.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

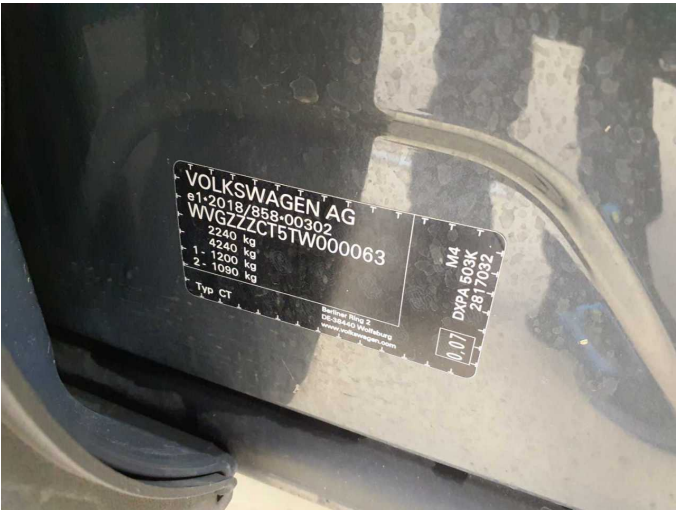


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Additional tyres



Figure 15: Additional tyres



Figure 16: Navigation



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.

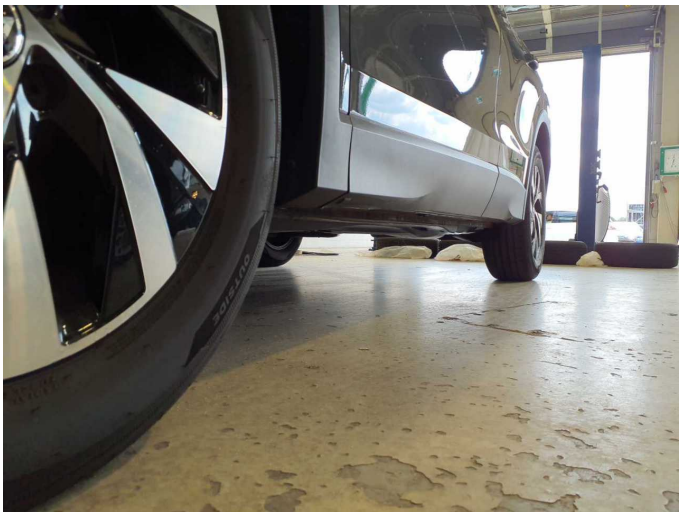


Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.




Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.

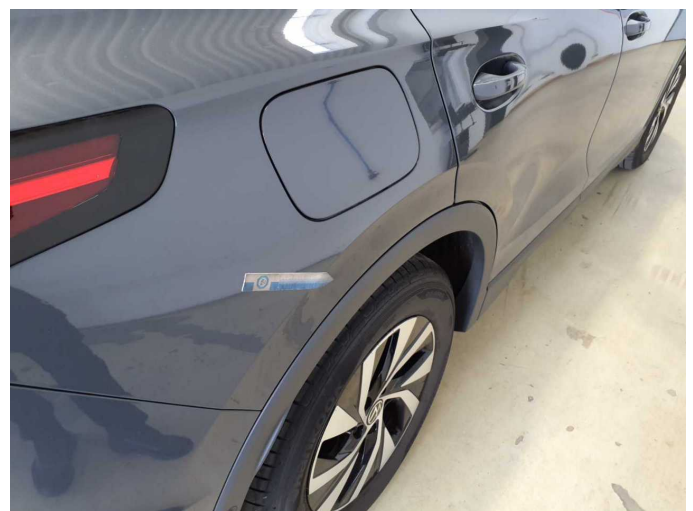


Damage 1: Side panel - rear right side: Side panel - dent(s) - Smooth repair work




Damage 1: Side panel - rear right side: Side panel - dent(s) - Smooth repair work



Damage 2: Trim / covers: Boot lid - interior trim - Scratch(es) - Replace

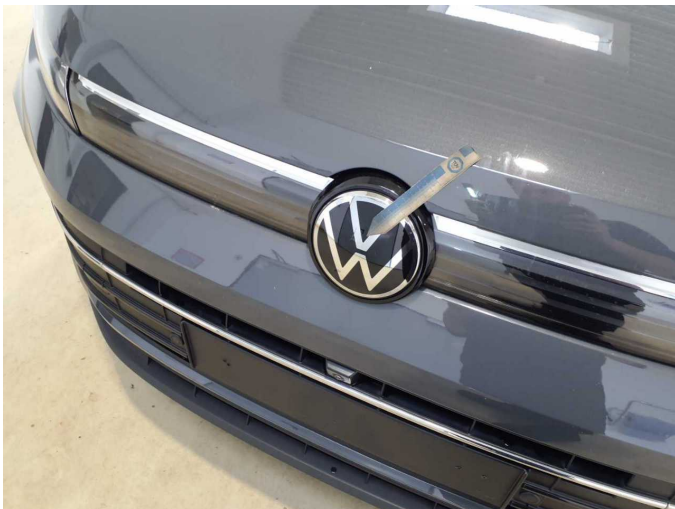

Damage 3: Front structure: Emblem - Stone chips - Replace

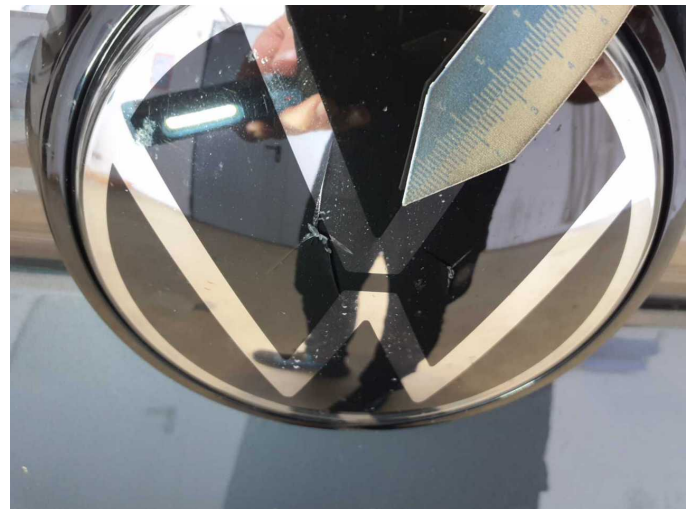

Damage 3: Front structure: Emblem - Stone chips - Replace