



Expertise

Protocol number: 46284528
Order No. / Reference: 26687537
Inspection date: 2 Jul 2026

Manufacturer: Ford

Model: Focus Turnier 1.0 EcoBoost Hybrid Aut. TITANIUM

VIN: WF0PXXGCHPPY06010



Vehicle details	
Manufacturer / Type / Model / Equipment	
Ford Focus Turnier 1.0 EcoBoost Hybrid Aut. TITANIUM	
Vehicle Identification number	WF0PXXGCHPPY06010
Mileage (Read)	70,240 km
First registration	26 Jun 2023
Number of holders	2
Next periodical technical inspection	06/2026
(Report not on hand)	
Power / Engine displacement	92 kw / 999 ccm
Fuel type / Cylinder	Hybrid Petrol / E / 3
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Frozen White
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	45 %
Last service on / at	10/2025 at 53,832 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GX169692
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	8566 / BUC 00143		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,005 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 92V	Summer tyres on Steel rim with wheel cover	Goodyear	5mm / 5mm
2)	205/60 R16 92V	Summer tyres on Steel rim with wheel cover	Goodyear	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 92H	Winter tyres on Light alloy	Continental	7mm / 7mm
2)	205/60 R16 92H	Winter tyres on Light alloy	Continental	7mm / 7mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 06/2027		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- Airbag: Passenger airbag deactivation
- Exterior mirrors painted in body color, electrically adjustable, heated and foldable - with integrated turn signals
- Tires: 6.5 J x 16 design wheels (4) with 205/60 R16 tires in a 10-spoke design, in black and silver
- Roof rails, aluminum
- Tachometer
- Driver information system with on-board computer, color (10.7 cm screen diagonal)
- Electric front and rear windows with all-around closing function
- FordPass Connect including live traffic information. Additionally for PowerShift automatic transmission: Ford Mobile Remote remote start function.
- Cruise control
- Transmission: 7-speed PowerShift automatic transmission
- rear window wiper
- Interior mirror, automatically dimming
- Intelligent safety system - Front airbags for driver and front passenger - Front and rear head/shoulder airbags - Side airbags for driver and front passenger - Seat belt tensioners and force limiters in the front and on the outer seats of the 2nd row - 3-point seat belts on all seats, height-adjustable in the front - Safety pedal assembly
- LED taillights
- Steering wheel: 3-spoke design steering wheel - in Sensico leather look
- Steering column, adjustable in height and reach
- Make-up mirrors in driver and passenger sun visors
- MyKey key system (individually programmable second key)
- Navigation: Ford SYNC 4 including Ford navigation system with AppLink, 13.2" touchscreen and DAB/DAB+ - 6 speakers - Amazon Alexa built-in voice assistant - Android Auto and Apple CarPlay - Steering wheel controls - Digital owner's manual - Bluetooth hands-free calling and audio streaming - USB ports - Voice control for audio and phone - Ford Power-Up software updates - Intelligent route suggestions - Customizable user profiles - Radio player - Audible and visual route guidance, dynamic and cloud-based navigation with advanced traffic information system, lane guidance and road map for Europe
- Pre-Collision Assist - Forward Alert System - with pedestrian and bicycle detection
- Tire Pressure Monitoring System (TPMS)
- Windscreen wipers with rain sensor (sensitivity adjustable)
- Headlight assistant with day/night sensor
- Electromechanical speed-dependent power steering EPAS (Electric Power Assisted Steering)
- Seats: Driver's seat height-adjustable with manually adjustable lumbar support
- Start-stop system
- Carpet floor mats in the front
- Lashing eyes in the luggage compartment
- Anti-lock braking system (ABS) with electronic brake force distribution (EBD)
- Attachment points behind the second row of seats for mounting the safety partition net
- Hill start assist
- Fabric headliner
- Roof spoiler painted in car color
- Electronic Stability Program (ESP) - with Emergency Brake Assist (EBA) and Traction Control System (TCS)
- Lane keeping assist including lane keeping assist
- Electric parking brake with auto-hold function
- Ford Power Start function (keyless start)
- Luggage compartment cover
- Luggage compartment lighting
- Speed limiter - Intelligent speed limiter with speed limit display
- Illuminated glove compartment
- Back window, heater
- Interior lighting with LED technology - front and rear, and map reading lights at the front.
- Isofix mounting including top tether anchor points on the outer seats of the 2nd row.
- Air conditioning with automatic temperature control for driver and passenger side, separately adjustable (2-zone automatic climate control)
- Headrests: 2 front and 3 rear, height adjustable
- LED headlights - LED low beam - LED high beam - LED daytime running lights including integrated LED turn signals at the front - LED cornering lights, static, including integrated LED fog lights and maneuvering lights
- Front center console "Premium" - sliding armrest - cup holder incl. cover - storage compartments - 12-volt and USB connection
- Emergency call assistant
- Otto particulate filter
- Front and rear parking pilot system
- Upholstery: Cloth
- Post-Collision Assist: In the event of a severe collision, such as one that would deploy the airbag and in which the driver might be incapacitated, this system initiates braking. This reduces the risk of further collisions with other obstacles and road users after the initial impact. The driver can intervene and manually operate the accelerator or brake pedal throughout the entire process.
- Tire repair kit, maximum speed 80 km/h permissible.
- Gear knob, Sensico in leather look
- Headlights with delayed shut-off
- Selective driving mode switch - including 3 selectable driving modes: Normal, Sport and Eco
- Seats: Passenger seat, 2-way adjustable
- Seats: Rear seat backrest foldable, 60:40 split
- Seats: Front sports seats with enhanced lateral support
- 12-volt power outlet in the luggage compartment



- Electronic immobilizer
- Central locking with remote control and remote luggage compartment release

- Variable radiator air intake
- Warning system for unfastened seat belts for the 1st and 2nd rows of seats

Extra equipment

- Paint finish: Frozen White
- Radio: B&O Sound System - 675 Watt premium sound system with 10 speakers, including subwoofer - Based on the renowned sound and design expertise of Bang & Olufsen
- Side windows from the 2nd row of seats and rear window, dark tinted.
- Seats: Front seats can be heated individually and variably.

- Package: Driver Assistance Package II Drive Assist Intelligent adaptive cruise control Lane keeping assist Traffic jam assist with Stop&Go Traffic sign recognition Wrong-way driver warning radio Evasive steering assist Distance display and distance warning Driver drowsiness detection High beam assist (in conjunction with adaptive LED matrix headlights with glare-free high beam assist) Blind spot assist with cross traffic alert including emergency braking function (when reversing out of parking spaces) and trailer recognition Rear view camera with split view Electrically folding exterior mirrors with surround view

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Misc.	Main inspection - No evidence - No deduction

Missing parts

Description

Documents - Owner's manual

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.

ALPHABET



Figure 1: Diagonal front (left)

ALPHABET



Figure 2: Diagonal front (right)

ALPHABET



Figure 3: Diagonal rear (left)

ALPHABET



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents



Figure 15: Additional tyres



Figure 16: Navigation

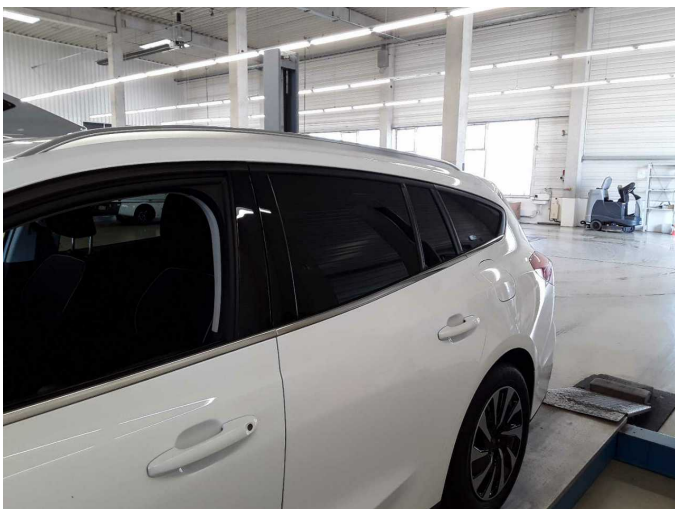


Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.

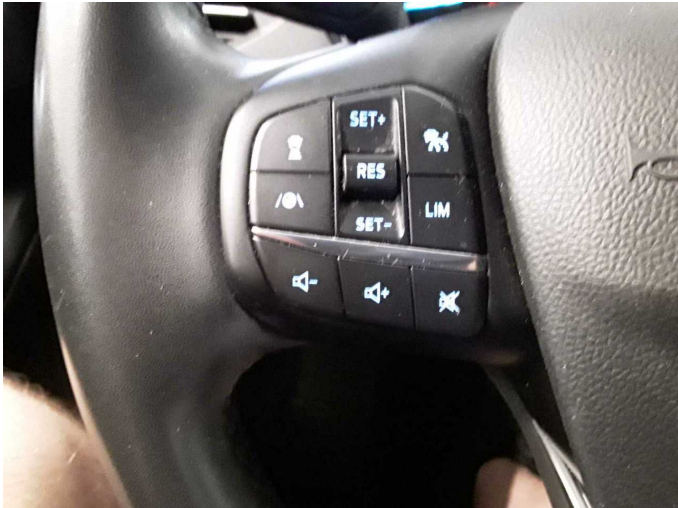


Figure 21: Misc.

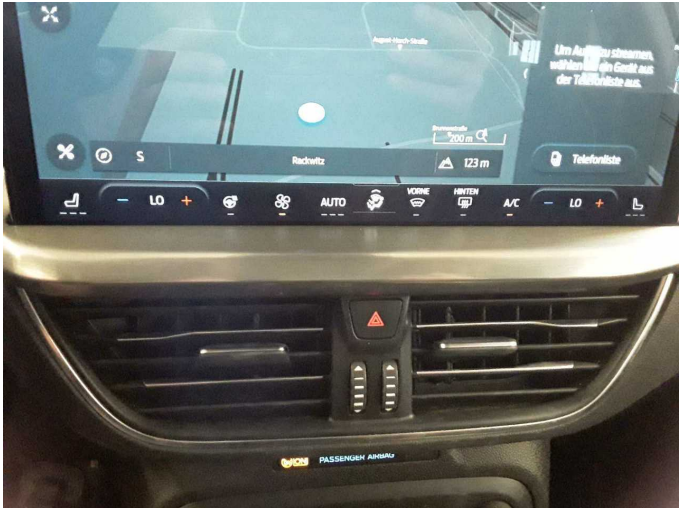


Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WF0PXXGCHPPY06010

Hersteller / Modell: FORD FORD Focus Turnier 1.0 EcoBoost Hybrid Aut. TITANIUM

Datum	KM-Stand	Beschreibung
22.10.2025	53.832	Bremsinspektion vo + hi; Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges; Zündkerzen ern
31.07.2024	25.056	Bremsflüssigkeit; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges